

Flexible world for you

amazon fulfillment



1 WHAT IS FLEXISMART?

FlexiSMART is a filament for 3D FFF/FDM printing made from thermoplastic elastomeric polymers (TPE) with chemical additives to make it easier to print for most 3D printers of the market.

FlexiSMART is flexible and it gets its shape back when you fold it, twist it or stretch it.

2 WHY USE A FLEXISMART?

FlexiSMART lets you enter a new world of possibilities thanks to the flexible nature of the filament. From now on you can print objects you couldn't before with a rigid filament: cases for Smartphone, tablets, slippers, templates, RC wheels, prosthesis, silent blocks, gears that need certain adaptability, and in general, any object you can think of and for which you can find a use. FlexiSMART has been design to be easily printed.

- It has a certain rigidness so that it can be printed by most direct extruders making none or few modifications.
- Adherence is excellent. You can print it even without a hot bed.
- Resistance is very high, for which the printed pieces won't get degraded quickly.
- It's the flexible filament with the most attractive prices in Europe.

3 DATA SHEET AND PRINTING PARAMETERS

Data sheet:

Material	FlexiSMART
Colors available1	1
Formats available	1kg, 250g
Thermic deflexion temperature	90°C
Fusion temperature	160°
Decomposition temperature	>240°
Density	0,96g/cm³
Maximum stretching	600%

Recommended temperature for printing	195°-220°
Recommended printing speed	20-60mm/s
Hot bed temperature	>18°
Optimal layer height	0,2mm
Perimeters	3
Top solid layers	5
Retraction	Desactivated or reduced

 $Printing\ parameters\ recommended\ using\ a\ nozzle\ of\ 0.4\ mm:\ 0.4\ mm\ is\ the\ standard\ size\ of\ nozzle\ for\ most\ domestic\ printers$

You can download our full printing profiles from the principal lamination programs (Cura, Slic3r y SImplify3D) from our web page:

Optimal parameters will depend on the 3D printer you use, however, they're good parameters to use as a starting point. With a few prints you'll be able to find the limits and the perfect setting for your machine.




4 PROBLEMS AND SOLUTIONS

4.1 Problems extruding FlexiSMART.

The main challenge when printing FlexiSMART and other flexible filaments derives from the nature of the material itself since, by being flexible, it can't be pushed as easily as rigid materials, in the same way you can't push a rope.

The problem arises when there are gaps on certain parts of the extruder, particularly, between the drive-gear (the dentate wheel that pushes the filament) and the hole through which the filament accesses the hot-end (metallic point that melts the filament)

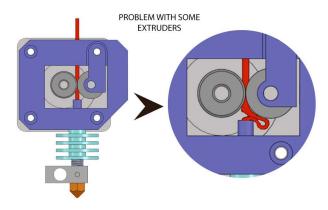


When this space is big enough the filament tends to get out of its route and make a knot that ends up poking through a side of the extruder, as can be seen on the image.

This problem is bigger when using the 1.75 mm filament since by having less suction is even more given to stray from its route.

The speed of extrusion is determinant for the appearance of this problem. If the extruder tries to push the filament to the maximum speed an upwards pressure is created that makes the filament stray from its natural route. Therefore the general recommendation is to start printing at a slow or very slow speed and increase it until you reach the maximum speed your extruder can stand. The size of the nozzle also affects the maximum limit speed for the bigger this is the more melted material can be extruded per unit of time, and therefore, higher will be the velocity at which it can be done.

The extruders designed to use flexible filaments minimize gaps stopping the filament from poking out and they incorporate a system of double drive-gear to channel with precision the filament and completely avoid the mentioned problem at the same time they allow to increase the printing speed.



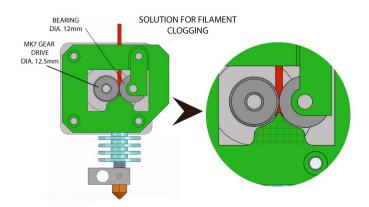

FlexiSMART has been designed thinking of these problems and it has a rigidity superior to other flexible filaments to help reduce them. However, on extruders that aren't designed to use elastic materials these problems it may appear.

4.2 Preparing the extruder to print FlexiSMART.

If you're having any of the problems previously mentioned you probably have to adapt or replace your extruder. In this sense there are some options that we detail below.

4.3 Modify your extruder:

Sometimes it's possible to use FlexiSMART on non-optimized extruders making some modifications on the extruder itself.

If you're having trouble printing FlexiSMART we suggest that you follow the following advices, exposed by complexity order.

4.3.1 File the conduct through which the filament accesses the hot-end:

If you use an extruder with a plastic body, as the printable extruders, we recommend that you try the following.

Slightly file the edges of the hole right under the drive-hear, a hole through which the filament is channeled to the hot-end. This allows to avoid friction and hitches that may provoke the previously described knots.


It might be necessary to dismount part of the extruder to make this operation.



4.3.2 Insert Teflon tube in the extruder:

A second option, more complicated but more effective, is to insert a Teflon tube (PTFE) in the mentioned hole. This technique also allows to reduce the space with the drive-gear since said tube can be placed very close to that one. You can even modify the entry to the Teflon tube to adapt it to the form of the drive-gear leaving a minimum space.

In general this technique implies to drill the extruder to allow insertion of the mentioned Teflon tube. Here you can see some images of the result:

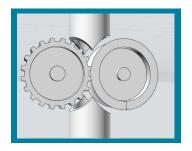







4.3.33 Print a guide for the filament and put it in the extruder:

The third choice is to print a piece that works as a guide for the filament and place it under the drive-gear. These pieces usually have a triangular shape and should be designed respecting the dimension of each extruder.



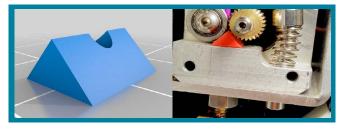

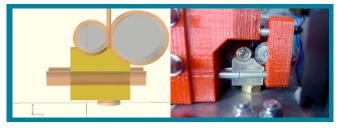




In the internet, in sites like www.thingiverse.com, you can download this type of adapters for some of the most usual extruders. However, this is a simple design that those with knowledge of 3D printing could easily create from scratch.

4.3.4 4 Adjusting the pressure of the drive-gear over the filament:

This being a flexible material it's particularly important that the pressure of the mechanism that pushes the

filament towards the hot-end not be excessive. In the rigid filaments an excess of pressure will produce small notches in its surface but in the case of FlexiSMART an excessive pressure disfigures the section of the filament giving it an oval shape that makes it be more prone to clog the extruder.

The extruders designed for the printing of flexible filaments consider this and have a mechanism to regulate the pressure of the tractor mechanism. If your extruder allows to regulate such pressure we recommend that you adjust it when using FlexiSMART. The adequate pressure will be the minimum necessary that allows the extruder to move the filament.

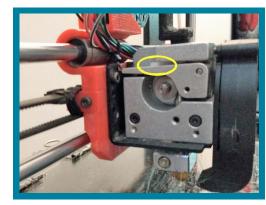

BQ HeatCore DDG Extruder de BQ Hephestos y BQ Witbox.

If your extruder doesn't have a mechanism to regulate the pressure you can still reduce it by changing the spring or reducing the possible route by placing a wedge on the right spot. As an example we show an image on how to reduce pressure in an extruder that is not ready for it.

4.3.5 Adding tension between the reel and the extruder:

It's been proved that in some models of printers it's convenient that when using flexible filament there be some tension between the reel and the extruder in a way that the filament isn't left hanging.

To get this you can try to stop the reel so that the extruder has to pull lightly from the filament to untangle it. You can also place a similar accessory to the one from the photograph to reach the same target.



Diseñado para Extrusor BQ Unibody de BQ Hephestos



4.4 Replace your extruder with an optimized one.

Nowadays flexible filaments have become popular to the point where it's hard for a last generation printer not to be prepared to print them.

Besides, many designers have created printable extruders capable of printing FlexiSMART and other filaments. These extruders can be downloaded from pages like Thingiverse to be printed and assembled at home.

They're also every time more the commercial extruders prepared to print flexible filaments that may be acquired and mounted on our printers.

4.4.1 1 DIY printable extruders.


Some of these extruders are designed from scratch and others are modifications made over existing designs. Here we present a non-exhaustive list of extruder designs that can downloaded from the internet. Following each link you could find the complete list of components as well as montage instructions and comments from other users.

The hot-end you install on your extruder must have a Teflon piece (PTFE) inside to avoid frictions and so that FlexiSMART can be printed correctly. FlexiSMART has been successfully tested on the following hot-ends:

J-Head MKV-B Budassnozzle V1.3 E3D v6 Leonnozzle V2

You must keep into account that said tests have been made with original hot-ends and we can't guarantee the result on imitations of such.

Depending on what printer you use, some of these extruders will be easier to install given that they might replace the original extruder of the machine.

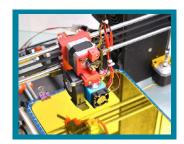

http://www.thingiverse.com/thing:147705 Direct-drive hinged extruder for E3D/J-Head hot-end (Prusa i3) by ffleury



http://www.thingiverse.com/thing:512338 Wade L3K Extruder (prusa I3) compatible filament flexible By Skarab



http://www.thingiverse.com/thing:403438 Printrbot Flexible Filament Direct Drive Extruder by thirdhorizon




http://www.thingiverse.com/thing:1102900 Ultimaker 2 PG35L Direct Drive Extruder for 1.75mm E3D v6 Hotend by jasonatepaint



4.4.2 Commercial extruders.

Acquiring a commercial extruder is more expensive that building one at home, however, they usually perform better than these and they are the best choice when you're going to use flexible filament intensively.

These extruders have been specifically designed to avoid all the problems previously mentioned and some can extrude FlexiSMART at speeds superior to 70 mm/s.

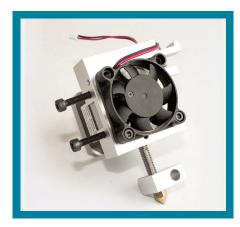


Recreus Extruder
www.recreus.com
Precio aproximado 100 euros



BQ HeatCore DDG Extruder www.bq.es Precio aproximado: 140€



Flexion Extruder
https://flexionextruder.com/
Precio aproximado 140€

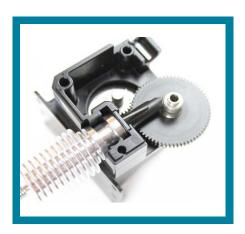

Titan Extruder www.e3d-online.com



5 ADVICES FOR OPTIMAL USE OF FLEXISMART

5.1 Retraction.

Retraction is a technique used on 3D FFF/FDM printers to improve finishing of the pieces. It consists on commanding the extruder to retire a few centimeters of filament when this is about to change position to avoid the stringing or apparition of littles threads of filament on different parts of the piece being printed.



When using flexible filaments it can happen that by trying to make a very abrupt retraction the filament stretches instead of pulling back. That's why it's very recommendable to use retraction parameters different to those used with rigid filaments.

The 2 parameters that we can control in the retraction are the size, or lineal amount in millimeters of retracted filament, and the speed on mm/s of the operation. Both values must be inferiors to those used regularly. The optimum way of calibrating these values is to run tests to find out which are the maximum values your printer can take when printing with FlexiSMART. On any case, as a starting point you can use the values recommended by us.


Retraction size: 1.5mm Retraction speed: 40mm/s

Depending on the printer it may be necessary to completely deactivate retraction.

5.2 Sequential printing.

When it comes about a FlexiSMART flexible filament they have a different viscosity to the one of other materials when it reaches its melting temperature. For this it's more given to leave small threads of filament between different parts of the piece when the nozzle must move from one point to the other without extruding.

Besides, when several pieces are going to be printed at the same time, these little threads can appear between the pieces since the nozzle has to constantly jump from one to others.

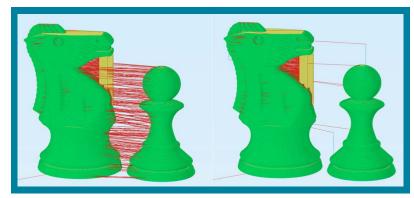

Comparación de las rutas de impresión entre impresion simultanea y secuencial.

As we've already previously commented this effect can be reduced by using retraction, but it's highly recommendable that also the different pieces be printed sequentially instead of simultaneously.



By sequential printing we mean completely printing a piece before starting printing the next.

This can be achieved in two different ways:

The trivial option is to print only one piece and once finished repeat the same print as many times as wanted.

The second alternative, more advanced and with some limitations, is to use the laminating option that some programs offer instead of printing one piece at a time. The maximum size of the pieces that can be printed using this method comes given by the dimensions of the nozzle and the disposition of the exes of the printer. We highly recommend that you get information about how to use the options as not to run the risk of damaging your printer. You can do it through the following links:

https://www.simplify3d.com/support/tutorials/multi-part-printing/

http://manual.slic3r.org/advanced/sequential-printing

https://ultimaker.com/en/community/3843-force-cura-to-print-objects-separately

5.3 The first layer.

The first layer is the foundation of the rest of the layers and it can mark the difference between a satisfactory print and a failed print.

When printing with FlexiSMART one must pay special attention to the first layer since, at times, a printer correctly leveled to print with PLA or ABS may not be so to print FlexiSMART adequately.

To know if the printer is correctly leveled you have to watch attentively how the machine makes the first layer.

If the first layer seems translucent it means that the nozzle is too close to the platform and it will be necessary to separate it a few microns.

On the other hand, if the first layer seems to detach or the tracks of the deposited material show spaces without plastic between them it will be necessary to bring the nozzle close a few microns to the platform.

This adjustment may be made by software, adjusting the z-offset in the laminated program, or regulating the level mechanism of the printing platform.

5.4 Lamination advices.

5.4.1 The height of the layer.

The height of the layer determines the quality of the piece and the time of printing.

Using a nozzle of 0.4 mm we have proved that the optimal height of the layer is 0.2 mm. With this height of layer you will get layers strongly attached with an excellent superficial finishing.



5.4.2 The top layers and perimeters.

The top layers and perimeters are the lateral and superior wrapping of the piece. The adequate number of these will depend on the infill and the use given to the piece.

With a high infill, you can reduce the top-layers number to 3 since the filling of the piece will give them a good base to stand on. Using some medium or low values of infill is recommendable to rise the number of top-layers to 5 to make sure that the top of the piece is completely sealed.

If the piece is going to suffer deformations it is recommendable to rise the number of shells or horizontal perimeters. Rising the number of horizontal perimeters will stop the walls of the piece to quarter when exerting pressure or traction on them.

These recommendations are valid when you use a nozzle of 0.4 mm and a layer height of 0.2 mm. if the size of the nozzle or the layer varies, the number of perimeters and optimal top-layers will also change.

We invite you to run your own tests and share the results with us.

5.4.3 Influence of the infill in flexibility.

The amount and design of the infill has a great influence on the degree of flexibility of the pieces printed with FlexiSMART.

A piece with infill close to 100% will behave as a rubber bloke and can be a good choice for pieces such as silent-blocks or spacers.

Using an infill of 15% you'll get the soft pieces that could be crushed and deformed.

The infill pattern also affects the flexibility and a rectilinear infill doesn't behave the same as a honeycomb infill. We invite you to make your own tests and choose the one that suits your project the most.

5.5 Use of a greater size nozzle.

The bigger portion of printers use as series a nozzle of 0.4 mm, a nozzle size that gives a good speed/resolution proportion. FlexiSMART is perfectly printed with this type of nozzle, however it is convenient to make some clarifications.

The size of the nozzle limits the amount of material that can be extruded per unit of time. By using rigid filaments this limit is higher since the speed can be increased and the filament itself supports the necessary extra pressure for the material to exit by the nozzle. With FlexiSMART however, the filament is compressed if this pressure is too high and, in general, it must be printed at lower speeds.

Therefore if you want to extrude FlexiSMART at high speeds it is recommendable that you use a nozzle of bigger size, from 0.6 mm. Using one of these nozzle you could print a lot quicker, with superior layer heights, sacrificing some resolution.



5.6 6 Support for the reel.

In long printings it is essential that the reel be placed on an adequate support that allows this to unwind softly and smoothly.

The reel of 250 grams of FlexiSMART has an inferior small diameter and may not be compatible with the support for reel you usually use.

We want to show you two supports for printable reel compatible with the ones we use for FlexiSMART:



Outside Diameter: 100 mm Inner Diameter: 18mm



Universal stand-alone filament spool holder (Fully 3D-printable) by CreativeTools http://www.thingiverse.com/thing:508896



CTC - Side SpoolHolder by FunkyArt http://www.thingiverse.com/thing:1187344



6 WOULD YOU LIKE TO SUPPORT OUR PROJECT?

All the members of FFF World love 3D printing and the maker community. We feel lucky to be able to work on projects where we can deliver our honest passion. In the future, we would like to be able to develop more materials, more colors and more formats. Ultimately, we would like to be able to make our company grow.

Therefore, one of the printable actions to help us, if you want to do it and you're satisfied with the filament, is to give us a 5 stars rating on amazon.



Thanks a lot!

7 OTHER MATERIALS WITH FANTASTIC CHARACTERISTIC ON AMAZON

FlexiSMART Tech: designed to resist the abrasion and wear of technical printings.

ABS Tech: Minimized warping effect. High performance on technical applications.

PETG Tech: Maximum mechanical resistance. Resistant to contact with water and UV rays. Apt for alimentary use.

FilaMETAL: PLA with non-abrasive metallic charge that gives a spectacular mechanical finish to your printings.

PC Tech: Polycarbonates with a high resistance to temperature and excellent metallic proprieties

Nylon Tech: printable at low temperature. Resistance to bangs with a certain degree of flexibility.

PVA Tech: Soluble in water filament indicated for use as support material. Excellent compatibility with PLA.

HIPS Tech: soluble in limonene filament indicated for use as support material. Good mechanical resistance and excellent compatibility with ABS.

amazon

You can contact us through Amazon for any doubt or question you may want to tell us about. Answer in less than 24h.

www.fffworld.com

FFF WORLD S.L

Pol. Ind: Casablanca. Laguardia 01300 Alava, España ESB01528306 (+34) 608 235 053