Closure access correction | installed upper shell

Native-derived section X=-32, positive-Y screw. Dimensions mm;10 points/mm (PDF3.528:1).

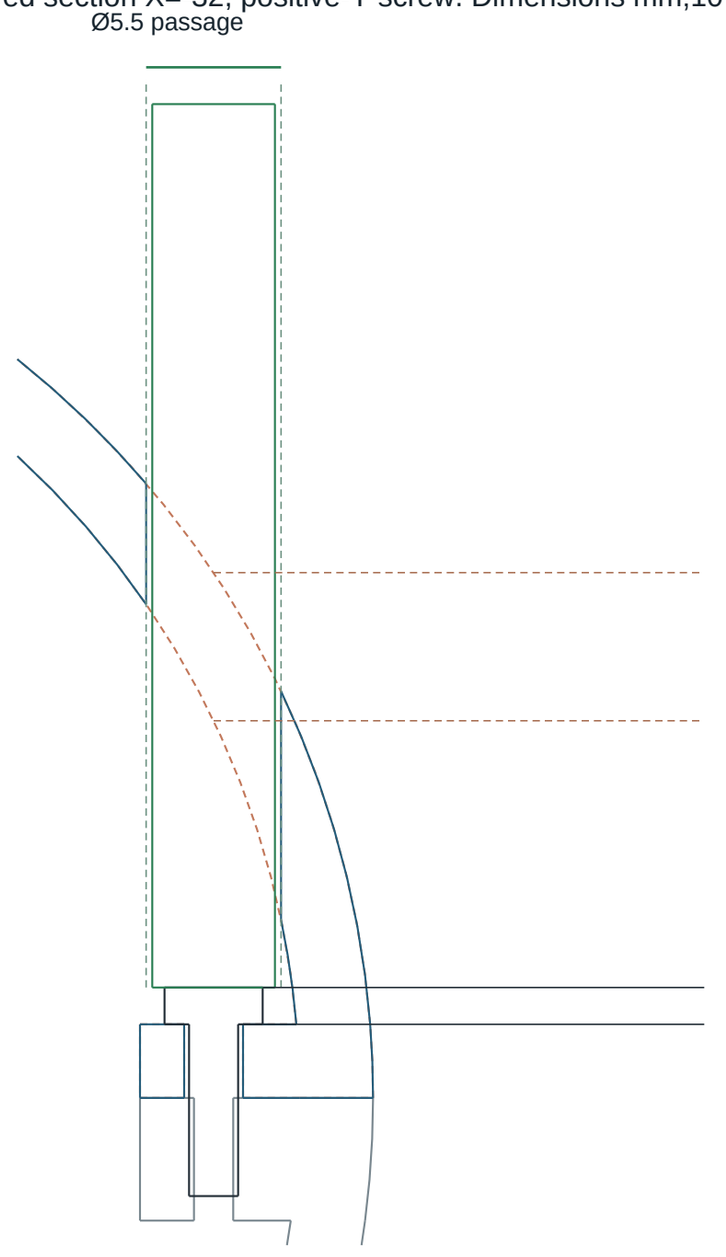

Four passages: X -110/-32; Y +/-32

Existing driver Ø5, Z4.5..40.5; cut Ø5.5, Z4.5..41.5

Nominal radial clearance0.25; allocated minimum0.05

Allocation: radius undersize0.10 + driver0.05 + axis0.05

Engineering tool/process budget only; no supplier qualification

Outer radius38.5: centreline exit Z21.4068

Inner radius35.5: centreline entry Z15.3704

Original centreline blockage6.0363; red dashed = frozen original

Original four solid intersections127.758..127.838 mm³; repaired0

Head top/tool tip Z4.5: intentional face touch, no volume

Bearing seat Z3: Ø4 head / Ø2.4 hole; radial land0.8

All four8.04248 mm² bearing areas preserved; bosses remain connected

Through-open ports; caps/sealing/IP/strength decisions remain UNMET

Blue = repaired upper; gray = lower; black = screw; green = complete actual driver envelope.

Only UpperShellRetention changes. No other parts, screw positions, boards, envelope or rotary geometry change.