One compact in-line allocation - not product acceptance

Equal-scale top views: 2.7 drawing points/mm. All24mm connector blanks retained and unqualified. No12V board-fit claim.

REJECTED BASELINE: 330 x89 x72 mm /2.115 L bounding box

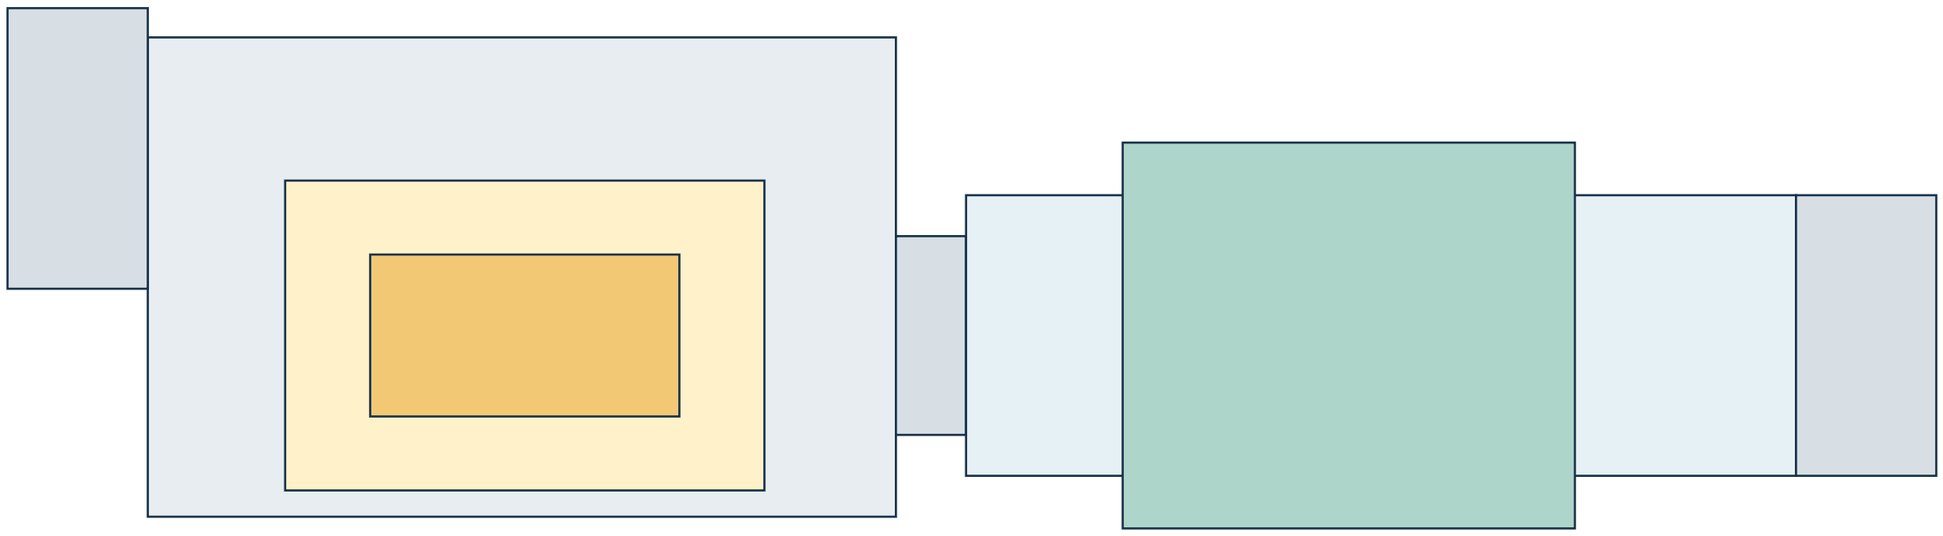

330 mm overall allocation; width 89 mm

SHORTENED COMPARISON: 270 x89 x72 mm /1.730 L /18.18% reduction

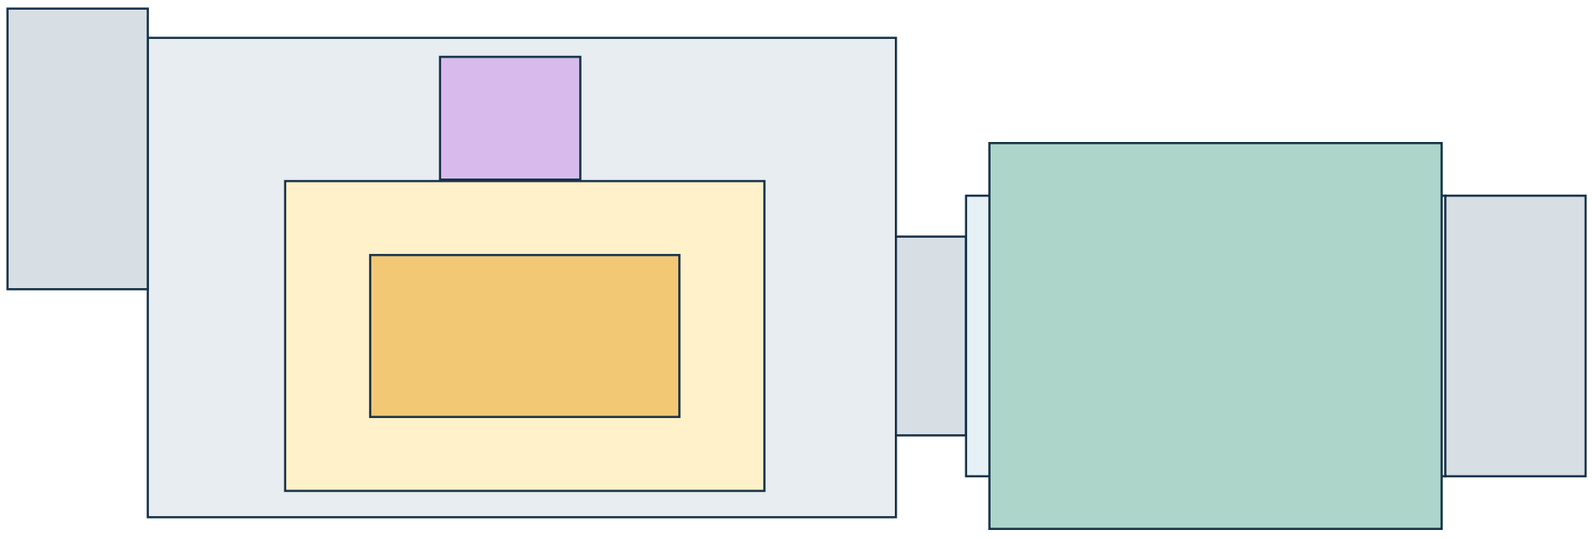

270 mm overall allocation; width 89 mm

Sourcepod unchanged128x82x62

Core142 ->82; collarshift -22.8

S12 stationaryboard+clamp inpurple

Carrier retention and terminal construction remain UNMET.

Gold: manufacturer-based insulation reservation / Green: intact oldcollar comparison / Grey: generic connector and housing allocations.

Two-arrangement screen and new source constraint

Offset rejected for transverse bulk, not falsely claimed to obstruct USB. S12 geometry has NOT been integrated into the collar.

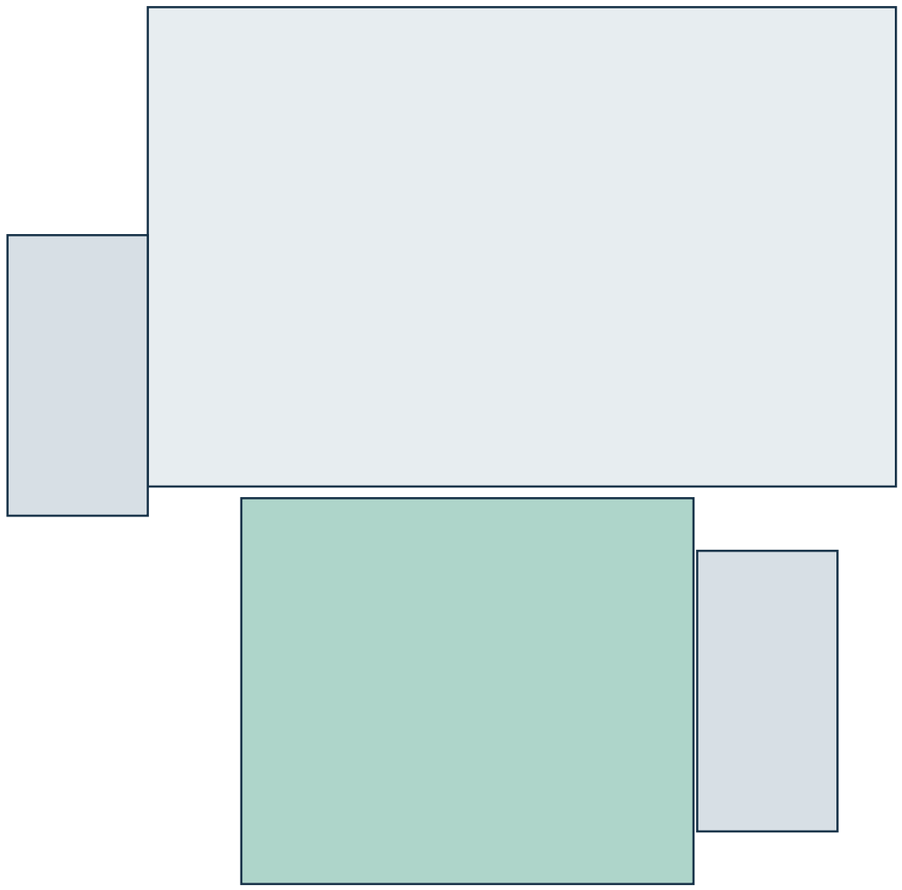

Offset lower allocation: 152 x150 x72 mm /1.642 L

Same2.7points/mm; excludes new transverse harness neck.

68.54% wider thaninline for5.12% smaller bounding volume.

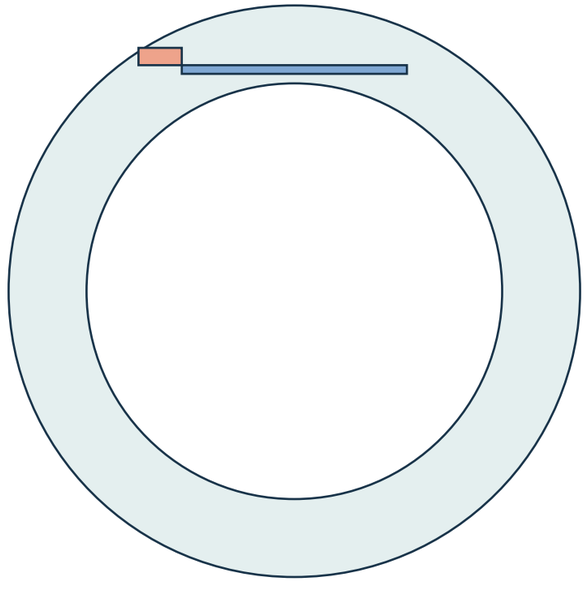

S12 cross-section:4points/mm, not same viewscale.

Board32axial x26tangential x1mm.

Clamp outercornerR=sqrt(28.1^2+18^2)=33.371mm.

Bare clamp exceedsR33; wall/clearance additional.

1mm wall +.25assembly ->minimum screenOD69.24.

USB bodyends5mm fartheraxially, NOT matingplane.

275mm length is only revised dimension screen.

Lowerbound beforewalls/bends/tools:72.9 source-only +77.37 collar +48 connectors =198.27mm.

Conservative81mm whole-carrier reservation gives206.37mm; neither is an achievable or approved housing minimum.

Finite wires and residual intersections are recorded inchecks.json. No mains/thermal/fixture/endurance/manufacturing acceptance.

New32x26 rotor and24x16 stationaryboards remain unrouted; outputprotection/startup/thermal gates stayopen.

FAILED integration: primarybranch overlap; LVspool/clamp interference and0.581mm tail gap. NOT a complete assembly.