

Management Procedure for Lot-Control-Specified Parts

Process 1	Identification of lot-control-specified-parts	Personnel resource	No designation
		Material resource	No designation

INPUT

The suppliers shall identify the products as lot-control-specified-products (parts) and apply key control when the products subject to the following items.

- a) Important safety parts designated as HS, HA or HB on product drawing (including processing charts, etc.)
(See SQM2.1 Special Characteristics)
- b) Products that cover ISO26262 Functional Safety Standard specified in the Requirements Specification (function requirements specification) issued by Honda
- c) Products specified by Honda with “Lot-Control-Specified Parts Notice”

Process 2	Determination of control method for lot-control-specified-parts	Personnel resource	No designation
		Material resource	No designation

INPUT

Regarding lot-control-specified-parts, the supplier shall determine the following items in consultation with Honda, but are not limited to the following:

- a) Manufacturing lot forming unit
- b) Manufacturing lot forming process and key process
- c) FIFO control method
- d) Display method of manufacturing lot identification including follows:
 - Manufacturing lot number structure
 - Identification display method on each delivery container (See SQM 3.2 Delivery Packaging)
 - Display languages
 - Display barcode labels
 - SRS ID Number (if applicable)

The supplier shall establish a system for recording manufacturing lot with considering the following items.

- e) Enables manufacturing lot and delivery lot to be retrieved from the manufacturing history of products (parts)
- f) If any changes to the process that may affect quality are found in a lot other than the manufacturing lot forming unit set forth above, record such changes as a manufacturing history and separate the lot


Manufacturing lot shall be formed in the range of parts that are or are deemed manufactured under the same conditions in accordance with the classification shown below.

Manufacturing lot size shall not exceed the volume of production per day.

Lot Formation Criteria

No.	Classification	Criteria for Manufacturing Lot Formation
1	Material	Form a manufacturing lot for each material charge No. or batch.
2	Method	Form a manufacturing lot when tooling in a process (including inspection process) is set up.
3	Equipment	Form a manufacturing lot for each manufacturing assignment which is made to two or more machines, equipment, molds, production lines, etc.
4	Work shift	Form a lot for each production date or work shift.

The supplier shall include the determined lot control method as an input in the preparation of the process flow chart.
(See SQM 3.3 PQCT(I)/Process Flow Chart)

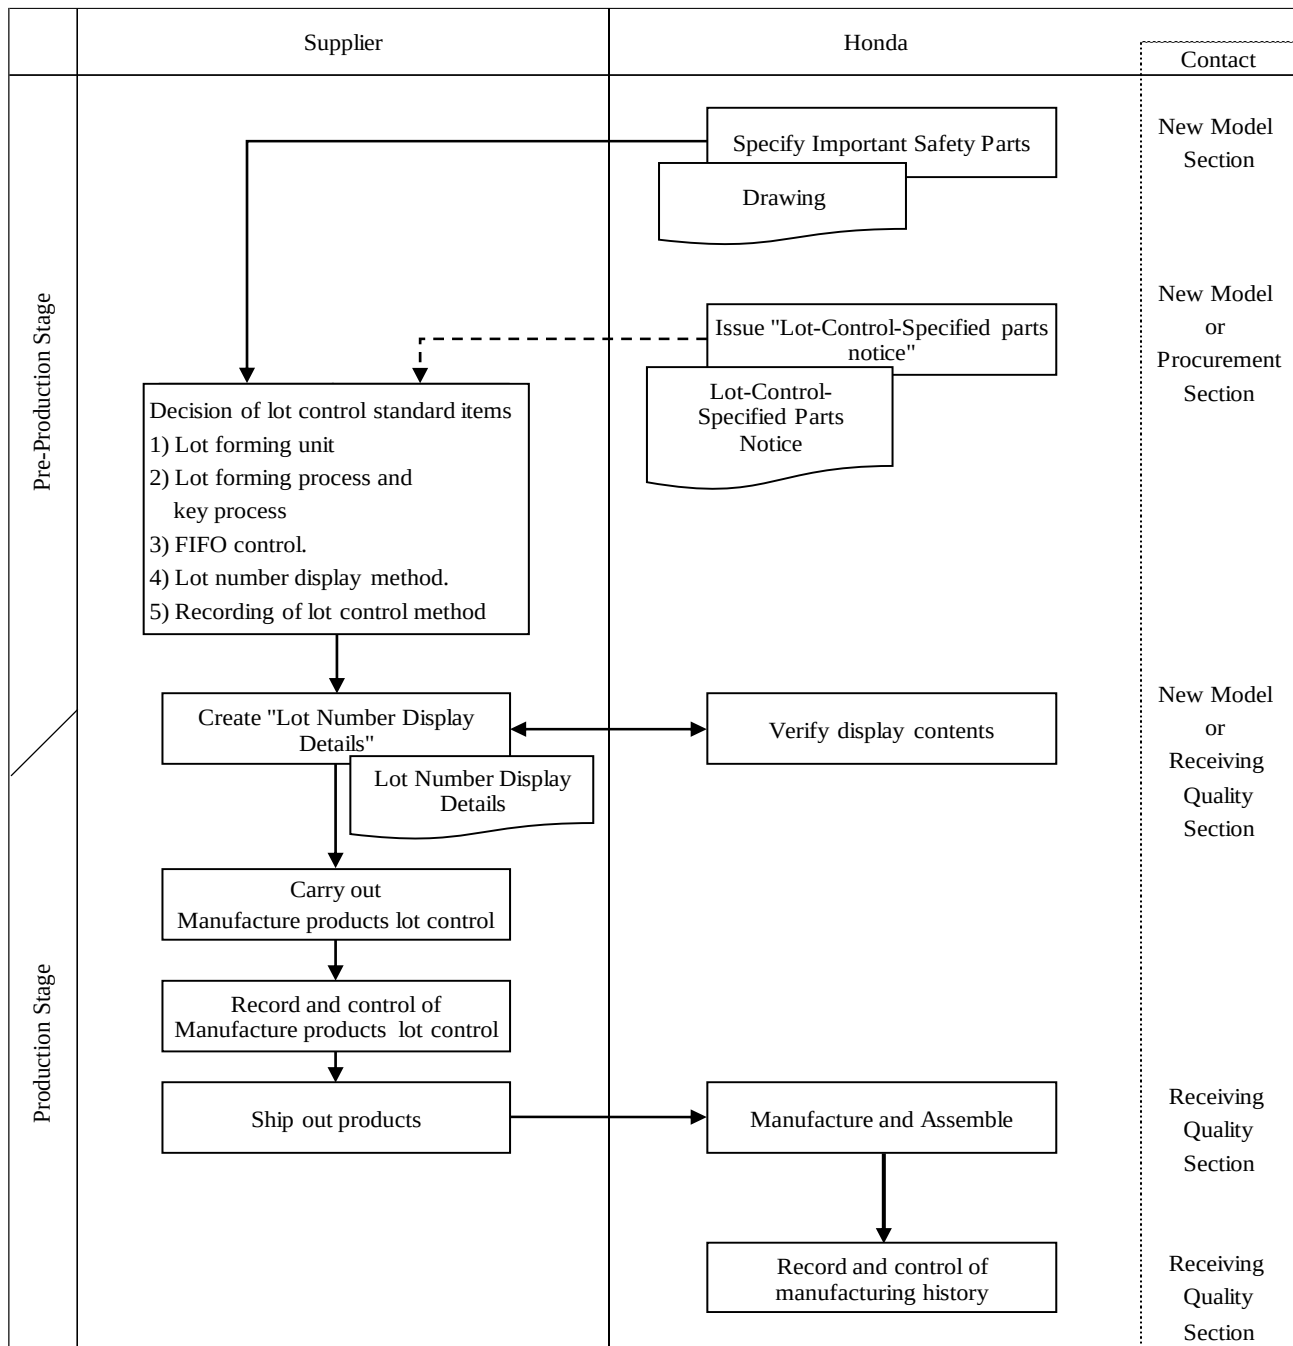

Legend : - - - -> In case Honda designates a part as a part subject to lot control, other than being designated as an important safety part on the drawing.

Lot control [specified parts]

Honda Motor Co., Ltd.

(Name of facility)

Issue Date: / / (YY/MM/DD)

Contact Section	Issue Section	

To: _____

Lot-Control-Specified Parts Notice

The following parts have been decided as lot-control-specified parts in addition to important safety parts (HS, HA and HB of important safety part rank) indicated in the title field of the drawing.

No.	Model	Part Number	Part Name	Critical Process

- (Note)
1. Upon receiving this notice, clarify the lot control method for parts subject to lot control in [Lot Number Display Details] or the like.
 2. Maintain [Lot Number Display Details] in a manner that it can be submitted if so requested.
 3. When display a lot mark on each part (if there is no specification on the drawing), consult with for display method.
 4. Parts are should be controlled on a "first-in first-out" basis.

05101