


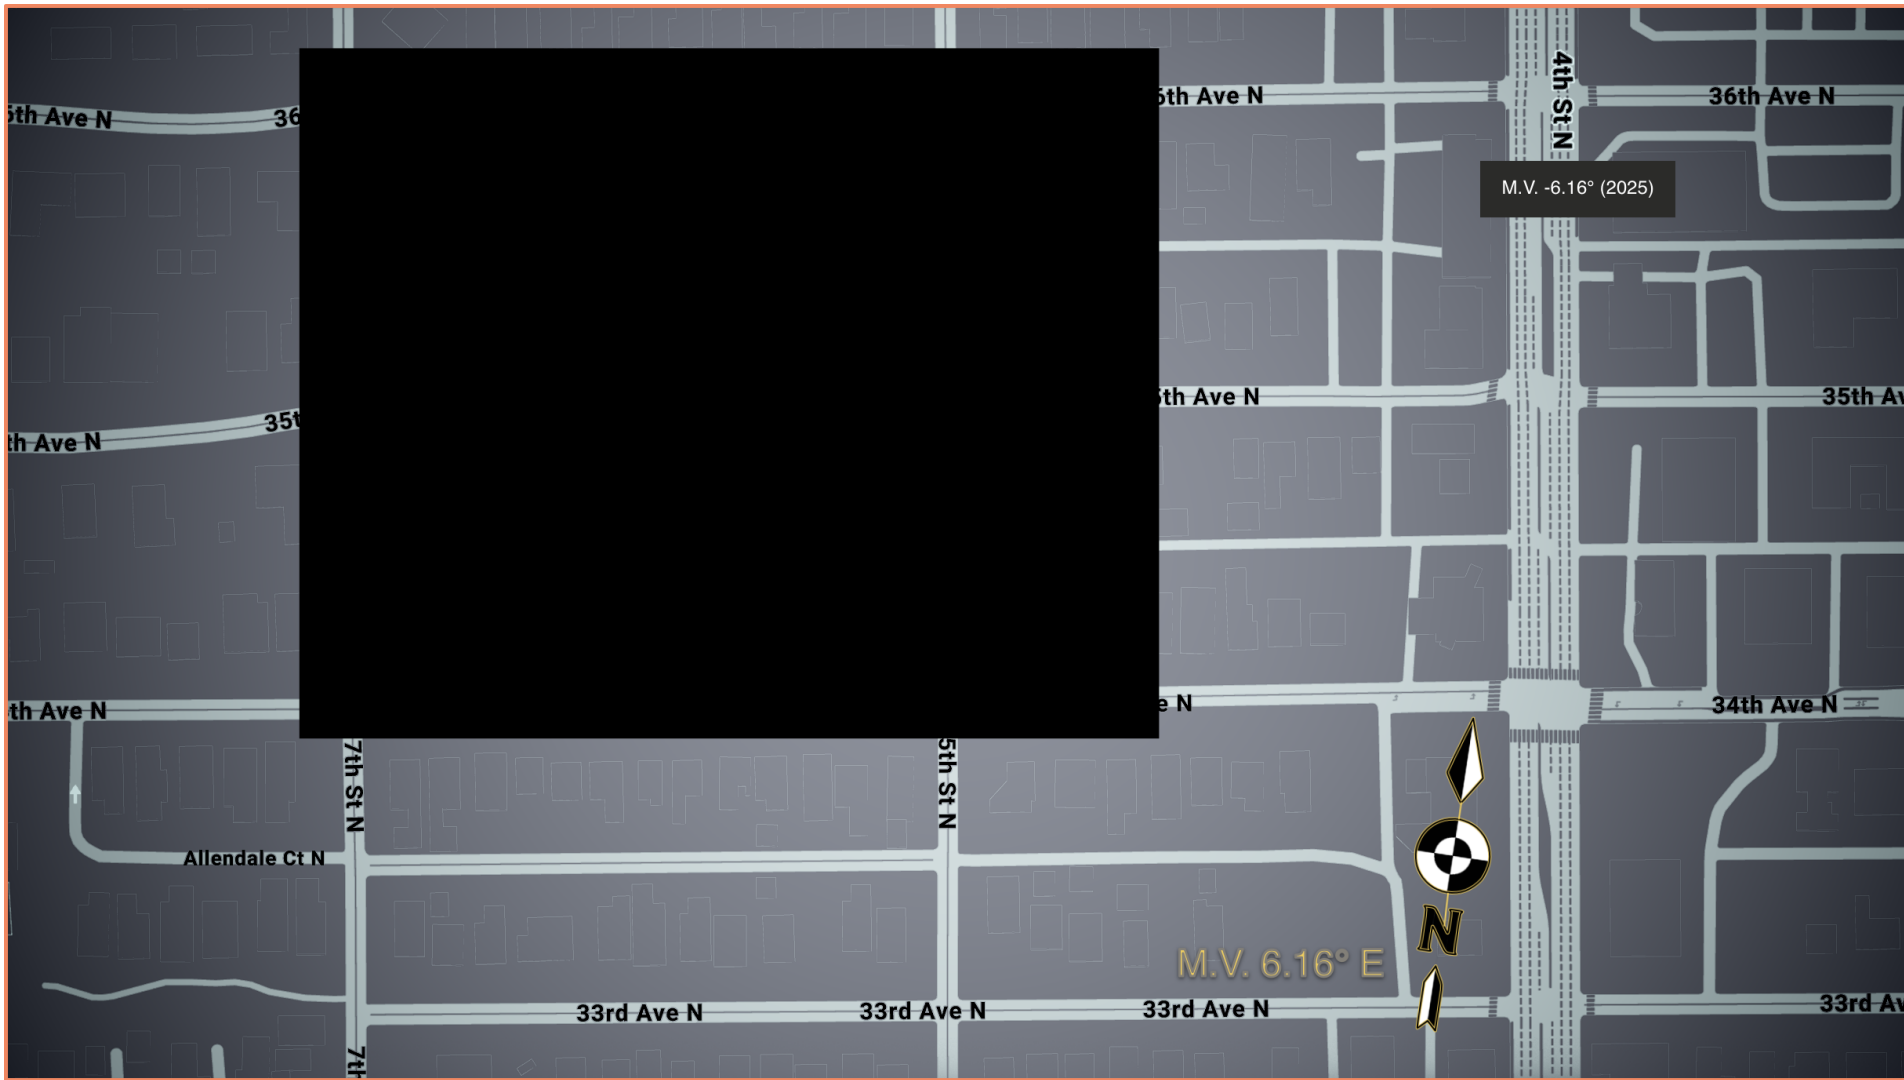

Project Data

Location	
Parcel Number	
Zoning	NT-2
Lot Size	127' x 45' -- ~5667 sq.ft. = 0.13 acres
Living Area	1288 sq.ft., 1-story
Gross Area	1957 sq.ft.
Building Use	Single-Family Residential, Single Unit
Occ. Group	R-3
Const. Type	Type V
Project Scope	Repair of vehicle impact damage to exterior and interior wood-framed wall. Scope includes replacement of four damaged 2x4 studs, interior drywall, exterior sheathing and stucco cladding to match existing. A 3'x3' window will be inspected for structural integrity and replaced to match existing if required. No structural changes to layout, roof, or foundation. No plumbing, electrical, or mechanical modifications involved. Smoke and CO alarms to be verified per FBC requirements.
Evacuation Zone	'C'
Flood Zone?	No
Market Value (2025)	\$413,815

Sheet Index

A0.1.....	Title, Index, Legend
A0.2.....	References, Resources, BOM
A1.1.....	Site Plan
A1.2.....	Floor Plan
A2.1.....	Damage Side Elevation
A3.1.....	Damage Wall Section
A5.1.....	Top Plate & Header
A5.2.....	Bottom Plate & Sub-Floor
A5.3.....	Window & External Repairs
A5.4.....	Storm Shutter Installation
A7.1.....	Miscellaneous



Points of Contact

Contractor:

Project Manager/Author:
Justin Lenhart



Author's Note
This plan set was prepared by the homeowner. I am NOT an architect, professional engineer, or even a draftsman - just a guy with a bit of spare time, some CAD skills, and a few engineering degrees that probably should have been civil instead of mechanical. If nothing else, at least the paperwork will look good.

I've tried to make this package thorough, clear, and compliant with the Florida Building Code, with all the citations and references that an inspector (or any code nerd) might want. While not stamped by a design professional, the details herein are prepared with care and a fair amount of engineering common sense. (For more details on my background, see the QR codes below for resume and LinkedIn.)

Envisioned Interior Repairs



Items & Tags	Areas	
Window Tag	Damage & Repair Area	
Door Tag	Sidewalk	
Smoke Detector	Road	
Material Tag	Unconditioned Space	
Electrical Outlet	Conditioned Space	
Fire/CO Detector (New)	<th>Walls & Boundaries</th>	Walls & Boundaries
Fire Detector (Existing)	Non-Structural and/or Interior Wall	
<th>Materials</th>	Materials	Structural and/or Exterior Wall
Existing Frame Member	Feature Wall (h=1'-0")	
Replacement Frame Member	Fencing	
Insulation	Property Limit	
Stucco	Sod/Turf/Yard/Etc.	
Sheathing		
Stucco (wall repair section view only)		

A0.1 Submittal Checklist (See note 1)

- ☒ Property address
- ☒ Contact info
- ☒ Building code ed.
- ☒ Occ. group/use
- ☒ #/stories
- ☒ Residence area
- ☒ Flood zone
- ☒ Zone district





BOM Spreadsheet

Project Bill of Materials

	Item	Approval Code	Mfg./Product Name	Qty.
01	Window, 3'-0"x3'0", SH	FL15906-R7	Andersen 100SHS3030	(1)
02	Stud, 2x4 in	[1]	Versa-Stud LVL 2x4 SP2650 (3 piece)	(2)
03	Stud, 2x6 in	[1]	Versa-Stud LVL 2x6 SP2650 (2 piece)	(1)
04	Drywall	ICC-ES ESR 3365 [2]	UGS Sheetrock Mold Tough 4x8ft	(2)
05	Insulation, 3.5x15x47 in.	ICC-ES ESR 3773	ComfortBatt R15, RXCB351525	
06	Sheathing, 48x96 in.	TER No. 1004-01 [6]	Homebrella Thermo-ply Red	
07	Stucco - TBD	TBD	TBD	
08	Fastener, 10d x 3 in	ICC-ES ESR 2236	Simpson SSA10	(53)
09	Fastener, 10d x 1-1/2 in	ICC-ES ESR 2236	Simpson SSNA10	(56)
10	Fastener, 16d x 3-1/2 in	ICC-ES ESR 2236	Simpson T16AKR	(16)
11	WRB, 3x165 ft	ICC-ES ESR 2375 [3]	Tyvek WRB	(1)
12	FlexWrap, 9 in x 75 ft	ICC-ES ESR 2375 [3]	Dupont FlexWrap	(1)
13	Tape, Flashing, 164 ft	ICC-ES ESR 2375 [3]	Tyvek Installation Tape	(1)
14	Window & Door Sealant, 10.1 oz	[4]	GE Advanced Silicone 2	(1)
15	Staples, Capped, 3/8 in, (2016) Box	ICC-ES ESR 1539	Stinger Model # 136420	(1)
16	Plate Connector, Double Stud (DSP)	FL10456.1 ICC-ES ESR 2613	Simpson Double Stud Plate Tie	(6)
17	Plate Connector, Reversible (RSP4)	FL10456.9 ICC-ES ESR 2613	Simpson Reversible Plate Tie	(1)
18	Shutter, Polycarbonate	FL28824.1	Polygal Storm Shutter, 3-Wall, 16mm	(1)
18	Detector, CO and Smoke/Fire	[5]	X-Sense SC07-WX	3

BOM Notes:

- [1] Boise Cascade Versa-Stud LVL SP-2650 1.7 (2x4 & 2x6) — Structural engineered wood stud. Compliance verified per ICC-ES Evaluation Report ESR-1040 (covers Versa-Lam/LVL and Versa-Stud products) for IRC R602 & IBC applications. Design and connections per NDS for structural composite lumber; ASTM D5456 standard applies.
- [2] USG Sheetrock® UltraLight Mold Tough® gypsum board — compliant with ASTM C1396, ICC-ES ESR-3365 for UltraLight Panel systems. Provides mold and moisture resistance. Florida Product Approval number not available; ICC-ES certification demonstrates recognized standards compliance.
- [3] Tyvek WRB, FlexWrap, and installation tape do not currently hold FL approvals, however, it is air and moisture barrier compliant per ICC-ES ESR-2375; meeting ICC-ES AC38 criteria for water-resistive and air barriers. Product is widely accepted by code jurisdictions and distributed in FL. A similar Dupont underlayment product is approved (FL20876.2-R2).
- [4] GE Advanced Silicone 2 Window & Door Sealant — 100% silicone, meets ASTM C-920, Type S, Class 35, and Federal Spec TT-S-00230C / TT-S-001543A. No Florida Product Approval or ICC-ES Evaluation Report is available; performance conforms to recognized national building sealant standards.
- [5] X-Sense SC07-WX combination smoke and CO alarm - battery powered and wireless interconnect. Unit is UL-listed to UL 217 (smoke) and UL 2034 (CO). No FL product approval number issued; installed under FBC 315.5 retrofit exception permitting battery-only units for permitted repair/alteration work. Placement under FBC 315: within 10 ft of sleeping areas, installed ~3-5 ft above finished floor or per mfg. instructions.
- [6] Thermo-ply Red - Florida product approval not found. Product is recognized as code-compliant per "DrJ Engineering TER No. 1004-01, demonstrating compliance with the FBC. Acceptable alternative to structural wood panel per URC/IBC when installed per conditions of the evaluation report. TER No. 1004-01 is available at: https://drive.google.com/file/d/1K4gdPZylAr6BAUmgP4URx7W4P_8Sjq0Q/view?usp=sharing

Dynamic BOM Spreadsheet:

https://docs.google.com/spreadsheets/d/1TvO3FhKCCr3YiPyszCzrsNon_qV9A5iQRR7v6dhQ81E/edit?usp=sharing



References

Governing Codes & Standards

- [1] Florida Building Code (FBC), 8th Ed. (2023) - Residential
- [2] Florida Department of Business & Professional Regulation- Florida Product Approvals
- [3] ICC Evaluation Service
- [4] ASCE 7 - Minimum Design Loads & Associated Criteria for Buildings & Other Structures

<https://codes.iccsafe.org/content/FLRC2020P1/>

https://www.floridabuilding.org/pr/pr_default.aspx

<https://www.icc-es.org/reports-directory/>

<https://ascelibrary.org/doi/book/10.1061/9780784414248>

Manufacturer Guides/Instructions

- [5] Andersen 100 Series Window Installation Guide
- [6] Tyvek WRB & Self-Adhered Flashing Products Installation Guidelines
- [7] Simpson Strong-Tie Fastener Overview
- [8] Simpson Strong-Tie Wood Construction Connectors Catalog Pgs 291-293
- [9] Storm Shutter Installation Guide

<https://drive.google.com/file/d/1iy18bsnQT2xB3OZhdUfovNhnuBnRoJnZ/view?usp=sharing>

Note: Generated from Andersen Installation Guide Configurator:

<https://www.andersenwindows.com/support/window-door-installation/installation-guide-configurator/>

<https://www.dupont.com/content/dam/dupont/amer/us/en/performance-building-solutions/public/documents/en/install-guide-single-family-wrb-and-flashing-after-wrb-43-d101048-enus.pdf>

<https://www.strongtie.com/products/fastening-systems/technical-notes/nails-overview>

https://ssttoolbox.widen.net/view/pdf/hnavunfsbl/C-C-2024_p291-293.pdf?t.download=true

<https://images.thdstatic.com/catalog/pdfImages/72/72c5e2f7-936d-47e7-8169-6987a08bbd45.pdf>

Miscellaneous Resources

- [10] OpenStreetMap/Open-Elevation/SRTM DEM Geospatial/Elevation Data
- [11] FEMA Flood Map Service Center
- [12] St. Petersburg Building Permit Website

<https://www.openstreetmap.org>

<https://msc.fema.gov/portal/search?>

https://www.stpete.org/business/building_permitting/building_permits.php

Notes

Structural Framing Repair

- Restore vertical and horizontal load path continuity per FBC R301.1. Replace damaged 2x4 studs with sisters per detail
- Headers: replace if necessary. Size per FBC R602.7 span tables. Provide king studs, trimmer studs, sill, and cripple studs per FBC Figure R602.3(2).
- Built-up members: nail plies per FBC Table R602.3(1) (10d @ 8" o.c.). Minimum 1-1/2 in. nail penetration into adjoining member.
- Sheathing: replace exterior wood structural panel ; sheathing, thickness, and nailing to match or exceed existing; maintain braced wall line continuity per FBC R602.10.
- Fireblocking & draftstopping: provide per FBC R302.11 at stud cavities interrupted by repairs; seal penetrations appropriately.
- Corrosion: All exterior/WRB-interface fasteners and connectors G185 hot-dip galvanized or stainless per FBC R317.3.

Connectors & Fasteners

- Simpson Strong-Tie where indicated to join vertical members with top and bottom plates.
- Fasteners: use specified nails per Simpson installation instructions and FBC Table R602.3(1). Nails to comply with ASTM F1667; maintain required embedment (generally, 1-1/2 in. into joined member).
- Substitution of fastener type/size requires equivalent or greater capacity per manufacturer evaluation (and ICC-ES or Florida approval).

Exterior Wall - WRB/Stucco/Flashing

- WRB: Install two independent layers over wood-based sheathing for stucco per FBC R703.7.3. Inner WRB is primary drainage plane; outer WRB serves as sacrificial sheet.
- Dupont Tyvek WRB products are not Florida approved but recognized under ICC-ES ESR 2375. Provide shingle-lapped seams; integrate with flashing at all penetrations.
- Flashing: Sill and jamb flashing through use of FlexWrap and Installation Tape; sequence per Reference [6] pages 30-34; sill weeps integrated into Andersen 100SHS3030.
- Stucco: Metal lath and three-coat cement plaster over WRB. Weep screed at base and casing beads per FBC Chapter 7.

Window Replacement

- Window: Andersen 100 Series model 100SHS3030. Install per manufacturer's instructions (Reference [5]).
- Provide approved shutter system per FBC R301.2.1.2.
- NFRC certified performance - U-Factor: 0.29; SHGC: 0.21; VT: 0.49.

Design Criteria


Risk Category II

V_{ULT}: 170 mph

FEMA FERM Designation: Zone X

Flood Risk: Pinellas County stormwater map does not indicate additional floodplain constraints.

Address:




Made by : Justin Lenhart

Date : 09/03/2025



Consolidated Reference Docs:

https://drive.google.com/file/d/1iy18bsnQT2xB3OZhdUfovNhnuBnRoJnZ/view?usp=share_link




tampa,

A0.2

BOM & REFERENCES

SCALE N/A

NOTES:

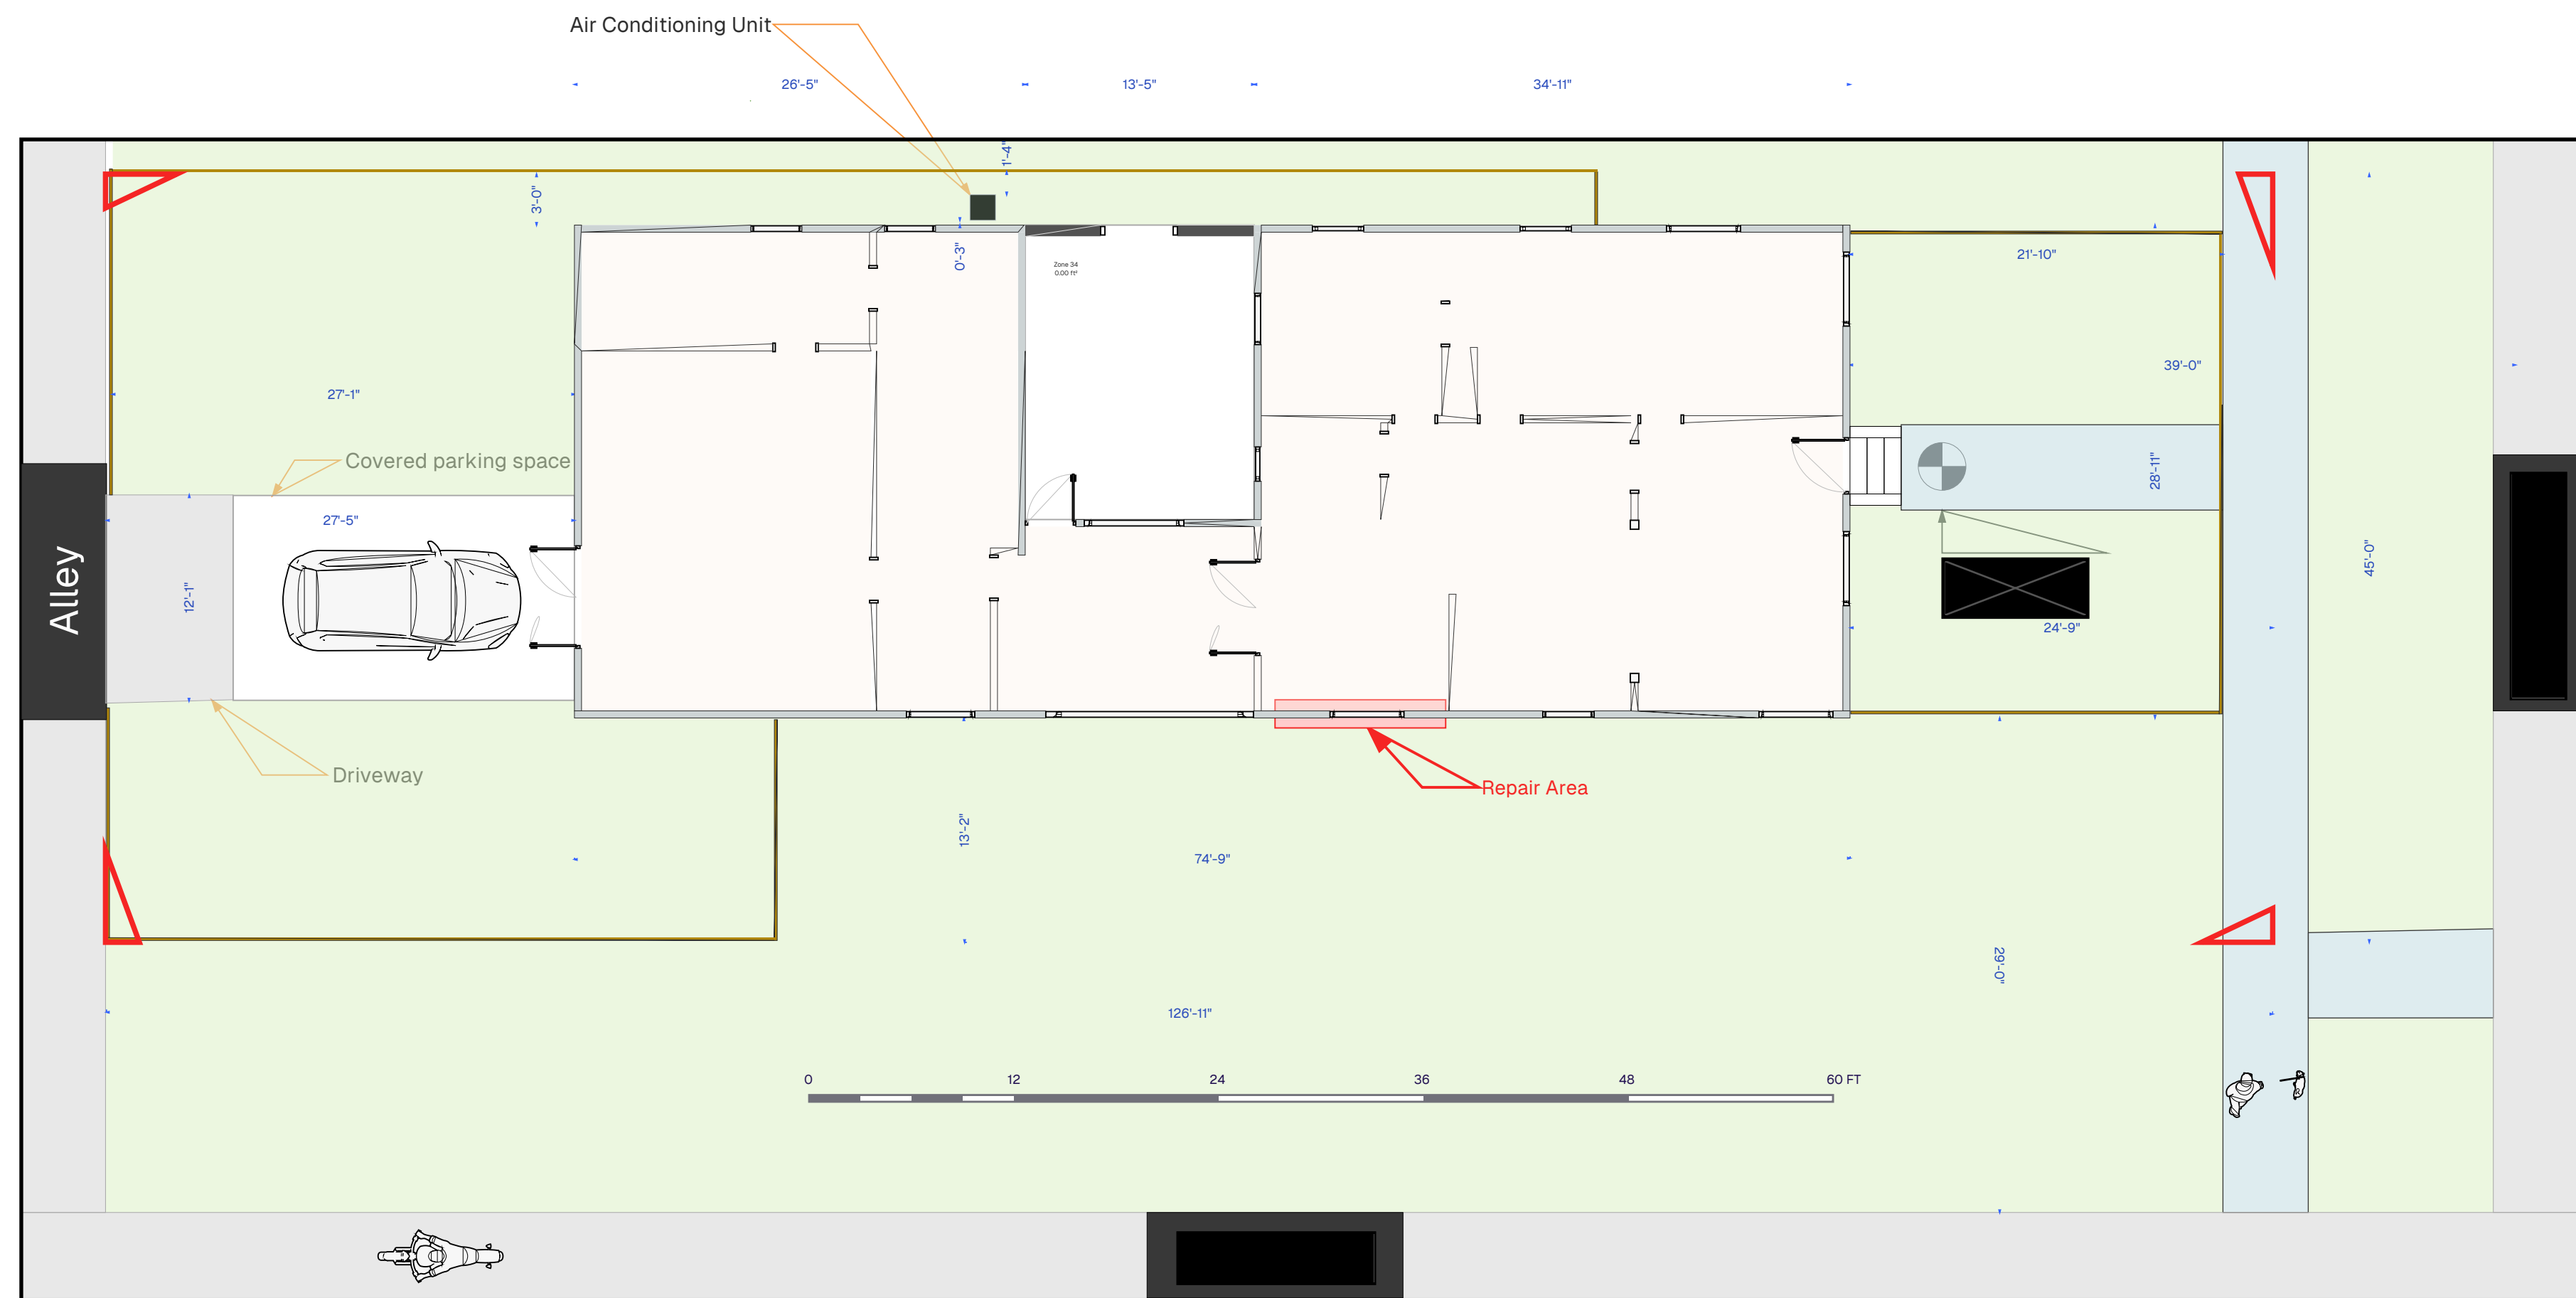

A1.1 Submittal Checklist (See note 3)

- ☒ Dimensioned with north-seeking arrow
- ☒ Location of property lines, streets indicated
- ☒ Bldg. footprint & orientation consistent throughout drawings
- ☒ Flood zone? **No**
- ☒ Location & dims. of sidewalks, driveways, parking
- ☒ Dims. from prop. lines to AC pad, fencing
- ☒ Attic access (originally from floor plan checklist)

Road	Damage & Repair Area	Non-Structural and/or Interior Wall	Unconditioned Space	Sod/Turf/Yard/Etc.
Property Limit	Sidewalk	Structural and/or Exterior Wall	Conditioned Space	
		Fencing		

NOTES:

- Street dimensions not to scale.
- Geospatial data is drawn from publicly available resources and should not be considered of survey precision.
- Checklist from Ref. [12] "Residential Plans Submittal Checklist".

Address: [REDACTED]

Made by : Justin Lenhart

Date : 09/03/2025



[REDACTED]
tampa,




A1.1

SITE OVERVIEW

SCALE
1:3/16


A1.2 Submittal Checklist (See note 2)

- ☒ Dimensioned with north-seeking arrow
- ☒ Area breakdown; (un)conditioned space noted
- ☒ Size/arrangement of rooms, intended use
- ☒ Room dimensions, heights (see 3.1 for height)
- ☒ Dwelling egress, window/door size/location noted
- ☒ Attic access (see 2.1)
- ☒ Smoke/CO detector location(s)
- ☒ North-seeking arrow

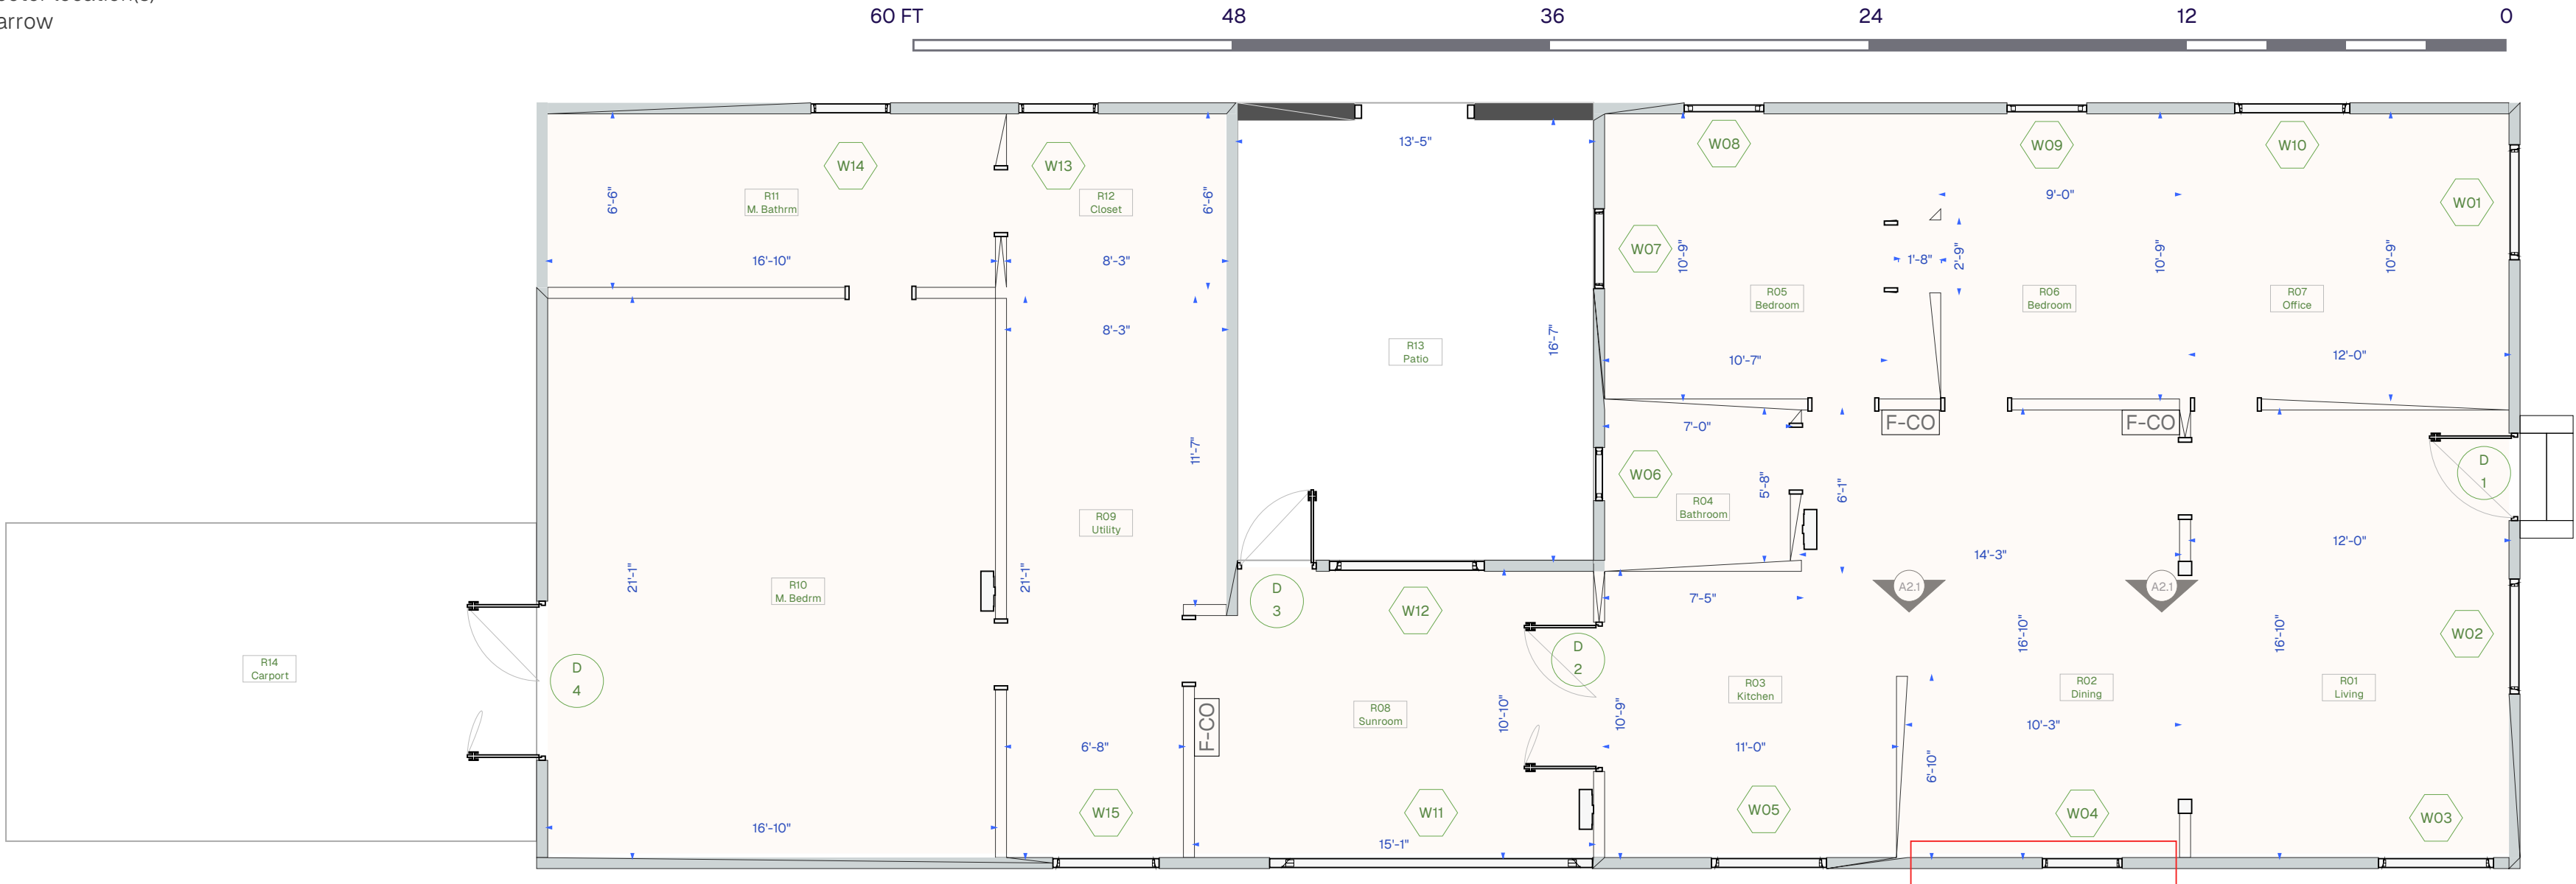

A2.1

A2.1

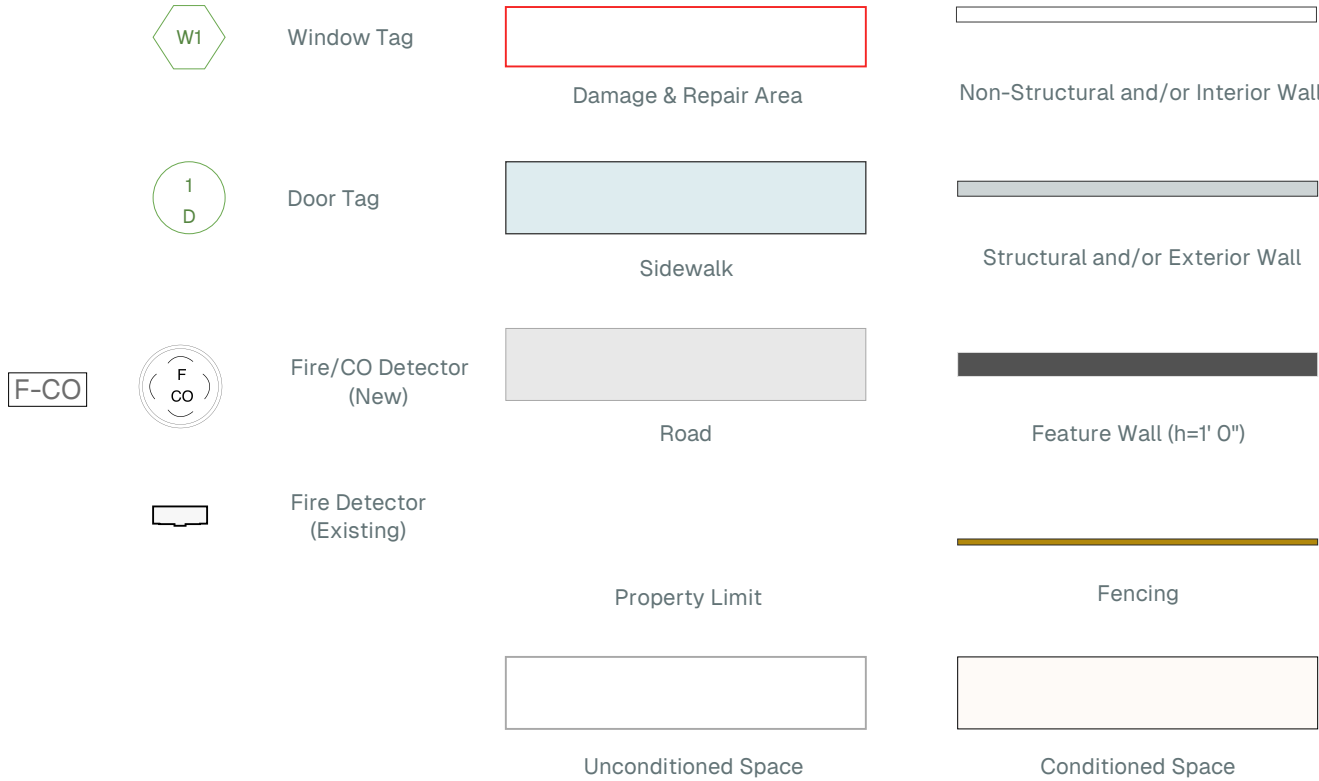


Window, Door, & Room Specifications

W01	4' 4" x 3' 2"	Single Hung	W09	3' 0" x 3' 0"	Picture	D 3	2' 8" x 6' 8"	Left Out-Swing	R01 Living	Living Room	202 sq.ft.	R06 Bedroom	Bedroom 2	101 sq.ft.	R11 M. Bathrm	Master Bath
W02	4' 4" x 3' 2"	Single Hung	W10	4' 4" x 3' 2"	Single Hung	D 4	6' 0" x 6' 8"	Double Out-Swing	R02 Dining	Dining Room	260 sq.ft.	R07 Office	Office	129 sq.ft.	R12 Closet	Closet
W03	4' 4" x 3' 2"	Single Hung	W11	12' 2" x 4' 2"	4 Section, Single Hung				R03 Kitchen	Kitchen	141 sq.ft.	R08 Sunroom	Sun Room	159 sq.ft.	R13 Patio	Patio
W04	3' 0" x 3' 0"	Single Hung	W12	5' 10" 4' 2"	Single Hung				R04 Bathroom	Bathroom	40 sq.ft.	R09 Utility	Utility Room	159 sq.ft.		
W05	4' 4" x 3' 2"	Single Hung	W13	4' 2" x 3' 0"	Single Hung				R05 Bedroom	Bedroom 1	114 sq.ft.	R10 M. Bedrm	Master Bedroom	356 sq.ft.		
W06	2' 0" x 2' 0"	Awning	W13	4' 2" x 3' 0"	Single Hung											
W07	3' 0" x 3' 0"	Single Hung	D 1	3' 0" x 6' 8"	Right In-Swing											
W08	3' 0" x 3' 0"	Picture	D 2	5' 0" x 6' 8"	Double Out-Swing											

NOTES:
1. Interior doors omitted for simplicity.
2. Checklist from Ref. [12] "Residential Plans Submittal Checklist".

Address: [Redacted]

Made by : Justin Lenhart
Date : 09/03/2025

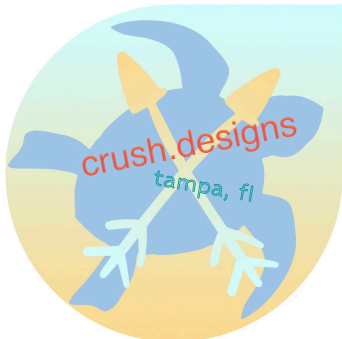


A1.2

PLAN VIEW
SCALE
1:3/16

A2.1 Submittal Checklist (See note 2)

- ☒ Windows & doors noted
- ☒ Exterior finish
- ☒ North-seeking arrow

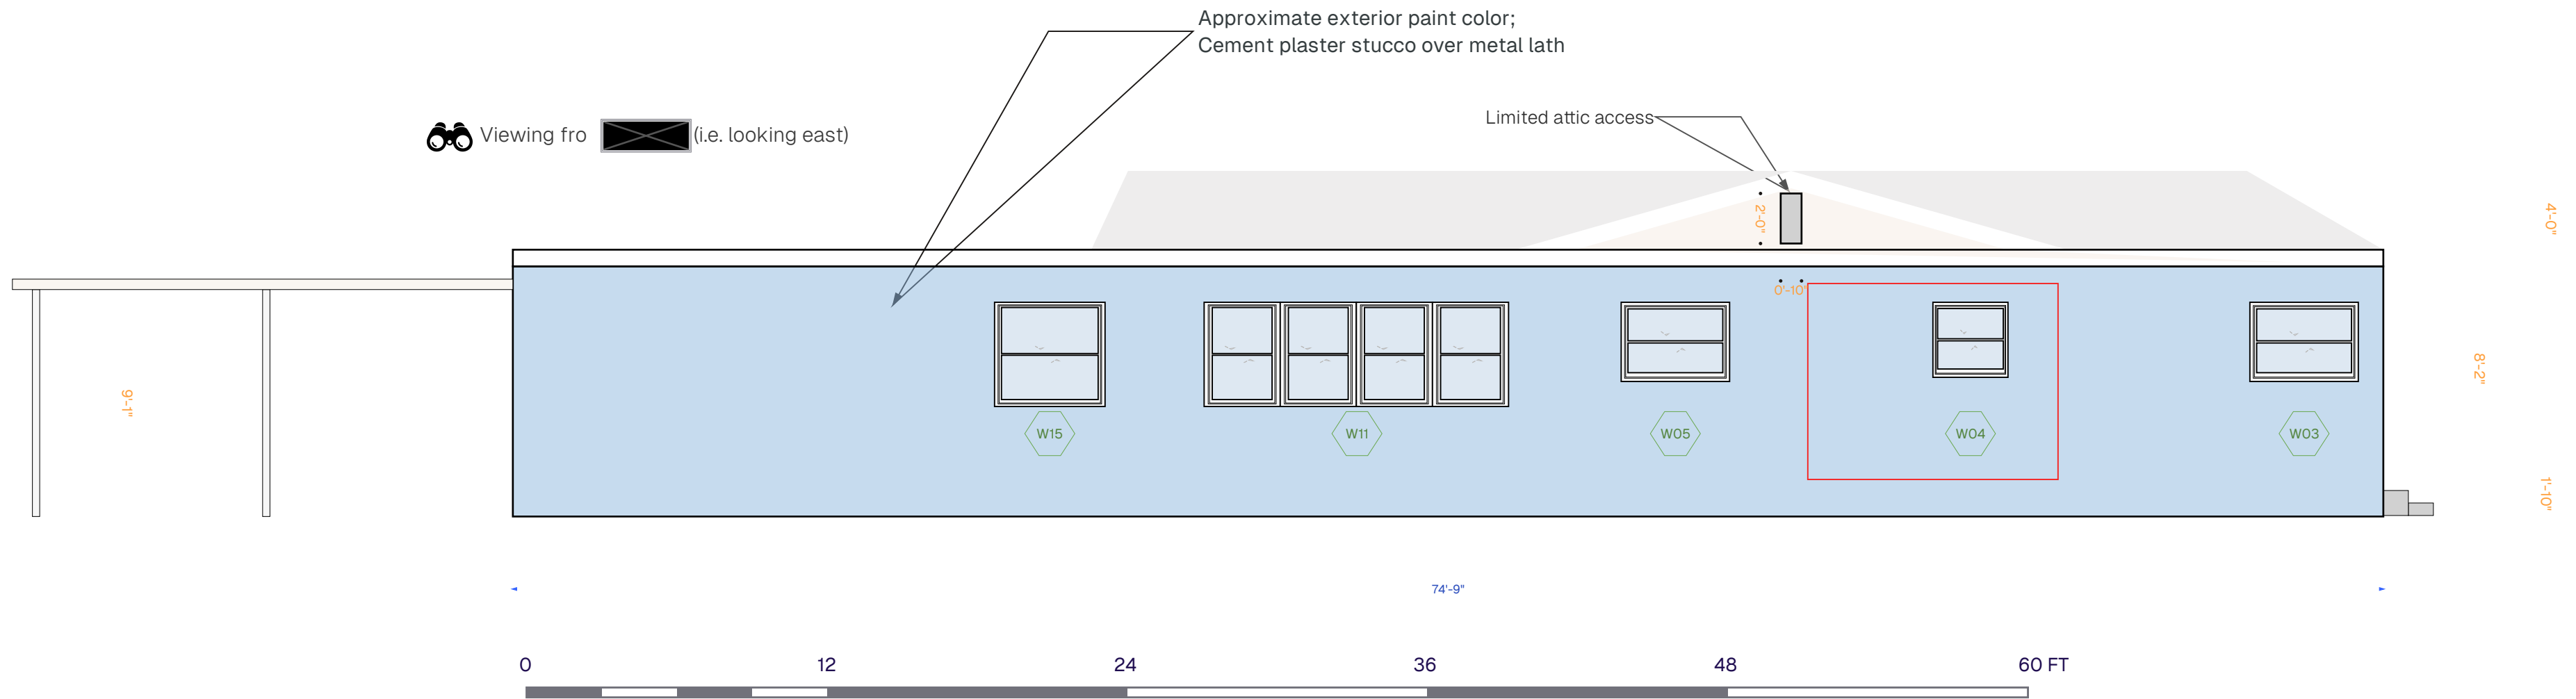


Window, Door, & Room Specifications															
W01	4' 4" x 3' 2"	Single Hung	W09	3' 0" x 3' 0"	Picture	D 3	2' 8" x 6' 8"	Left Out-Swing							
W02	4' 4" x 3' 2"	Single Hung	W10	4' 4" x 3' 2"	Single Hung	D 4	6' 0" x 6' 8"	Double Out-Swing							
W03	4' 4" x 3' 2"	Single Hung	W11	12' 2" x 4' 2"	4 Section, Single Hung										
W04	3' 0" x 3' 0"	Single Hung	W12	5' 10" 4' 2"	Single Hung	R01 Living	Living Room	202 sq.ft.	R06 Bedroom	Bedroom 2	101 sq.ft.	R11 M. Bathrm	Master Bath		
W05	4' 4" x 3' 2"	Single Hung	W13	4' 2" x 3' 0"	Single Hung	R02 Dining	Dining Room	260 sq.ft.	R07 Office	Office	129 sq.ft.	R12 Closet	Closet		
W06	2' 0" x 2' 0"	Awning	W13	4' 2" x 3' 0"	Single Hung	R03 Kitchen	Kitchen	141 sq.ft.	R08 Sunroom	Sun Room	159 sq.ft.	R13 Patio	Patio		
W07	3' 0" x 3' 0"	Single Hung	D 1	3' 0" x 6' 8"	Right In-Swing	R04 Bathroom	Bathroom	40 sq.ft.	R09 Utility	Utility Room	159 sq.ft.				
W08	3' 0" x 3' 0"	Picture	D 2	5' 0" x 6' 8"	Double Out-Swing	R05 Bedroom	Bedroom 1	114 sq.ft.	R10 M. Bedrm	Master Bedroom	356 sq.ft.				

NOTES:
1. Interior doors omitted for simplicity
2. Checklist from Ref. [12] "Residential Plans Submittal Checklist".

Address: [X]

Made by : Justin Lenhart

Date : 09/03/2025




A2.1

ELEVATION VIEW (DAMAGE SIDE)

SCALE
1:3/16

See Addendum (sheet 7.1) for order of interior repairs.

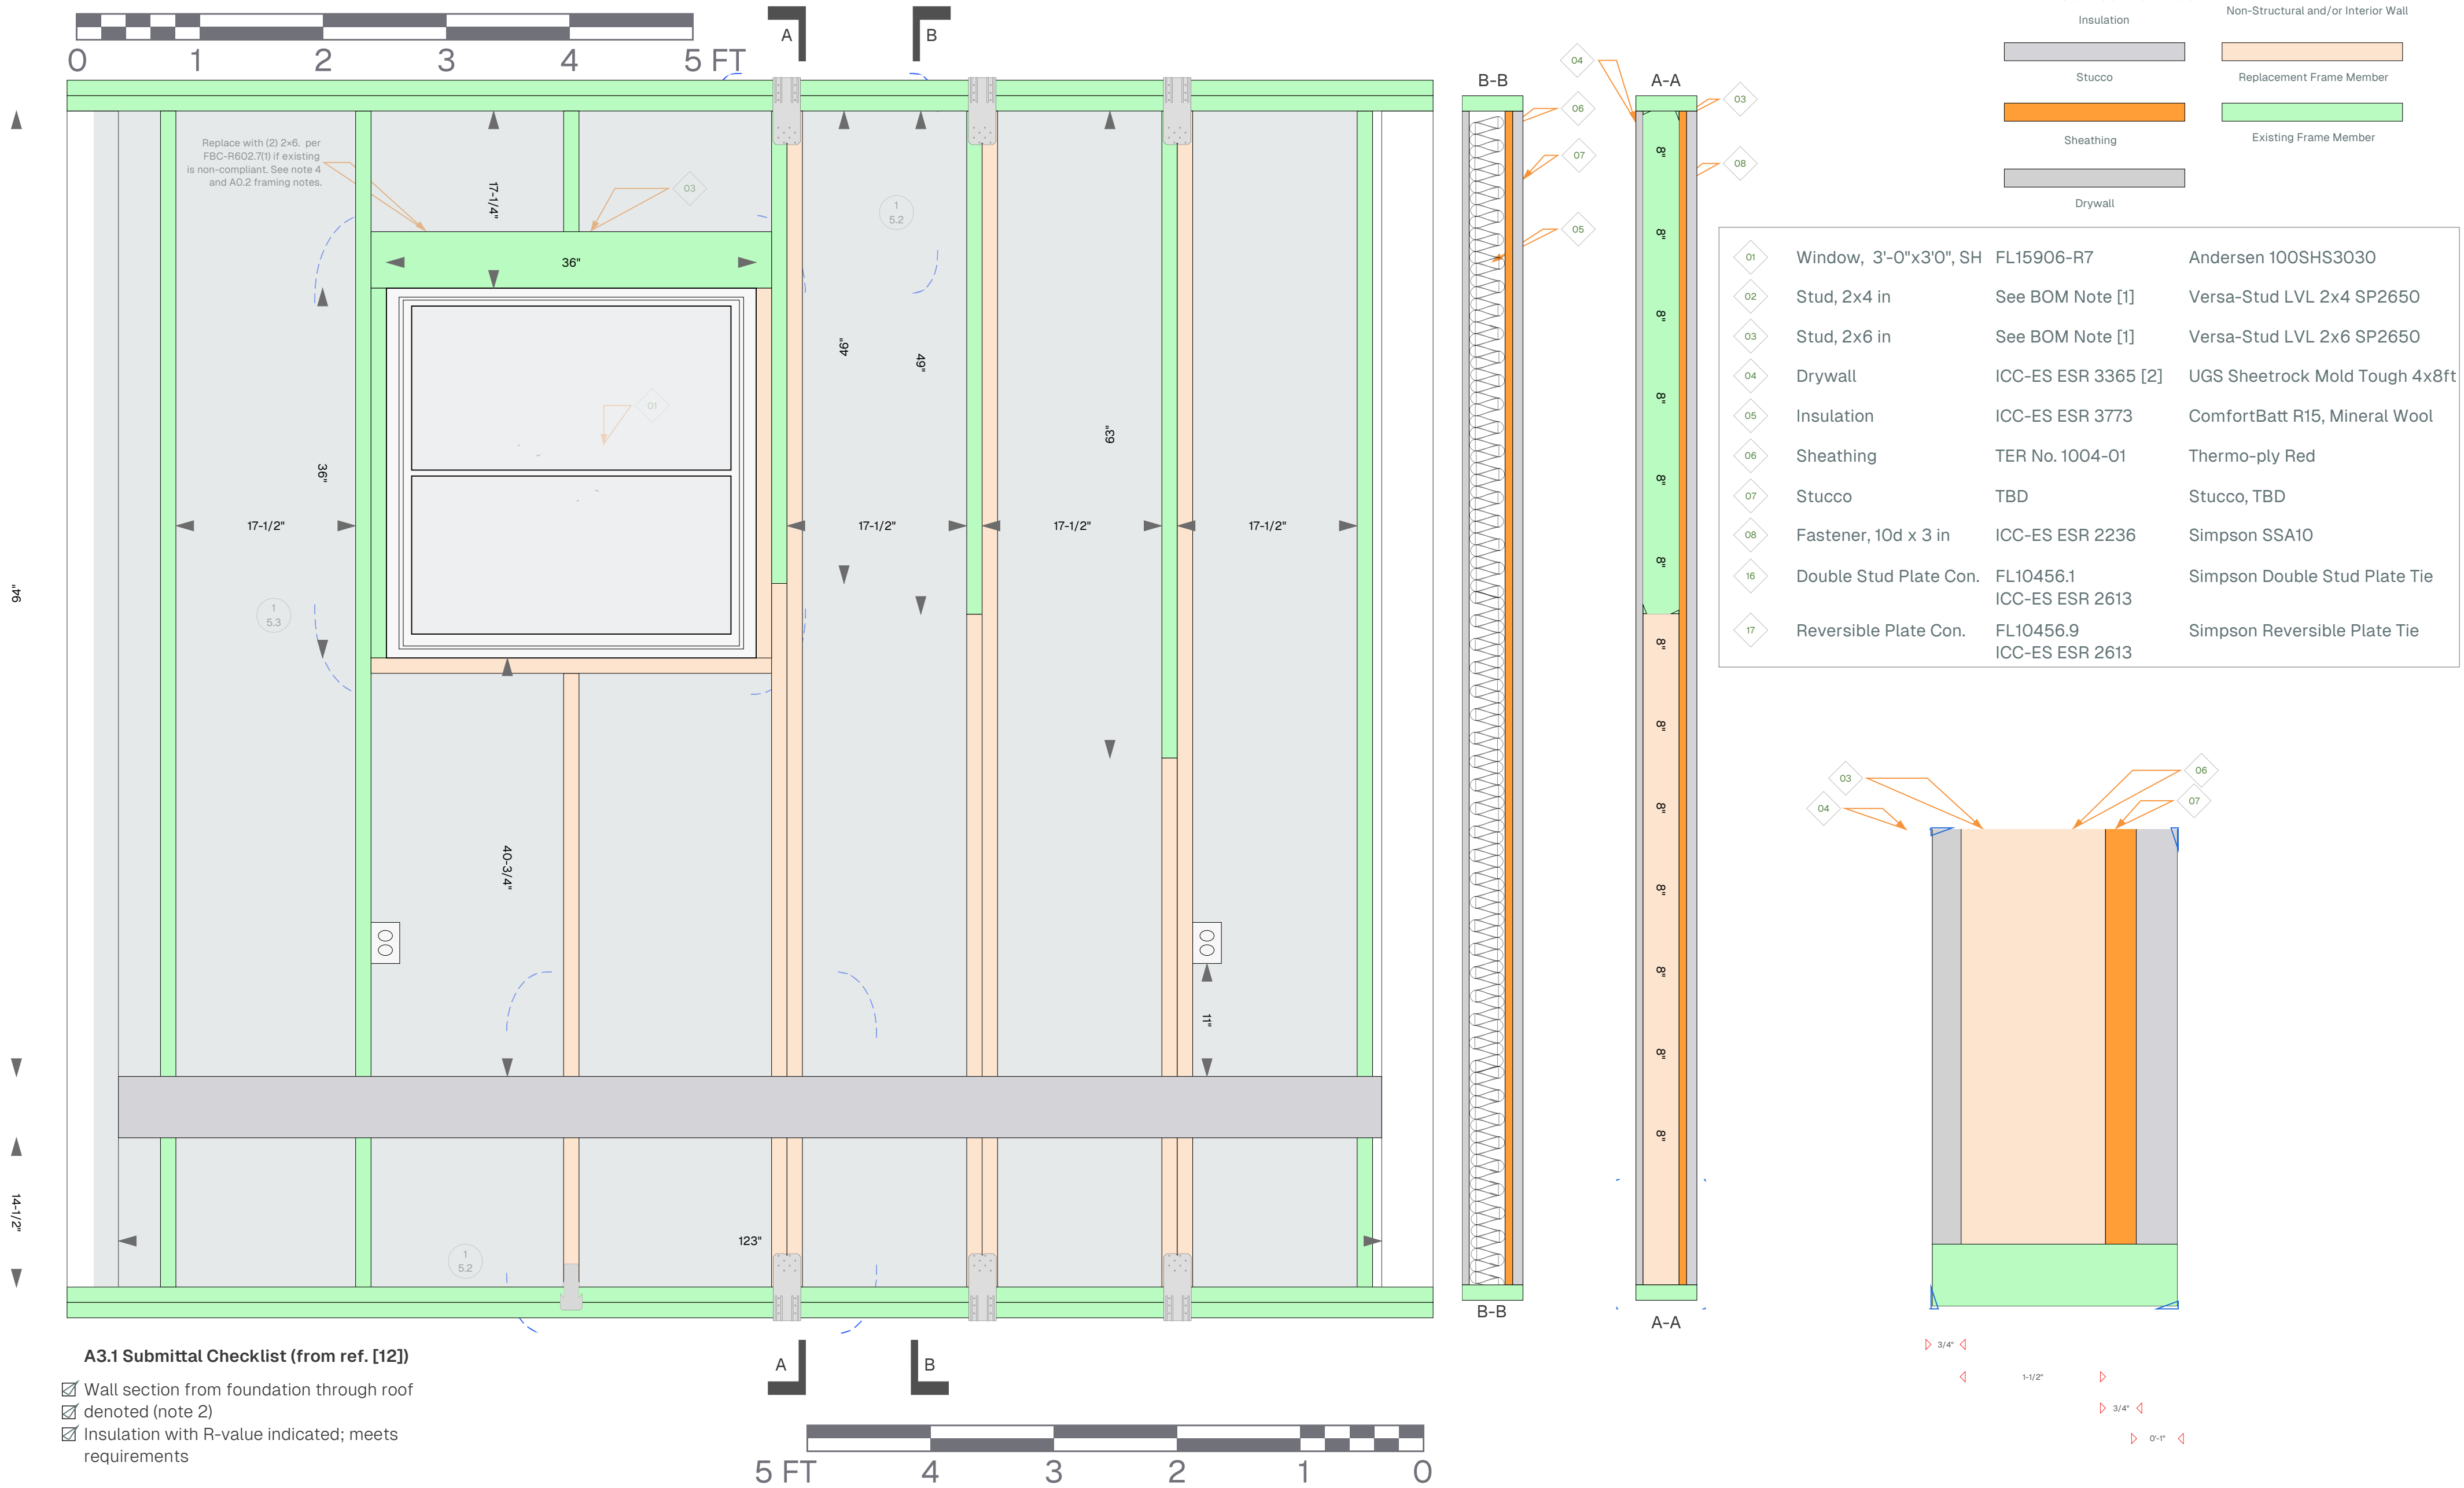

Reference for section view only

A3.1

WALL REPAIR SECTION

SCALE
1:1-7/64



Address: [Redacted]

Made by : Justin Lenhart

Date : 09/03/2025



[Redacted]

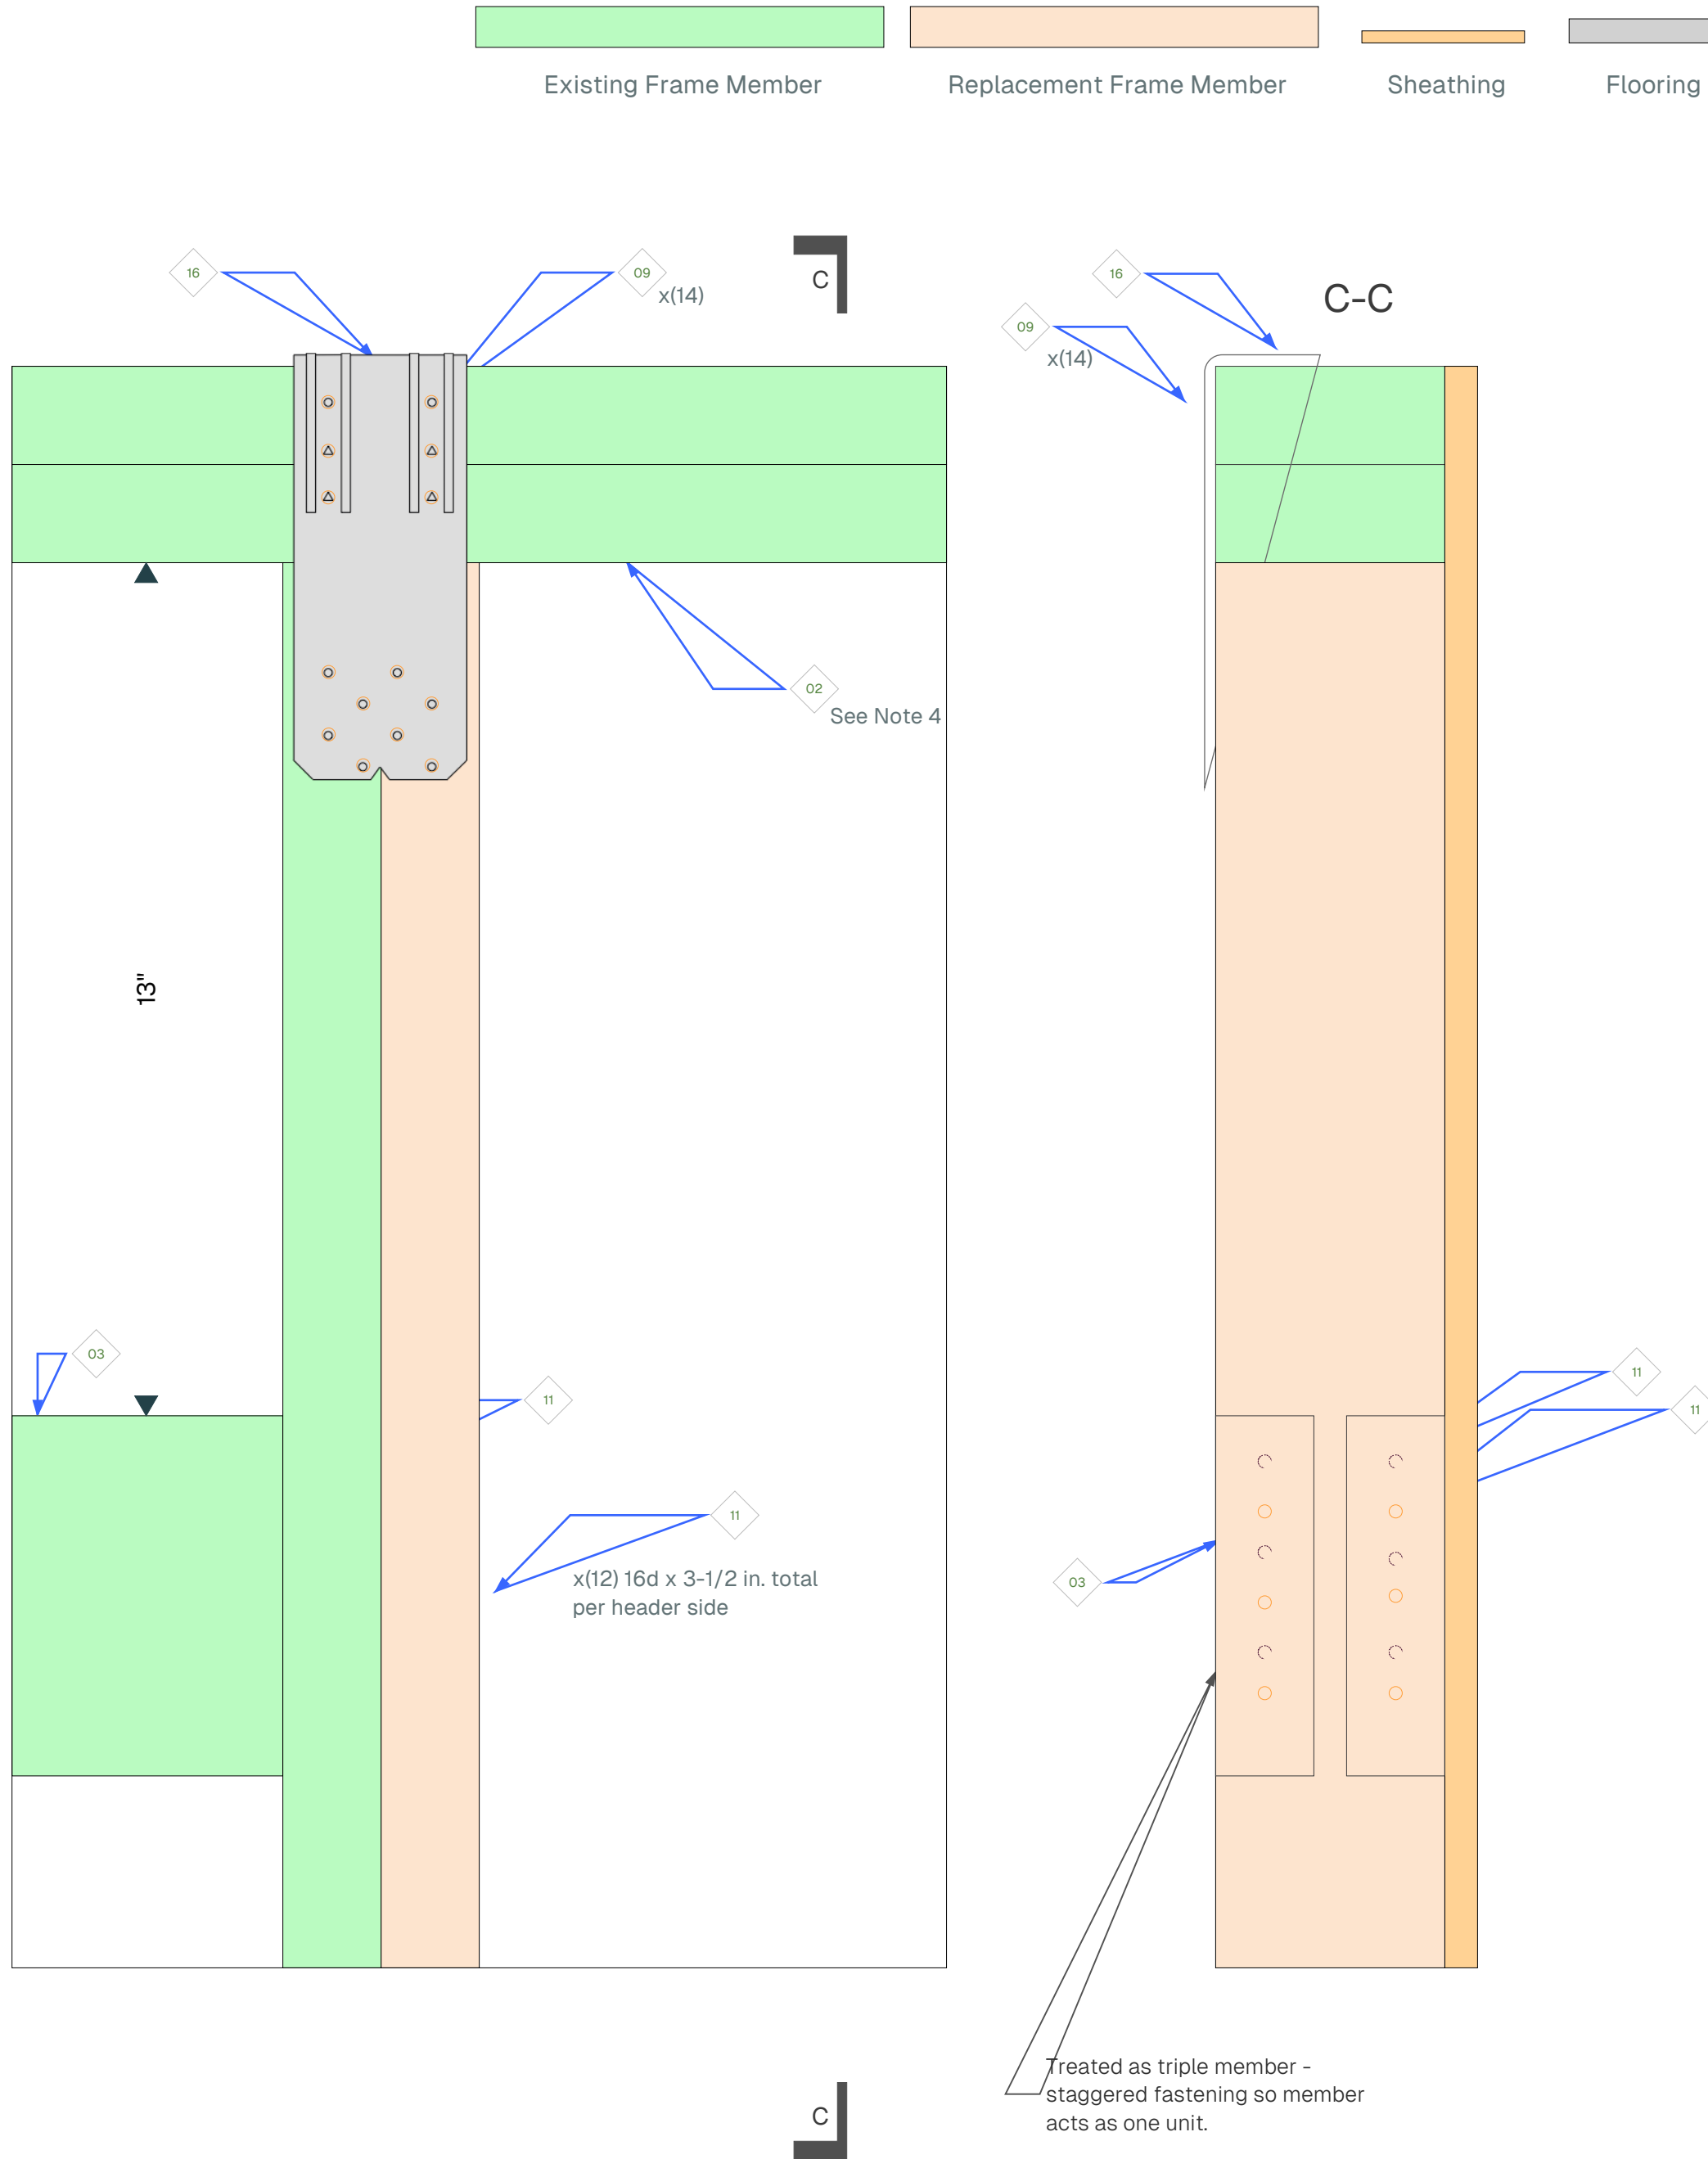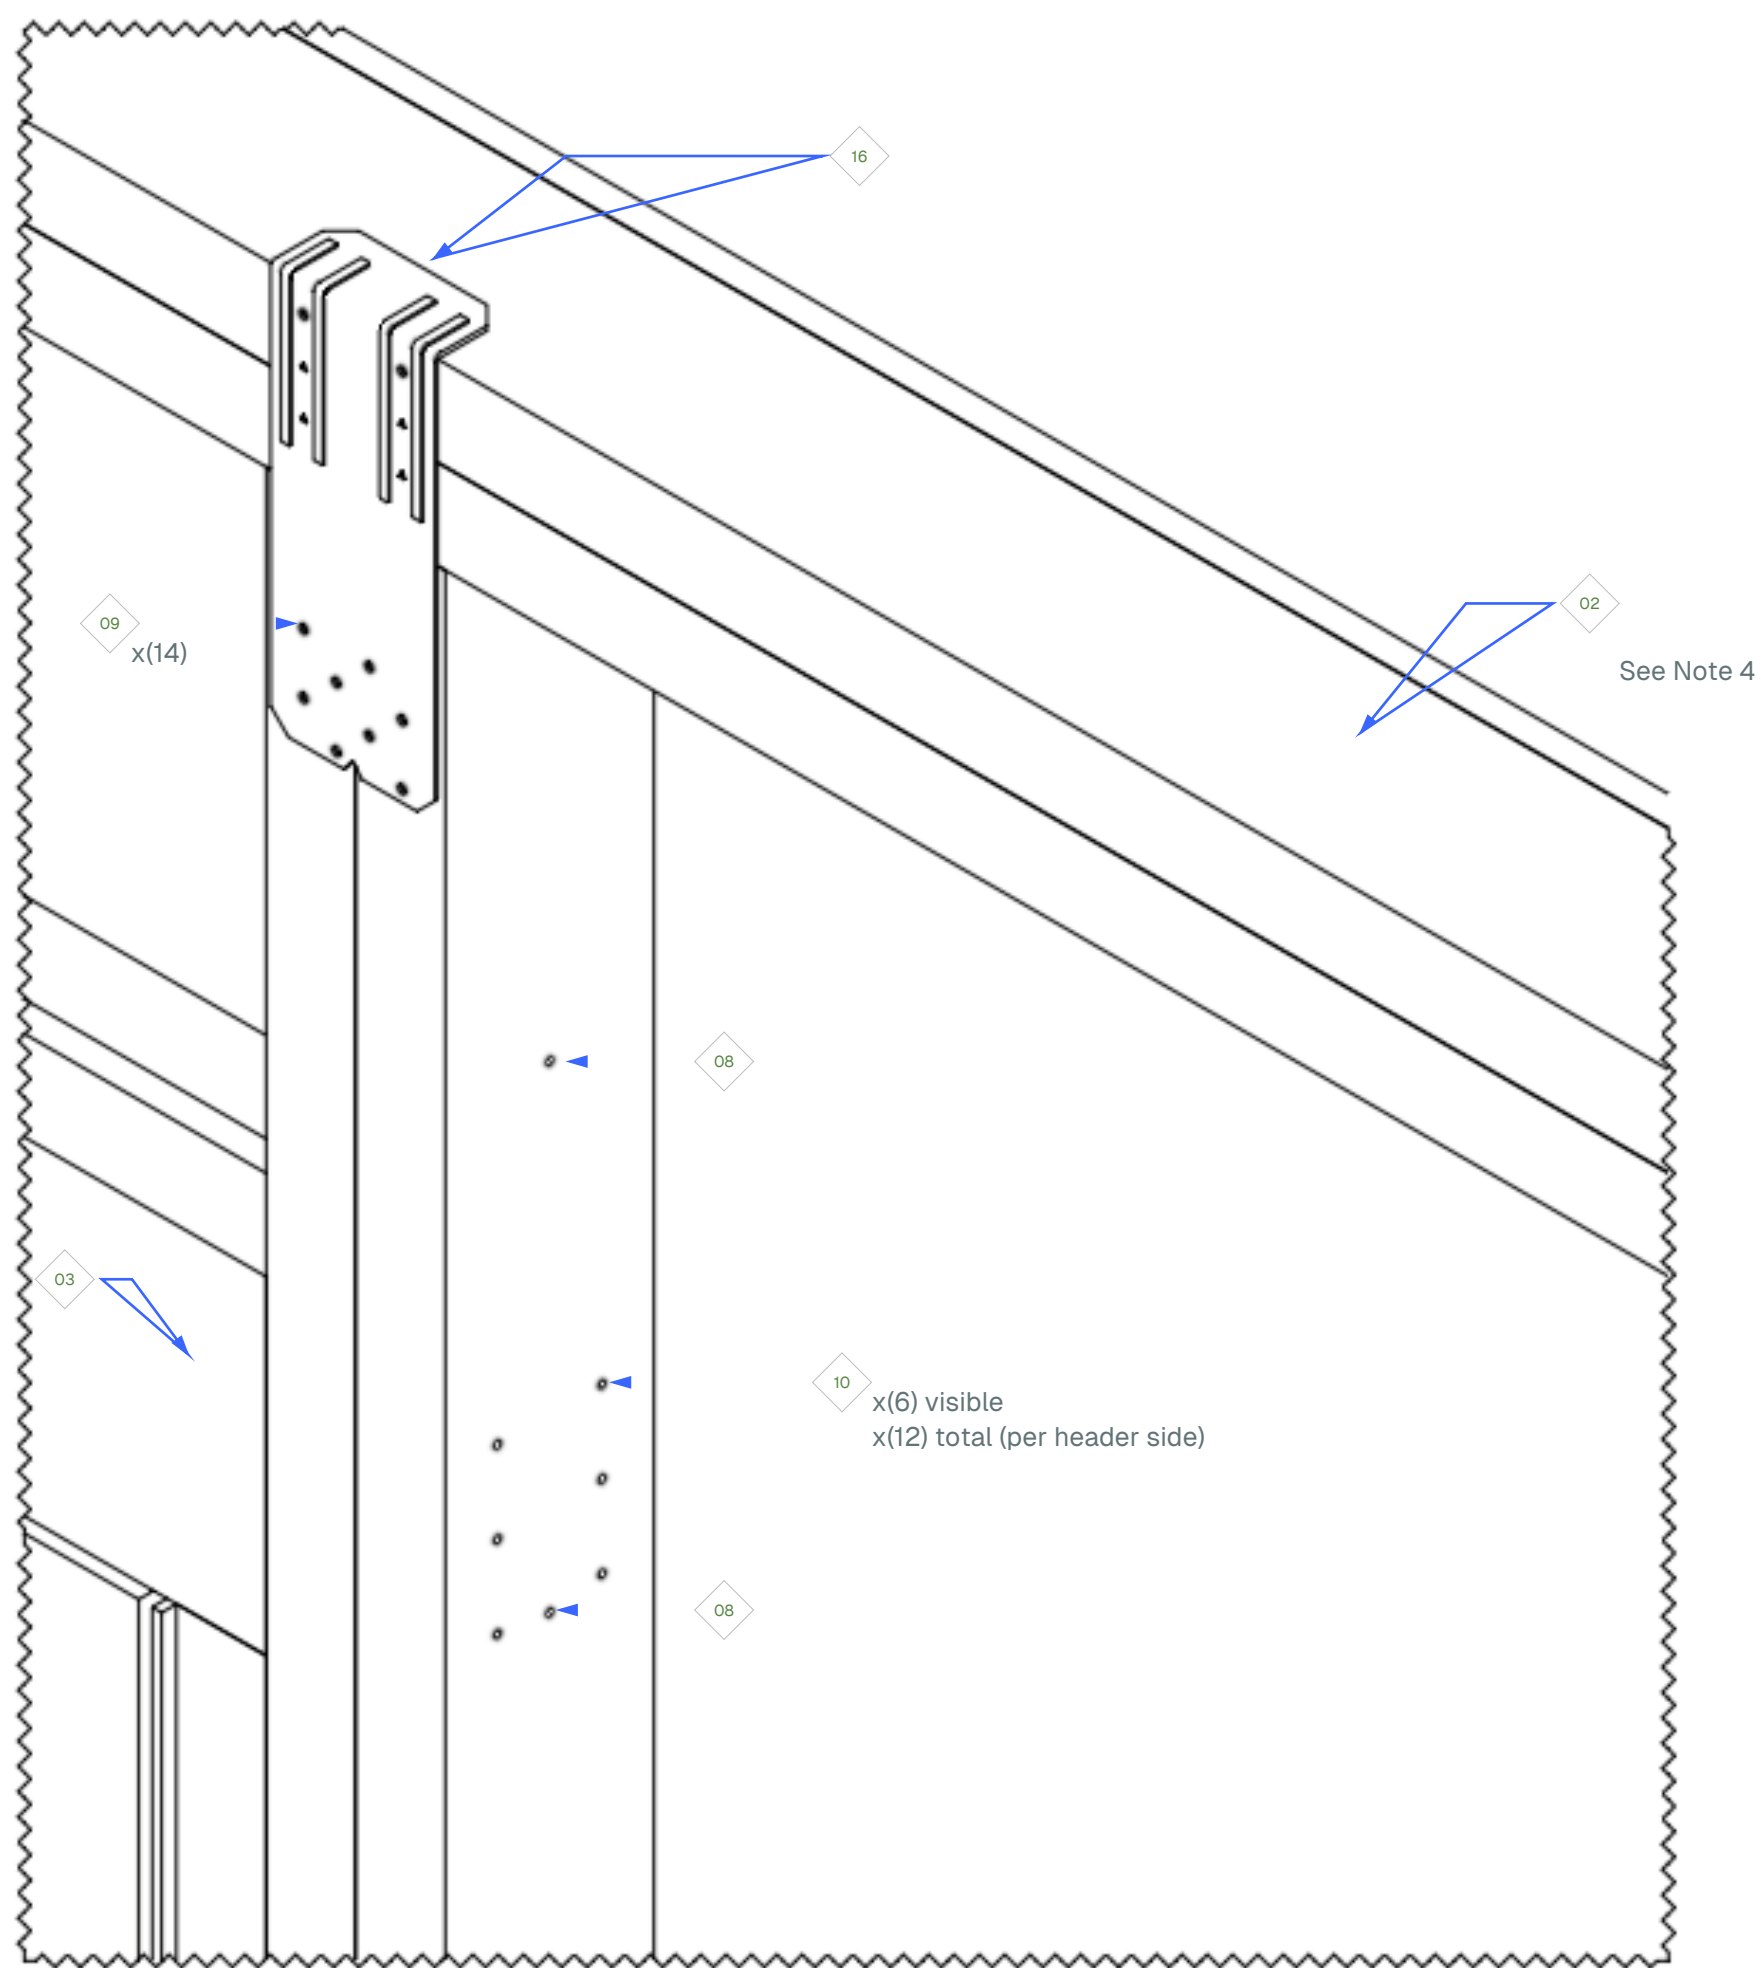

02	Stud, 2x4 in	See BOM Note [1]	Versa-Stud LVL 2x4 SP2650 (3 piece)
03	Stud, 2x6 in	See BOM Note [1]	Versa-Stud LVL 2x6 SP2650 (2 piece)
08	Fastener, 10d x 3 in	ICC-ES ESR 2236	Simpson SSA10
09	Fastener, 10d x 1-1/2 in	ICC-ES ESR 2236	Simpson SSNA10
10	Fastener, 16d x 3-1/2 in	ICC-ES ESR 2236	Simpson T16AKR
16	Plate Connector, Double Stud (DSP)	FL10456.1 ICC-ES ESR 2613	Simpson Double Stud Plate Tie

A5.1

TOP PLATE & HEADER DETAIL

SCALE 1:5

NOTES:

- Scale applies to detail view - parametric view is approximately same scale.
- Existing window header to be inspected. If not meeting minimum code requirements for a load bearing exterior wall opening (minimum (2) 2x6 per FBC-R602.7(1) for current

- conditions- it will be replaced with a header sized per FBC-R602.7(1).
- Adjacent top plate-vertical member connections not depicted, but will join in equal manner to depicted in this detail.
- All structural framing is 2x4 (MatTag 02) unless otherwise indicated.
- See Addendum (sheet 7.1) for amplified interior repair guidance.


Address

Made by : Justin Lenhart

Date : 09/03/2025




All wood-scabbing framing connections to use 10d x 3 in SSA10 nails (MatTag 08).

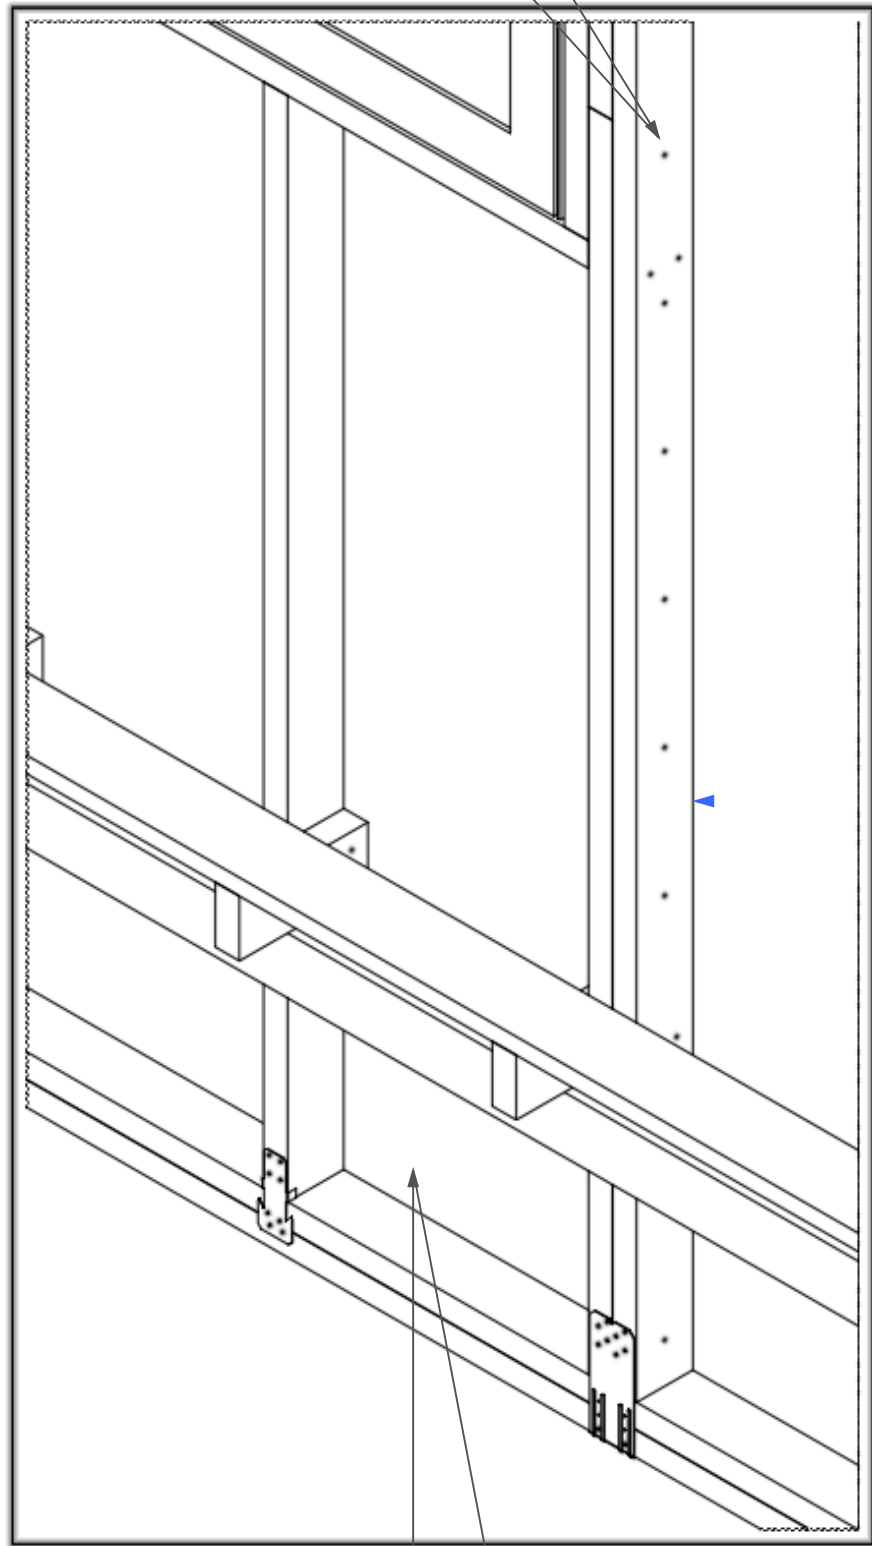


Subfloor crossbeam repairs to be conducted as necessary. Like for like replacement. 10d x 3 in. SSA10 nails to be used for stud-to-stud connections (MatTag 08).

Subfloor stud-to-stud connection example. (4) 16d x 3 in nails per connection.

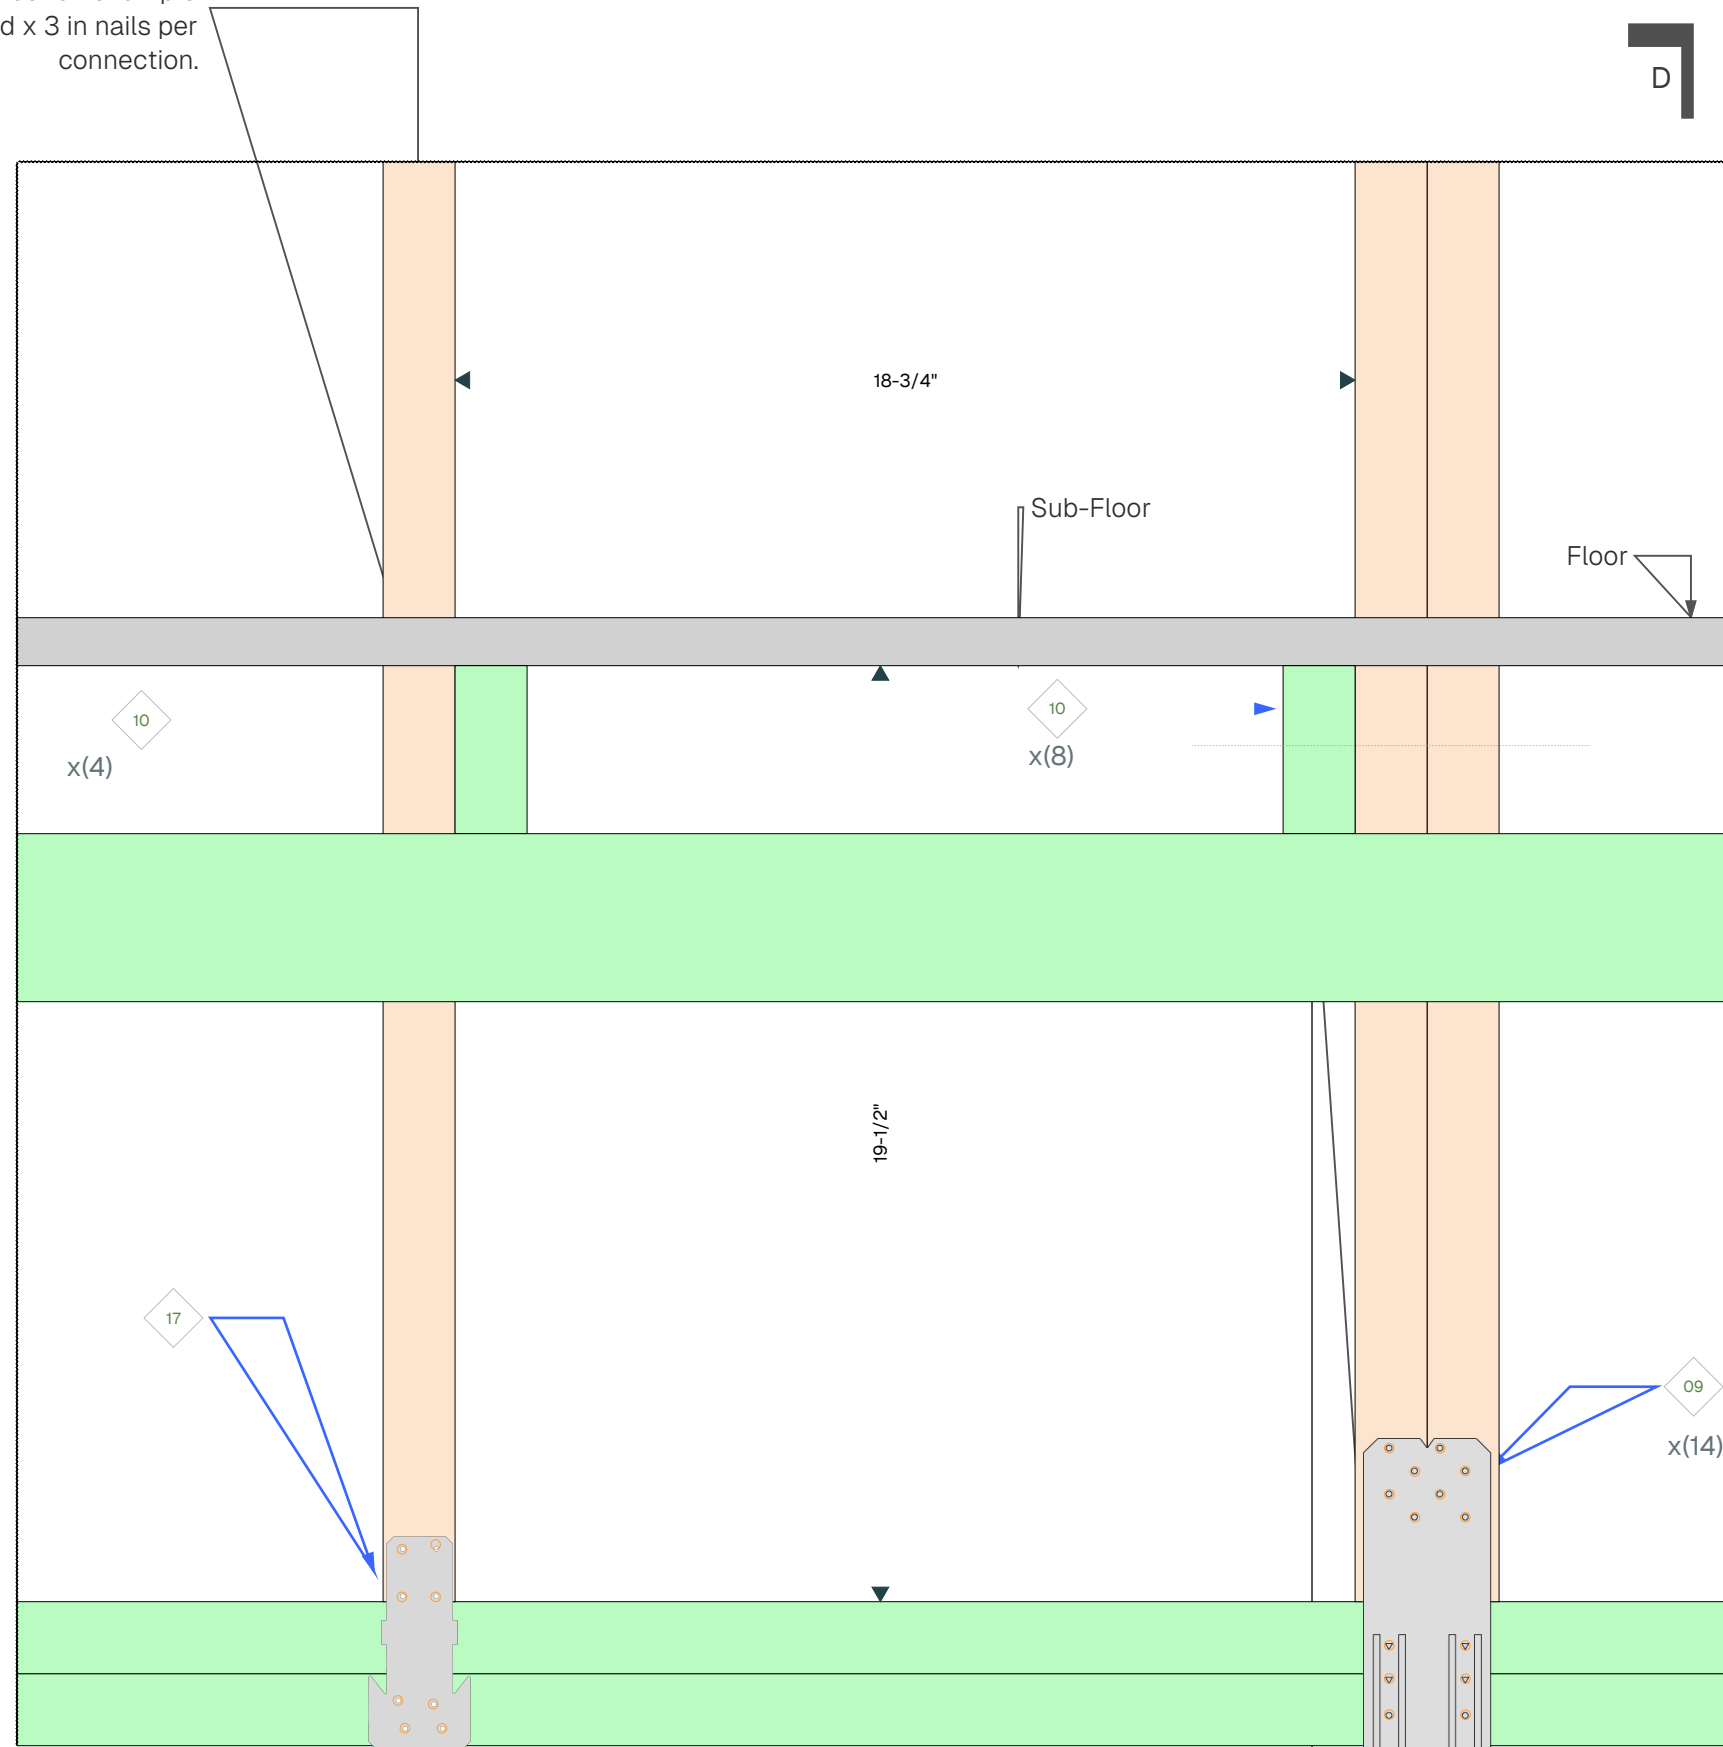

In case of triple connection - staggered fastening with 10d x 3 in nails to adjacent ply to ensure unit acts as one member.

D-D

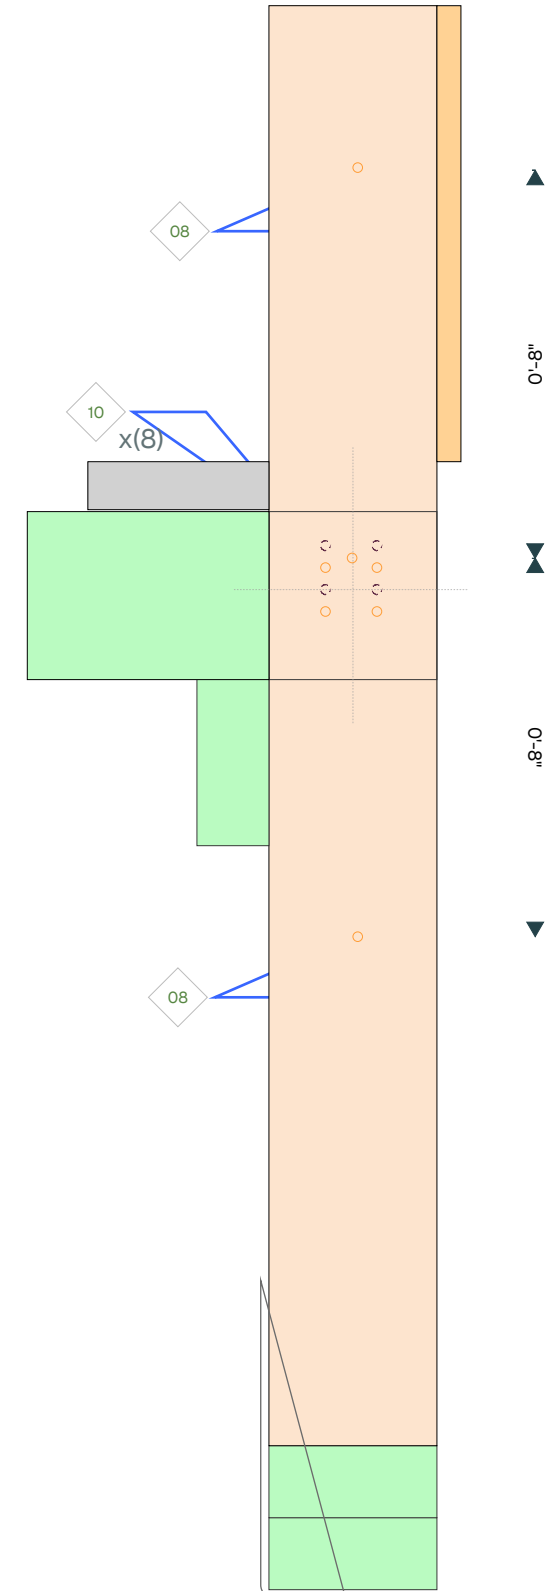

02	Stud, 2x4 in	See BOM Note [1]	Versa-Stud LVL 2x4 SP2650 (3 piece)
08	Fastener, 10d x 3 in	ICC-ES ESR 2236	Simpson SSA10
09	Fastener, 10d x 1-1/2 in	ICC-ES ESR 2236	Simpson SSNA10
10	Fastener, 16d x 3-1/2 in	ICC-ES ESR 2236	Simpson T16AKR
16	Plate Connector, Double Stud (DSP)	FL10456.1 ICC-ES ESR 2613	Simpson Double Stud Plate Tie
17	Plate Connector, Reversible (RSP4)	FL10456.9 ICC-ES ESR 2613	Simpson Reversible Plate Tie

A5.2

BOTTOM PLATE AND SUB-FLOOR DETAIL

SCALE 1:3

NOTES:


1. All structural framing is 2x4 (MatTag 02) unless otherwise indicated.
2. Adjacent bottom plate-vertical member connections not depicted, but will join in equal manner to depicted in this detail.
3. See Addendum (sheet 7.1) for amplified interior repair guidance.


Address:



Made by : Justin Lenhart



Date : 09/03/2025



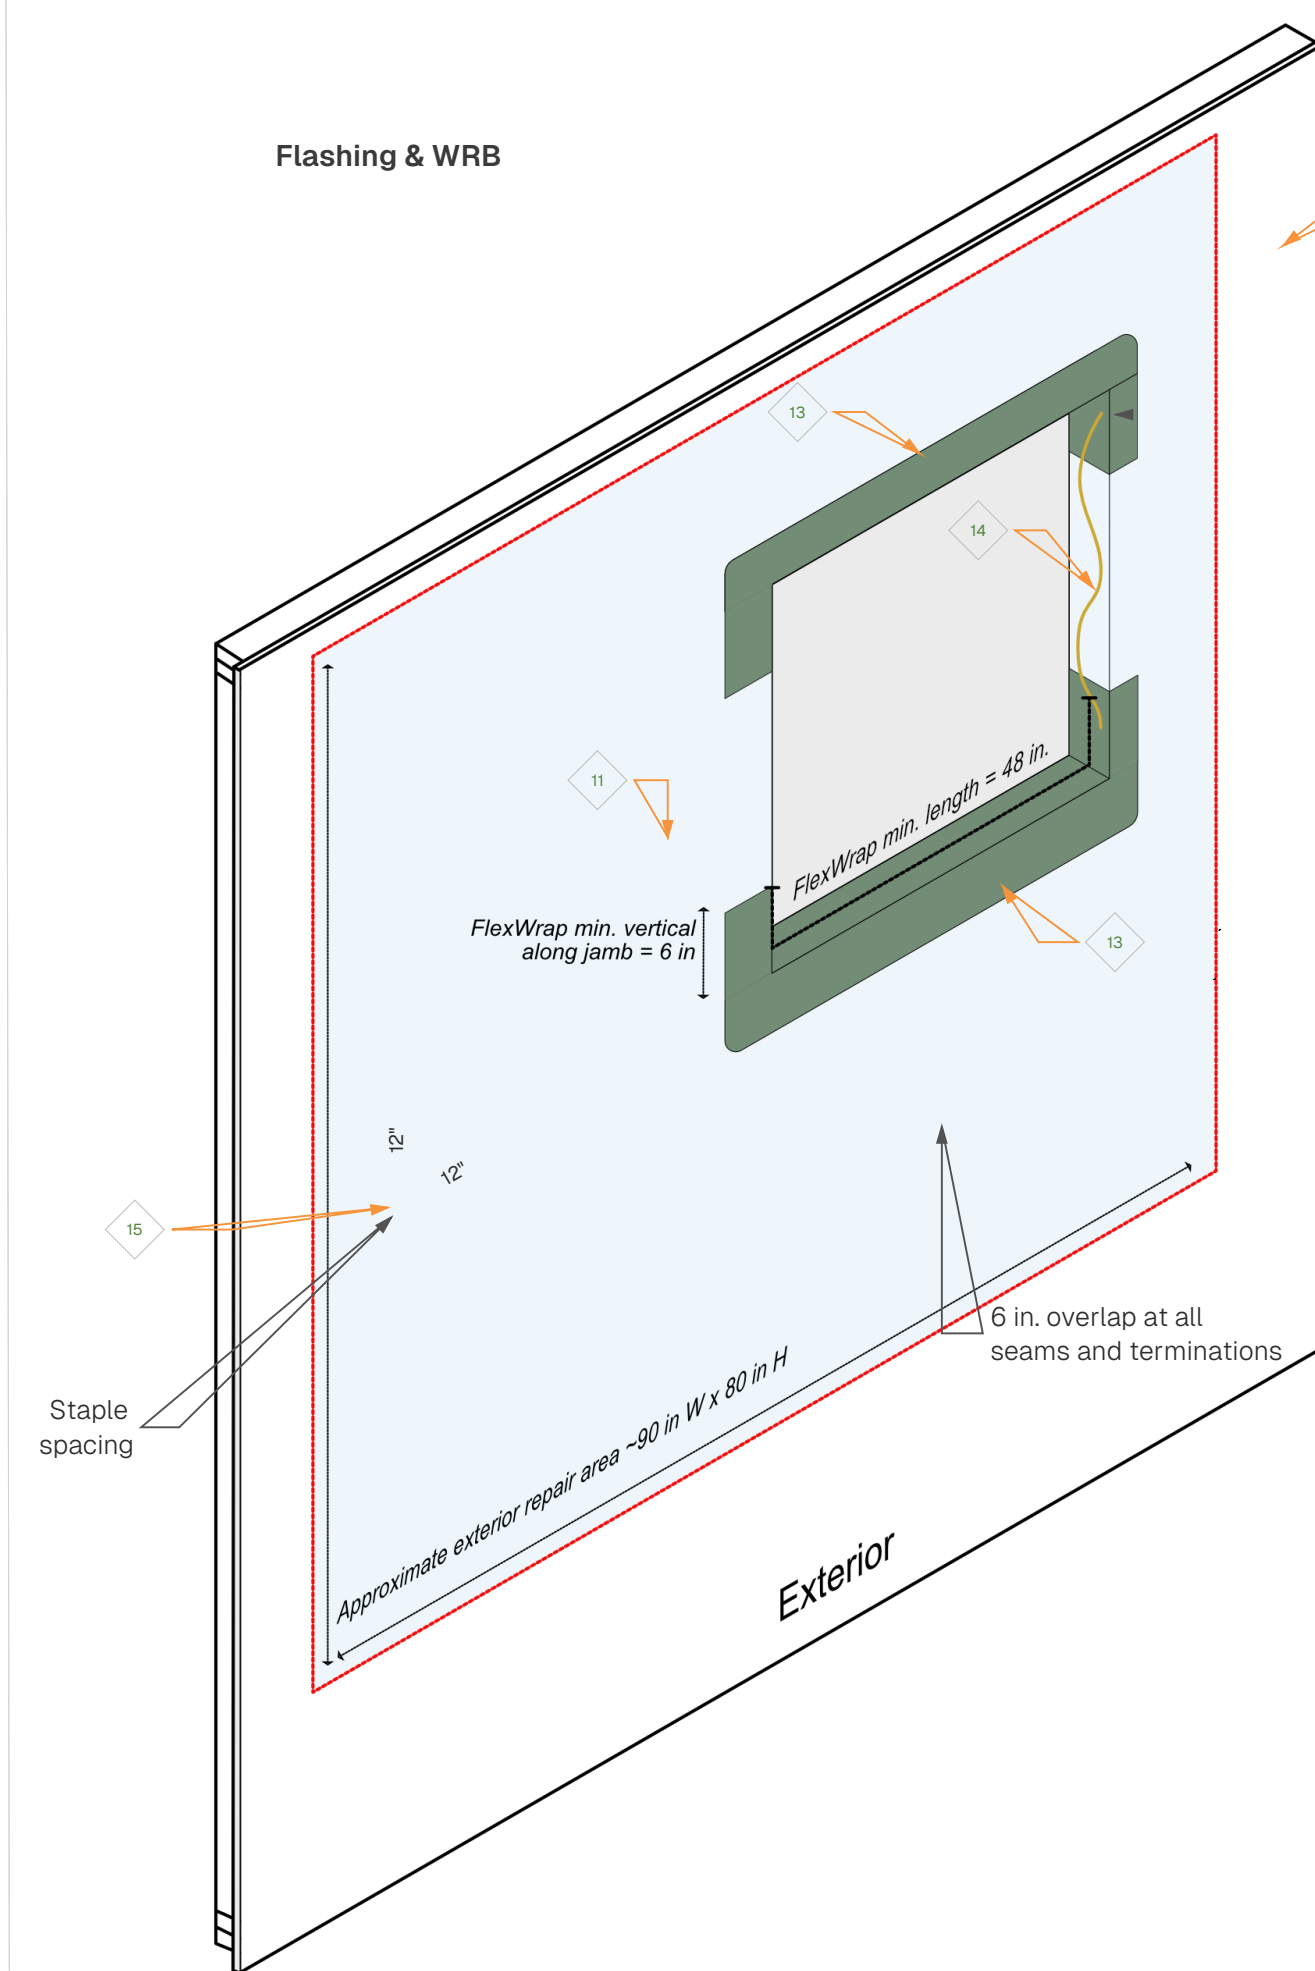

Flashing to be installed between WRB layers per FBC R703.7.3


Sill & Cripple

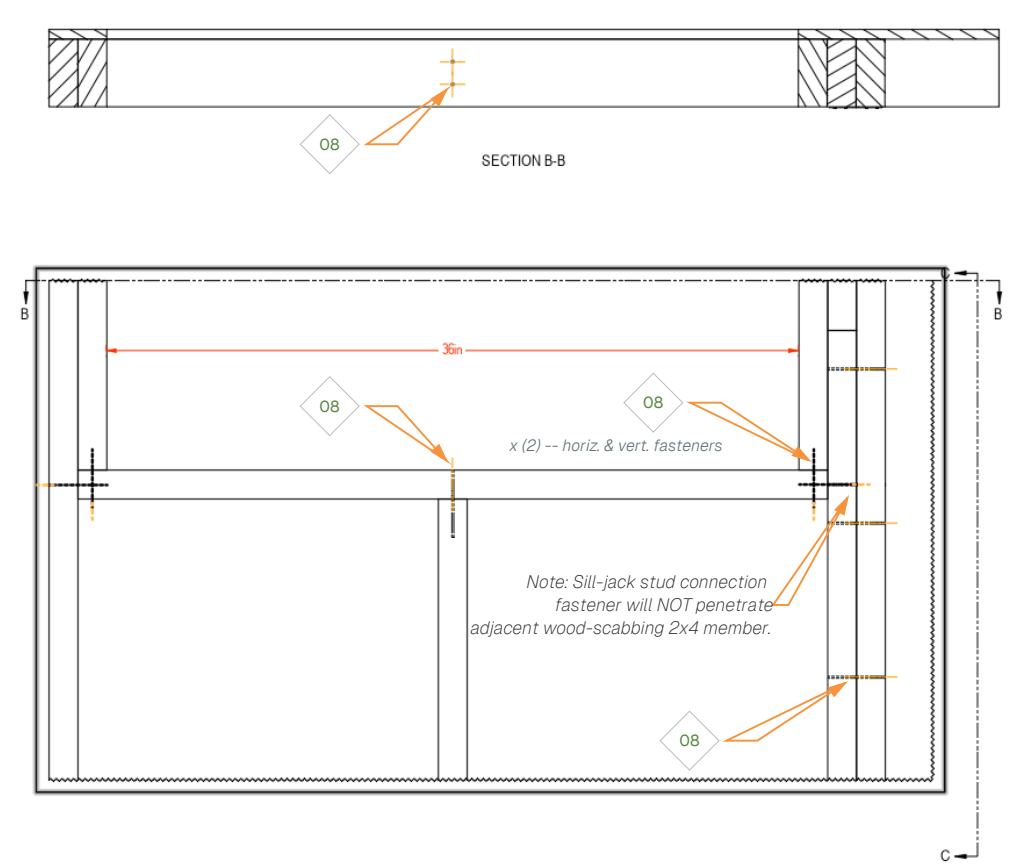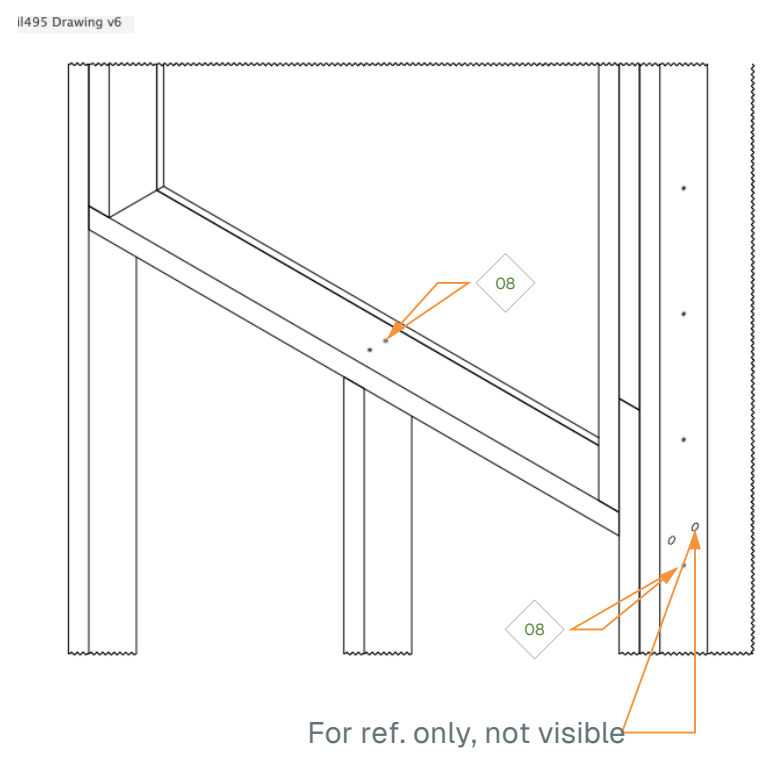

06	Sheathing	TER No. 1004-01	Thermo-ply Red
07	Stucco	TBD	Stucco
08	Fastener, 10d x 3 in	ICC-ES ESR 2236	Simpson SSA10
09	Fastener, 10d x 1-1/2 in	ICC-ES ESR 2236	Simpson SSNA10
10	Fastener, 16d x 3-1/2 in	ICC-ES ESR 2236	Simpson T16AKR
11	WRB, 3x165 ft	ICC-ES ESR 2375 [3]	Tyvek WRB
13	FlexWrap, 9 in x 75 ft	ICC-ES ESR 2375 [3]	Dupont FlexWrap
13	Tape, Flashing, 164 ft	ICC-ES ESR 2375 [3]	Tyvek Installation Tape
14	Window & Door Sealant, 10.1 oz	[4]	GE Advanced Silicone 2
15	Staples, Capped, 3/8 in, (2016) Box	ICC-ES ESR 1539	Stinger Model # 136420
18	Shutter, Polycarbonate	FL28824.1	Polygal Storm Shutter, 3-Wall, 16mm


Exterior Order of Repair/Install (See Note 6)

1. Install exterior structural sheathing per FBC 602.10
2. Apply first WRB layer as primary drainage plane, shingle-lapped
3. Flash window rough opening with FlexWrap at sill/jambs
4. Seal rough opening and set window plumb/level mfg. guidance
5. Apply self-adhered flashing tape at jamb/head, lap over WRB
6. Install second WRB layer as slip sheet beneath stucco (FBC R703.7.3)
7. Apply stucco cladding (3-coat system) over lath with weep screed

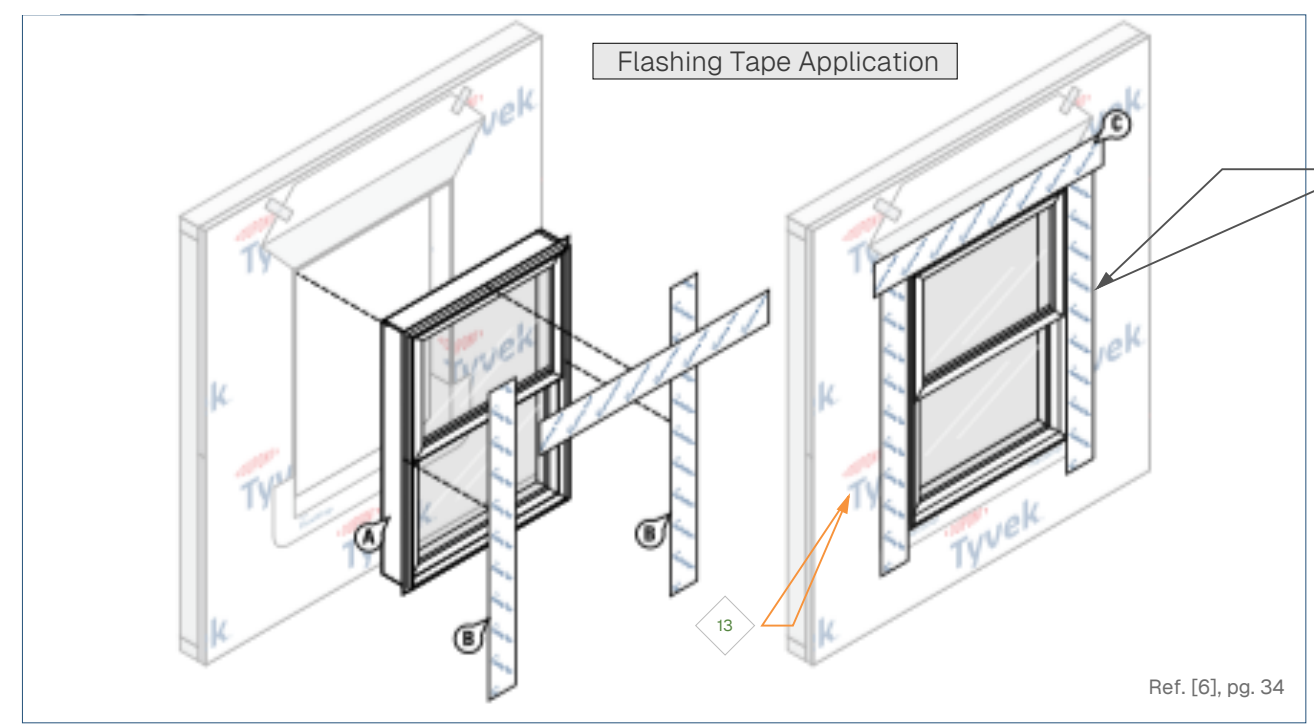

Flashing to be installed between WRB layers per FBC R703.7.3



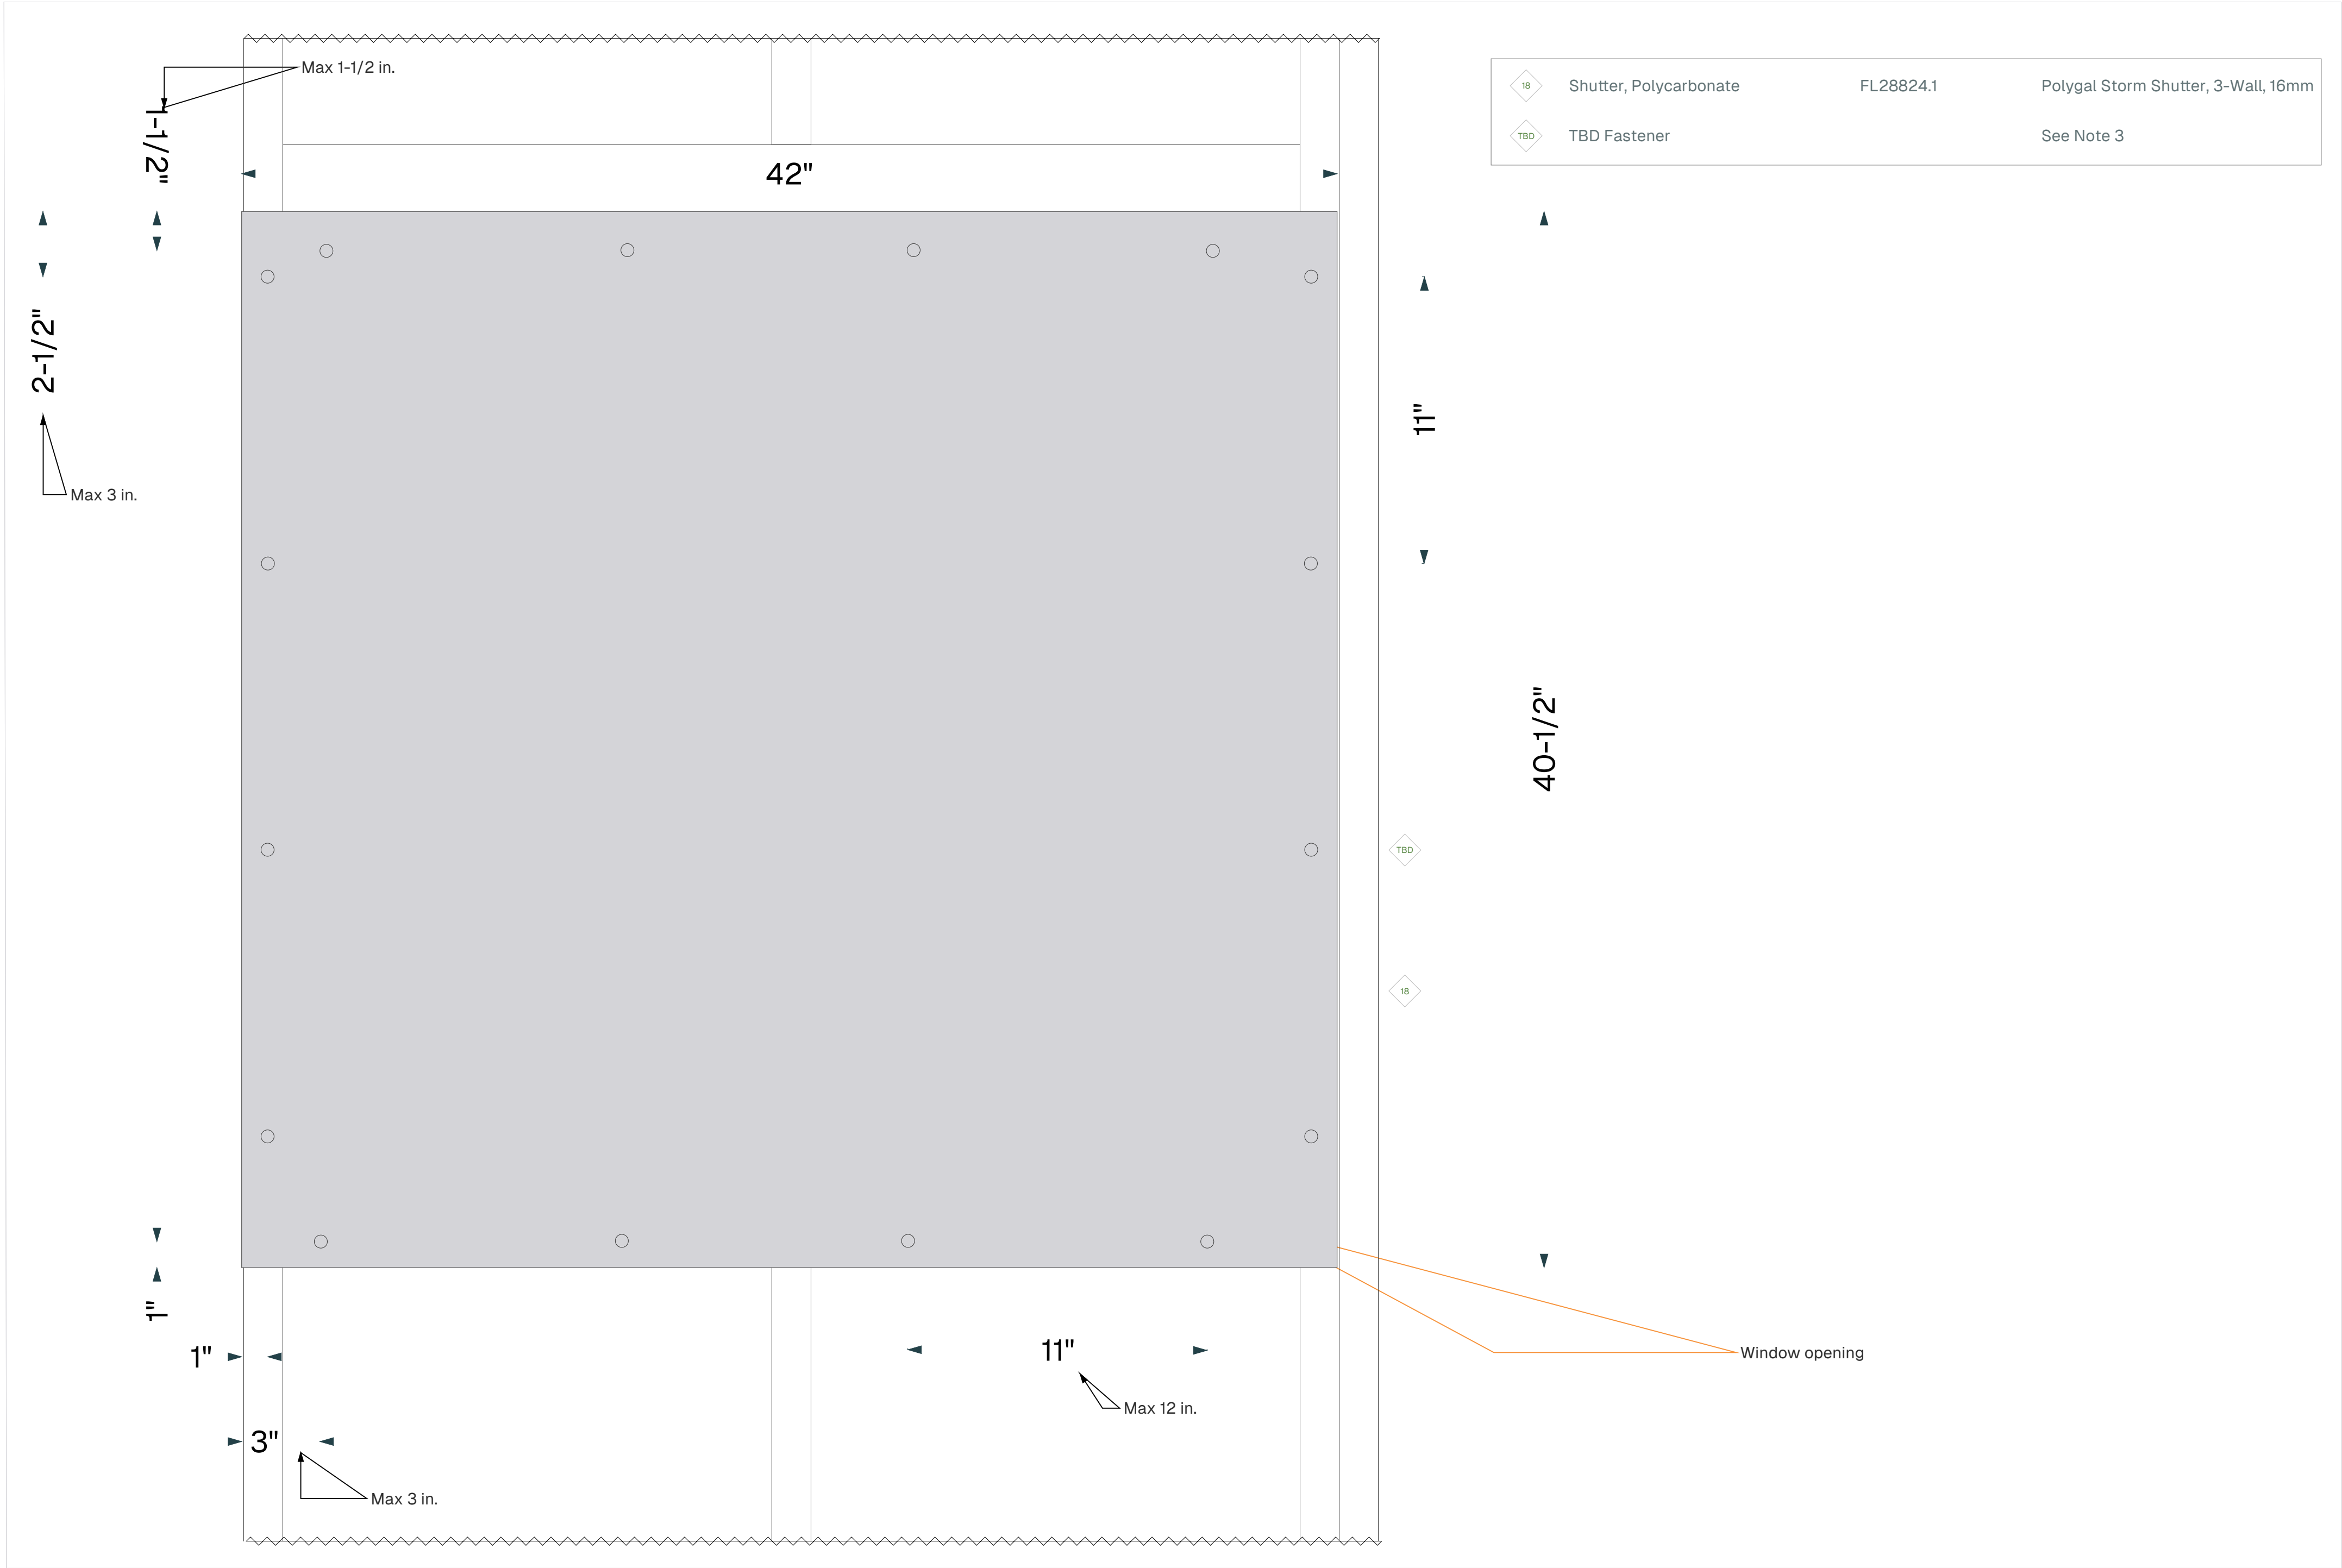

A5.4

STORM SHUTTER SYSTEM



1:3

NOTES:
1. Storm shutter N/A if "impact" rated window installed.
2. Storm shutter to be installed per mfg. installation instructions:
<https://images.thdstatic.com/catalog/pdfimages/72/72c5e2f7-936d-47e7-8169-6987a08bbd45.pdf>
3. Anchor screws to be similar to:
<https://www.homedepot.com/p/Tapcon-1-4-in-x-2-1-4-in-Hex-Nut-White-Concrete-Anchor-Storm-Guard-Hurricane-Anchoring-Kit-25-Piece-35235/313599190>


Alternate URL for installation instructions:
<https://drive.google.com/file/d/191YkRm45HLNiYwllcWE1nVkHu0hcCut3/view?usp=sharing>

Address: 

Made by : Justin Lenhart
Date : 09/03/2025

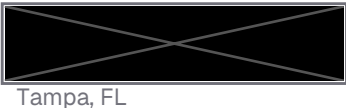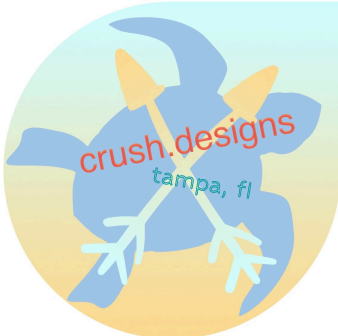


Fastener Overview

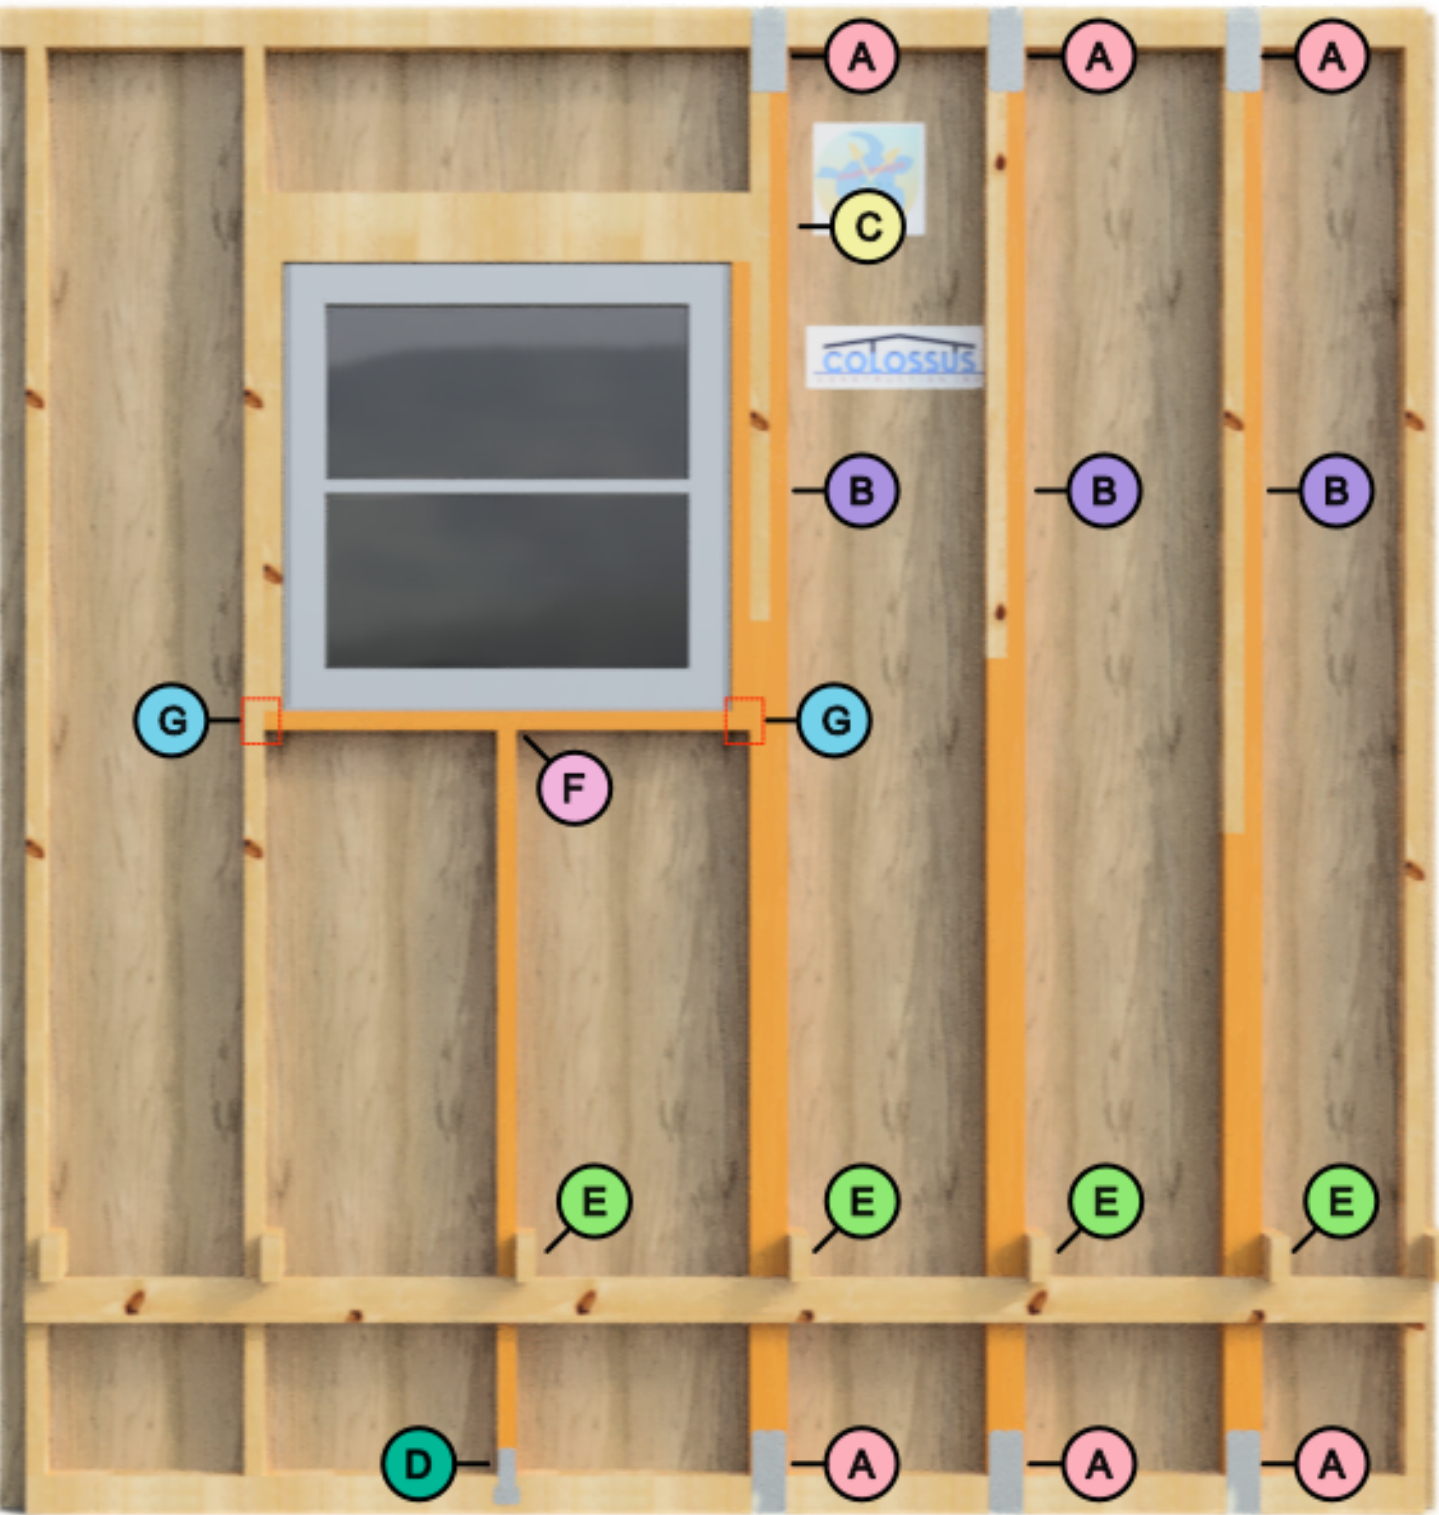

Connection	Location(s)	Qty/Instance	Fastener Type	Mfg/Model	Tag	Note
DSP – Stud	A	(14)	10d x 1-1/2 in.	Simpson N10	09	
RSP4 – Stud	D	(8)	10d x 1-1/2 in.	Simpson N10	09	.131 in. (8d) min per mfg instructions; 12d for proj. consistency
Stud-to-Stud	B E	B – o.c. 8 in. E – (4)	10d x 3 in.	Simpson T10	08	
Stud – Header	C	(6)	16d x 3-1/2 in.	Simpson T16AKR	10	
Sill-to-Stud (Jack & King Stud)	F G	F – (3) G – (2)	16d x 3-1/2 in.	Simpson T16AKR	10	

Notes:
1. In all instances, nails shall penetrate the joined member by at least 1-1/2 in.
2. If screws are to be substituted for nails in any instance, they shall penetrate at least three full threads into the joined member

Damage Photographs

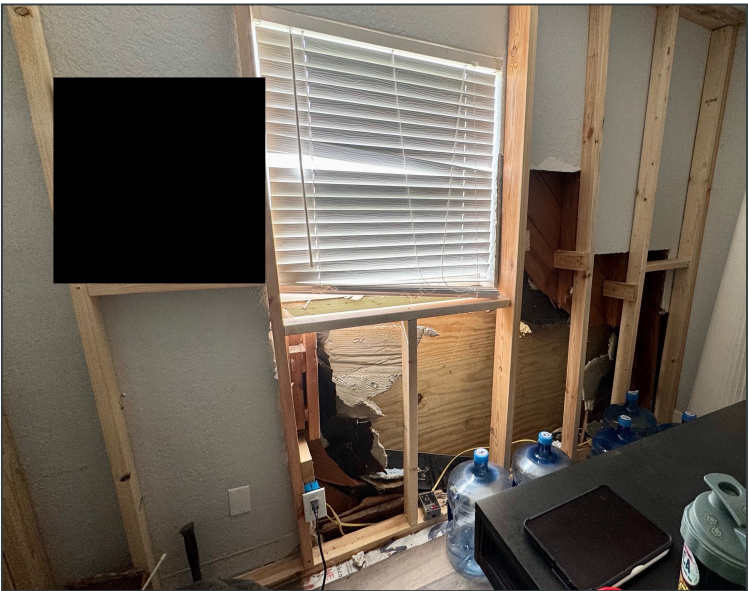

Exterior Order of Repair/Install - Expanded

1. Install structural sheathing
- Apply approved exterior-grade structural panel sheathing (e.g., plywood/OSB) fastened per FBC R602.10 to restore wall continuity and provide substrate for subsequent weather-resistive barriers.
2. Install first weather-resistive barrier (WRB)
- Apply first layer of Tyvek WRB as the primary drainage plane, installed shingle-lapped and fastened per mfg. instructions and FBC R702.3. Integrate with base flashing to establish continuity.
3. Install window rough opening flashing (FlexWrap) at jamb/sill
- Provide flexible flashing (DuPont FlexWrap) at window sill and jambs per mfg instructions R703.4, ensuring positive slope at sill to direct incidental water outward.
4. Sealant application and window installation
- Apply approved sealant bead to perimeter of rough opening; install window unit (Andersen 100SHS3030) plumb, level, and square per mfg. installation guide. Provide shimming no greater than 1/4 in. as required for alignment; maintain desired drainage gaps at head/jamb.
5. Apply perimeter flashing tape
- Install self-adhered flashing tape over jambs and head flange, extending onto WRB, lapped shingle-fashion over sill flashing. Maintain continuity with drainage plane.
6. Install second WRB layer
- Apply second WRB layer over flashing, acting as sacrificial slip-sheet beneath stucco per FBC R703.7.3. Lap and fasten IAW mfg. instructions.
7. Apply stucco cladding
- Apply metal lath and three-coat cement plaster per ASTM C926/C1063 and FBC Chapter 7. Include weep screed at base of wall and casing/beads/control joints at required intervals. Ensure stucco integrates with WRB to maintain drainage and ventilation.

Interior Order of Repair

1. Framing repair and replacement
- Remove damaged studs and replace with new 2x4 SPF or LVL (ICC-ES ESR-1040), installed full height between sill and double top plate per FBC R602.3. Provide jack, king, and cripple studs as required by header detail. Fasten per Table R602.3(i).
2. Fireblocking & draftstopping
- Install fireblocking at stud cavities interrupted by repairs, using 2x material, 1/2 in. gypsum, or approved mineral wool insulation per FBC R302.11. Ensure concealed draftstop integrity is restored at floor and ceiling levels.
3. Insulation
- Replace or restore cavity insulation to match or exceed existing R-value, in compliance with FBC-Energy Conservation requirements (typ. R-13 batt for 2x4 stud cavity). Fit tightly with no voids or compression.
4. Drywall
- Install 1/2 in. USG Sheetrock UltraLight Mold Tough gypsum board (ICC-ES ESR-3365; ASTM C1396). Fasten to studs with approved drywall screws per Table R702.3.5, maintaining 3/8" minimum edge clearance.
5. Taping & finishing
- Apply joint tape and three-coat joint compound system per GA-214 Recommended Levels of Finish. Finish to Level 4 standard (ready for paint and light texture) unless matching adjacent finish requires otherwise.
6. Priming & painting
- Apply interior-grade primer and topcoat paint system. Match color, sheen, and texture of adjacent finishes. Ensure surfaces are clean, dry, and properly cured prior to application.
7. Interior trim & fixtures
- Apply interior-grade primer and topcoat paint system. Match color, sheen, and texture of adjacent finishes. Ensure surfaces are clean, dry, and properly cured prior to application.

