

Combined recording overview

122.18 s total • 394,424 messages • 65.44 s common caster recording • original data retained


Measured paths during encoder overlap

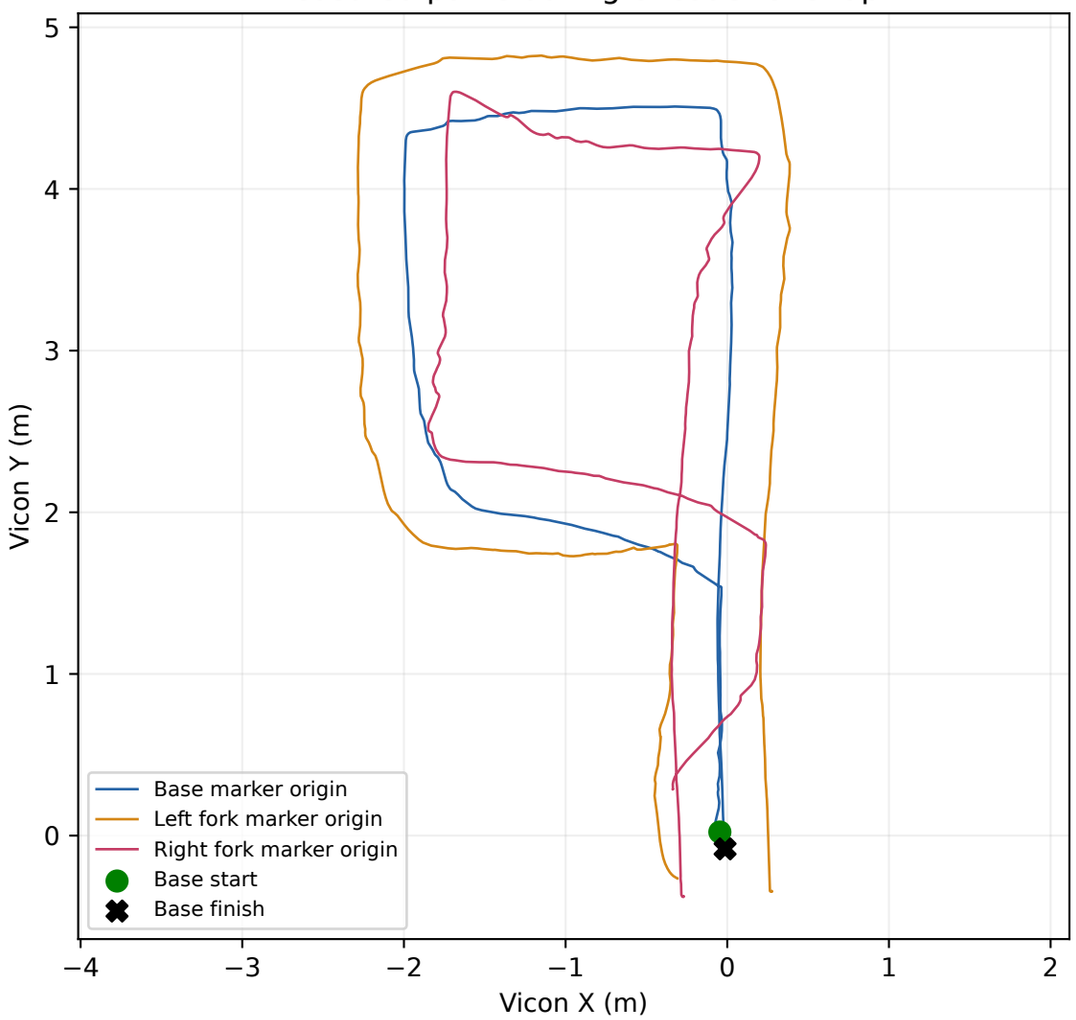


Recorded waypoint route (separate frame)

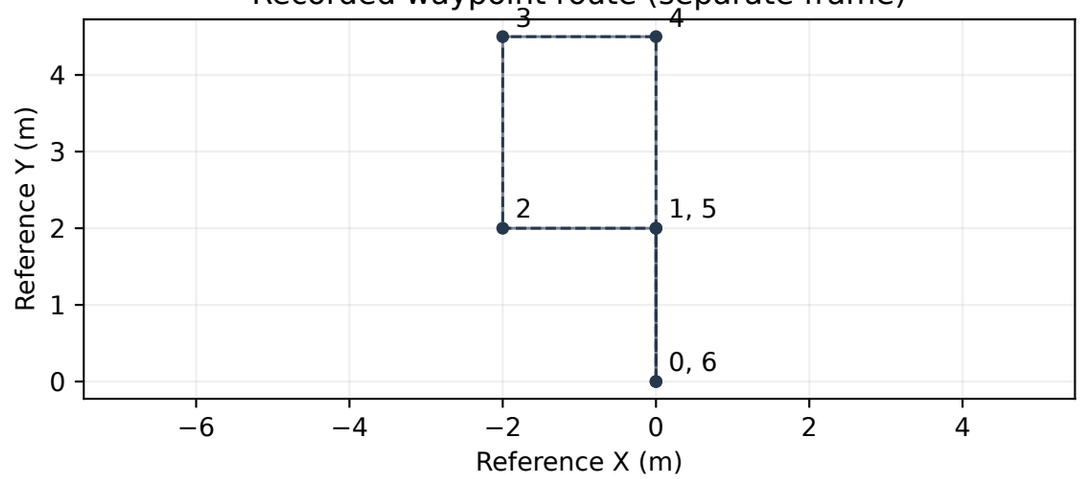


Data coverage | shared encoders 20.59–86.03 s

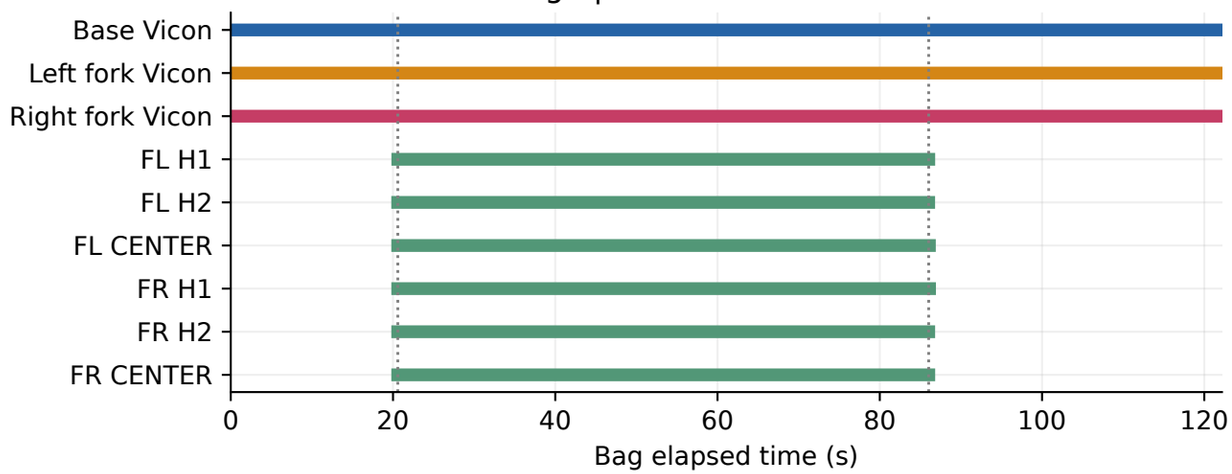


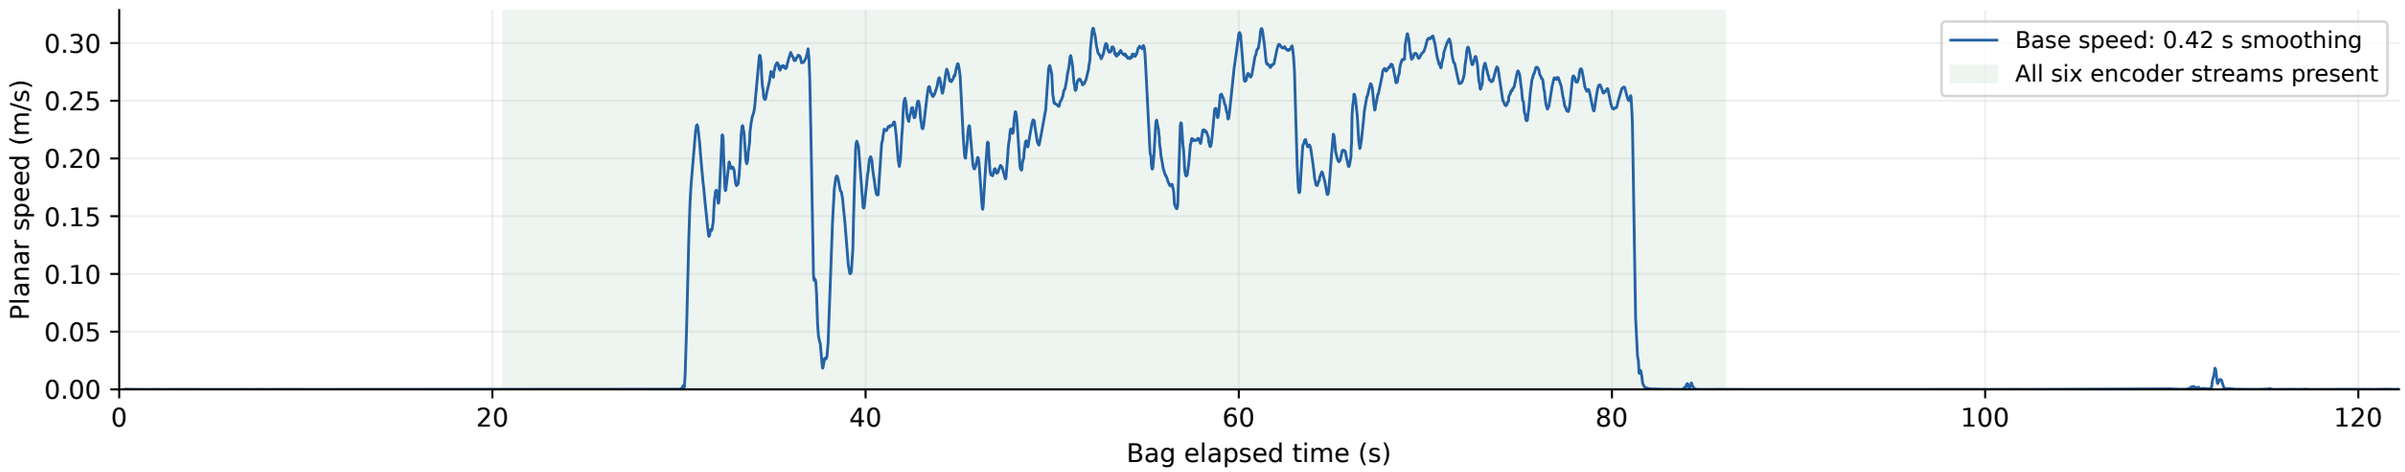



Six encoder angle histories


First sample subtracted; CENTER unwrapped. Independent y scales; no CAD signs, phase offsets, or smoothing applied.

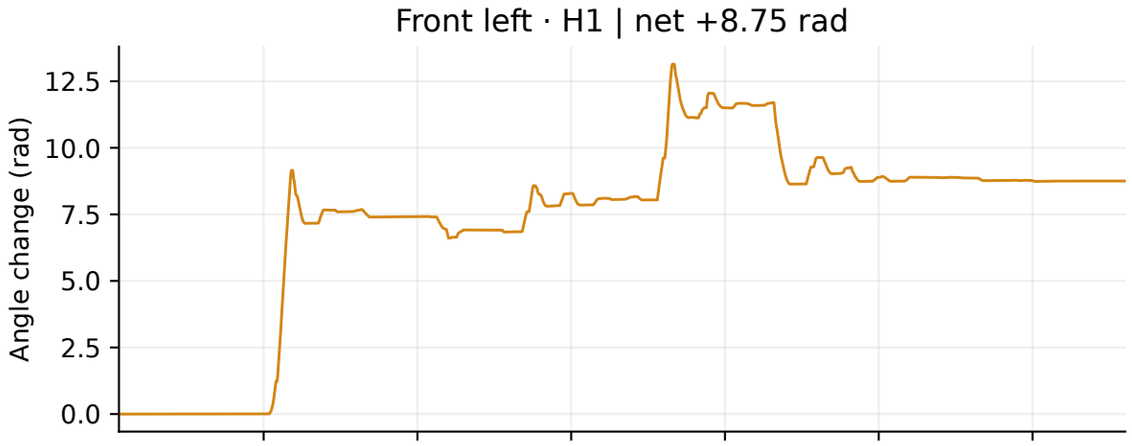


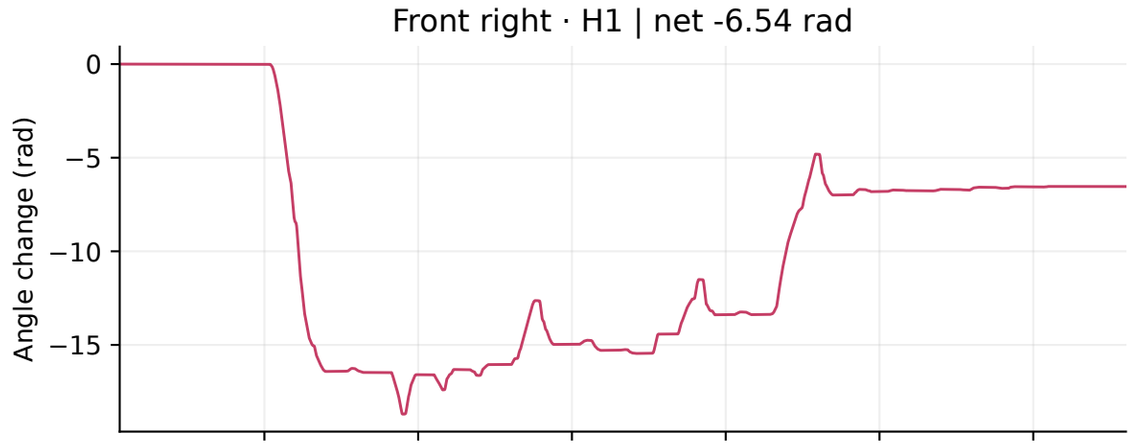

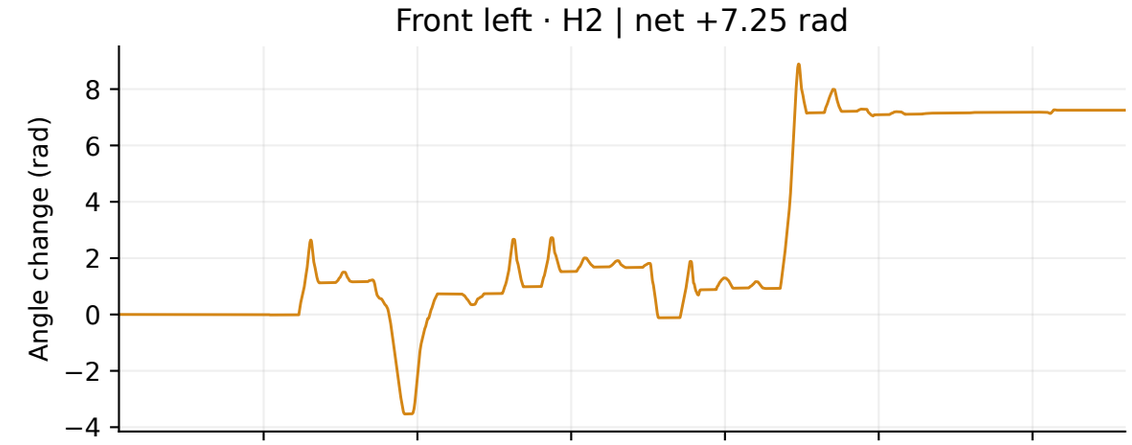

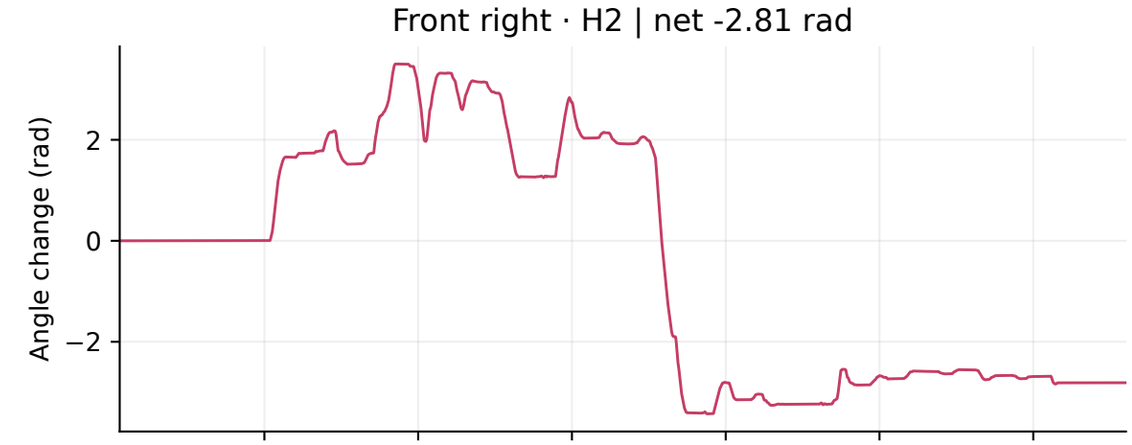


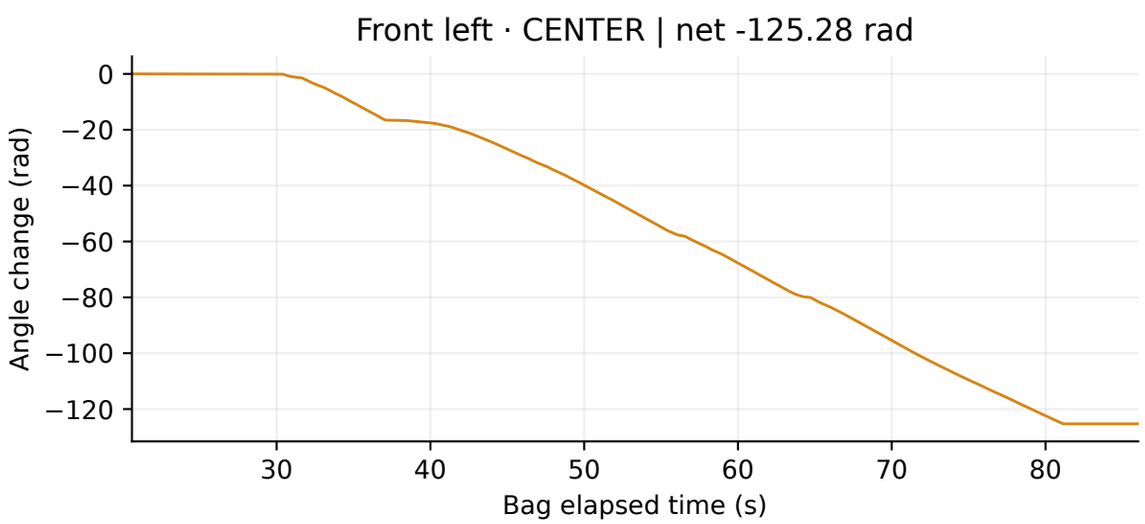

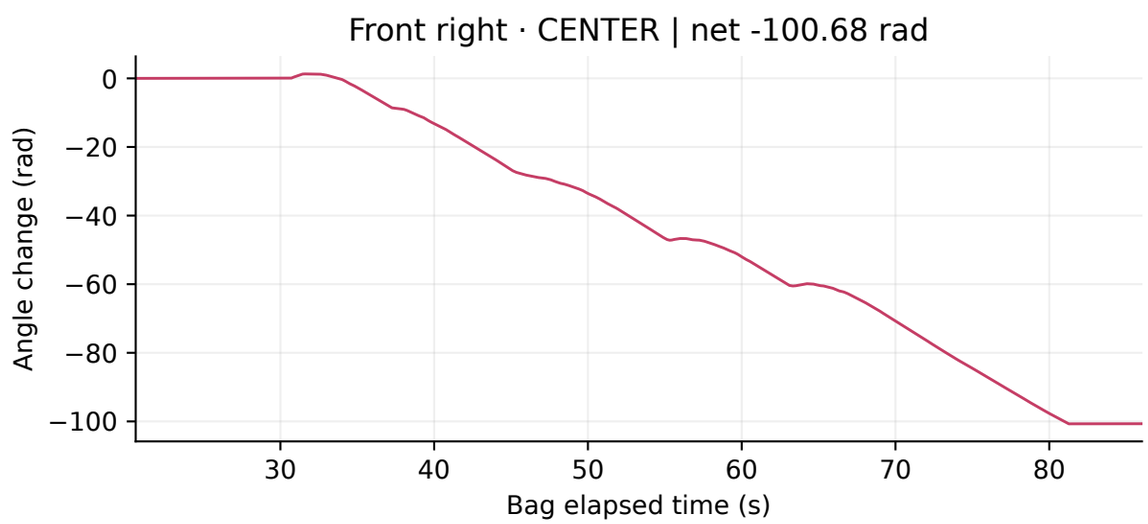



Encoder angular velocities


Recorded JointState velocity fields; no differentiation or smoothing added. Missing initial rates remain missing.

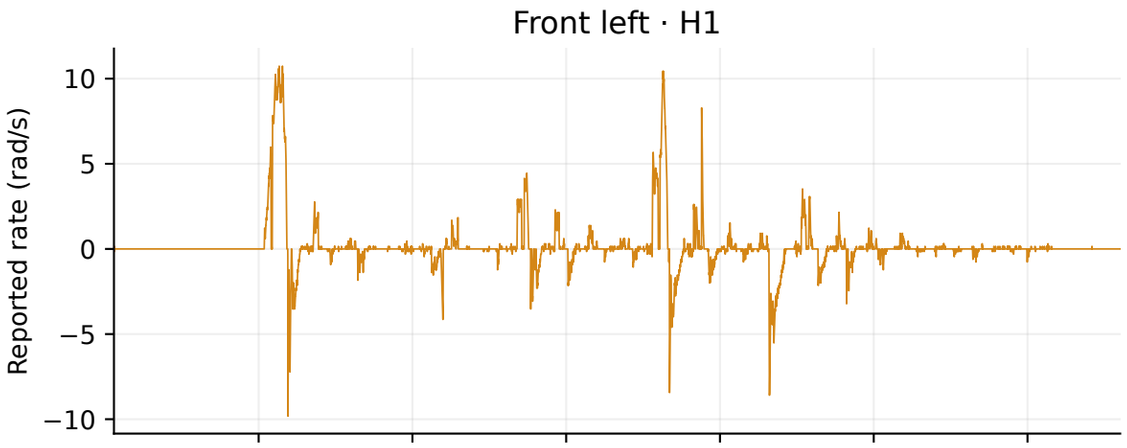




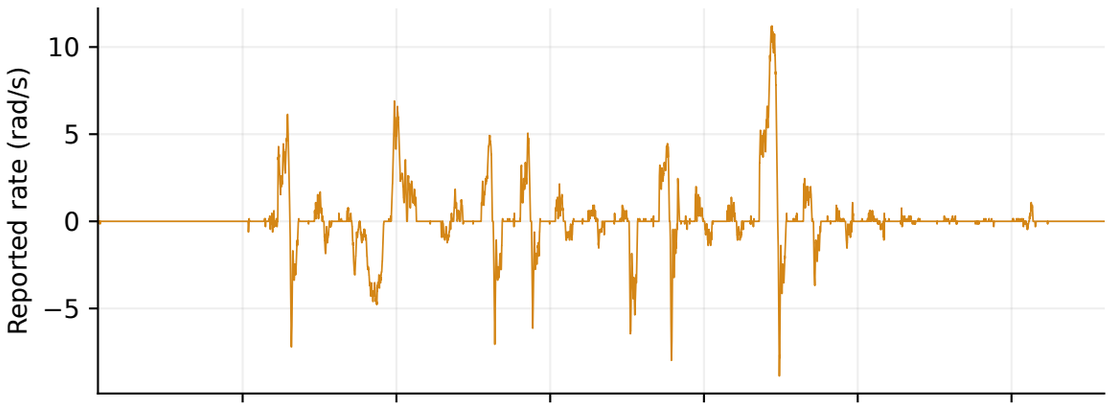

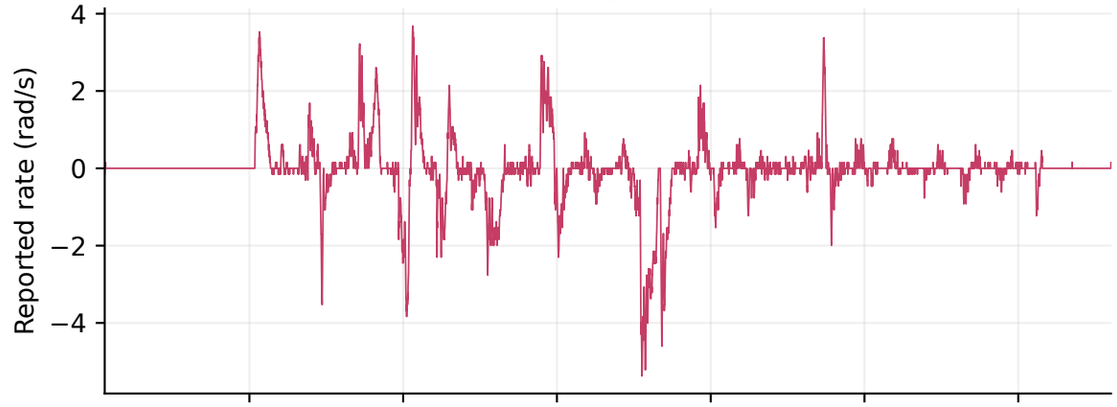


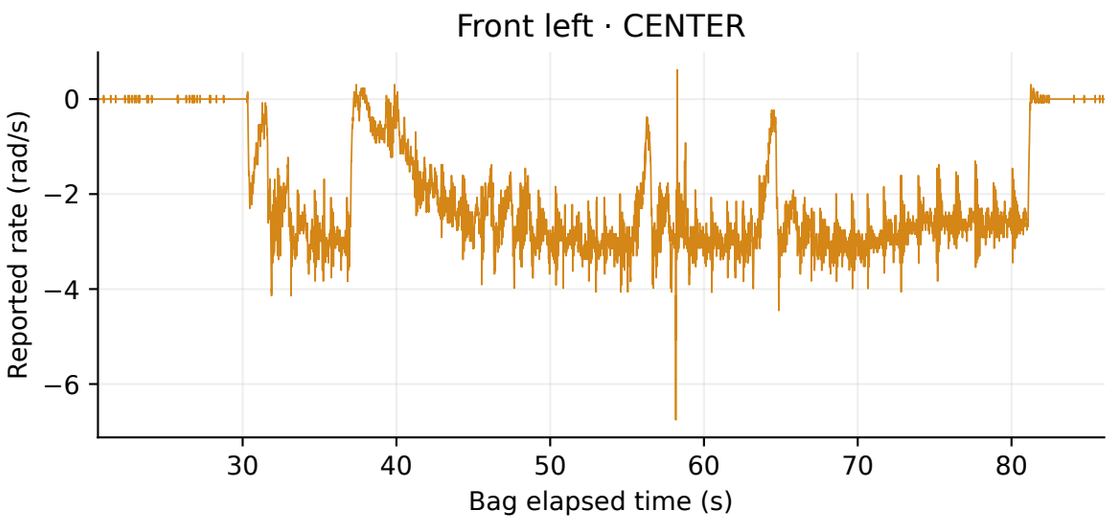


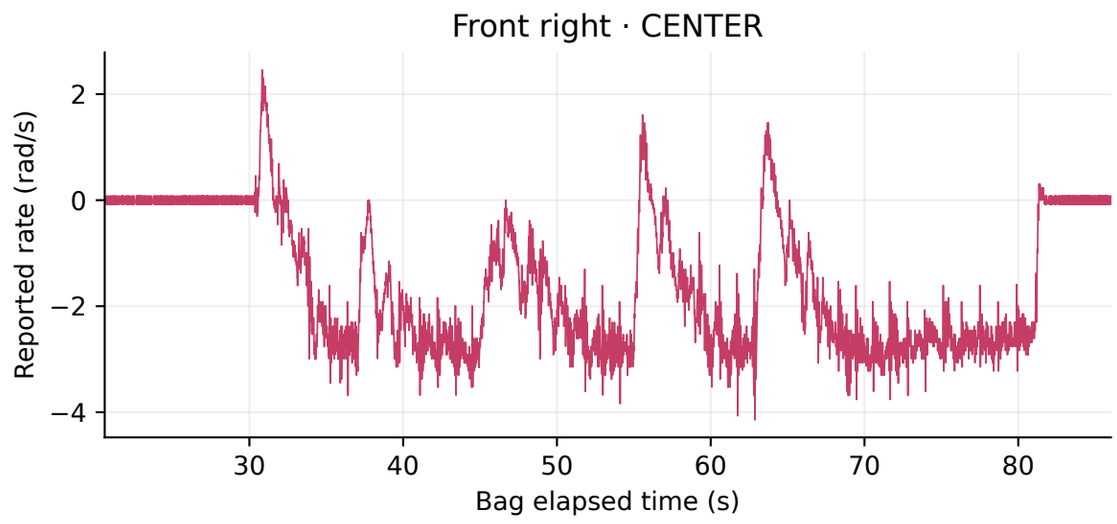



Raw Vicon position and orientation


Marker origins and axes differ between rigid bodies. Euler wraps are display conventions; 3D jump checks are on the next page.

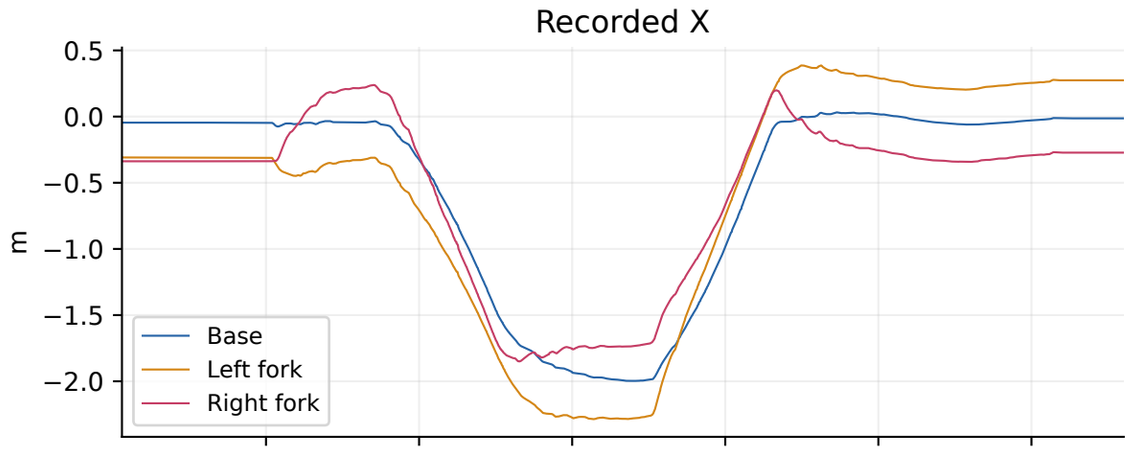


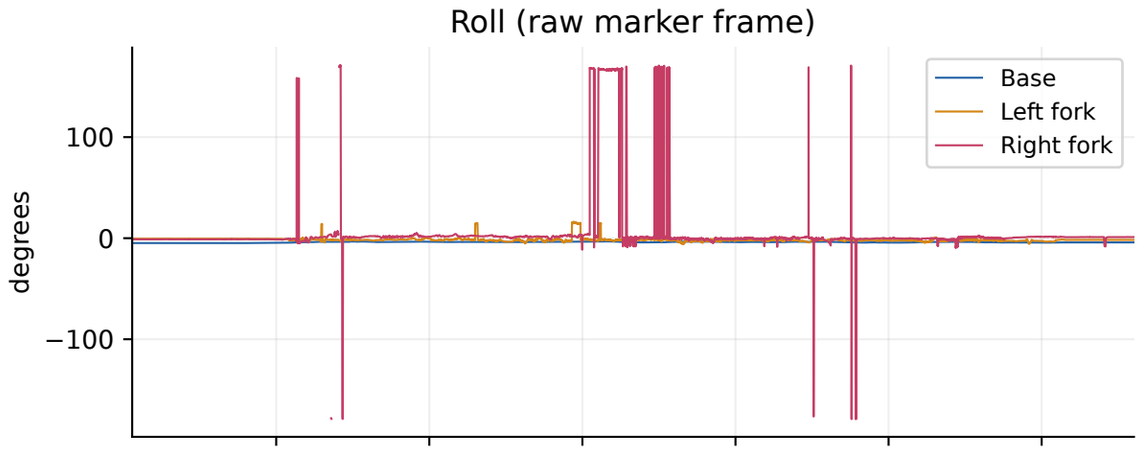

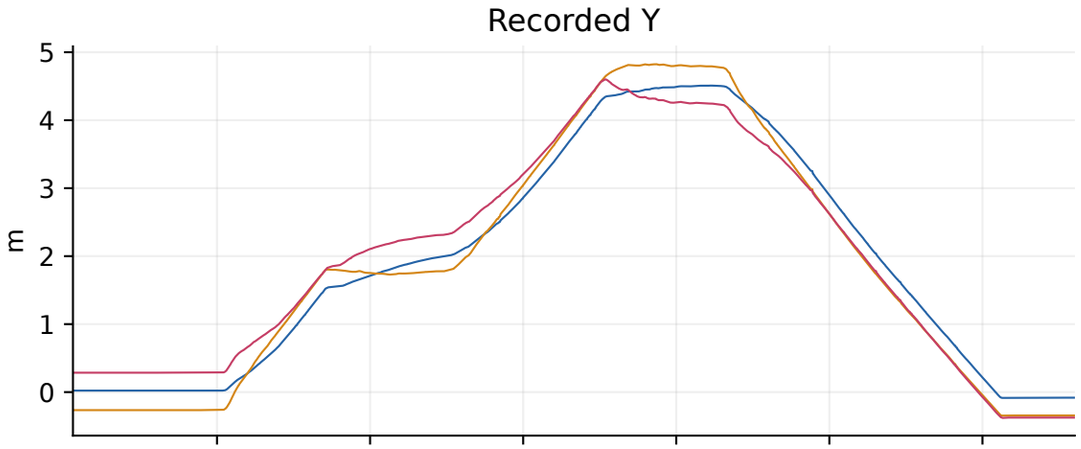

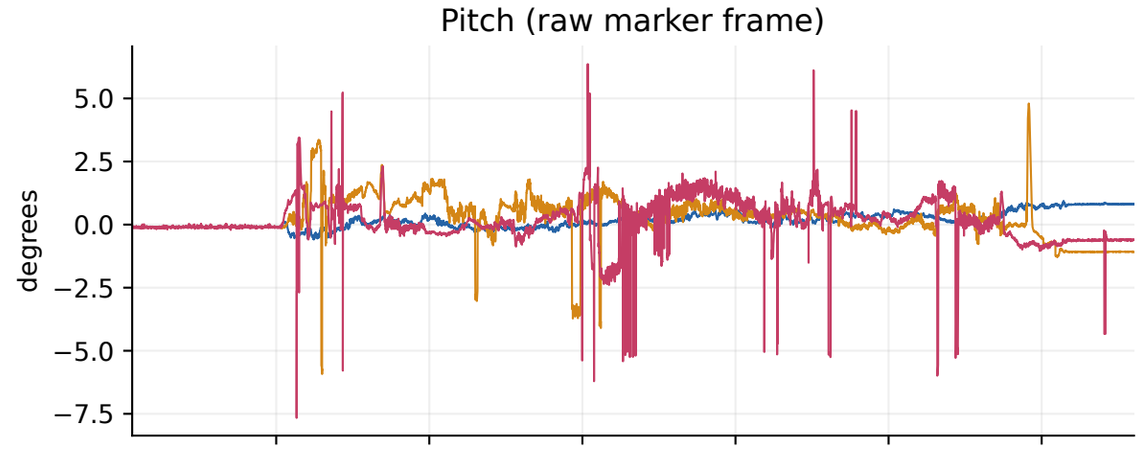


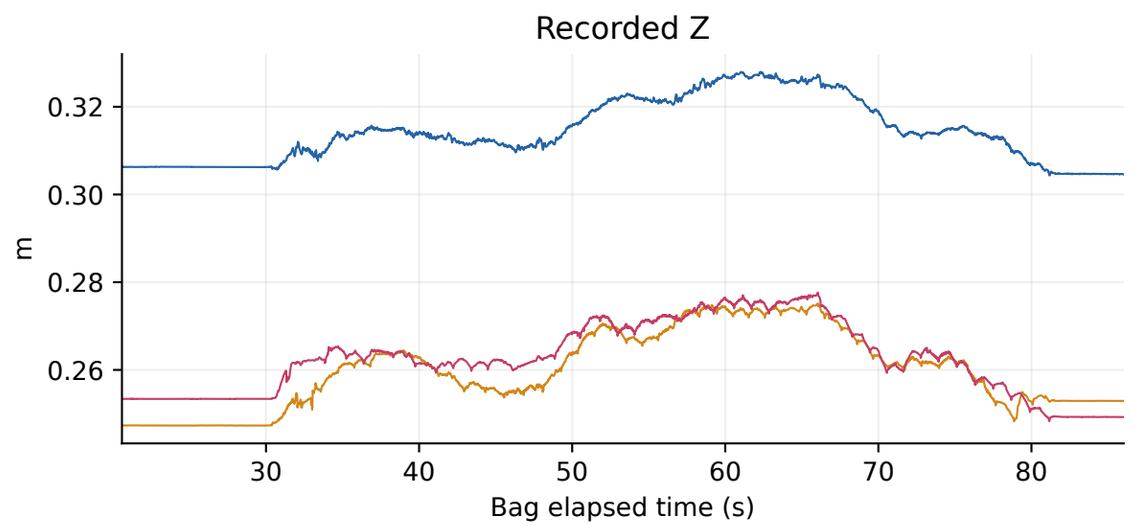


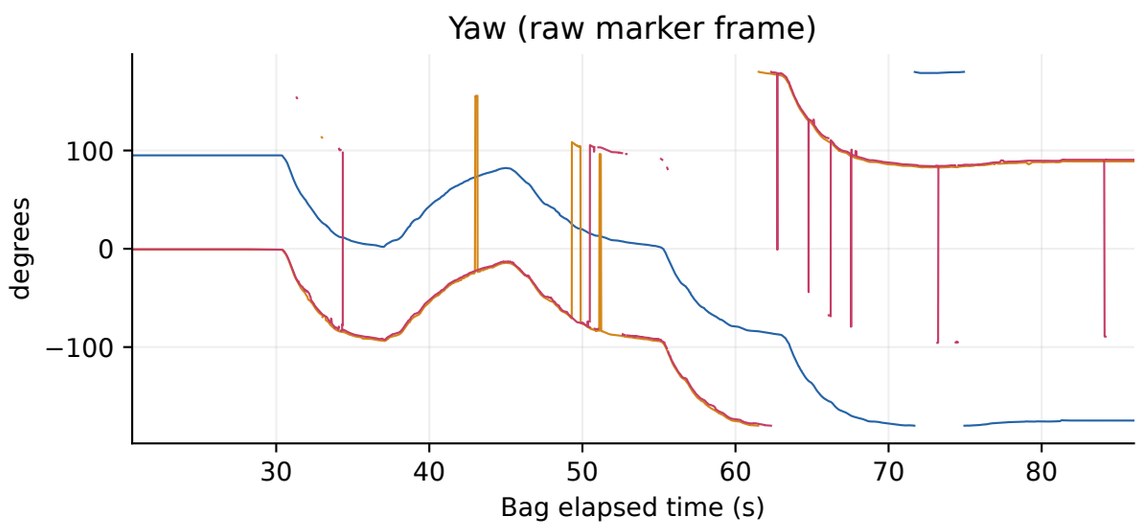

Vicon tracking discontinuities

Raw data, with no automatic correction. Large relative rotations of fixed forks suggest tracking/model ambiguity; cause is unconfirmed.

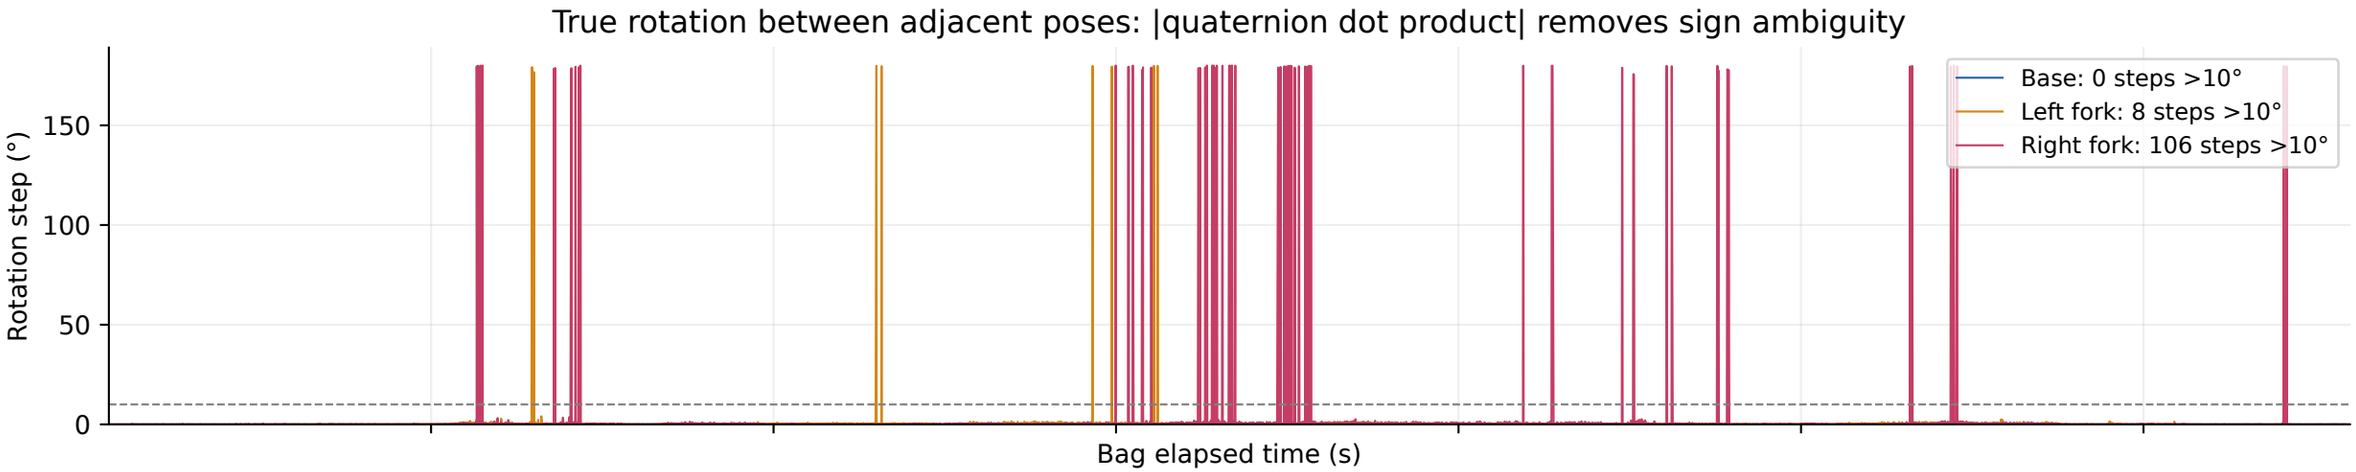


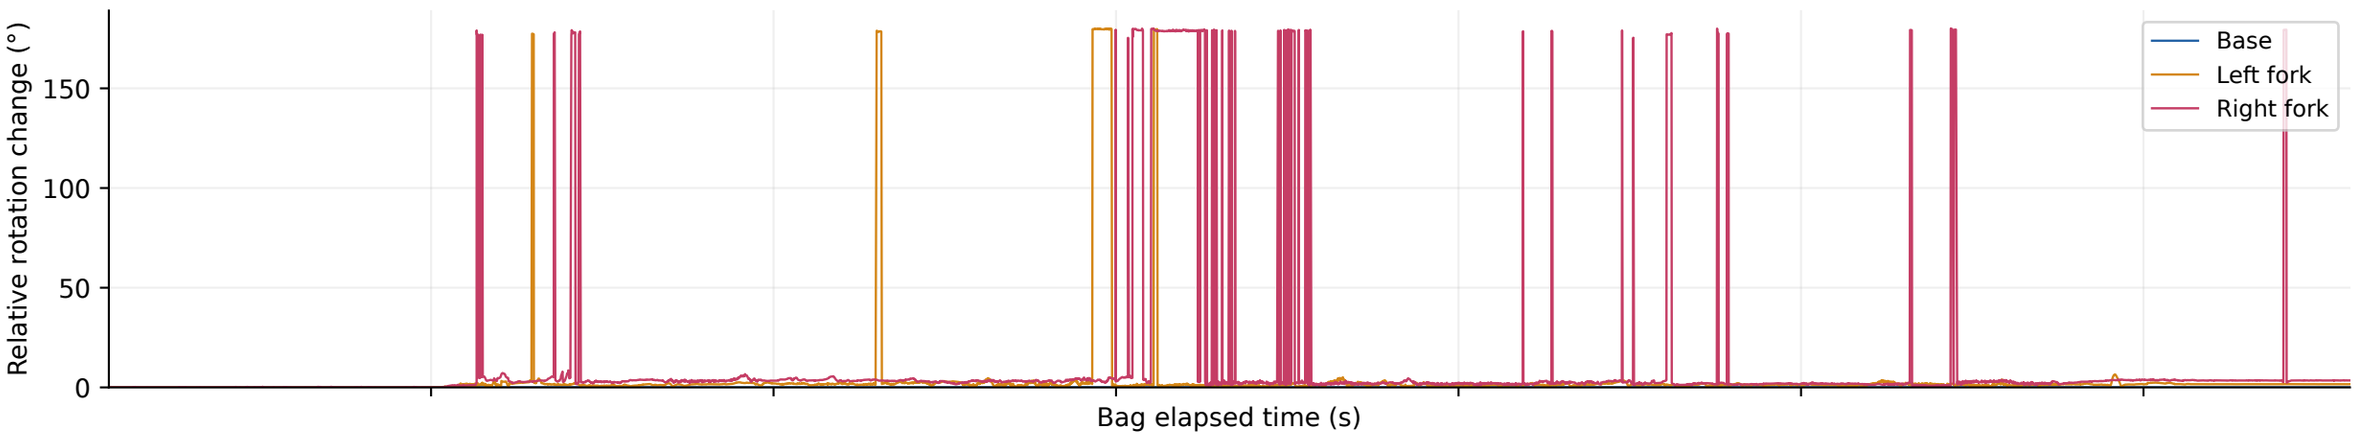




Drive commands and measured response

wheel_control_status_v1 fields, decoded using the repository schema. No extra timing shifts or filters applied.

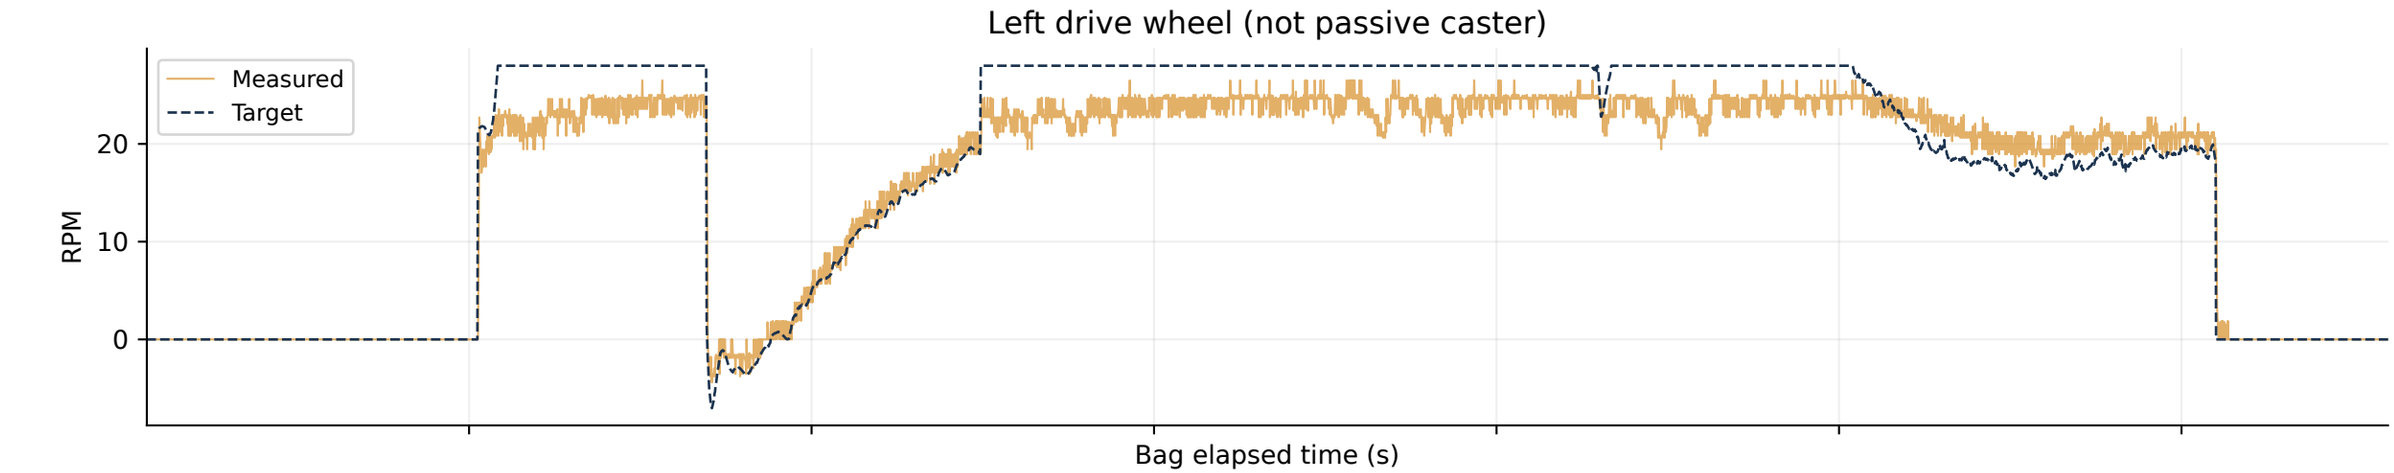

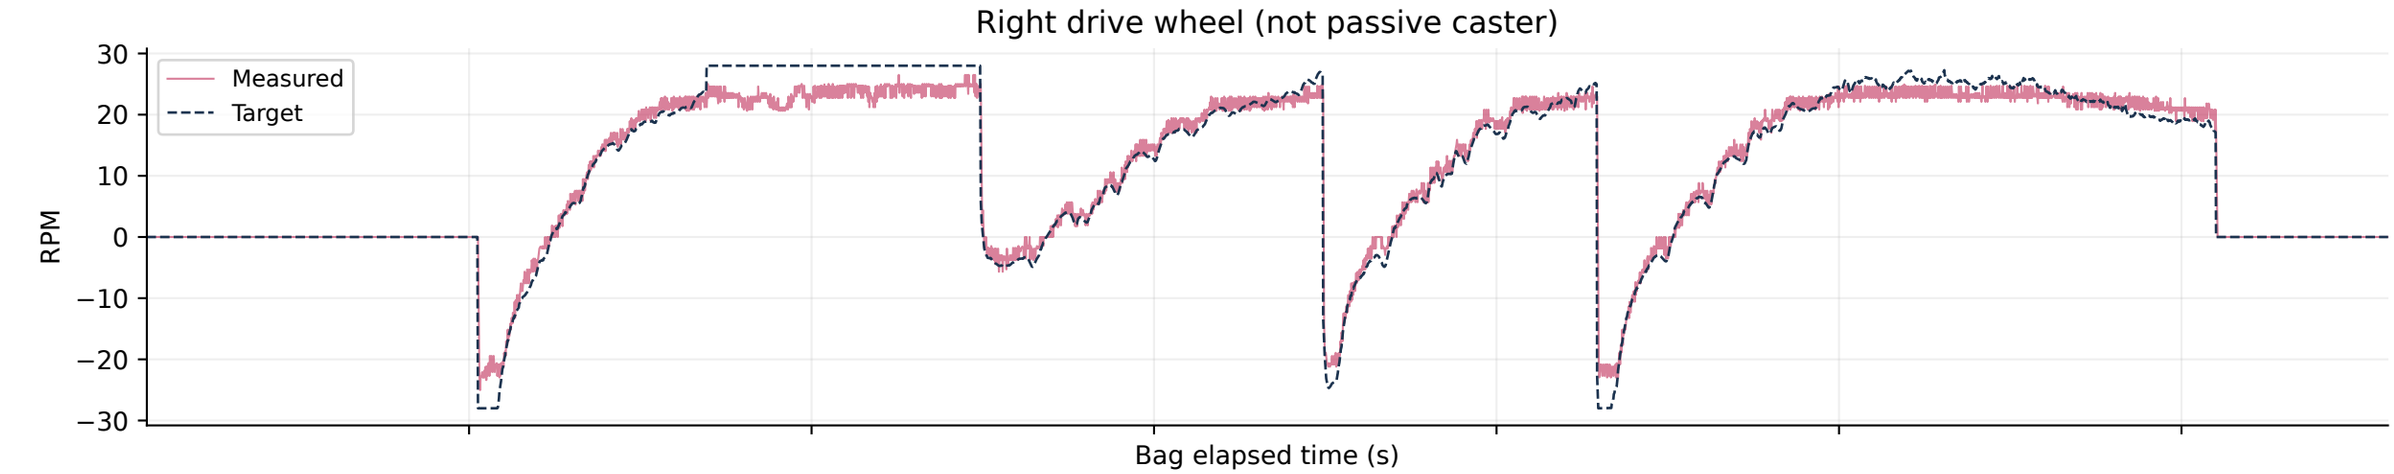



Timing and synchronization

High sample rates do not establish cross-sensor synchronization. The original estimated encoder clock mapping is preserved.

