

Image-Only ADR Similarity Screen — Mixed 2017 Challenger, Charger and Chrysler 300 Catalog Drawings

2026-07-31

Decision rule

Visible image geometry only. Part numbers, descriptions, applicability, dimensions, materials, fitment and compliance evidence were excluded from the similarity decision.

Result: 9 of 19 screened ADR rows receive a user-defined image-similarity pass. This is not an ADR compliance pass.

Image-similarity pass list

ADR	Subject	Outcome
3/03	Seats and Seat Anchorages	IMAGE-SIMILARITY PASS
4/05	Seatbelts	IMAGE-SIMILARITY PASS
10/02	Steering Column	IMAGE-SIMILARITY PASS
11/00	Internal Sun Visors	IMAGE-SIMILARITY PASS
21/00	Instrument Panel	IMAGE-SIMILARITY PASS
22/00	Head Restraints	IMAGE-SIMILARITY PASS
42/04	General Safety Requirements	IMAGE-SIMILARITY PASS
69/00	Full Frontal Impact Occupant Protection	IMAGE-SIMILARITY PASS — DEPICTED HARDWARE ONLY
73/00	Offset Frontal Impact Occupant Protection	IMAGE-SIMILARITY PASS — DEPICTED HARDWARE ONLY

Full 19-row matrix

ADR	Subject	Outcome	Visible basis
2/01	Side Door Latches and Hinges	INSUFFICIENT / NO IMAGE-ONLY PASS	Direct latch/hinge geometry is not comparably shown; only a small lock-cylinder component family looks similar.
3/03	Seats and Seat Anchorages	IMAGE-SIMILARITY PASS	Direct seat frame, track/adjuster and seat-back structures are highly similar or similar with visible differences.
4/05	Seatbelts	IMAGE-SIMILARITY PASS	Direct restraint assemblies are near-identical in the strongest mixed-model pair.
5/05	Anchorages for Seatbelts	PARTIAL / NO IMAGE-ONLY PASS	Belts and seat frames look similar, but the vehicle structural anchorage points are not comparably exposed.
8/01	Safety Glazing Material	INSUFFICIENT COMPARABLE IMAGE	No comparable glazing image pair was captured.
10/02	Steering Column	IMAGE-SIMILARITY PASS	Steering column geometry is highly similar and steering-wheel/airbag interfaces are visibly similar.
11/00	Internal Sun Visors	IMAGE-SIMILARITY PASS	The roof-liner/visor attachment architecture is similar with visible differences.
14/02	Rear Vision Mirrors	INSUFFICIENT COMPARABLE IMAGE	No comparable mirror assembly pair was captured.
18/03	Instrumentation	INSUFFICIENT / NO IMAGE-ONLY PASS	Dashboard shells are comparable, but direct cluster/tell-tale geometry is not comparably depicted.
21/00	Instrument Panel	IMAGE-SIMILARITY PASS	Full dashboard shells show similar visible architecture with substantial local differences.
22/00	Head Restraints	IMAGE-SIMILARITY PASS	Head restraints, guides and seat-back families are visibly similar with configuration differences.
25/02	Anti-Theft Lock	INSUFFICIENT / NO IMAGE-ONLY PASS	The direct steering/ignition lock or immobilizer mechanism is not visibly isolated for comparison.
29/00	Side Door Strength	VISUALLY DIFFERENT / NO IMAGE-ONLY PASS	Door/body structural views show major two-door/four-door geometry and segmentation differences.
34/02	Child Restraint Anchorages and Child Restraint Anchor Fittings	INSUFFICIENT / NO IMAGE-ONLY PASS	Rear-seat architecture looks similar, but child-restraint anchors are not visibly isolated or comparable.
42/04	General Safety Requirements	IMAGE-SIMILARITY PASS	Several directly depicted interior assemblies show similar visible geometry across mixed models.
69/00	Full Frontal Impact Occupant Protection	IMAGE-SIMILARITY PASS — DEPICTED HARDWARE ONLY	Multiple frontal-restraint hardware classes are highly similar or visibly similar; no crash-performance inference is made.
72/00	Dynamic Side Impact Occupant Protection	PARTIAL / NO IMAGE-ONLY PASS	Belts look similar, but direct side-airbag and side-structure coverage is insufficient and body structures visibly differ.
73/00	Offset Frontal Impact Occupant Protection	IMAGE-SIMILARITY PASS — DEPICTED HARDWARE ONLY	Multiple frontal-restraint hardware classes are highly similar or visibly similar; occupant-cell/crash performance is not addressed.
85/00	Pole Side Impact Performance	INSUFFICIENT / NO IMAGE-ONLY PASS	Direct pole-side restraint/structure coverage is insufficient; body-side structures visibly differ. Probably not mandatory for these 2017 vehicles, but applicability is separate from this image screen.


seat-belts

Visual grade: HIGHLY SIMILAR (Very high confidence)

Visible commonalities: The best pair is visually indistinguishable after pixel normalization; webbing paths, retractors, buckles and callout placement coincide.

Visible differences/limits: Image identity does not prove fitted identity, webbing specification, pretensioner behaviour or anchorage strength.

seat-belts: Challenger vs Charger
visual grade=HIGHLY SIMILAR automated pixelscore=1.0

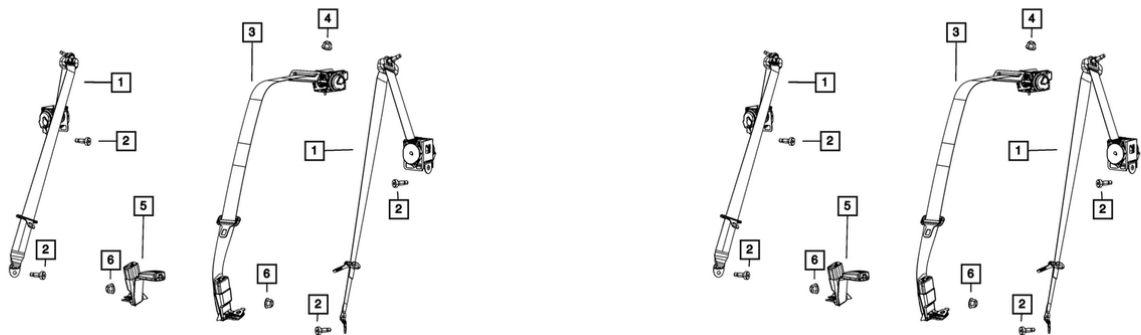



front-seat-adjusters

Visual grade: SIMILAR WITH VISIBLE DIFFERENCES (High confidence)

Visible commonalities: Both drawings show matching seat-back frame, cushion/track frame, side shield and floor-foot arrangement.

Visible differences/limits: Spring field, side hardware and small attachment layout differ.

front-seat-adjusters Chrysler 300 vsCharger
visual grade=SIMILAR WITH VISIBLE DIFFERENCES; automated pixel score=0.758966

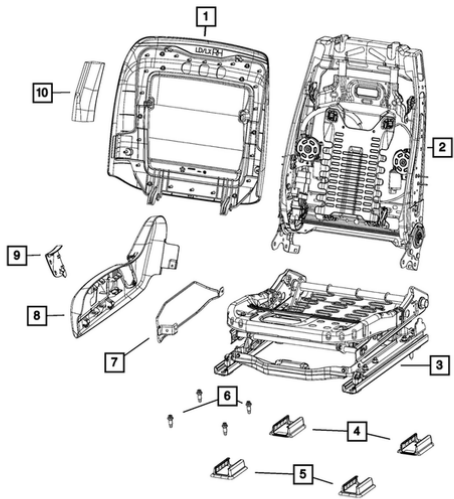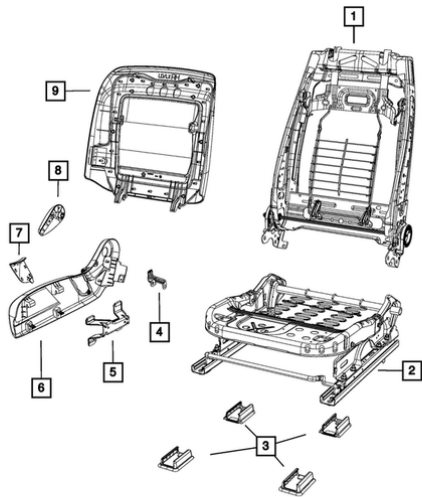



rear-seat-adjusters

Visual grade: HIGHLY SIMILAR (High confidence)

Visible commonalities: Twin seat-back frames, perforated panels, central latch/bracket cluster and peripheral hardware have closely corresponding geometry.

Visible differences/limits: Callout numbering and several small peripheral pieces differ.

rear-seat-adjusters: Chrysler 300 vs Charger
visual grade=HIGHLY SIMILAR; automated pixel score=0.664822

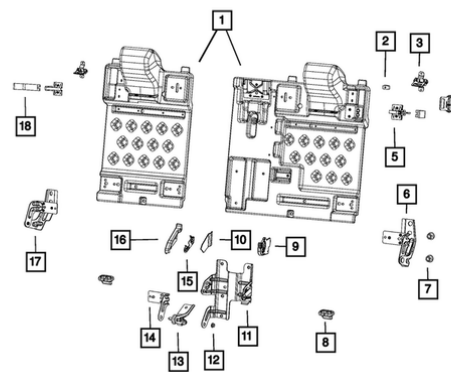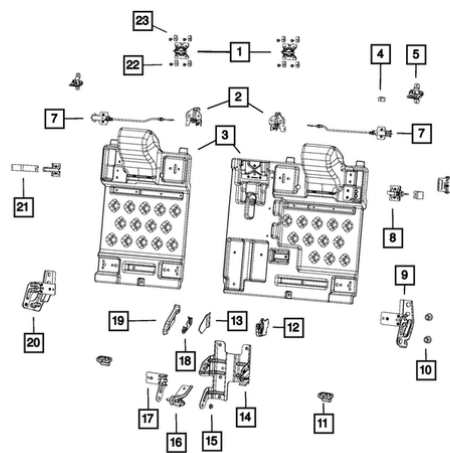



steering-column

Visual grade: HIGHLY SIMILAR (High confidence)

Visible commonalities: Angled column shaft, upper housing, mounting bracket, coupling and fastener locations closely correspond.

Visible differences/limits: One drawing includes an additional large shroud/module and callout layout differs.

steering-column: Chrysler 300 vs Charger
visual grade=HIGHLY SIMILAR, automated pixel score=0.58138

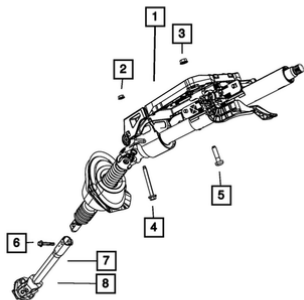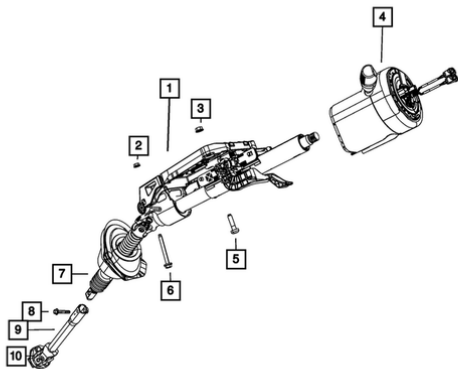



steering-wheel

Visual grade: SIMILAR WITH VISIBLE DIFFERENCES (High confidence)

Visible commonalities: Both show a round three-spoke wheel, central airbag/hub interface, side switch/trim modules and lower spoke trim.

Visible differences/limits: Spoke trim, hub detail and peripheral module shapes differ.

steering-wheel: Challenger vs Chrysler 300
visual grade=SIMILAR WITH VISIBLE DIFFERENCES automated pixel score=0.641131

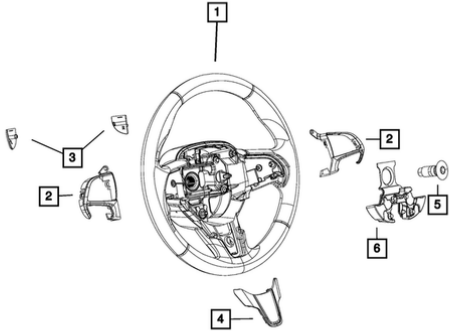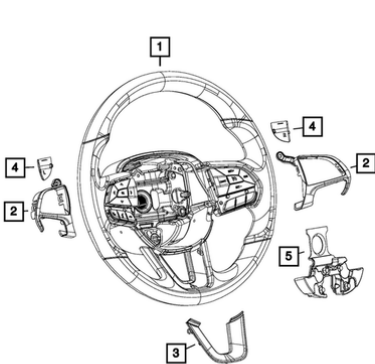


air-bags

Visual grade: HIGHLY SIMILAR (High confidence)

Visible commonalities: Passenger-airbag module, steering-wheel airbag family and lower bolster occupy the same three-part exploded layout.

Visible differences/limits: Steering-wheel hub/spoke detail differs; the drawing does not show calibration, sensors or deployment behaviour.

air-bags: Chrysler 300 vs Charger
visual grade=HIGHLY SIMILAR automated pixel score=0.853304

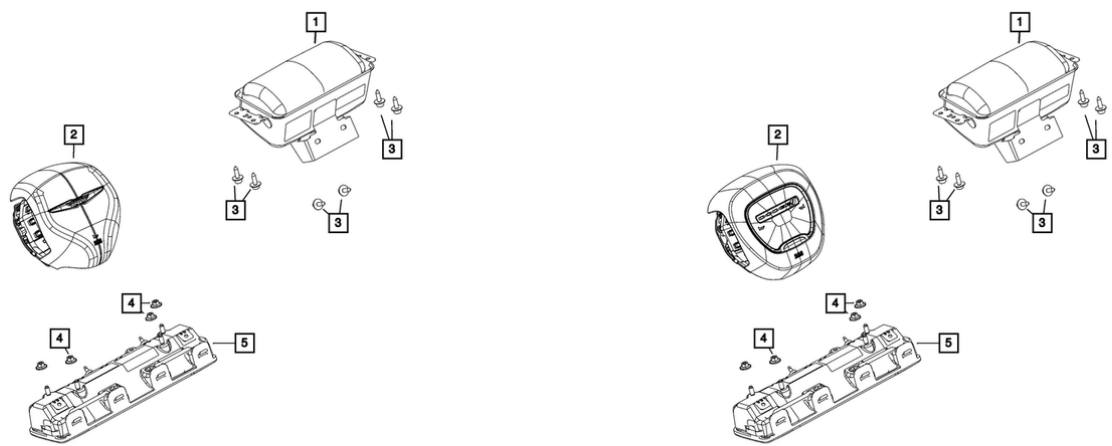



headliners-visors

Visual grade: SIMILAR WITH VISIBLE DIFFERENCES (Medium confidence)

Visible commonalities: Both show a large roof-liner panel with front visor/console attachment groups and perimeter fasteners.

Visible differences/limits: Roof openings, panel contour and quantity/location of smaller attachments differ; visor geometry is small in the source view.

headliners-visors: Challenger vs.Charger
visual grade=SIMILAR WITH VISIBLE DIFFERENCES, automated pixel score=0.568377

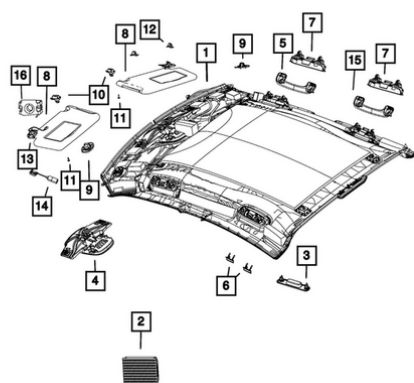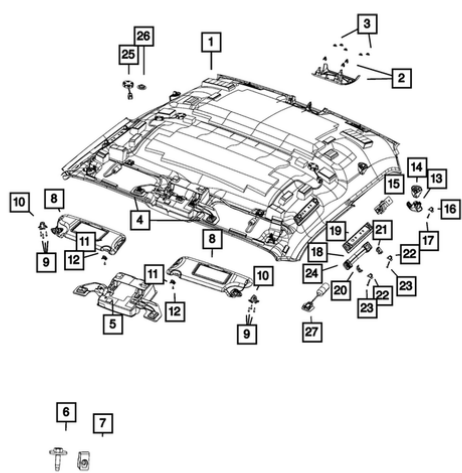



instrument-panel

Visual grade: SIMILAR WITH VISIBLE DIFFERENCES (Medium confidence)

Visible commonalities: Both show a full-width dashboard shell with instrument binnacle, centre stack, vent groups, glove-box region and lower trim.

Visible differences/limits: Main shell contour, centre-stack shape, component count and callout arrangement visibly differ.

instrument-panel: Chrysler 300 vs Charger
visual grade=SIMILAR WITH VISIBLE DIFFERENCES, automated pixel score=0.554849

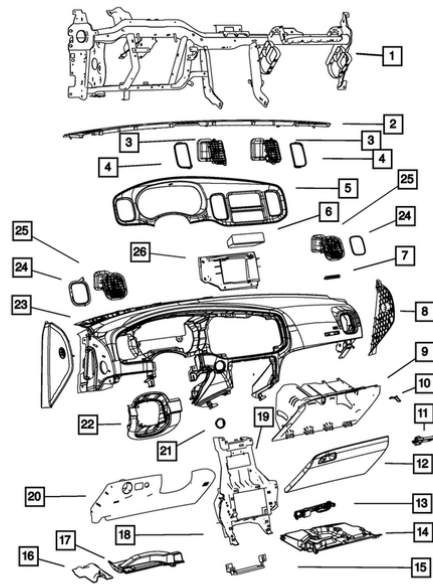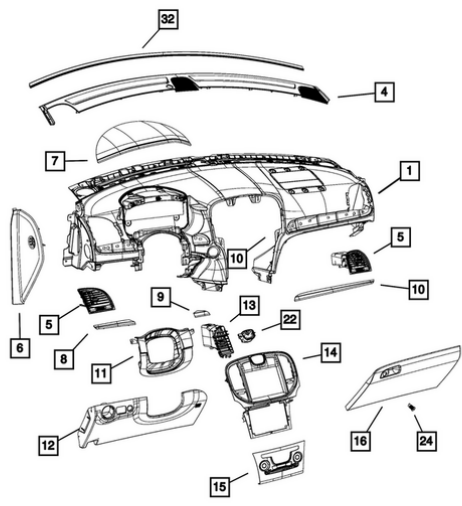



rear-seats-second-row

Visual grade: SIMILAR WITH VISIBLE DIFFERENCES (Medium confidence)

Visible commonalities: Both show split rear seat-backs, head restraints, side bolsters, cushions and lower trim in a comparable exploded arrangement.

Visible differences/limits: Backrest split/configuration, cushion segmentation and accessory layout differ; child anchors are not visibly isolated.

rear-seats-second-row: Chrysler 300 vs Charger
visual grade=SIMILAR WITH VISIBLE DIFFERENCES; automated pixelscore=0.627052

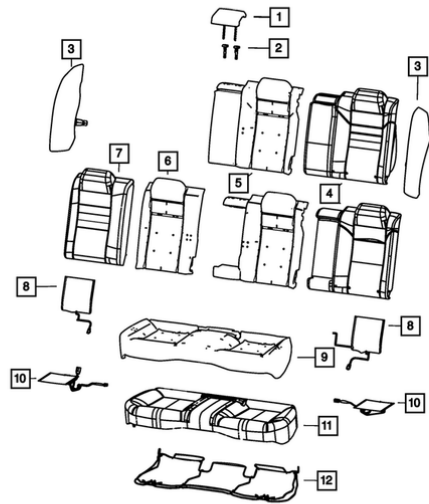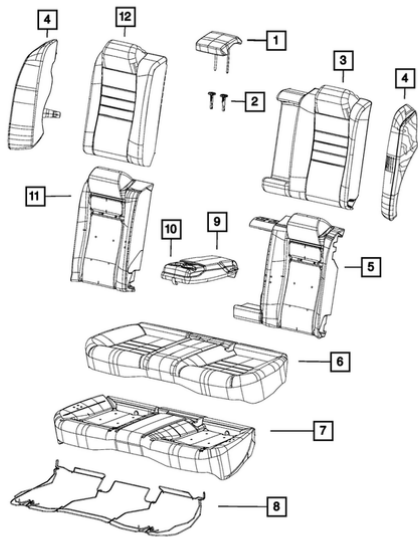

Non-negotiable limitation

Image similarity does not prove part identity, dimensions, materials, attachment strength, fitment, interchangeability, software, calibration, dynamic performance or ADR compliance. ADR 69/00 and ADR 73/00 are depicted restraint-hardware screens only.

Reproducibility

89 images; 2,628 cross-model pixel-scored pairs; 12 same-category classes manually reviewed. Pixel metrics used whitespace-trimmed grayscale structure, foreground-mask Dice, perceptual hash and difference hash.