

Resin Pouring — Production Logging

Operations Handbook

An hourly production record for the pouring station, kept by the operators on the phones they already carry. Part One is what runs today and what comes out of it. Part Two is what the same record can be asked to do, each of which is a setting rather than a requirement.

CONTENTS

What is in this handbook

Part One is the system as it runs: one screen an operator uses, and everything read back out of what they enter. **Nothing in it requires an entry from anyone but the operator.** Part Two is what the same record supports if it is wanted, each one a setting that is switched off until somebody switches it on.

PART ONE — IN SERVICE

01	What it records	What the record holds, and what it asks of anyone	3
02	How it fits together	One database, and every screen a window onto it	4
03	The operator terminal	The one screen an operator uses	5
04	Lot traceability	Which lot went into which containers	6
05	What comes out of it	Scrap, trends, exports and the shift handover	7
06	The floor as it is now	The live view of the floor as it stands	10
07	Who can do what	Roles, and what each one can reach	11
08	Running it	Backups, accounts, and keeping the record honest	12

PART TWO — AVAILABLE IF WANTED

09	Assigning work to stations	Dispatching runs to stations and tracking them	14
10	Fill weight and giveaway	Recording what a container actually weighed	15
11	Reactors and the floor display	Vessel levels and the wall display	17

APPENDICES

A	Guide — Operator	Working guides for operator, manager and administrator	18
B	Reading the screen on the floor	Gloves, lighting, contrast and colour on the floor	24
C	How it is tested	What is checked before a release, and what that has caught	25
D	Built, not in service	Built, not in use, and not proposed	26

ON SCOPE

This system was built on the floor alongside the job, and it covers more ground than the plant needs today. The marker on each section says which is which: **In service** runs now; **Optional** is finished and switched off until somebody wants it; **Not in service** was built to find out whether an approach works, with nothing depending on it. **Part One is what is being proposed** — the rest is here so the capability is known, not because it is being asked for.

A production record for resin pouring

Resin pouring has never had a production tracking system. Counts, downtime, changeovers and cartridge lots lived on paper and in people's heads, which means the plant has been running without a record it could query, an hourly pace it could see, or any way to answer a quality question after the fact.

This is that record. A web application opened in a browser — on an operator's phone at the pump, on a desk in the office, and on the floor display — backed by a PostgreSQL database. Operators log the hour as it happens, at the pump. That log is the whole input: the figures on the wall display, in the analytics charts and in the emailed shift handover are not separate reports, they are the same rows read different ways.

Nothing here asks a manager to enter anything, and nothing asks the plant to find somebody to administer it: as a logging system a manager holds the console too, so a PIN reset or a new pump does not wait on a second person. The system installs with work orders switched off — a plant that wants to dispatch runs to stations and track them against a target turns that on, and the screens for it appear; a plant that does not is a log, and the operator terminal never mentions runs at all. Everything in Part Two of this handbook works the same way: a setting, answering a question somebody asked first, not a step in getting the record.

1

screen an operator uses, on the phone already in their pocket

0

entries required from a manager for the record to be kept

3

roles, each seeing only what its job needs

2

shifts, a plant setting rather than an assumption in the code

18

database tables of production, quality and configuration

959

automated checks run before a release, including a browser driven through a shift

What it records


- Every unit poured, attached to an operator, a station, a resin, a lot number and a timestamp.
- A lot check against each pouring log — every container format — including the ones that failed.
- Downtime by reason and duration, and scrap split between empty and filled containers.
- Start-of-shift, changeover and spill photo audits, filed against the station.
- Pre-shift validation per operator, per shift, per pump station.
- Reactor volume, reconciled against what has been logged rather than overwritten.

SCOPE

The system is in service for resin pouring. Pack-out logging and machine integration are built but not in use; both are described in Appendix D rather than here, because neither has been committed to.

One database, many windows

Nothing on the floor keeps its own copy of the numbers.

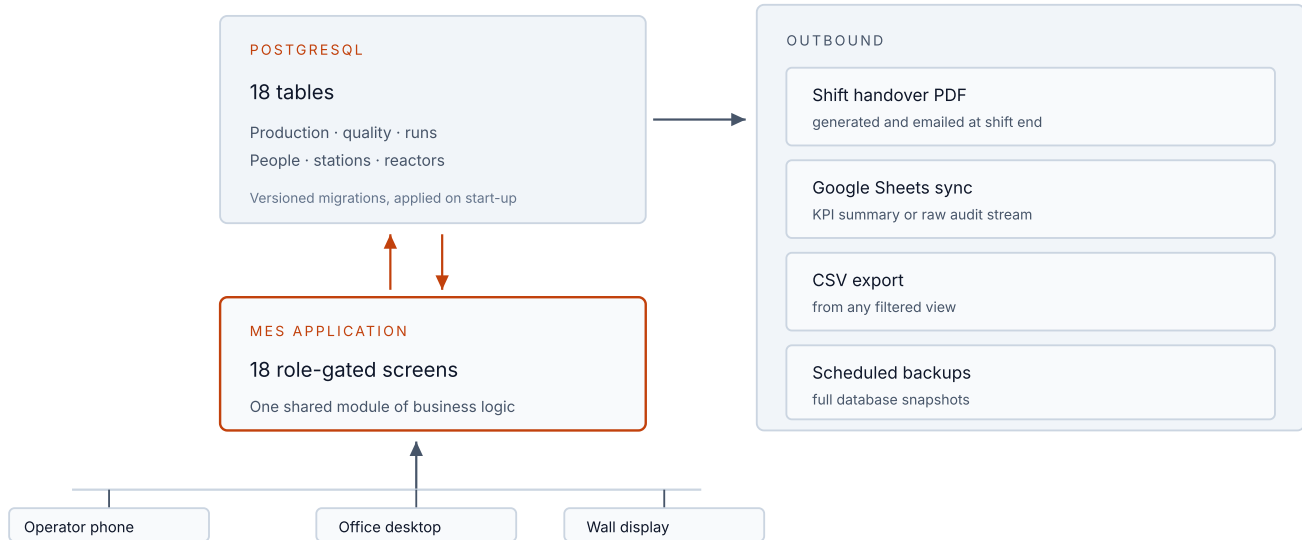

Schema changes

Structural changes ship as numbered migrations that apply themselves on start-up, rather than SQL run by hand. Logs carry foreign keys to the operator and station as well as the legacy name text, so renaming someone does not split their history.

Where the logic lives

Business logic sits in one module the whole application shares. Every screen that shows a figure reads it through the same functions, so a change to how yield is calculated applies everywhere at once.

What happens when an operator submits a log

- 1 Checked at the station**
 The lot on the container is compared against the run before the form accepts the entry.
- 2 One transaction**
 The log and its verification record are written together; neither can exist without the other.
- 3 The run re-counts**
 Progress is recomputed from the logs matching its station, resin, format and lot.
- 4 Everything else follows**
 Display, analytics, handover and exports all read those same rows.

The operator terminal

One screen, sized for a gloved thumb on a phone: stacked inputs, large targets, no navigation to get lost in. Operators open it on their own handsets rather than at a shared terminal.

The screenshot shows a mobile application interface for an operator terminal. On the left is a dark sidebar with the user's name 'Ana Ruiz', role 'OPERATOR', and shift 'Shift 1'. Below this is a 'Navigation' section with buttons for 'Live SCADA', 'Workstation', and 'Live Reactors'. At the bottom of the sidebar are 'Account & Preferences' and a 'LOG OUT & CLEAR DEVICE' button. The main content area has a dark background and contains two sections. The first section, '1. Station & Material Setup', includes dropdown menus for 'Pump Station' (New Pump #1), 'Container Format' (V2 (1L Cartridge)), and 'Resin Formulation' (Bioresin XZ9). Below these is a 'Bioresin XZ9' label and a target weight 'Target: 1050.0g | Range: 1040-1060g'. The second section, '2. Cartridge Lot Verification', includes instructions to turn the cartridge over and type the lot number. A text input field contains the lot number '241180742'.

The hourly log. Station and material, the lot read off the container, then the counts. This is the screen in full — there is nothing above it and nothing after the submit button.

TAB 1

Log hourly pouring

Station, container format, resin, verified lot, good units and both scrap categories, with the target fill weight and tolerance for the selected resin shown alongside.

TAB 2

Log station downtime

Reason from the plant's configurable list, duration and notes. Feeds the downtime ranking used in analytics.

TAB 3

Cleanliness & photo audit

Start of shift, end of shift, line transfer or spill, with a camera capture or upload, filed against the station.

TAB 4

Manager comms

A direct message thread with the plant lead, inside the terminal.

ALWAYS VISIBLE

Units poured, scrap and quality yield for that operator sit at the top of the screen and update as they log. It is the same figure management sees; there is no separate scoring.

Lot verification

Lot labels get mixed up at the pumps: a pallet of pre-labelled empties is staged that belongs to a different lot, and resin goes into it. An earlier build of this form auto-filled the run's lot and printed it on screen, which meant an hour could be logged without a cartridge ever being turned over — the check was answering its own question.

2. Cartridge Lot Verification

Expected lot for this run: ***** hidden on purpose — read the cartridge, not the screen

Turn the cartridge over. The lot label on the bottom reads **L-** followed by the lot. Type it exactly as printed — spacing, case and the prefix don't matter.

L- — lot on the cartridge bottom label

2411A0742

The check. The lot the run expects is masked. The operator turns the container over and types the **L-** code from the lot label on its bottom. Spacing, case and the prefix are normalised, so a code typed verbatim matches a run lot entered bare.

STOP — DO NOT POUR. This cartridge is not from the lot assigned to your run. Set it aside and get your lead.

Pulled the cartridge instead? Log the catch — it belongs in the record.

WRONG CARTRIDGE — PULLED IT, NOTHING POURED

Logging it anyway? Say what happened.

Choose an option

Details (required)

When it doesn't match. Submission is refused until the cartridge is pulled — recorded as a catch, with no production logged — or a cause, details and a photograph of the label are supplied. The log then saves flagged, carrying the lot physically in the container.

FREQUENCY

Full check, then a confirm

The full check runs on the first log of a shift, on any change of run, lot, resin or station, after four hours, and on every tenth log. Otherwise a single confirmation tap.

COST

Photo only on a mismatch

A clean check is one field and one tap. The photograph is required only when logging against a flag — and deliberately not required to pull a cartridge, so the safe action is never the slower one.

2. Jug Lot Verification

Expected lot for this run: ***** hidden on purpose — read the jug, not the screen

Turn the jug over. The lot label on the bottom reads **L-** followed by the lot. Type it exactly as printed — spacing, case and the prefix don't matter.


L- — lot on the jug bottom label

The same check on a bulk jug. RPS was the one exempt format, on the understanding that jugs carried nothing to read. They carry the same lot label a cartridge does, in the same place — so it is the same check, and only the noun changes with the format picked above.


DESIGN NOTE

A mismatch does not stop the line; it asks for an explanation, because a control that halts production is one people learn to work around. Every flag and every pulled container reaches the manager's review page.

Review and scrap intelligence

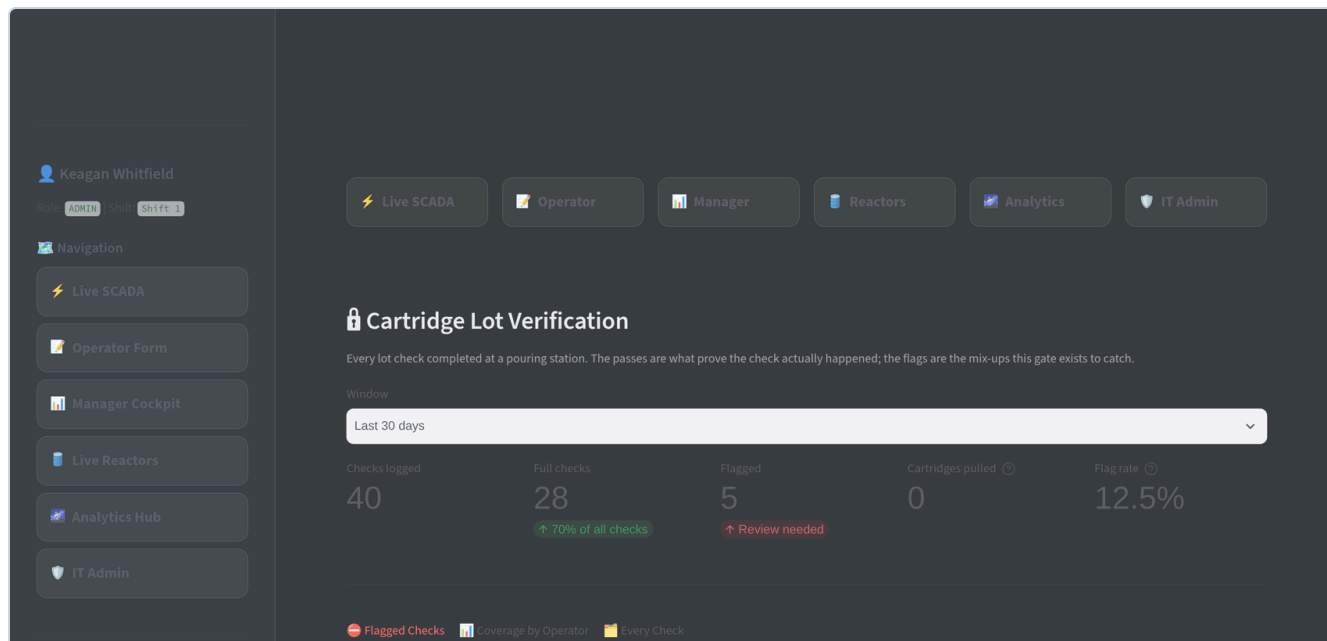

Lot Verification review. Every check completed, pass or fail. The passes record that the check happened; the flags are the mix-ups. Coverage per operator shows who is completing full checks and who is using the confirmation tap.

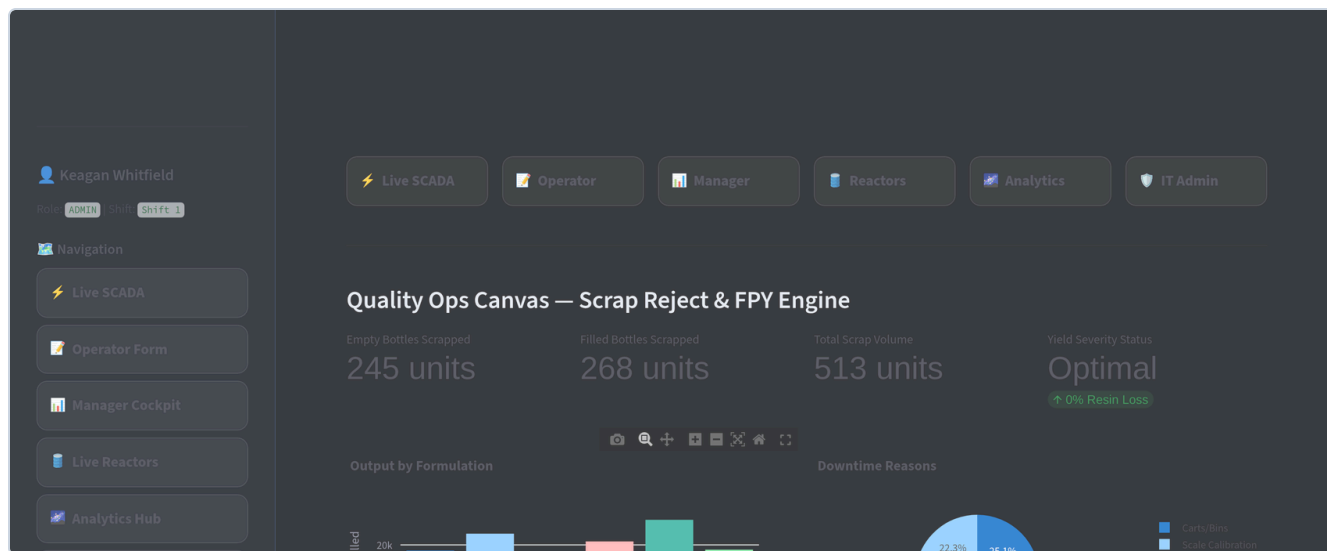

Scrap & Yield Intelligence. First-pass yield against the configured target, with scrap split between empty and filled containers — a handling problem and a lost-resin problem respectively — and downtime reasons ranked alongside.

PHOTO AUDITS

Cleanliness gallery


Start of shift, end of shift, line transfer and spill audits with photograph, station, operator and timestamp. Spills are counted separately.

EXPORT


CSV from the register

The verification register exports directly, so a quality question or customer audit can be answered without a database query.

Trends

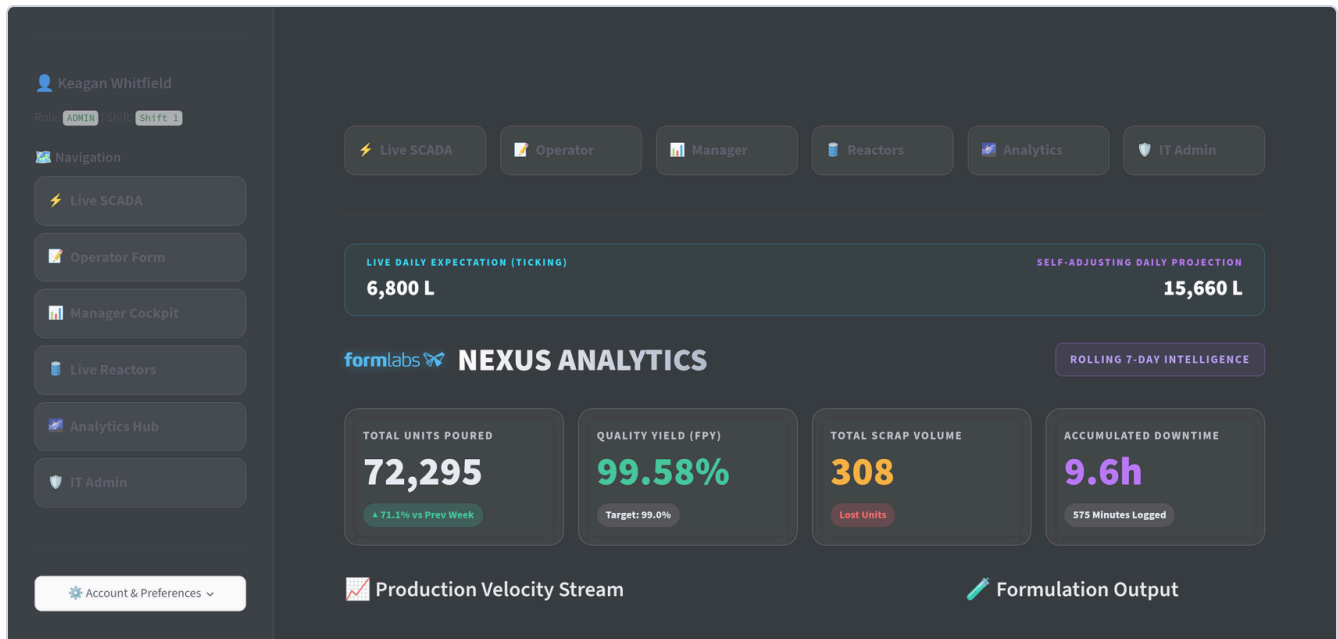


Analytics Hub. Output trend over the selected horizon, share of production by resin formulation, and downtime ranked by reason.

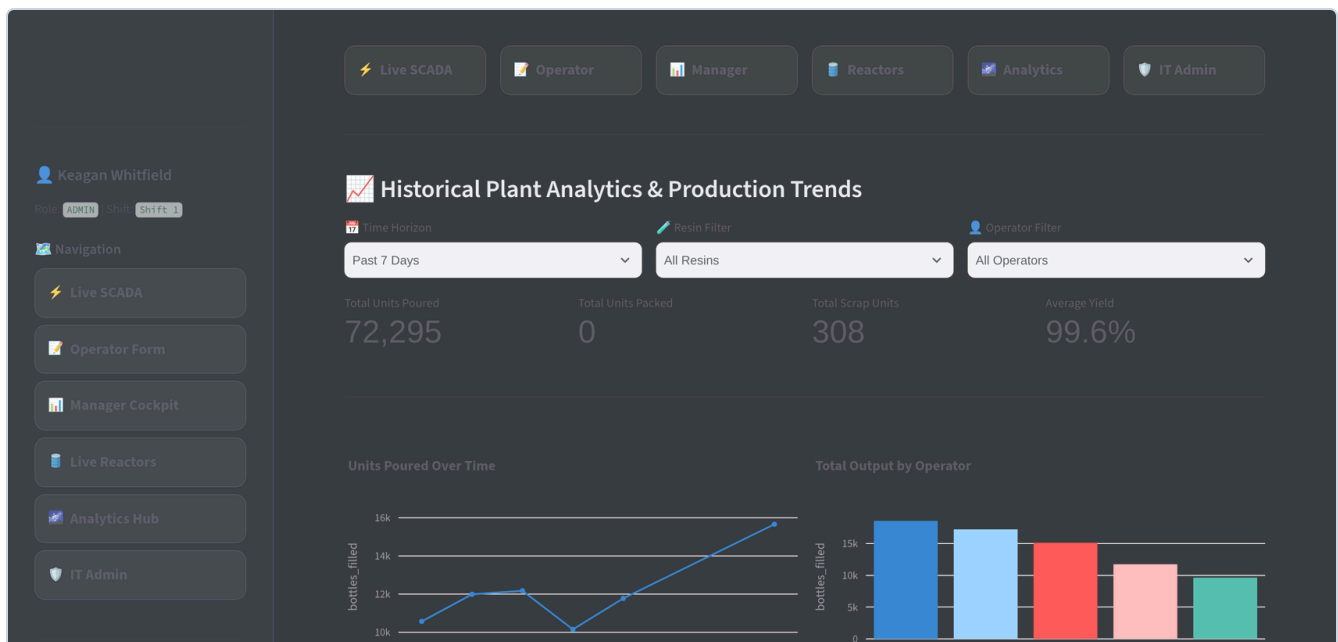

Historical Production Trends. The same data filtered by horizon, resin and individual operator, for month-to-date, year-to-date or any range.

Reporting out

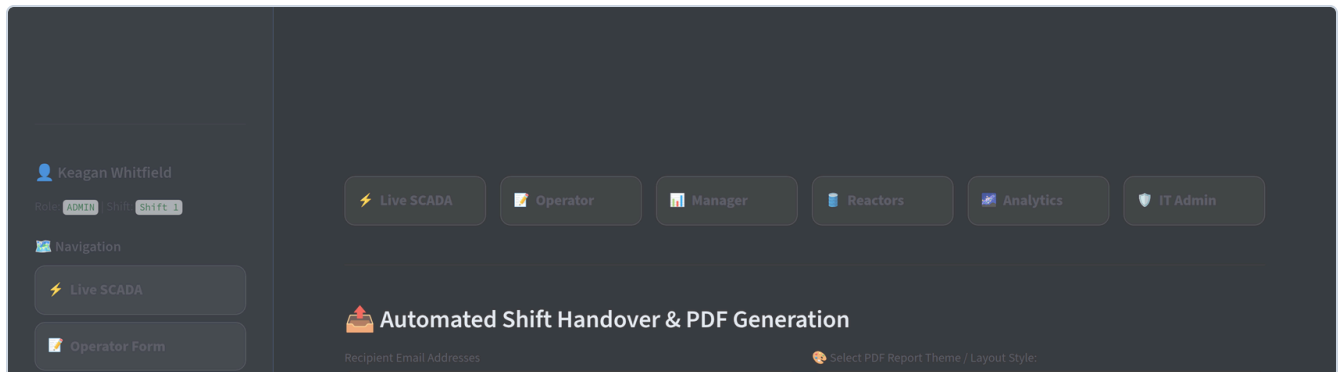

Automated Shift Handover. Output, yield, downtime and scrap for the shift, rendered as a PDF in one of two layouts and emailed to the plant's distribution list.

CLOUD EXPORT

Google Sheets sync

Two payload shapes — an aggregated KPI summary or the raw production audit stream — across four time horizons, pushed on demand, at shift handover, or on a scheduled webhook. Columns are selectable, and internal-only fields are stripped before anything leaves the app.

SELF-SERVICE

CSV from any view


Filtered log views and the verification register export directly, so finance, quality or an audit can be answered without a developer.

ONE SOURCE

The handover PDF, the Google Sheet, the CSV export and the floor display all render from the same production log rows. There is no second system to keep in step.

The floor as it is now

The landing screen for every role. Filters across time horizon, station, resin, operator and shift recalculate every figure on the page.

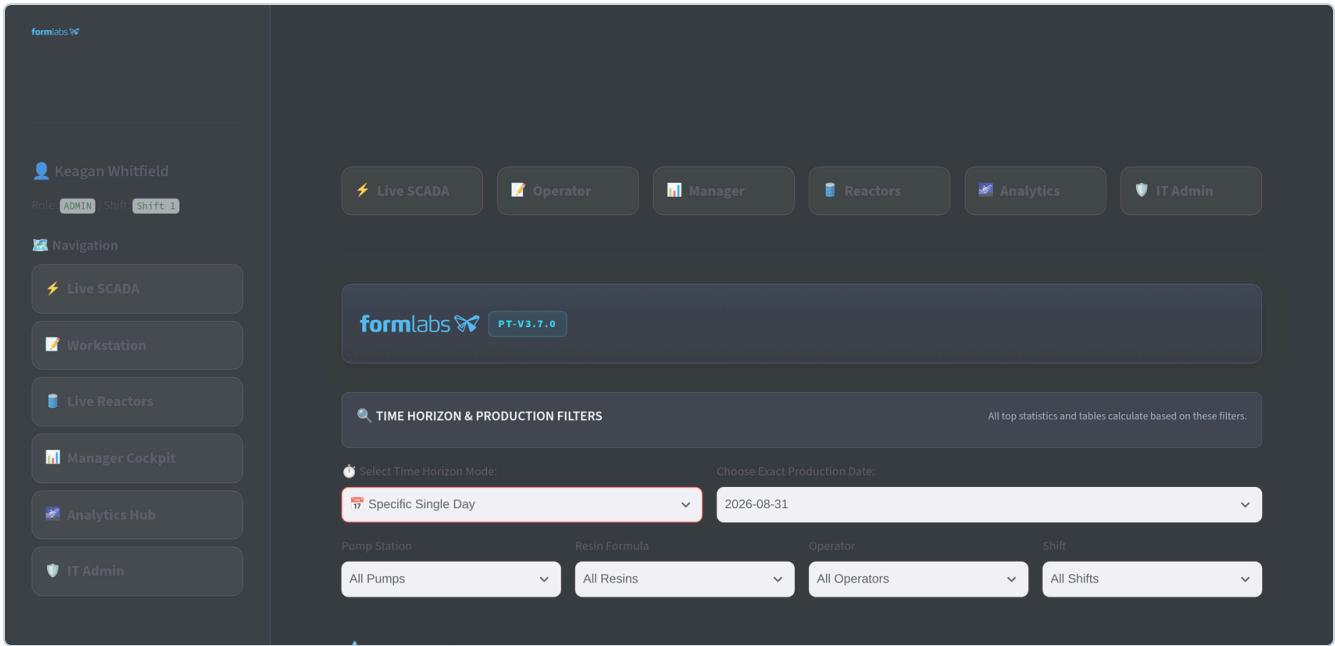

Live SCADA. Volume output, resin mass poured (calculated from each formulation's master fill weight), run velocity against the configured target, and pouring yield.

formlabs

Keagan Whitfield

Role: ADMIN Shift: SHIFT 1

Navigation

- Live SCADA
- Workstation
- Live Reactors
- Manager Cockpit
- Analytics Hub
- IT Admin

#3 Dee Okafor1,116 L/h

Filtered Master Production Stream

Showing 60 matching records.

Sort Table By: Newest First

timestamp	date_str	log_type	operator_name	pump_station	cartridge_type	resin_type	bottles_filled	scrap_empty	scrap
2026-08-30 23:56:15	2026-08-31	Hourly Bottle Count	Dee Okafor	Pump 2	V2	High Temp Amber V3	309	0	0
2026-08-30 23:53:15	2026-08-31	Hourly Bottle Count	Dee Okafor	Pump 1	V2	High Temp Amber V3	248	2	0
2026-08-30 23:50:15	2026-08-31	Hourly Bottle Count	Sana Moreau	Pump 3	V2	Standard Grey V5	281	0	0
2026-08-30 23:50:15	2026-08-31	Hourly Bottle Count	Sana Moreau	Pump 3	V2	Standard Grey V5	317	0	1
2026-08-30 23:48:15	2026-08-31	Hourly Bottle Count	Sana Moreau	Pump 3	RPS	Standard Black V5	55	0	0

Below the fold. Shift trajectory against pace, a pouring leaderboard, and the filtered production stream — the individual logs behind the figures above.

Roles

Everyone signs into the same application and sees a different one. Access is checked on every page, so the difference is enforced rather than cosmetic.


The column that moves is **Manager**. A plant running this as a logging system has no separate IT role — there is nobody to be it — so a manager is the administrator: accounts and PIN resets, equipment, plant settings, backups and cleanup. Switch to an execution system and those hand back to administrator accounts, which is what the shaded rows below mean.

CAPABILITY	OPERATOR	MANAGER	ADMIN
Live SCADA dashboard	Yes	Yes	Yes
Startup checklist & terminal unlock	Required	n/a	n/a
Log hourly pouring & lot verification	Yes	Test mode	Test mode
Log downtime & cleanliness audits	Yes	Yes	Yes
Message the plant lead	Yes	Both ways	Both ways
Live reactor fleet & reconciliation	Yes	Yes	Yes
See the lot a run expects	Masked	Yes	Yes
Create & dispatch work orders	—	Yes	Yes
Analytics hub & historical trends	—	Yes	Yes
Lot verification review & scrap intelligence	—	Yes	Yes
Shift handover PDF & Google sync	—	Yes	Yes
Floor roster & PIN resets	—	Floor staff	All users
Master resin specifications	—	Yes	Yes
Log management & bulk cleanup	—	Yes	Yes
Plant configuration, shift count & parameters	—	Logging mode	Yes
Record a check weight against an hourly log	Optional	Optional	Optional
Undo your own last log, within two minutes	Own only	Own only	Own only
Database backup & restore	—	Logging mode	Yes
Provision accounts & reset any PIN	—	Logging mode	Yes
Choose how the plant runs this system	—	Logging mode	Yes

Logging mode marks the rows a manager holds only while the plant runs as a log. *Test mode* lets a manager or administrator log on behalf of an operator for training and troubleshooting; the entry is attributed to the operator selected and is visible in the log.

One thing the mode cannot do is strand a plant: an execution system restricts this console to administrator accounts, so the switch is refused while no such account exists, rather than locking everybody out of the screen that would switch it back.

Running the system

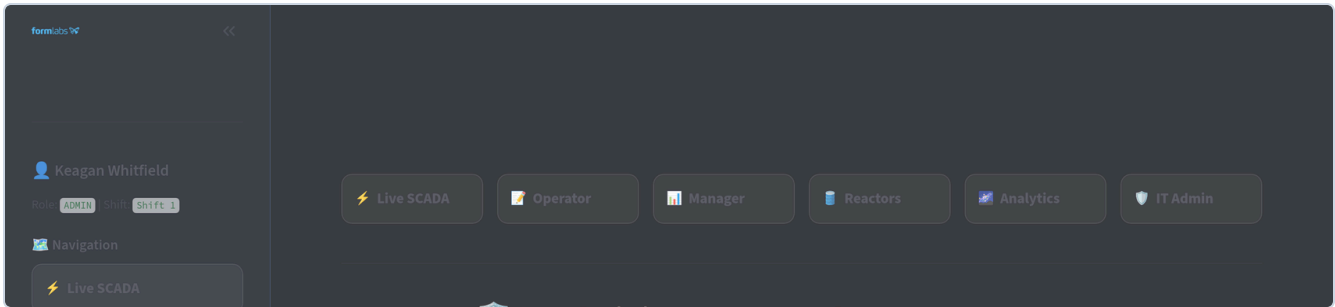

IT Administration. Roster, the issue inbox, database utilities and global plant configuration.

PEOPLE

Accounts and roles

Provision staff, assign role and shift, set per-operator rate targets, reset PINs and unlock accounts. Managers can provision floor personnel without full IT access.

PLANT

Global parameters

How many shifts the plant runs — this one runs two — with start times, lengths and breaks; rate and yield targets; handover email recipients; and the address of the pump form the operator terminal links out to.

EQUIPMENT

Stations, reactors, reasons

Pump stations, the reactor fleet and capacities, and the downtime reason list, so the vocabulary stays the plant's own.

RECOVERY

Backup and restore

Full database snapshots on demand or on schedule, and a restore path from any snapshot.

Quick Search by SKU, Resin Name, or Code

Showing: ALL (16 Resins)

ID	FORMAT	SKU	CODE	RESIN NAME	TARGET (G)	MIN (G)	MAX (G)	TARGET (KG)	MULTIPLIER	LIFETIME
8	RPS	RS-R5-GPBK-05	FLGPBK05	Black V5	5000.0	4950.0	5050.0	5.0	1.0	24
6	V1	RS-C1-DRV2-01	FLDRV201	Draft V2	1120.0	1110.0	1130.0	1.12	1.0	24
11	V1	RS-C1-FL80-01	FLFL8001	Flexible 80A V1	1070.0	1060.0	1080.0	1.07	1.0	24
7	V1	RS-C1-TO15-01	FLTO1501	Tough 1500 V1	1070.0	1060.0	1080.0	1.07	1.0	24
16	V2	RS-C2-BIOX-01	FLBIOX01	Bioresin XZ9	1050.0	1040.0	1060.0	1.05	1.0	24
15	V3	RS-C3-BLK6-01	FLBLK601	Black V6	1110.0	1100.0	1120.0	1.11	1.0	24

Master Resin Specifications. Target fill weight, tolerance band and shelf life — what every check weight is judged against, and what turns a bottle count into resin mass. Each formulation carries its colour from the plant's own master sheet.

Access control and data integrity

Accounts

- **PINs are hashed.** Salted with bcrypt; the database holds no readable PIN, including for administrators.
- **Lockout.** Five failed attempts locks the account for fifteen minutes, with an instant IT unlock.
- **Sessions are tokens.** A signed token with a fixed lifetime backs "remember this device", revocable server-side.
- **Every page checks the role.** Enforced on the page itself, so typing a URL for a screen your role lacks returns access denied.
- **Output is escaped.** Values typed on the floor are escaped before rendering, so a note cannot inject markup or break its own card.

The record


- **History survives a rename.** Logs carry foreign keys to the person and station as well as the name text.
- **Deletions re-sync.** Removing a log recalculates whatever work order it counted toward.
- **Bulk deletion is deliberately hard.** Disabled until the word DELETE is typed into a confirmation box.
- **Corrections are visible.** A plant-level correction is written as a labelled system adjustment, not by editing an operator's entries.
- **Credentials are kept out of the application itself.** Connection strings and passwords live in a configuration file on the machine, not written into the program.

Log Management & Cleanup. Filter production and downtime logs by date, station, resin or operator, review, and delete with the work-order re-sync handled automatically.

Work orders

Off unless a plant turns it on, and the operator terminal in Part One is complete without it. This page is what becomes available if somebody wants work dispatched to stations and tracked against a target.

A manager creates a work order against a reactor, resin, container format and lot. Hourly logs submitted at that station are matched to it automatically, and the lot check gains something to compare against instead of only recording what was read.

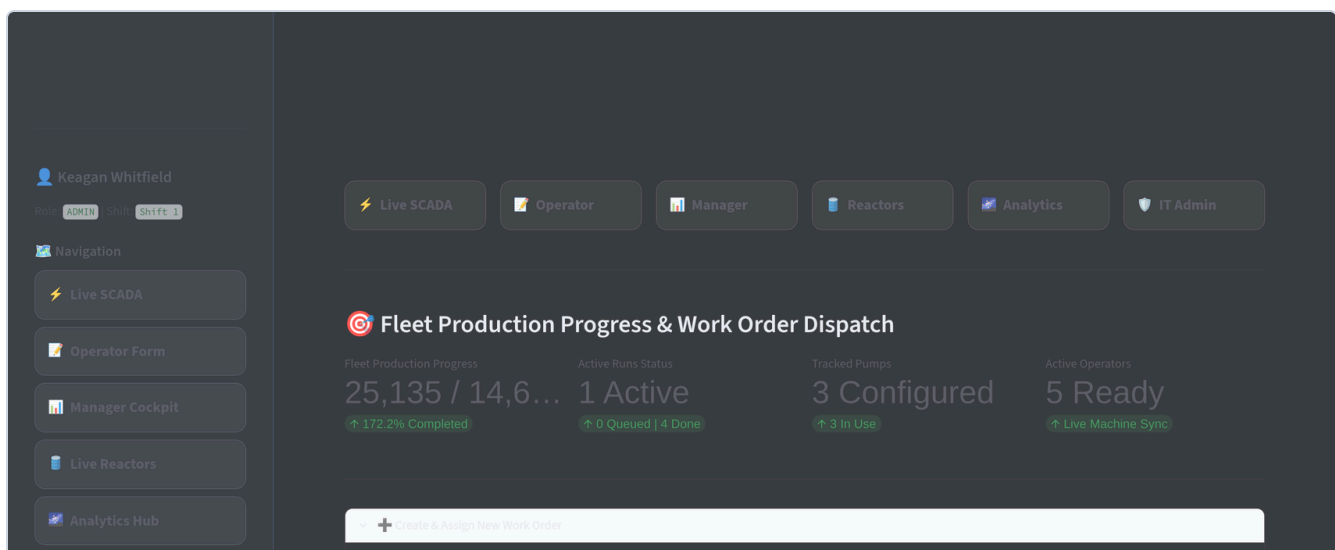

Work Orders & Assigned Runs. Fleet-wide progress across active runs, with status, assigned operator, pump station and lot. Completed orders move to a separate history tab.

DISPATCH

Create and assign

Reactor, size, resin, container format, target units, station and lot number, dispatched to a station rather than to one named person.

COUNTING

Progress from logs

A run's count is recomputed from the production logs that match it, so deleting a bad entry re-syncs the order instead of leaving it overstated.

SHARED STATIONS

Several operators, one run

Progress follows the pump station, so any number of operators can work the same run without a duplicate assignment being created for each.

CLOSEOUT

Finish on the real number

A run can be completed on a custom final total when the physical count differs, and the reactor it drew from is released.

Fill weight and giveaway

The system has always known what every cartridge is supposed to weigh. Until now it never recorded what one actually weighed, so it could say how many units were poured but not how much resin went into them.

16

resin specifications, each with its own target and tolerance window

1

optional reading an hour — never mandatory, never pre-filled

4 kg

given away per thousand cartridges by a pump running 4 g heavy

Why a passing check is not the same as a right weight

A pump set up to stay safely clear of the low limit sits *above* target on every cartridge it fills. Every one of those passes. Every one carries resin the customer did not pay for. On a 1110 g target each gram over is about 0.09% of the fill — small on one cartridge, and 4 kg per thousand at four grams heavy. Four of the sixteen specifications make it worse by being lopsided: **Grey V5** and **Clear V5** allow 10 g under target and only 5 g over, so the safe place to sit is nearer the ceiling. The giveaway does not depend on that, though — it happens on a symmetric window too. It was invisible because the target was displayed and never compared against anything.



3. Production Output

 Good Units / Containers Filled

- +

 Scrap Empty

- +

 Scrap Filled

- +

 Check weight (g) — optional
 ?

✖ - +

 In band — 4.0 g over target.

Process Observations / Notes

e.g. Target fill weight nominal...

One box on the hourly form. The reading is judged against that resin's own window as it is typed. Here 1114 g on a 1110 g target is inside spec and four grams heavy — a cartridge that passes and still gives resin away.

OPTIONAL BY DESIGN

It can never block a log


The lot gate stops the line because a wrong lot is a defect. A heavy cartridge is information. Make a weight mandatory and within a week it is the target typed from memory on every log — and a column full of **1110** is worse than an empty one, because it looks like data. Sparse and honest beats dense and invented.

NEVER PRE-FILLED

The box starts empty

For the same reason the run card had to stop printing the lot the check was hiding: a field that already contains the right-looking answer gets accepted, not measured.

What the readings add up to

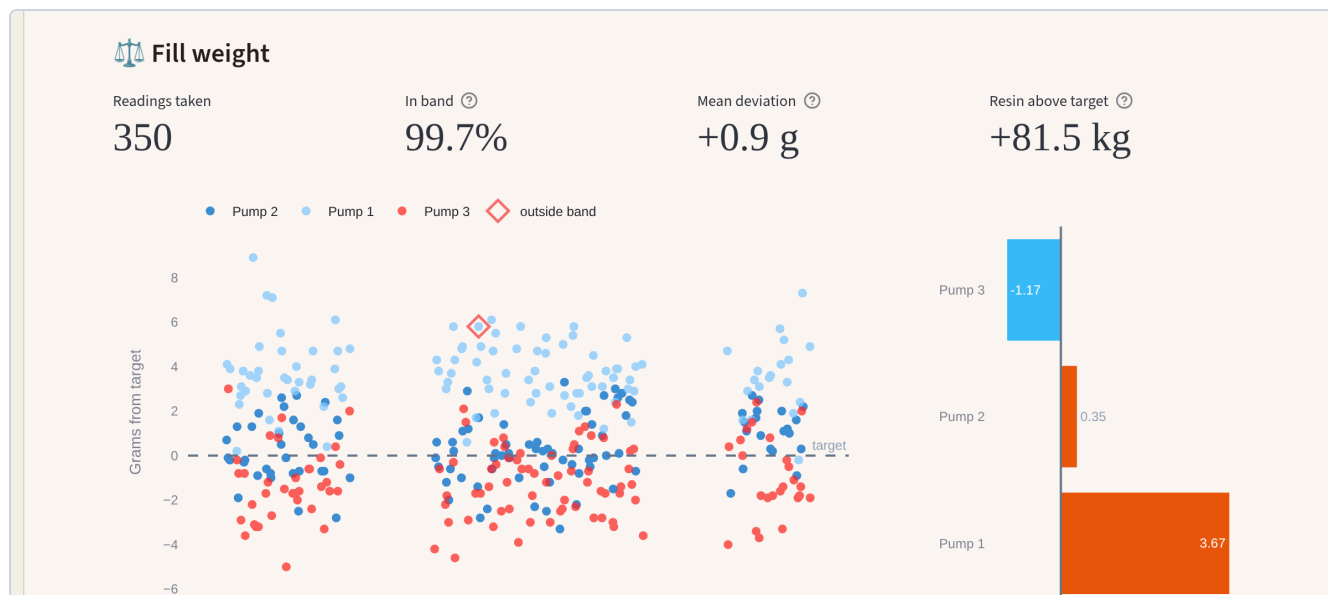

Fill weight, across a fortnight of pouring. Deviation from target rather than absolute grams, so resins with different targets can share an axis; zero is target and out-of-band readings carry their own marker. On the right, mean deviation per pump — one running heavy, one light, one close to nominal. That is the whole argument in one chart: every point above the dashed line passed its check.

ONE READING, NOT THREE

Between hours, not within a minute

Three cartridges weighed in the same minute mostly measure the scale. The variation worth catching is hour to hour, so one reading stands as a sample of its hour — and each is weighted by the units logged beside it, which is what turns “four grams heavy” into kilograms.

JUDGED ONCE

The verdict is stored, not recalculated

A reading is compared against the window in force when it was taken, and that verdict is kept. Editing a specification later changes what happens next; it cannot retrospectively re-judge readings somebody already took.


ONE NUMBER THAT HAS TO STAY HONEST

The headline share of readings inside their window never rounds a near-miss up to a clean 100%. 349 of 350 is 99.7%, and printing that as 100% directly above a chart in which the one exception is plainly visible costs the reader's trust in every other figure on the page — and that one exception is the reason to look.


WHERE THIS LEADS

The machine-integration gateway described in Appendix D already carries a serial adapter written for exactly these bench scales. If they have a serial output the weight arrives with no operator effort at all — and these manual readings are what that automated capture would have to be validated against, since checking it needs known-good numbers to check against.

Reactors and the floor display

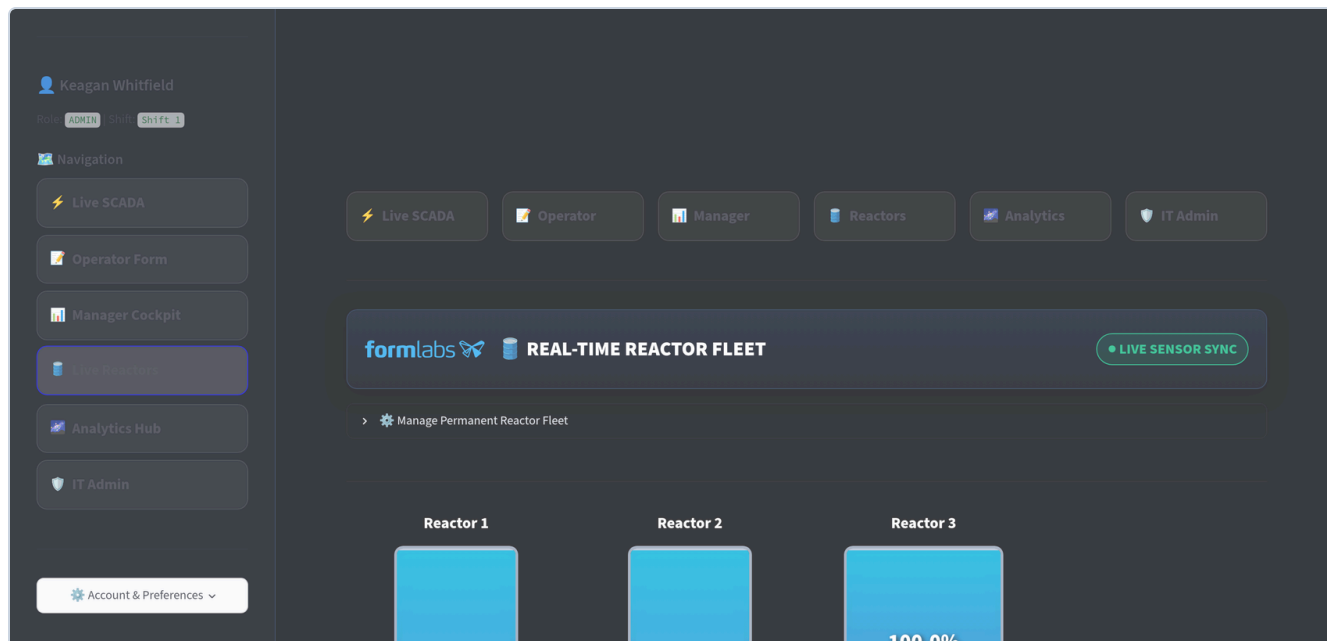

Live Reactor Fleet. Each vessel's current resin, assigned pump and remaining volume, with reconciliation by visual fill percentage or measured litres when the calculated figure has drifted from what is in the tank.

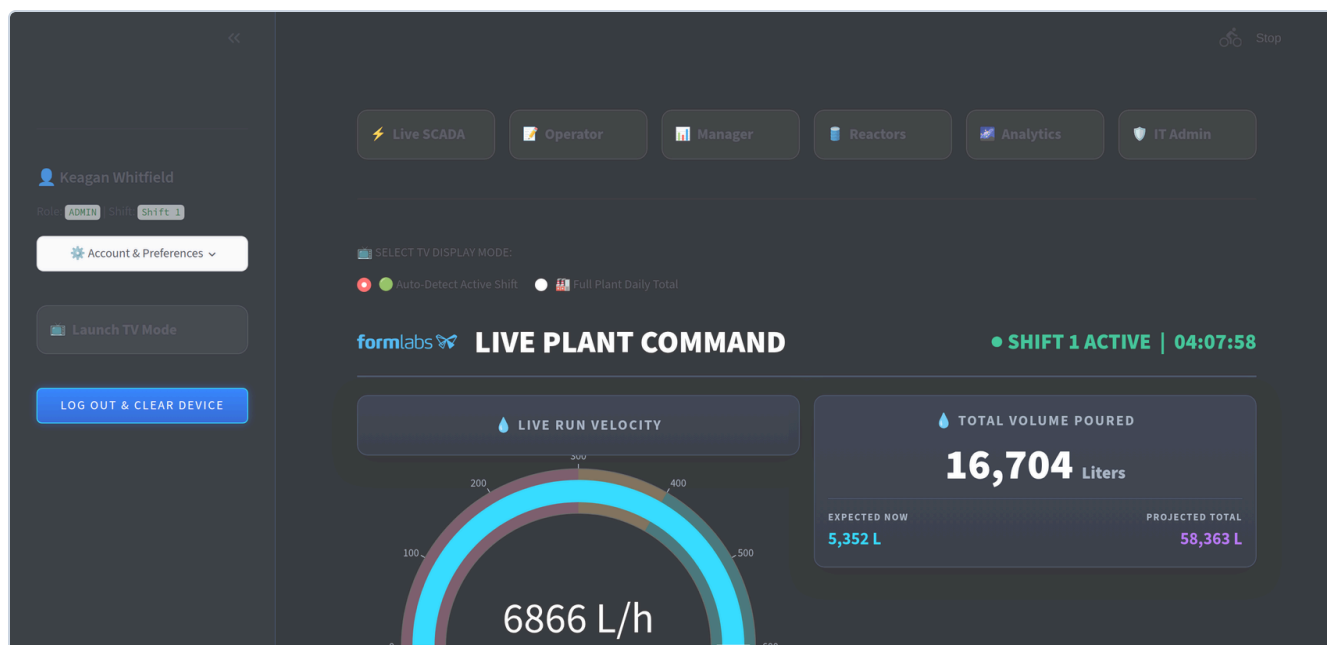

Floor display mode. A full-screen, self-refreshing view that auto-detects the active shift or shows the full plant day, so the team can see its own pace without opening anything.

Your shift, start to finish

Operator

Pours resin at a pump station

Manager

Dispatches and reviews

Admin

Runs the system

1 Sign in on your phone

Operators work from their own handsets rather than a shared station terminal. Open the plant address in your browser and sign in with your operator ID and PIN, then add it to your home screen so it is one tap next hour. Tick *Remember this device* — on a phone only you carry that is the right answer, and it means you are not typing a PIN every time you log an hour. Five wrong PINs locks the account for fifteen minutes — ask your lead for a reset rather than guessing.

2 Clear the startup checklist for your pump

The terminal stays locked until you do. Pick the pump you are starting at, submit the start-of-shift cleanliness photo for that station, then confirm the QC checksheet and that your empties and receiving carts are staged. **Moved to a different pump later? The checklist comes back for that pump** — it certifies the station you are standing at.

The screenshot shows a mobile app interface with a dark theme. On the left, there is a blue button labeled 'LOG OUT & CLEAR DEVICE'. The main area has a red banner at the top that says 'TERMINAL LOCKED: PRE-SHIFT VALIDATION REQUIRED'. Below this, a message reads: 'Welcome, Ana Ruiz. Complete the startup checklist for New Pump #1 on Shift 1 before the production modules unlock.' There is a question 'Which pump station are you starting at?' followed by a dropdown menu showing 'New Pump #1'. Below that is a section titled 'Daily Startup Checklist' with a clipboard icon, and a step indicator showing 'Step 1: Perform & Submit Morning Cleanliness Check'.

Terminal locked. Choose your pump here; the answer carries through to your logging tab, so you pick your station once.

3 Check the run, if your plant assigns them

Work orders are optional and off unless the plant turns them on. Where they are in use, a run assigned to your station appears at the top with reactor, container format and live progress, and if nothing is listed you can mention it to your lead afterwards — your units are recorded either way. Where they are not in use the screen never mentions runs, and there is nothing here to check.

IF YOU ARE LOCKED OUT

Five attempts, fifteen minutes

The lock releases on its own, but a manager can reset your PIN from the floor roster immediately.

YOUR OWN PHONE

Nobody else logs under your name

Because it is your handset you can stay signed in between shifts — there is no next operator picking it up. What matters instead is that every log is attached to whoever is signed in, so do not hand your phone to someone else to log their hour. If you lose it, tell your lead and have your PIN reset.


Logging an hour of pouring

4 Set your station and material

Pump station, container format (V2, V1, RPS bulk jug or Pigment) and resin formulation. The target fill weight and tolerance for that resin appear underneath — check it against your scale.

5 Verify the lot

Turn the container over and read the **L-** code from the lot label on its bottom — the same label on a cartridge and on a jug. The lot the run expects is hidden on purpose — **read the container, not the screen**. Spacing, case and the prefix do not matter.

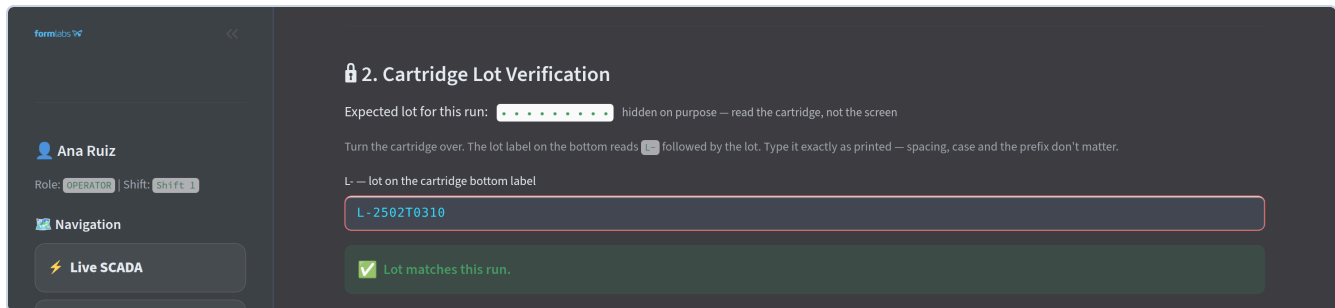

A clean check. Green means the cartridge belongs to this run. On the next log at the same station with nothing changed, this becomes a single confirmation tap — returning to the full check on any change of run, lot, resin or station, after four hours, and on every tenth log.

6 If it does not match, stop

A red **STOP — DO NOT POUR** means the cartridge is not from your run's lot. Set it aside, tell your lead, and press *Wrong cartridge — pulled it, nothing poured*. That records the catch. If your lead decides the pour goes ahead, choose the reason, add the detail and photograph the lot label — the log saves with the flag attached.

7 Enter your counts and submit

Good units filled, plus scrap empty and scrap filled kept separate — they mean different things to quality. Add anything worth noting, then submit. Your totals and the run's progress both move immediately, and the screen says plainly whether the entry reached the database — if it did not, nothing was recorded, so submit again rather than wondering.

8 Weigh one if you have the scale to hand

Optional, every time. One cartridge, one number, in the *Check weight* box; it says straight away whether that cartridge is inside its window and how far off target. Leaving it blank never blocks anything — a blank is honest, a guess is worse than nothing.

9 Typed the wrong number? Take it back

Two minutes to undo your own most recent log — a 2500 that should have been 250 no longer needs a manager. Your latest entry only, and never a flagged one.

The rest of your terminal

WHEN THE LINE STOPS

Log the downtime

Reason, minutes, and anything useful. Log it as it happens rather than reconstructing it later: downtime you do not record shows up as poor yield instead of a machine problem, and the ranking management uses to prioritise fixes is built from these entries.

CHANGEOVERS AND SPILLS

Photo audits

Start of shift, end of shift, moving a line onto a different resin, or a spill. These are the record that a changeover was done cleanly.

QUESTIONS

Manager comms

A direct thread with the plant lead inside the terminal, so the answer stays attached to your account rather than living in a text message.

YOUR NUMBERS

Today's performance

Units poured, scrap and quality yield at the top of your screen, updating as you log.

THE PUMP FORM

A button, not a walk to the sticker

If a pump form has been configured, a button at the top of the terminal opens it in a second tab. The MES stays open behind it, so you finish the form, close it, and are back mid-log with nothing retyped — which scanning the QR sticker cannot do, because that navigates away from the MES.

WORTH KNOWING

Your logs are attached to you, and nobody can quietly overwrite one.

Every container format is checked, RPS jugs included. Jugs carry the same lot label in the same place, so it is the same job — turn it over, read the code. The screen says jug or cartridge to match the container format you picked.

Nothing you submit is silently discarded. If a log cannot be matched to an active run you are told on screen, rather than finding out later that a progress bar never moved.


THE ONE RULE

Log it when it happens. An hour reconstructed at the end of a shift is a guess, and every pace figure, yield number and downtime decision downstream is built on what you enter.

Dispatching the day

This page applies only where work orders are switched on. Where they are not, a manager enters nothing at all — the next page, reading the floor and closing the day, is the whole of the role.

Operator Pours resin at a pump station	Manager Dispatches and reviews	Admin Runs the system
--	--	---------------------------------

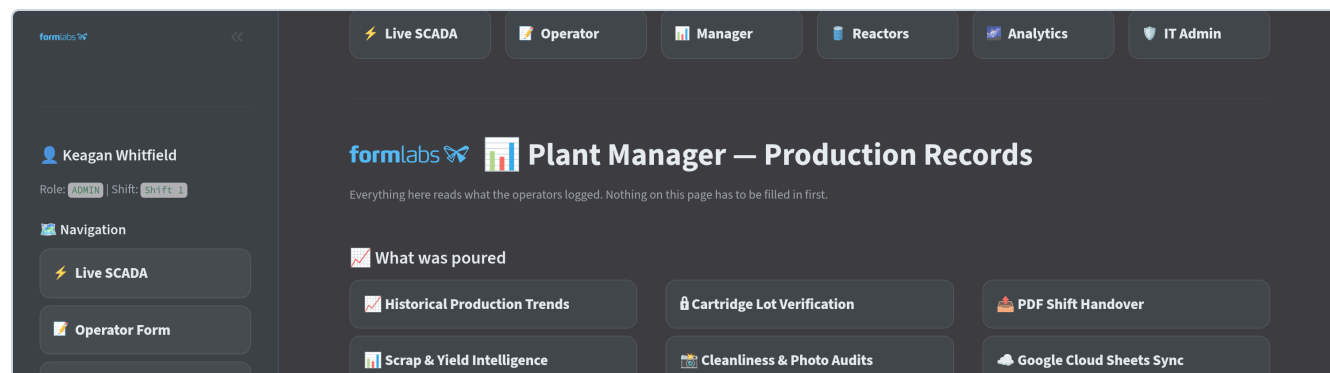

Manager Cockpit. Each management module on its own screen rather than one page trying to do everything.

- Create the work orders**
 Reactor and size, resin, container format, target units, pump station and lot number. Assign an operator for accountability, but note progress follows the *station* — anyone working that pump contributes to the same run.
- Enter the lot exactly as printed**
 The most important field on the form: it is what the operator's cartridge check is compared against. Enter the number as printed after **L-** on the base. Spacing, case and the prefix are normalised, but a wrong number cannot be.
- Watch the fleet, not the logs**
 The work order page rolls up fleet progress, active and queued counts, tracked pumps and operators ready. Drill into a run only when its progress stalls.

IF A PROGRESS BAR IS NOT MOVING

Almost always one of three things: the operator's station does not match the run's, the resin or container format differs, or the lot on the run does not match what is staged. The verification review shows which.

Reading the floor, closing the day

DAILY

Flagged lot checks

Mismatches poured anyway and cartridges pulled, each with the photograph, both lot numbers and the operator's reason. A mismatch that is really a formatting difference means the run's lot needs correcting, not the operator.

DAILY

Scrap and downtime

Yield against target, the empty-versus-filled split, and downtime by reason. Empty scrap is a handling problem; filled scrap is lost resin and considerably more expensive.

WEEKLY

Verification coverage

Full checks versus confirmation taps per operator. A station showing almost no full checks is one taking the fast path every hour.

WEEKLY

Trends

Output trend, share by resin, and per-operator history. The historical page covers anything beyond the current fortnight.

4

Close out finished runs

Complete a run on its real final count when the physical number differs. The correction is booked as a labelled system adjustment and the reactor is released.

5

Send the handover

Generate the PDF and dispatch it to the recipient list. Use the print-friendly layout for anything read on paper or forwarded outside the plant.

6

Answer the floor

The communications page holds every operator's thread. A question left unanswered there gets solved badly on the floor instead.

Keeping it running

Operator Pours resin at a pump station	Manager Dispatches and reviews	Admin Runs the system
--	--	---------------------------------

In a plant running this as a logging system this page is the **manager's** job, not a separate person's — there is no separate IT role to hold it. The work is the same either way; only who does it changes.

ON JOINING

Provision the account

Create the user with the correct role and shift before their first shift. Role decides which screens exist for them; shift decides which checklist and pace target apply.

ON LEAVING

Remove access, keep history

Deleting a user removes access. Production history stays attached through the foreign key on every log.

WEEKLY

Verify a backup

Take a snapshot and confirm it lands. A backup that has never been restored is a hypothesis; the restore path is on the same page.

PER RELEASE

Let migrations run

Schema changes apply on start-up. After deploying, start the app once and confirm it comes up before the shift arrives.

SEASONALLY

Review plant parameters

Shift times, lengths, break minutes, rate and yield targets. Every pace indicator and yield judgement is measured against these.

MONTHLY

Clear the suggestions inbox

Staff file requests, bugs and floor issues from inside the app. An inbox nobody empties is one nobody writes to.

NOT THIS

Do not edit production rows directly in the database to fix a number. Use log management to remove the bad entry — it re-syncs the affected work order — or a reconciliation to book a variance. Both leave a visible record; a direct edit leaves the totals right and the story wrong.

Readability where the work happens

A phone held in a gloved hand at arm's length, in a room lit for pouring resin, is a different reading problem from an office monitor. These are the settings that address it. All of them are per-user and remembered; none of them changes what is recorded.

GLOVES

Glove mode

Nitrile still registers on a touchscreen, but precision drops, and the pouring form asks for number steppers and a lot field. One toggle pushes every target past the accessibility touch size and scales the type. It is remembered against the *terminal*, not the account — being gloved is a property of where you are standing, not of who you are.

LIGHTING

Light and dark

A dark screen is unreadable under bright shop lighting and a light one is glare on a wall display at night, so both exist and the operator picks. The choice follows the account, so a shared terminal does not undo it.

CONTRAST

Measured, not assumed

Text is checked against the accessibility floor of 4.5:1 rather than eyeballed. The check found real failures in themes already in use — card labels in the default, and again across the sidebar, widget labels and popovers, where the worst measured 1.01:1. All fixed, and an audit screen re-runs the measurement on demand, so it is something you can see rather than something that was checked once.


NIGHTS

Automatic dimming

Derived from the plant's own configured shift times rather than a fixed hour, because “night” here means “not the day shift”. A gentle brightness and warmth reduction rather than a different set of colours. Photographs are exempt, so a lot label under review keeps its true colour.

Resin colour, and why colour alone was not enough

Wherever a resin is named it carries the colour from the plant's own master sheet, so screen and sheet read as one document; a new formulation takes its family's colour from its name. But five pairs in that palette are the same colour to the eye, and a Clear/Rigid mix-up is exactly what the lot check exists to catch — so each chip also carries a **texture** from the resin family: Clear V4 and Clear V4.1 match, Clear and Rigid cannot. Texture survives greyscale printing and colour blindness, which a colour alone does not.

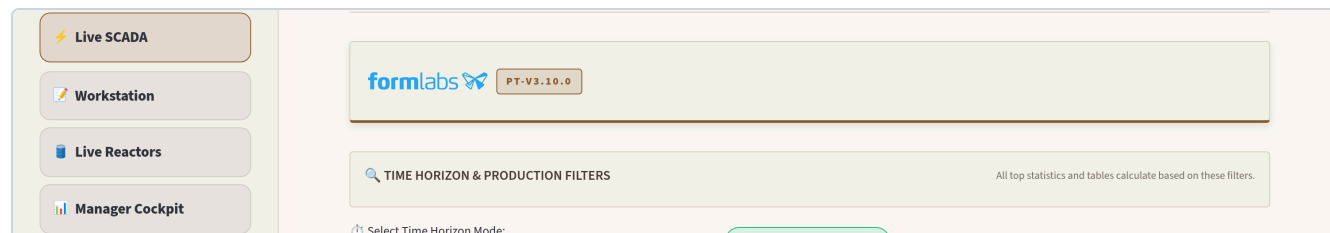

The same screen, light. Themes change presentation only — every figure, filter and control is identical, so a handbook page describes one screen regardless of how the reader has theirs set.

How it is tested

Before a release the system is exercised end to end against a throwaway database built from nothing each time. It refuses to run against the production connection.

895

assertions across nine suites — workflow, interface, roles, colour, fill weight, shifts, links, boot paths

45

checks driving a real browser through an operator's shift, on a desktop and a phone

19

screens rendered and checked for errors on every pass

What the simulation covers

All nine migrations are applied to an empty database and the result compared table by table against the application's own model definitions. A manager then creates three work orders; operators clear per-station checklists and pour — clean logs, a fast-path log, a mismatched cartridge, a cartridge pulled before pouring, a log with no run behind it, and a gated RPS jug — alongside downtime. Every figure the interface displays is then recomputed from the raw rows and compared against hand-figured expectations: poured, scrap, yield, per-operator totals, run progress, flag rate and variance.

What that has caught

- **The run card was printing the lot the check was hiding.** An operator could have read the expected lot off the screen instead of the cartridge, which would have made the whole check decorative. Found because the interface test asserts the lot appears nowhere on the page.
- **Plant settings could never be saved.** The Admin Panel's save button passed a dictionary to a function expecting fifteen positional arguments, so shift times, rate targets and yield targets had never been changeable from the interface.
- **A content-delivery fetch could take the terminal down.** An unguarded network call for a decorative animation ran on every interaction; a floor PC that lost its internet would have hung the terminal before a control rendered.
- **Eight pages failed on a theme change,** and log cleanup crashed whenever a filter matched fewer than ten records — both long-standing.
- **A setting that saved and was never read back.** The number of shifts had a column, a migration, an admin field and a working save path — and the function every screen reads settings through never returned it, so all of them silently used the default. It happened to be the right answer for this plant, which is why nobody noticed.
- **Every light theme rendered its stylesheet as visible text.** Found in a browser after the tests had passed: an indented style block appended after other content is treated as a code listing and displayed rather than applied. The twenty-four older themes were never bitten because theirs comes first.

CLOSED SINCE THE LAST ISSUE

The page sweep renders every screen but did not submit forms, which is how the settings save stayed broken. The interface suite now drives the real pouring form through submission — including the two rules that matter most about the check weight, that it never blocks a log and is never pre-filled — and a screenshot comparison catches a card that lost its border or a chart that came back empty, neither of which raises an error.

Experiments, not commitments

Two things exist in the codebase that are **not in use and not decided on**. They are described here so the capability is known, not because there is a plan attached to either. Both were built to find out whether the approach works.

Pack-out logging

A packing role, a pack-out logging tab, and skid conversion using each resin's units-per-skid figure. Poured and packed totals are counted separately, and the gap between them reports as floor work-in-progress. A reconciliation flow books the variance between what was poured for a lot and the final packed count as a single labelled system adjustment.

It is switched off. Turning it on is a single plant setting, but nobody has decided whether pack-out should be logged this way, and the workflow has not been tested against how the line actually runs.

Machine integration

A protocol-agnostic gateway for reading floor equipment directly, so counts and weights would not have to be typed. Each machine is a row in a registry and the polling logic sits behind one shared interface, with adapters written for Modbus TCP, Modbus RTU, OPC-UA, MQTT, Serial ASCII and HTTP. Readings would write through the same logging path the operator screen uses, so analytics and run tracking would need no changes. A registry screen for it is written — add a machine, point it at the pump station it sits on, map its raw tags — and is deliberately not linked from anywhere in the application, so it cannot be reached by an administrator who has not been told it is there.

None of it has been tested against real equipment.

The adapters were written to cover whatever the scales or pump controllers turn out to speak; which of them is correct is unknown until someone connects one. Until then the screen stays unlinked rather than deleted, so nothing is lost if the plant ever wants it.

The screenshot displays a web application interface for 'formulas'. On the left, a sidebar shows the user 'Keagan Whitfield' with role 'ADMIN' and shift 'DAY 1'. Navigation buttons include 'Live SCADA' and 'Workstation'. The main content area is titled '1. Packing Details' and contains a form with the following elements: a 'Location' dropdown set to 'End-of-Line / Pack-Out', a 'Container Format' dropdown set to 'V2 (1L Cartridge)', a 'Resin Formulation' dropdown set to 'Bioresin XZ9', and a button labeled 'Biorein XZ9'. At the bottom of the form, it says 'Batch Lot Number Being Packed'.

Pack-out logging, currently disabled. Container format, resin, lot and units packed, with the skid equivalent calculated as the count is typed.

READ THIS AS

Neither of these is a roadmap item or a commitment of dates. They are experiments that happen to be finished enough to demonstrate, and either could be abandoned without affecting anything in service.