# Detection of Bare PCB Defects by Image Subtraction Method using Machine Vision

| Article      | July 2011  |                |  |  |
|--------------|--|----------------|--|--|
| CITATIONS 31 | 5  | READS<br>3,628 |  |  |
| 3 author     | rs, including:   |                |  |  |
|              | Sharat Chandra Bhardwaj Grphic Era University, Dehradun 14 PUBLICATIONS 58 CITATIONS SEE PROFILE |                |  |  |
| Some of      | f the authors of this publication are also working on these related projects:                    |                |  |  |
| Project      | Inspection of surface mounted components View project  |                |  |  |
| Project      | Troposcatter Communication View project  |                |  |  |

# Detection of Bare PCB Defects by Image Subtraction Method using Machine Vision

Ajay Pal Singh Chauhan, Sharat Chandra Bhardwaj

Abstract— A Printed Circuit Board (PCB) consists of circuit with electronic components mounted on surface. There are three main steps involved in manufacturing process, where the inspection of PCB is necessary to reduce the defects. First step is printing, second step is the components fabrication over the PCB surface and third is the components soldering. In this paper Machine Vision PCB Inspection System is applied at the first step of manufacturing, i.e., the making of bare PCB. We first compare a standard PCB image with a PCB image to be inspected, using a simple subtraction algorithm that can detect the defected regions. Our focus is to detect defects on printed circuit boards. Typical defects that can be detected are over etchings (opens), under-etchings (shorts), holes etc.

Index Terms— Machine vision, PCB defects, Image subtraction, PCB inspection, Particle analysis

### I. INTRODUCTION

NOWADAYS Machine Vision inspection process [1], [2] is necessary to improve the quality of PCB. In manufacturing industry there are defects, misalignment, and orientation error so automated inspection [3], [4] is required. The defects can be analyzed by machine vision using algorithms developed for it. So machine vision provides a measurement technique for regularity and accuracy in the inspection process.

These systems have advantage over human inspection in which subjectivity, fatigue, slowness and high cost is involved. In recent years, the PCB industries require automation due to many reasons. The most important one is the technological advances in PCB's design and manufacturing. New electronic component fabrication technologies require efficient PCB design and inspection method with compact dimension [5]. The complex and compact design causes difficulties to human inspection process. Another important factor is necessity to reduce the inspection duration. These factors lead to automation in PCB industry. Nowadays automated systems are preferred in manufacturing industry for higher productivity.

#### II. MATERIAL AND METHODS

#### A. Machine vision

Machine vision is the science and technology of machines that "See". It is the science in which a computer is programmed to process and understand images and video [2]. It can be assumed as signal processing applied to images, videos. Machine vision is concerned with the theory behind artificial systems that extract information from

Ajay Pal Singh Chauhan is with Electronics and Communication Engineering Department, Sant Longowal Institute of Engineering and Technology, Longowal, Punjab, India, Phone: +91-94171-06644, e-mail: ajaypal\_singh@yahoo.com

Sharat Chandra Bhardwaj is with Electronics and Communication Engineering Department, Sant Longowal Institute of Engineering and Technology, Longowal, Punjab, India, e-mail: bhardwaj.sharat@gmail.com

images and sequence of images. The image data can take many forms, such as video sequences, views from multiple cameras, or multi-dimensional data from a medical scanner.

On a technical ground, it is necessary to implement the proposed theory and method to construct a machine vision system. Machine vision can be implemented for the system involving following processes.

- Automated Inspection process
- Process control
- Data base collection and indexing
- Modeling of system and environment

#### B. Bare PCB Defects

During the manufacturing there are some defects commonly found on PCB. These defects are divided into two categories, potential and fatal defects. Short-circuit and open-circuit defects are in fatal defects category. Breakout, under etch, missing hole, and wrong size hole fall in potential defects category [6], [7], [8]. Fatal defects are those in which the PCB does not meet the objective for which it is designed, while the potential defects are those which compromise the PCB performance during utilization. During etching process, the anomalies occurring on bare PCB could be largely classified in two categories: the one is excessive copper and missing copper. The incomplete etching process leaves unwanted conductive materials and forms defects like short-circuit, extra hole, protrusion, island, and small space. Excessive etching leads to opencircuit and thin pattern on PCB [7], [8]. In addition, some other defects may exist on bare PCB, i.e. missing holes, scratch, and cracks.

There are many ways to designate PCB errors as shown in Table I.

TABLE I PCR FRRORS CLASSIFICATION

| PCB ERRORS CLASSIFICATION |  |                            |  |  |  |  |
|---------------------------|--|----------------------------|--|--|--|--|
| FATAL                     | 1 Breaks                               | 1.1 Fracture               |  |  |  |  |
|                           |  | 1.2 Cut                    |  |  |  |  |
|                           |  | 1.3 Scratches              |  |  |  |  |
|                           |  | 1.4 Cracks                 |  |  |  |  |
|                           | 2 Shorts/bridges                       |                            |  |  |  |  |
|                           | 3 Missing conductor                    |                            |  |  |  |  |
|                           | 4 Incorrect hole dimension             |                            |  |  |  |  |
|                           | 5 Missing hole                         |                            |  |  |  |  |
| POTENTIAL                 | 6 Partial Open                         | 6.1 Mouse bit              |  |  |  |  |
|                           |  | 6.2 Nicks                  |  |  |  |  |
|                           |  | 6.3 Pinholes               |  |  |  |  |
|                           | 7 Excessive spurious                   | 7.1 Specks                 |  |  |  |  |
|                           |  | 7.2 Spurs/protrusions      |  |  |  |  |
|                           |  | 7.3 Smears                 |  |  |  |  |
|                           | 8 Pad violations                       | 8.1 Under etching          |  |  |  |  |
|                           |  | 8.2 Over etching           |  |  |  |  |
|                           |  | 8.3 Breakout               |  |  |  |  |
|                           | 9 Variations between the printed lines | 9.1 Small thickness wiring |  |  |  |  |
|                           |  | 9.2 Large conductors       |  |  |  |  |
|                           |  | 9.3 Excessive conductors   |  |  |  |  |
|                           |  | 9.4 Incipient short        |  |  |  |  |
|                           |  | (conductor too close)      |  |  |  |  |

ISBN: 978-988-19251-4-5 WCE 2011

ISSN: 2078-0958 (Print); ISSN: 2078-0966 (Online)

Proceedings of the World Congress on Engineering 2011 Vol II WCE 2011, July 6 - 8, 2011, London, U.K.

Fig. 1 (a) and (b) show the examples of reference PCB image and defective image. Each defect shown in Fig.1 (b) is a representative example of certain defects as listed in Table I, though the shape and the size of the defects may vary from one occurrence to another.

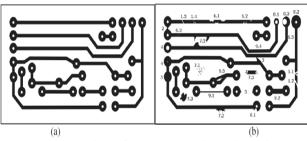


Fig.1 PCB without error (a) PCB with error (b)

#### C. Concepts of logic Operator for Image

An arithmetic or logic operation between images is a pixel-by-pixel transformation. It produces an image in which each pixel derives its value from the value of pixels with the same coordinates in other images [9].

If A and B are the images with a resolution XY, and Op is the operator, then the image N resulting from the combination of A and B through the operator Op (fig.2) is such that each pixel P of the resulting image N is assigned the value pn = (pa)(Op)(pb); where pa is the value of pixel P in

pn = (pa)(Op)(pb); where pa is the value of pixel P in image A, and pb is the value of pixel P in image B.

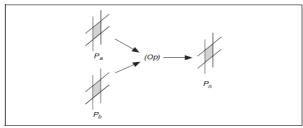


Fig. 2 Operator Concept

# D. Logic and Comparison Operators

Logic operators are bitwise operators listed in Table II. They manipulate gray-level values coded on one byte at the bit level [9]. In the case of images with 8-bit resolution, logic operators are mainly designed to combine gray-level images with mask images composed of pixels equal to 0 or 255 (in binary format 0 is represented as 00000000, and 255 is represented as 11111111), or to combine or compare images with a binary or labeled content (after thresholding the image).

TABLE II LOGICAL OPERATORS

| Logical Operators | Operator Equation    |
|-------------------|----------------------|
| AND               | pn = pa AND pb       |
| NAND              | pn = pa NAND pb      |
| OR                | pn = pa OR pb        |
| NOR               | pn = pa NOR pb       |
| XOR               | pn = pa XOR pb       |
| Logic Difference  | pn = pa AND (NOT pb) |

#### III. IMPLEMENTATION OF METHOD

To implement the image subtraction logic some software tools are required. There are various tools available for implementation. Here NI Vision Assistant is being used as a development tool.

#### A. Vision Assistant 2009

Vision Assistant is a tool for prototyping and testing image processing applications. Build custom algorithms with the Vision Assistant scripting feature [9] are used to prototype an image processing application. The scripting feature records every step of the processing algorithm. After completing the algorithm, we can test it on other images to make sure it works. The algorithm is recorded in a Builder file, which is an ASCII text file that lists the processing functions and relevant parameters for an algorithm that we prototype in Vision Assistant.

## B. Inspection flow chart

The PCB inspection using Image subtraction method [7], [10], [11] is performed in steps. As shown in flow chart (fig. 3) the first step load a reference image, second step buffers the reference image so that it can be used for subtraction operation. The third step loads the image which is going to be inspected. To find the PCB error, inspected image is XORed with reference image; this process is also called Image subtraction.

#### C. Image Subtraction Operation

Image subtraction operation is performed in order to get the differences between two images [3], [4]. The images are the reference image and the inspected image. The method compares both images pixel-by-pixel using XOR logic operator [7], [9], [12]. The resulting image obtained after this operation contains defects (fig.4).

The subtraction operation will produce either negative or positive image, '1' represents white pixel and '0' represents black pixel in a binary image.

Two rules exists for image subtraction operation Rule 1: If 1-0 = 1 then it gives positive pixel image Rule 2: If 0-1 = -1 then it gives negative pixel image



Fig. 3 Inspection flow chart

ISBN: 978-988-19251-4-5 WCE 2011

ISSN: 2078-0958 (Print); ISSN: 2078-0966 (Online)

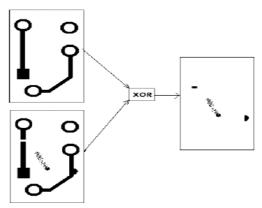


Fig.4 Image subtraction operation

In fig. 5 and 6, corresponding reference and inspected PCB images are shown. These images are converted into grayscale and added into image buffer before subtraction process. The conversion of image into grayscale is needed for obtaining binary image and this image is further processed for measurement purposes.

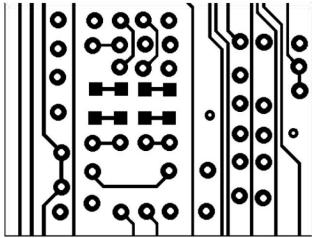


Fig. 5 Reference image

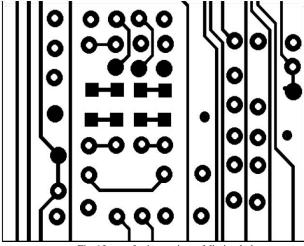


Fig.6 Image for inspection: - Missing holes

For the image subtraction operation it is required that both images has same size in terms of pixels. The logical XOR operation gives defects in inspected image as compared with reference image. Fig.7 shows the resultant image and also some other steps are shown in same image which are required in order to perform image subtraction.

These steps are shown in icon form.

The resultant image is further processed for thresholding as shown in fig. 8 in order to convert the resultant image in binary form. The binary form of image shows the resultant area into '1' and '0' form. The image area which contains information is represented by '1' and rest of portion is considered as'0'.

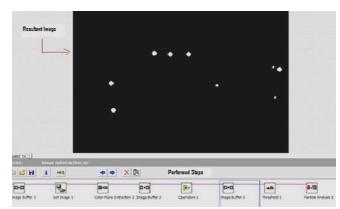


Fig.7 Resultant image after subtraction operation



Fig.8 Resultant image after thresholding

For the measurement purpose 'Particle Analysis' function of the NI Vision Assistant is used [9]. This 'Particle Analysis' is applied on the obtained defected area of PCB and outputs are represented in terms of parameters such as area, orientation, X and Y coordinate etc. All measurements can be done in terms of pixel or system calibrated units. Here pixel is being used as a unit for measurement. In fig.9 the image is shown after 'Particle Analysis' and corresponding measurements are given in table III. The parameters for measurement in table III such as X and Y pixels shows the position of defect in image area, Hydraulic radius shows the size, Area represents the area of defected object, Orientation gives the angular position of defects and last one gives the percentage defected area.



Fig.9 Image after Particle Analysis

ISBN: 978-988-19251-4-5 WCE 2011 ISSN: 2078-0958 (Print); ISSN: 2078-0966 (Online)

TABLE III MEASUREMENT OF DEFECTED ORIECT IN RESULTANT IMAGE

| Obje | First | First | Hydraulic | Area | Orientation | %          |
|------|-------|-------|-----------|------|-------------|------------|
| ct#  | Pixel | Pixel | Radius    |      |             | Area/Image |
|      | X     | Y     |           |      |             | Area       |
| 1    | 237   | 126   | 3.15657   | 140  | 73.23927    | 0.04574    |
| 2    | 284   | 128   | 3.26468   | 141  | 95.19179    | 0.04607    |
| 3    | 338   | 128   | 3.3144    | 147  | 64.26647    | 0.04803    |
| 4    | 588   | 171   | 1.51631   | 40   | 62.10365    | 0.01307    |
| 5    | 606   | 175   | 3.35801   | 145  | 39.82985    | 0.04737    |
| 6    | 110   | 218   | 3.23436   | 144  | 86.26726    | 0.04705    |
| 7    | 422   | 228   | 1.80509   | 41   | 135         | 0.0134     |
| 8    | 593   | 265   | 1.76106   | 40   | 104.297     | 0.01307    |
| 9    | 117   | 301   | 3.22703   | 141  | 84.71497    | 0.04607    |

The above discussed methods namely Image subtraction, Image Thresholding and Image Particle Analysis are repeated for other defects and corresponding figures and measurements are as given below

- 1. Missing Circle (Fig. 10, Fig.11 and Table IV)
- 2. Under Etching (Fig. 12, Fig.13 and Table V)
- Over Etching (Fig. 14, Fig.15 and Table VI)

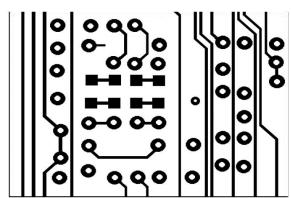


Fig10. Missing circles

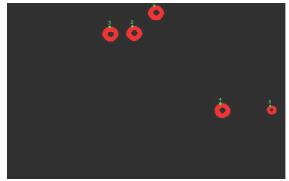


Fig11. Resultant Image of Missing circles after Particle Analysis

#### TABLE IV MEASUREMENT OF MISSING CIRCLES

| Objec | First | First | Hydraulic | Area | Orientation | %         |
|-------|-------|-------|-----------|------|-------------|-----------|
| t#    | Pixel | Pixel | Radius    |      |             | Area/Imag |
|       | X     | Y     |           |      |             | e Area    |
| 1     | 335   | 21    | 7.16103   | 782  | 175.8629    | 0.2555    |
| 2     | 287   | 69    | 7.03816   | 792  | 118.9301    | 0.25876   |
| 3     | 237   | 70    | 7.2236    | 796  | 0.90421     | 0.26007   |
| 4     | 481   | 253   | 7.13164   | 786  | 145.3381    | 0.2568    |
| 5     | 591   | 258   | 4.40511   | 297  | 177.4269    | 0.09704   |

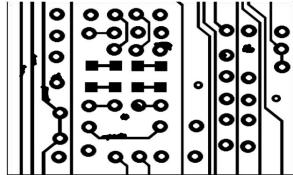


Fig12. Under etching

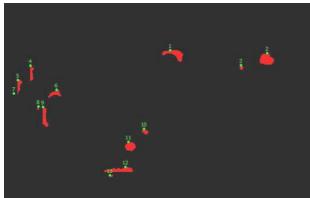


Fig13. Resultant Image of Under etching after Particle Analysis

#### TABLE V MEASUREMENT OF UNDER ETCHING

| Obje<br>ct# | First<br>Pixel<br>X | First<br>Pixel<br>Y | Hydraulic<br>Radius | Area | Orientation | %<br>Area/Im<br>age<br>Area |
|-------------|---------------------|---------------------|---------------------|------|-------------|-----------------------------|
| 1           | 341                 | 112                 | 3.92964             | 454  | 160.9356    | 0.14833                     |
| 2           | 534                 | 118                 | 5.84762             | 519  | 159.1196    | 0.16957                     |
| 3           | 482                 | 144                 | 1.85472             | 52   | 98.70858    | 0.01699                     |
| 4           | 63                  | 145                 | 2.11688             | 156  | 89.92514    | 0.05097                     |
| 5           | 38                  | 176                 | 2.05739             | 147  | 83.21509    | 0.04803                     |
| 6           | 115                 | 197                 | 2.59926             | 189  | 17.64021    | 0.06175                     |
| 7           | 30                  | 205                 | 0.41886             | 3    | 90          | 0.00098                     |
| 8           | 79                  | 233                 | 0.99288             | 18   | 90          | 0.00588                     |
| 9           | 88                  | 234                 | 2.91444             | 281  | 94.98278    | 0.09181                     |
| 10          | 289                 | 281                 | 2.60645             | 95   | 138.103     | 0.03104                     |
| 11          | 258                 | 309                 | 4.66598             | 304  | 5.37413     | 0.09932                     |
| 12          | 252                 | 363                 | 3.17572             | 399  | 2.86564     | 0.13036                     |
| 13          | 221                 | 381                 | 1.17503             | 22   | 0           | 0.00719                     |

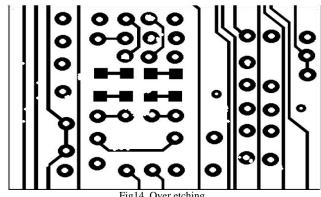


Fig14. Over etching

WCE 2011 ISBN: 978-988-19251-4-5

ISSN: 2078-0958 (Print); ISSN: 2078-0966 (Online)

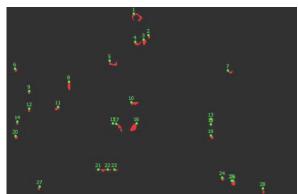


Fig15. Resultant Image of Over etching after Particle Analysis

#### TABLE VI MEASUREMENT OF OVER ETCHING

| Obje | First | First | Hydraulic | Area | Orientation | % Area   |
|------|-------|-------|-----------|------|-------------|----------|
| ct#  | Pixel | Pixel | Radius    |      |             |          |
|      | X     | Y     |           |      |             |          |
| 1    | 282   | 26    | 1.30644   | 116  | 154.1259    | 0.0379   |
| 2    | 313   | 74    | 1.29642   | 26   | 90          | 0.00849  |
| 3    | 303   | 84    | 2.05769   | 69   | 87.4019     | 0.02254  |
| 4    | 285   | 89    | 1.42436   | 57   | 178.7164    | 0.01862  |
| 5    | 231   | 131   | 1.35834   | 77   | 169.4399    | 0.02516  |
| 6    | 31    | 149   | 1.4275    | 29   | 90          | 0.00947  |
| 7    | 481   | 153   | 1.01505   | 31   | 164.3084    | 0.01013  |
| 8    | 145   | 178   | 1.87745   | 81   | 90.09171    | 0.02646  |
| 9    | 61    | 199   | 1.27232   | 22   | 90          | 0.00719  |
| 10   | 277   | 224   | 1.91409   | 72   | 4.92401     | 0.02352  |
| 11   | 122   | 234   | 1.75838   | 49   | 30.88693    | 0.01601  |
| 12   | 61    | 238   | 1.29642   | 26   | 90          | 0.00849  |
| 13   | 445   | 261   | 0.86366   | 21   | 94.44627    | 0.00686  |
| 14   | 36    | 267   | 1.25307   | 24   | 91.22265    | 0.00784  |
| 15   | 238   | 271   | 0.81528   | 8    | 0           | 0.00261  |
| 16   | 288   | 271   | 2.833     | 149  | 55.4278     | 0.04868  |
| 17   | 245   | 272   | 1.33758   | 67   | 122.1898    | 0.02189  |
| 18   | 445   | 273   | 0.76935   | 8    | 90          | 0.00261  |
| 19   | 445   | 298   | 1.69796   | 38   | 105.0594    | 0.01242  |
| 20   | 32    | 299   | 1.66832   | 34   | 90          | 0.01111  |
| 21   | 207   | 374   | 1.07835   | 43   | 177.1994    | 0.01405  |
| 22   | 227   | 374   | 0.92879   | 16   | 176.5585    | 0.00523  |
| 23   | 241   | 374   | 1.17503   | 22   | D           | 0.00719  |
| 24   | 469   | 392   | 1.71757   | 37   | D           | 0.01209  |
| 25   | 489   | 399   | 0.32979   | 2    | 45          | 0.000653 |
| 26   | 492   | 399   | 2.21096   | 69   | 84.64742    | 0.02254  |
| 27   | 83    | 412   | 1.13215   | 23   | 69.76584    | 0.00751  |
| 28   | 555   | 416   | 1.05435   | 30   | 96.11076    | 0.0098   |

#### IV. LIMITATIONS

- 1) Some of the Bare PCB defects such as open circuit, short circuit, incorrect dimensions, missing conductor etc. cannot be detected by this Image Subtraction method.
- Image subtraction method requires same size of 2) reference and inspected PCB image.
- Orientation of inspected image must be the same as the reference image.

#### V. CONCLUSION

The bare PCB is analyzed and the defects of PCB are extracted in terms of various parameters. These parameters can be taken as referential data base for further analysis to fabricate defect free PCB and can assist in making an automated system for inspection. In order to use this method in an industrial application some improvements need to be done. Future work consists of inspecting and analyzing a PCB with Surface Mounted Devices.

#### REFERENCES

- Der-Baau Perng, Chuan-Pei Liu, Yen-Chung Chen, and Cheng-Chuan Chou, Advanced Smd Pcb Vision Inspection Machine Development Department of Industrial Engineering and Management National Chiao-Tung University, 15th IPPR Conference on Computer Vision, Graphics and Image Processing, 2002
- Yi L et al "Machine Vision Algorithms Using Interactive Learning For VFD Inspection," Journal of Applied Intelligence, 2000
   Y. Sun, C Tsai. "A New Model-Based Approach for Industrial Visual
- Inspection", Pattern Recognition, Vol. 25, (1992), pp. 1327-1336.
- [4] W. Wu, M. Wang and C. Liu, Automated inspection of printed circuit boards through machine vision, Computers in Industry 28, pp103-111, 1996.
- [5] Fabiana R. Leta, Computer Vision System For Printed Circuit Board Inspection, Universidade Federal Fluminense Programa de Pós-Graduação em Engenharia Mecânica, ABCM Symposium Series in Mechatronics - Vol. 3 - pp.623-632, 2008
- Ismail Ibrahim, Zuwairie Ibrahim, Mohamad Shukri Zainal Abidin, Musa Mohd Mokji, Syed Abdul Rahman Syed Abu Bakar, and Shahdan Sudin An Algorithm For Classification Of Six Types Of Defect On Bare Printed Circuit Board, Faculty of Electrical Engineering, Universiti Teknologi Malaysia 81310 UTM Skudai, Johor, Malaysia, TUBITAK-MISAG-65,1995
- K. Sundaraj, PCB Inspection for Missing or Misaligned Components using Background Subtraction, University Malaysia Perlis School of Mechatronic Engineering 02600 Jejawi - Perlis MALAYSIA kenneth@unimap.edu.my Issue 5, Volume 6, May 2009
- [8] Zuwairie Ibrahim and Syed Abdul Rahman Al-Attas, Wavelet-Based Printed Circuit Board Inspection System, International Journal of Information and Communication Engineering 1:2 2005
- [9] Vision assistant concept manual, NI Instruments.
- [10] S. Yamada, M. Iwahara, Y. Fukuda, T. Tanigichi, and H. Wakiwaka, "Inspection of Bare Printed Circuit Board Using Planar Type ECT probe," Review of Quantitative Nondestructive Evaluation, Vol. 23, pp. 374-381, 2004.
- [11] Moganti, M., Ercal, F., Dagli, C. H. and Shou, Tsunekawa, "Automatic PCB Inspection Algorithms: A Survey", Computer Vision and Image Understanding, Vol. 63, No.2, (1996), pp. 287-313.
  [12] Z. Ibrahim, S.A.R. Al-Attas, and Z. Aspar, "Model-based PCB
- inspection technique using wavelet transform", Proceedings of the 4th Asian Control Conference, Singapore, 2002. pp. 2026 – 2029.

ISBN: 978-988-19251-4-5 ISSN: 2078-0958 (Print); ISSN: 2078-0966 (Online)