

List of Components Required

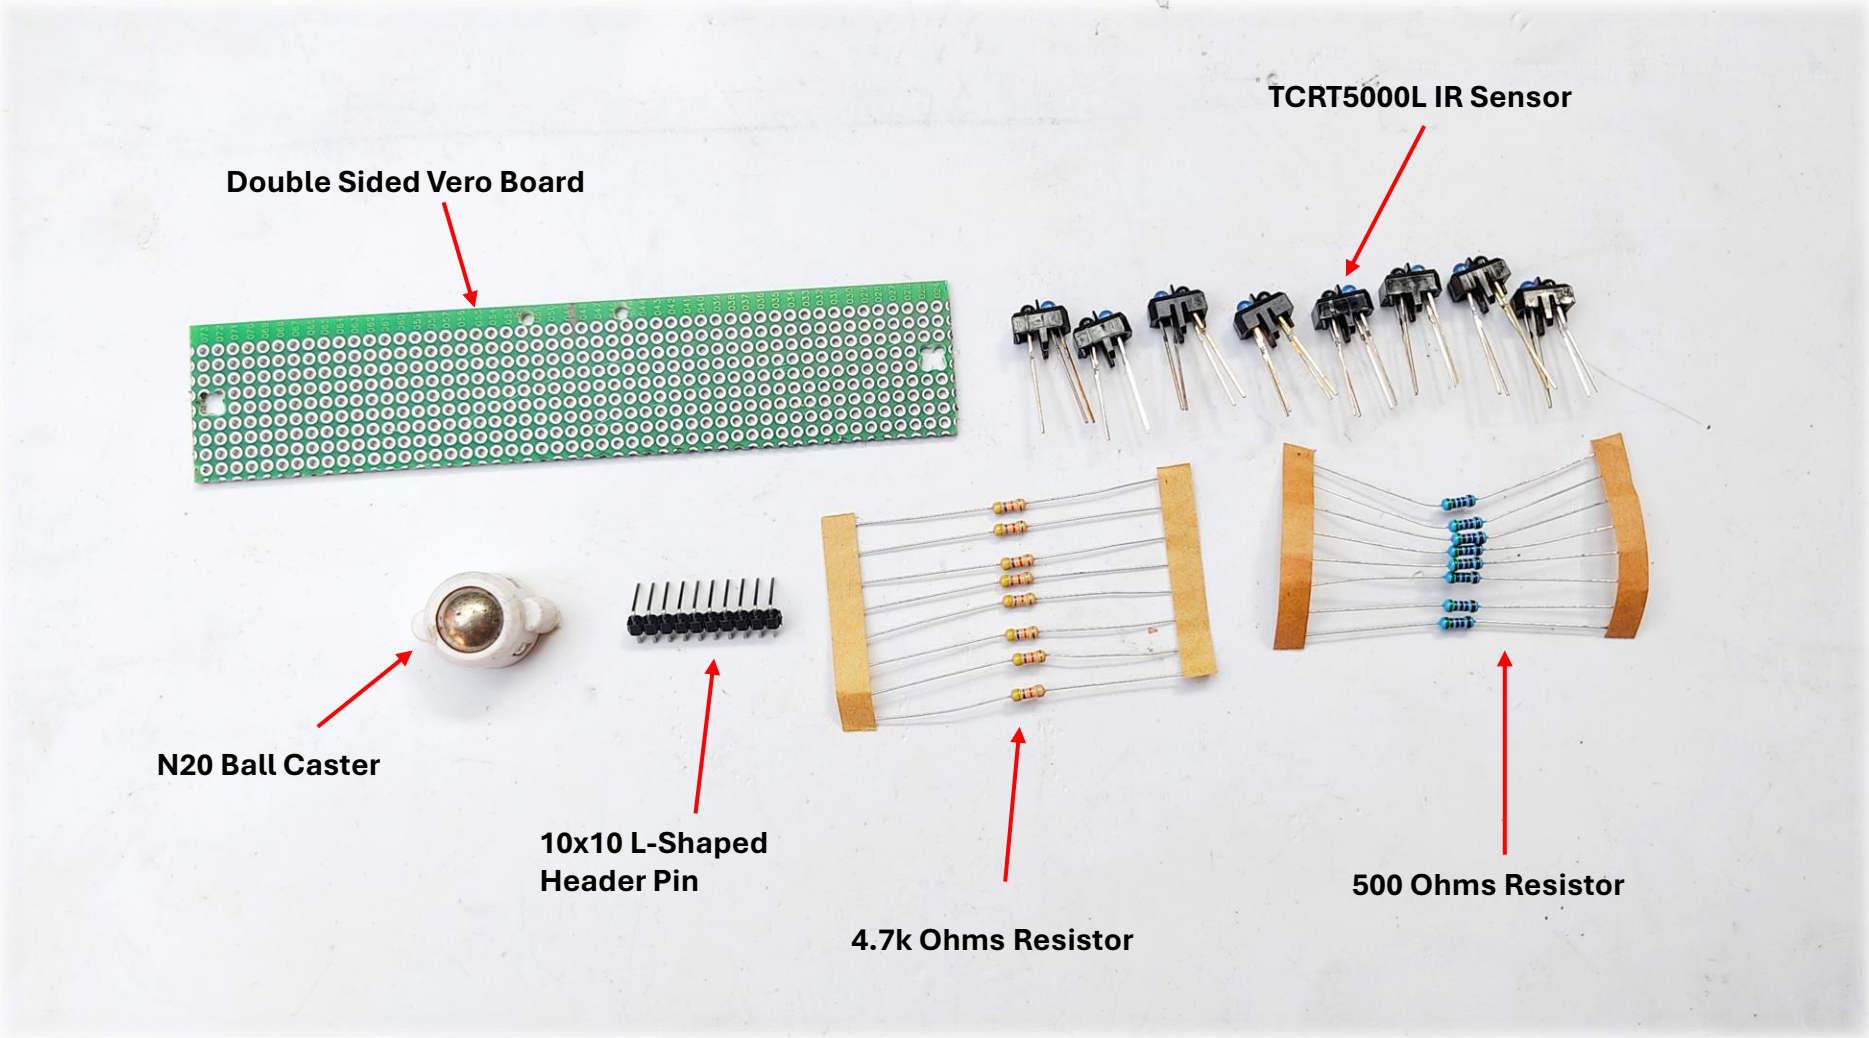


TCRT5000L Pinout


Top View

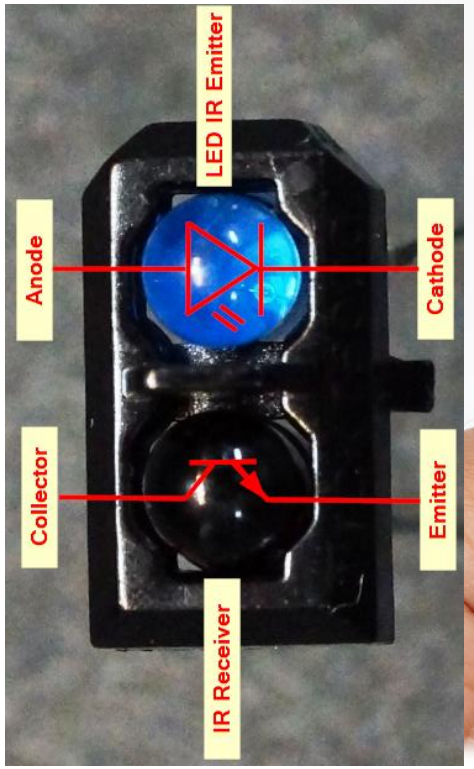

Cut Unnecessary Parts
From the Sensor Guard

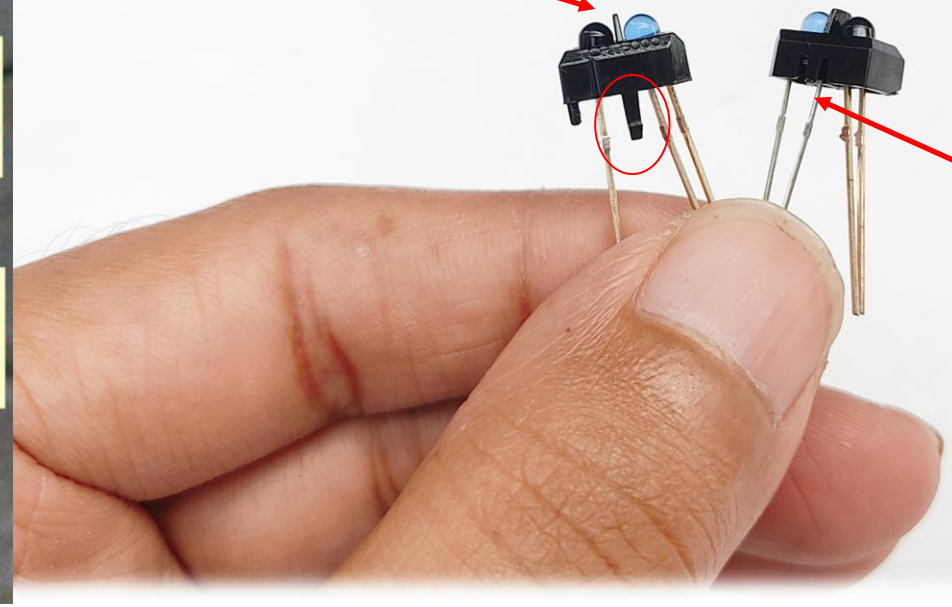


Bottom View

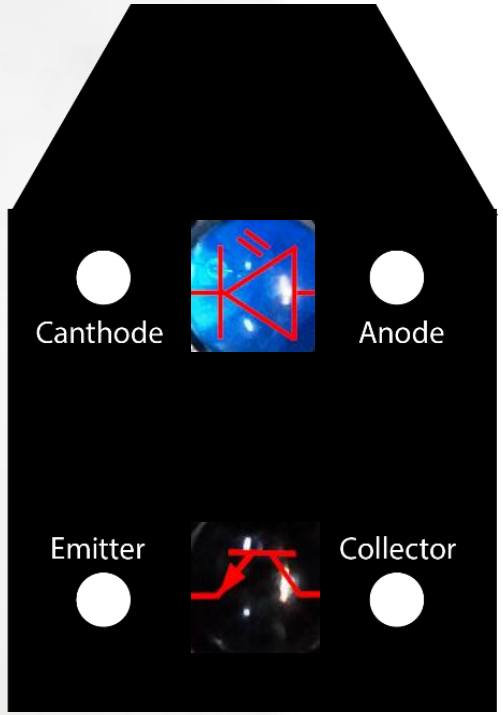



TCRT5000L Pinout


Top View

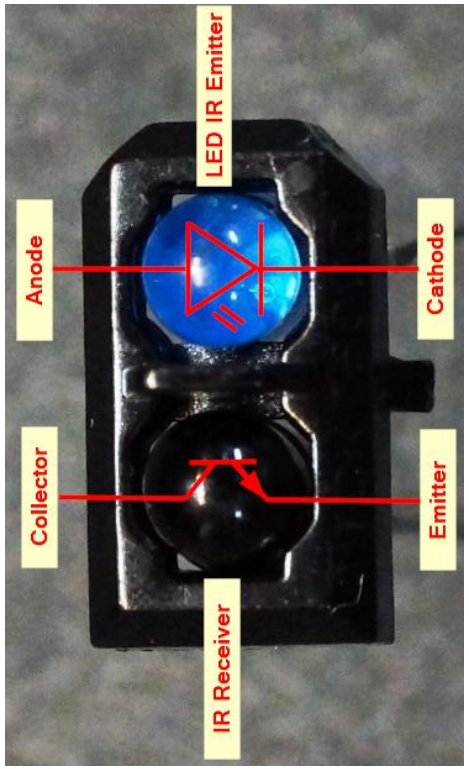


Bottom View

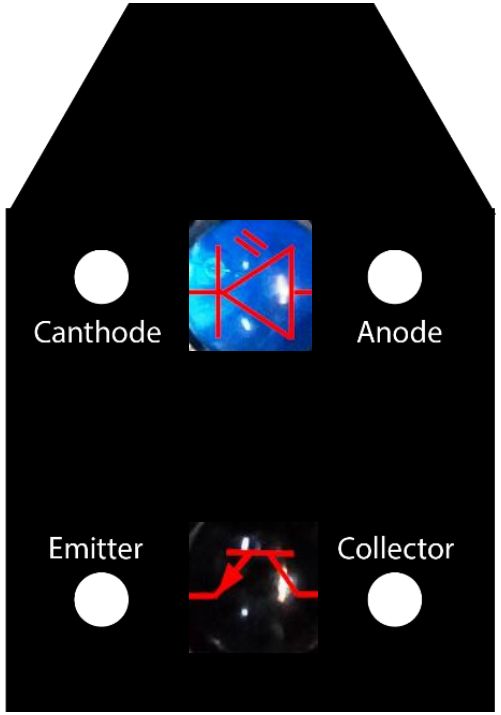


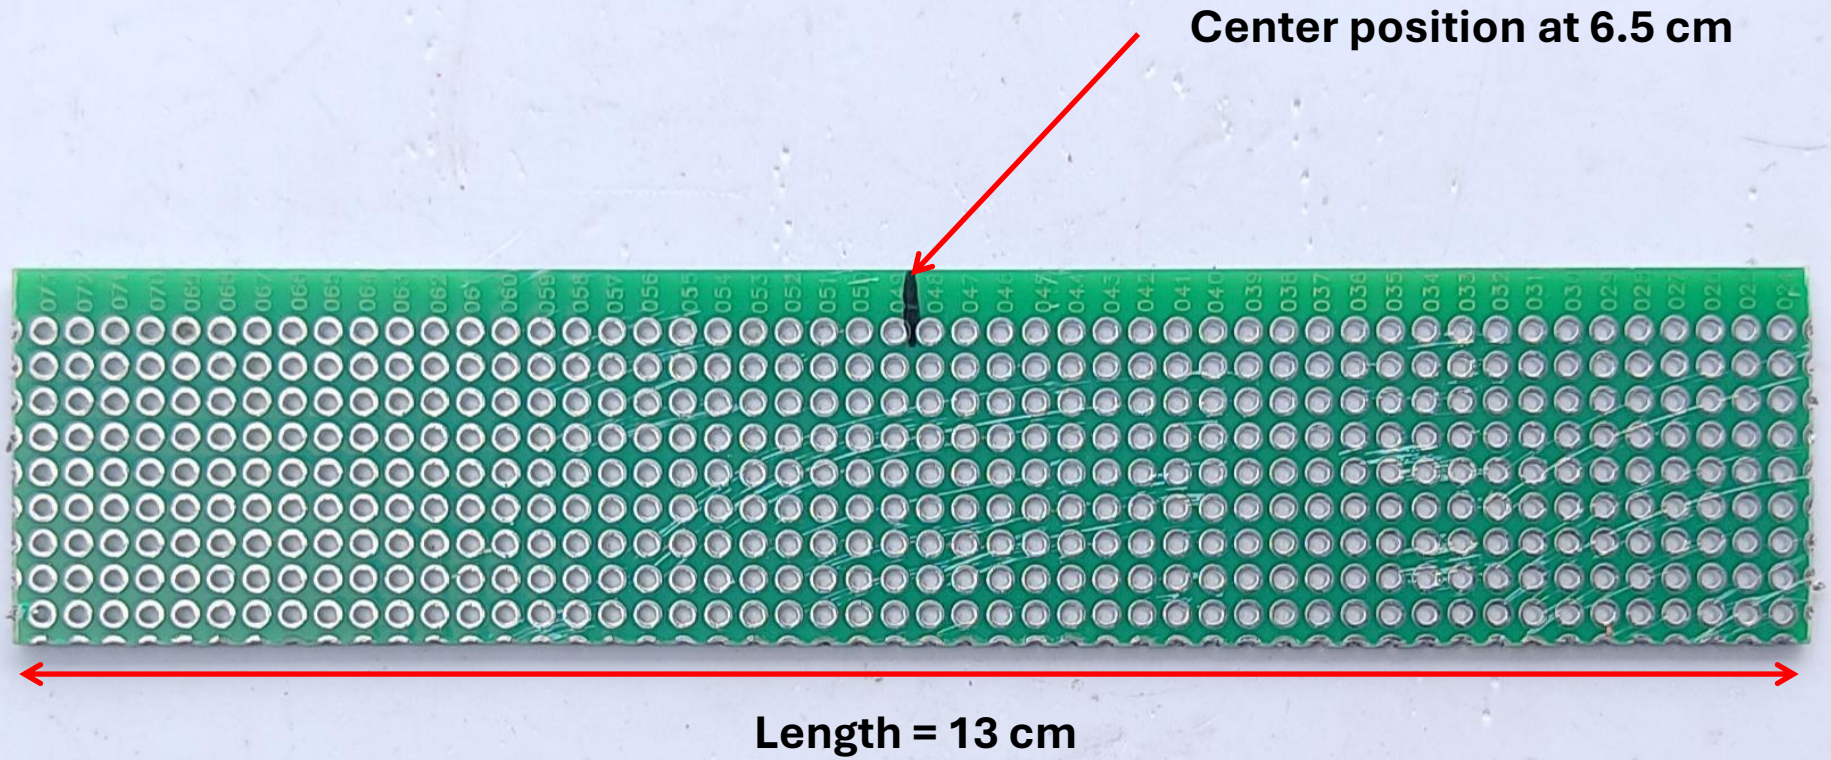
Center position at 6.5 cm
Length = 13 cm

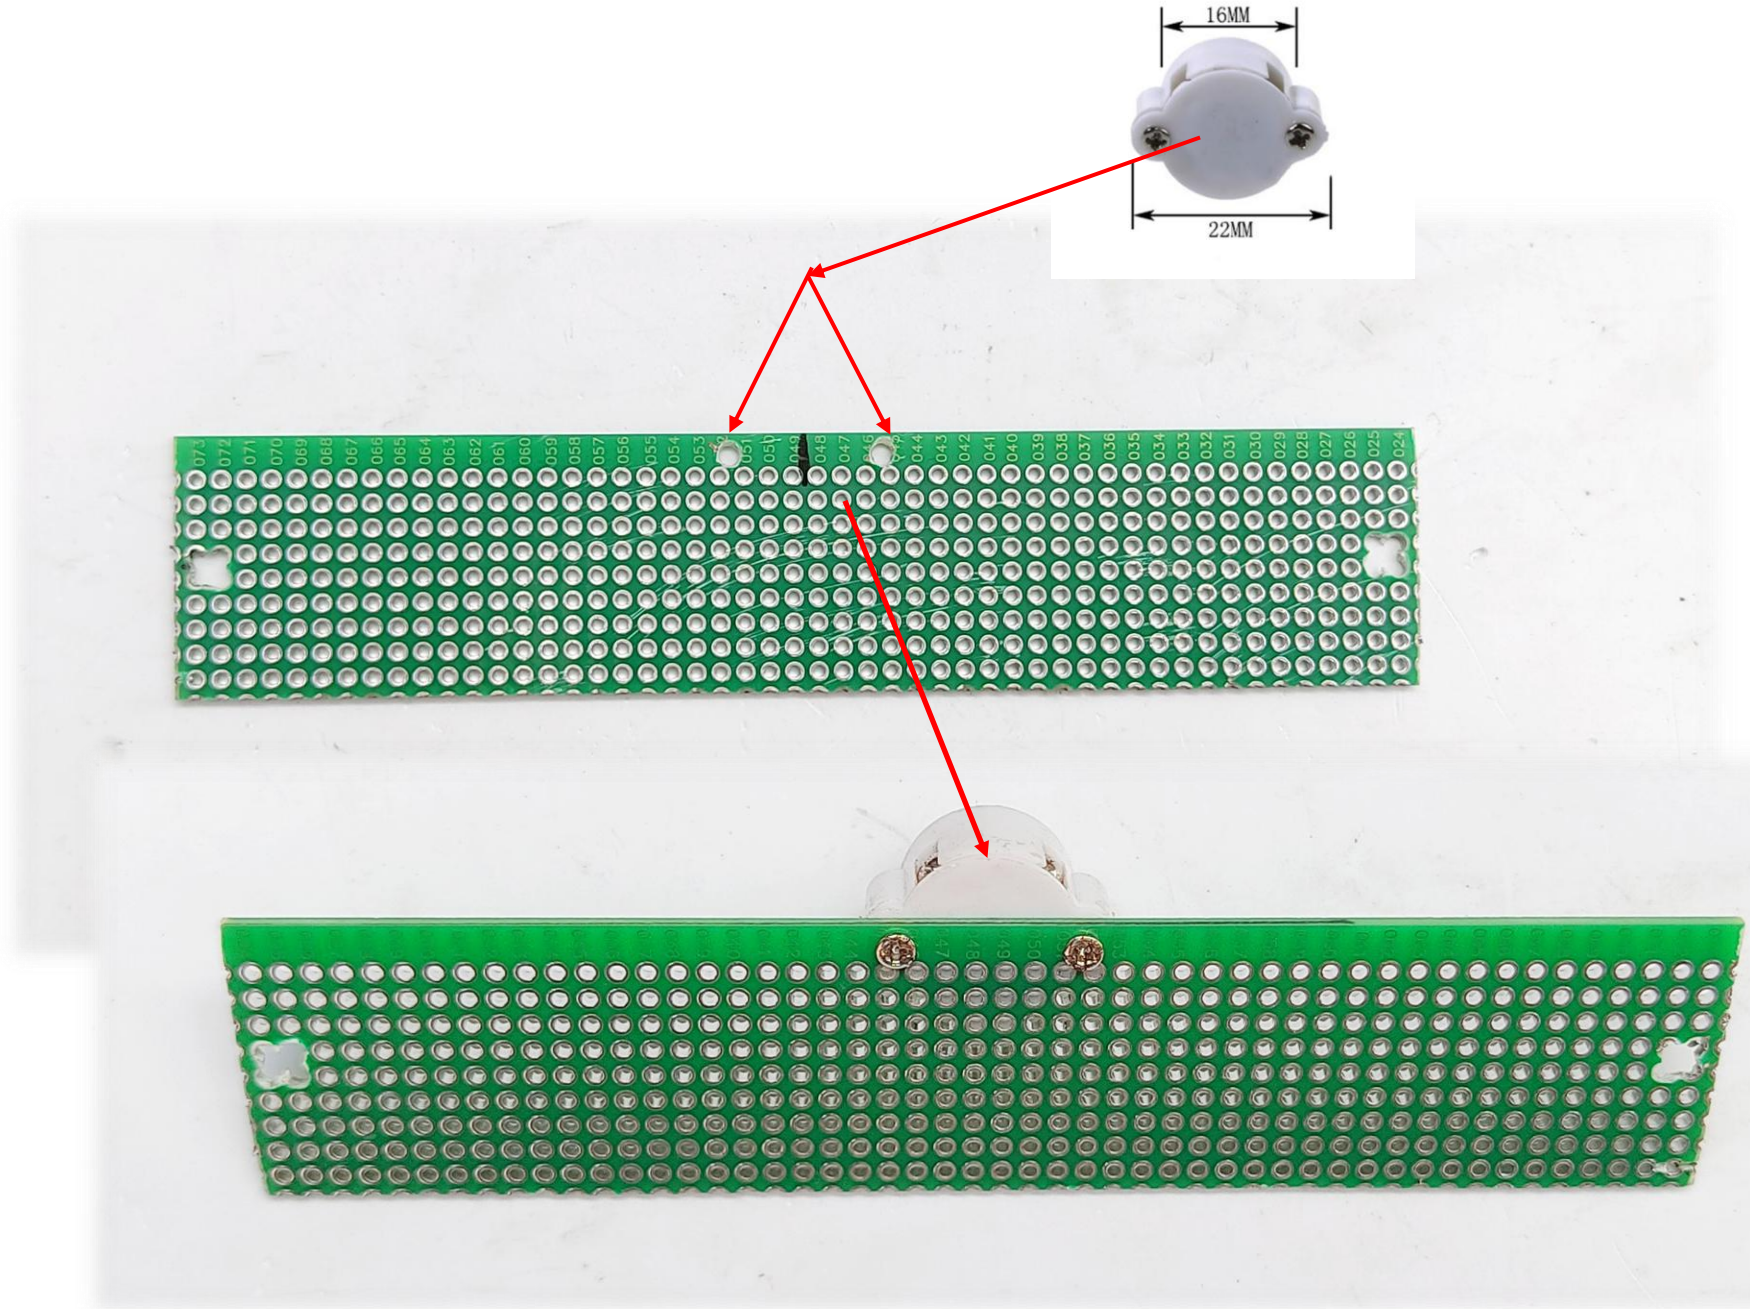

16MM
22MM

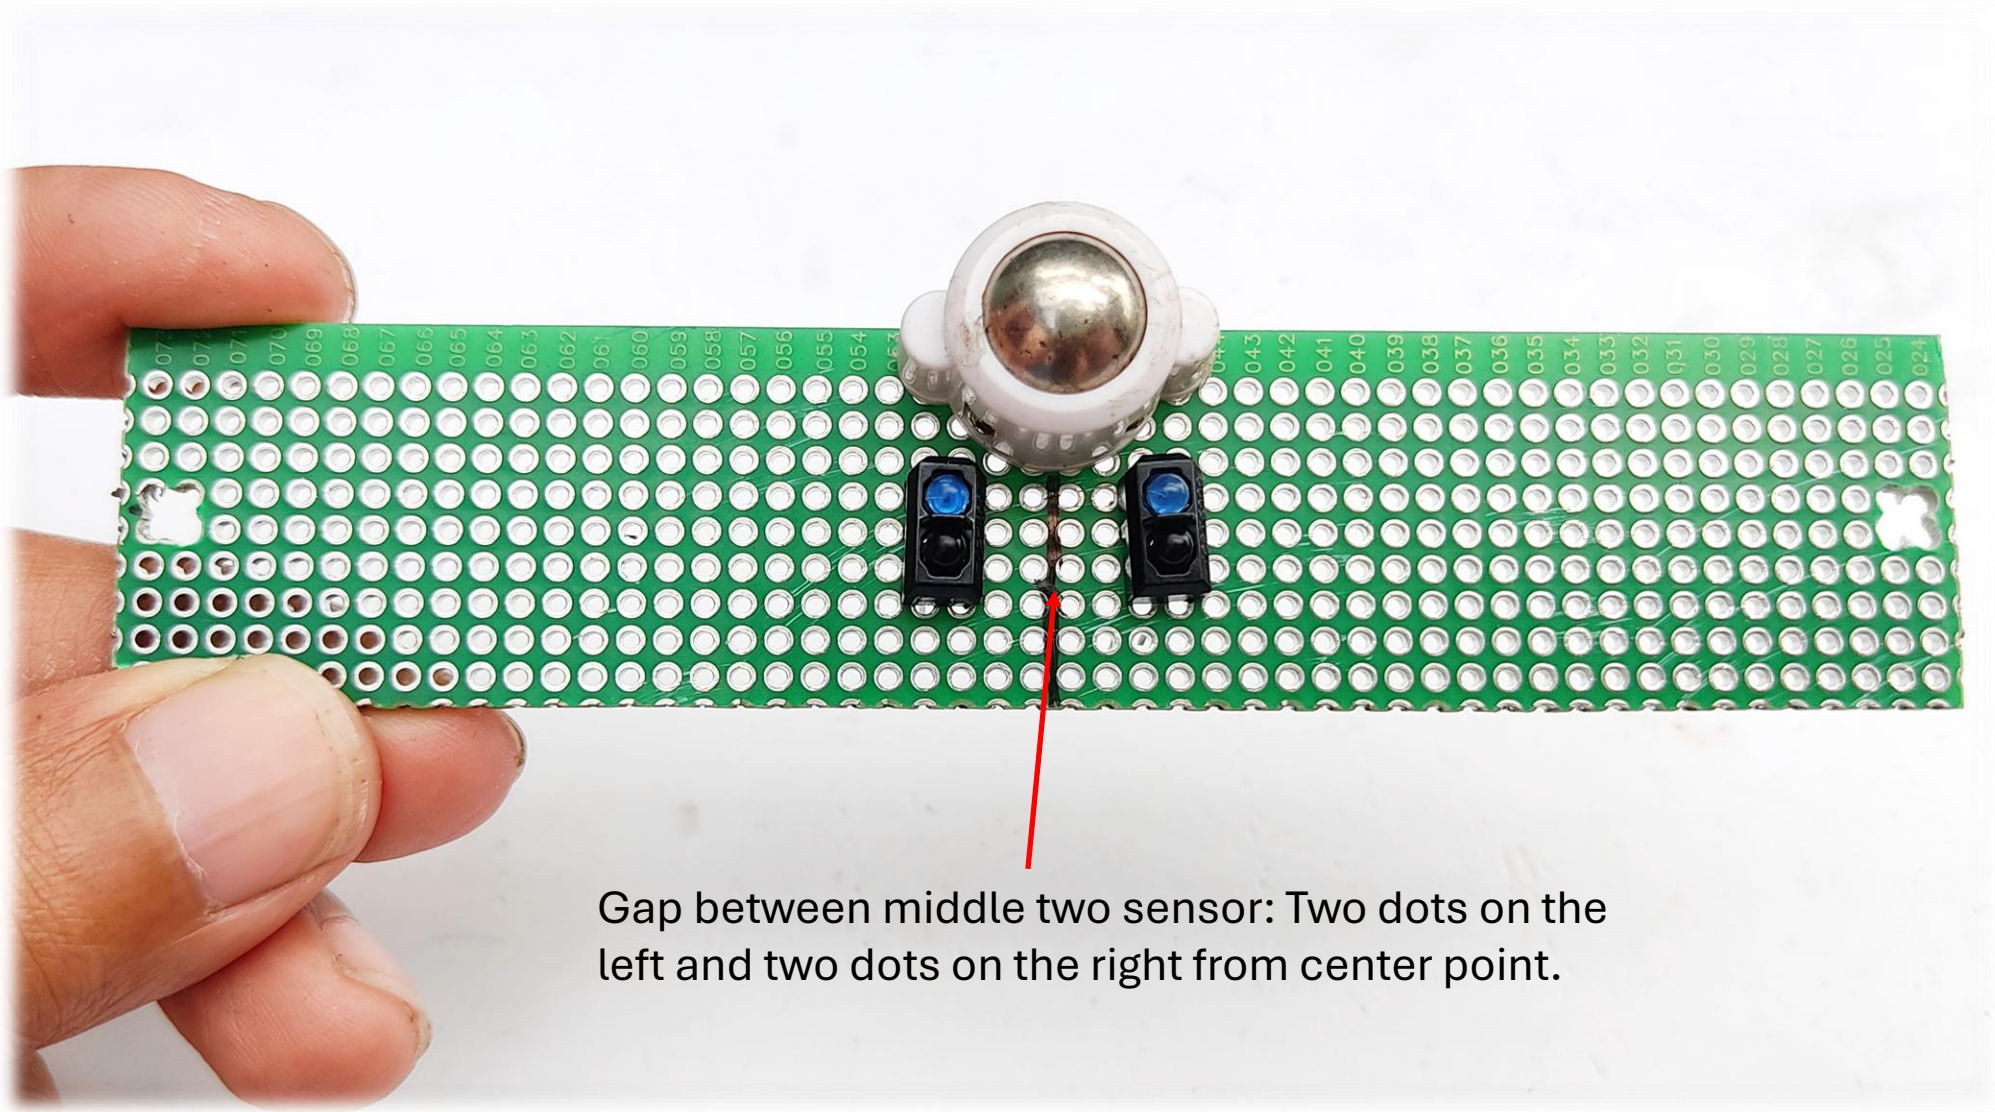


Gap between middle two sensor: Two dots on the left and two dots on the right from center point.

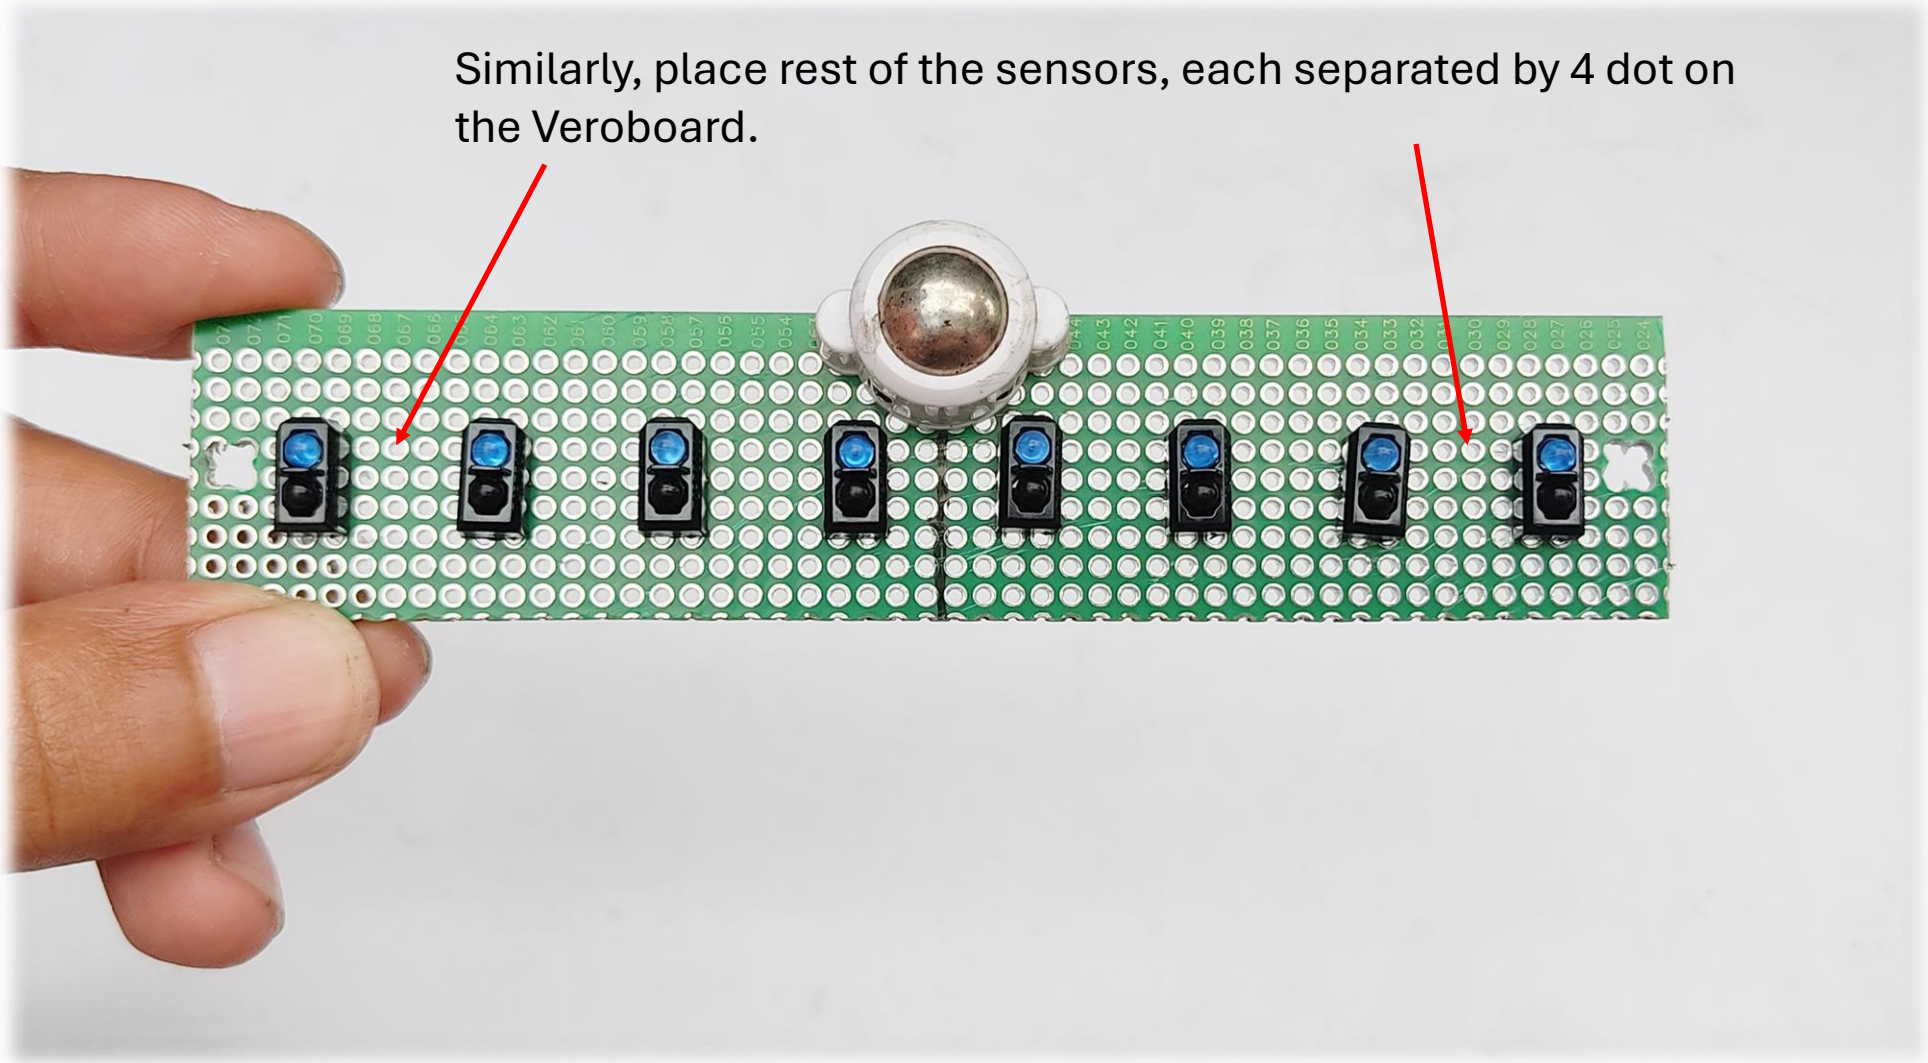
Similarly, place rest of the sensors, each separated by 4 dot on the Veroboard.


After Soldering all the sensors with Veroboard

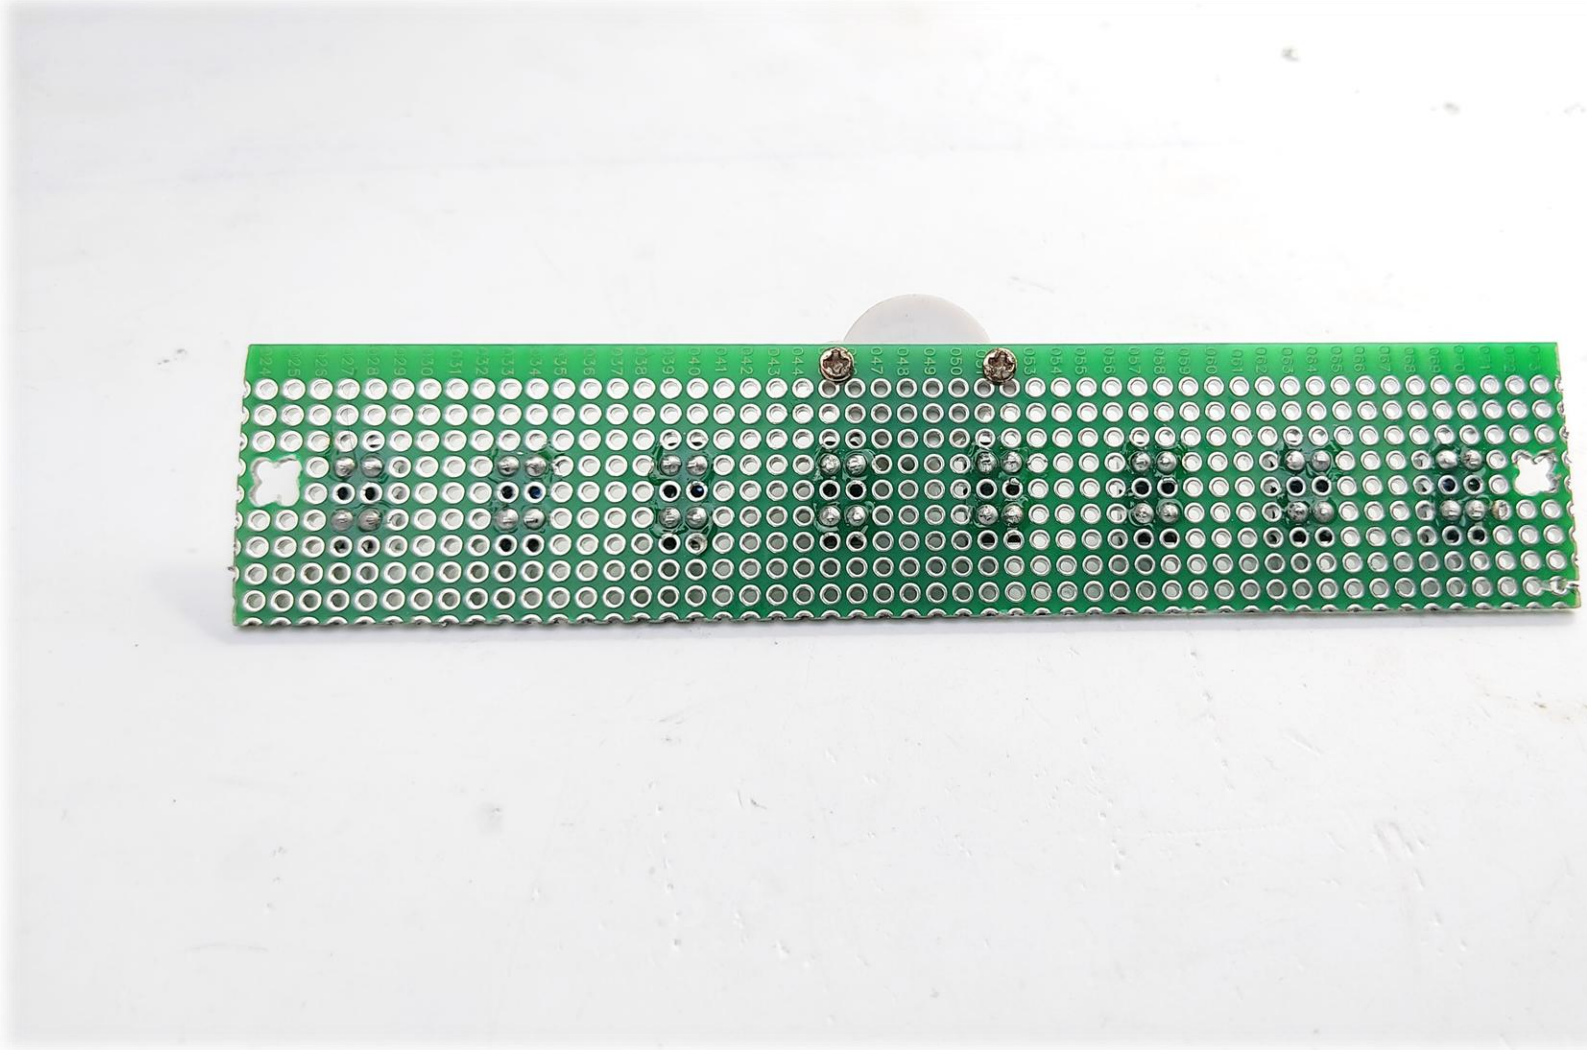


Bottom View

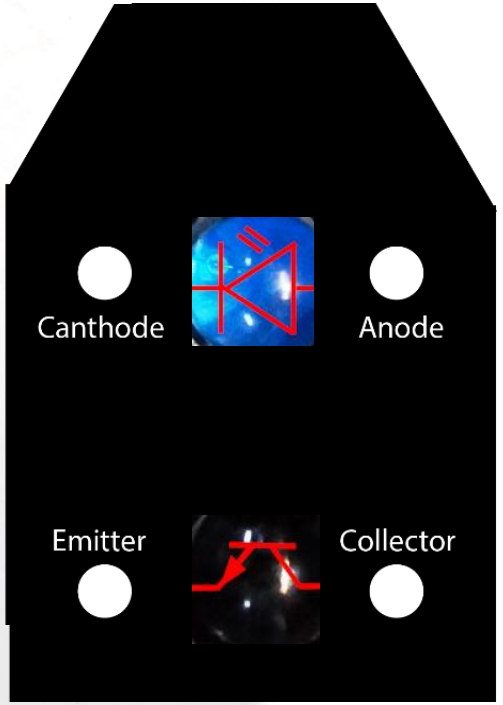


Connect all Cathode of IR transmitter and all emitter of IR receiver together (will be connected to ground at the end)

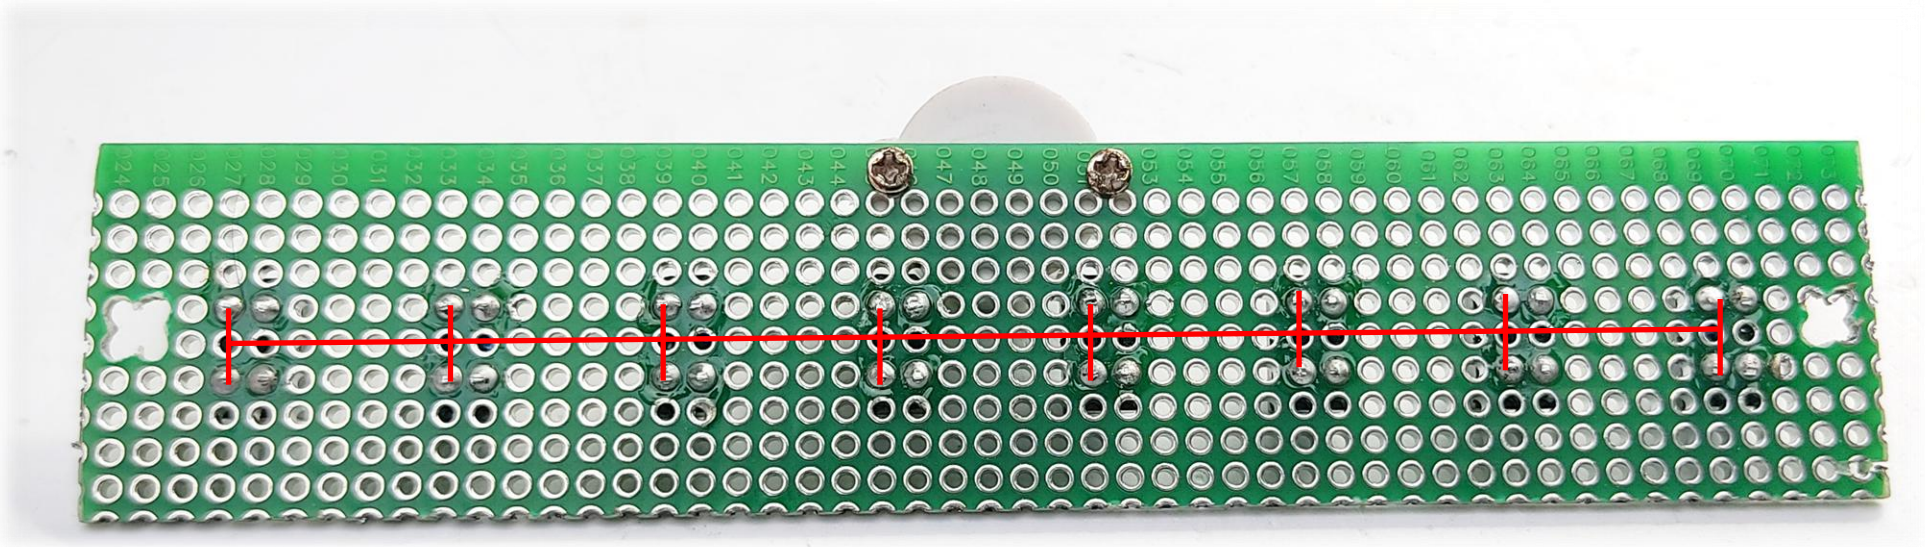


Bottom View

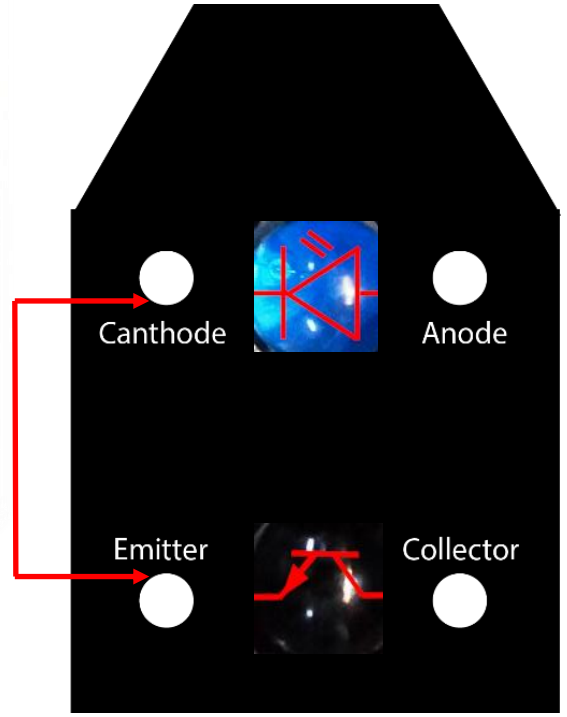

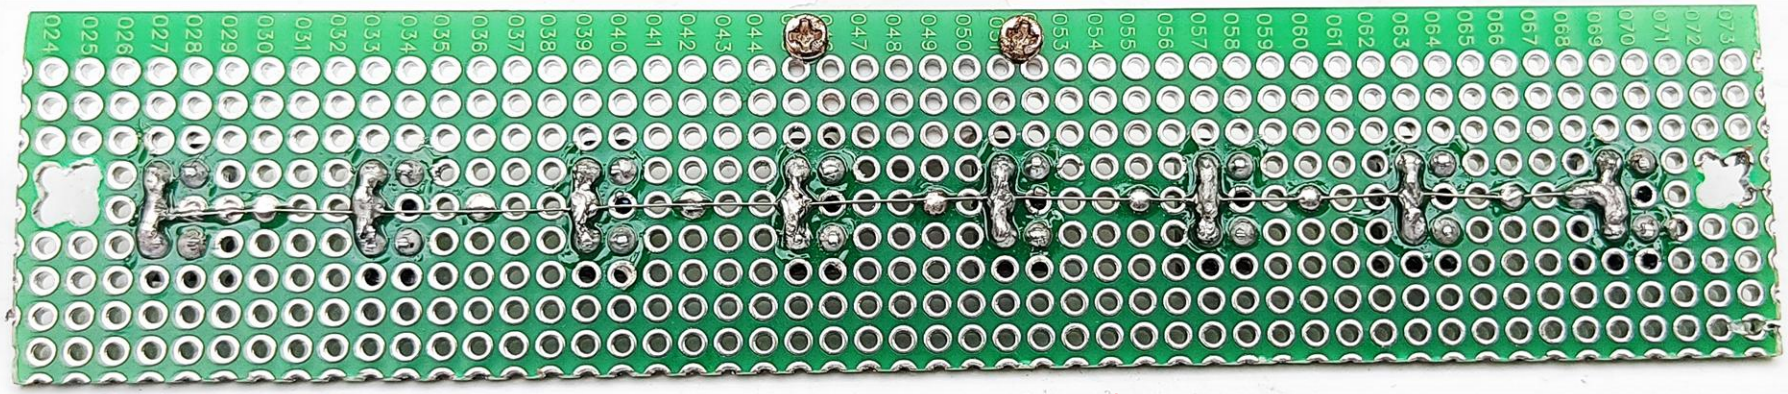


After connecting them
(ground line)


Bottom View

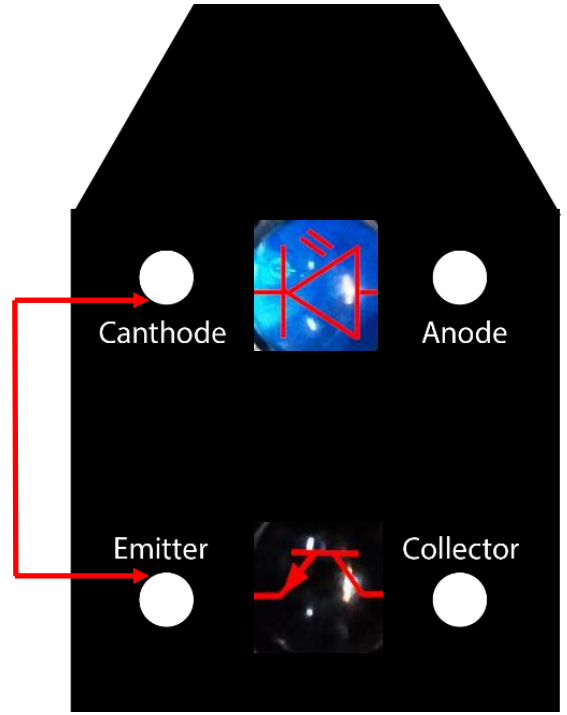


Connect the anode of all the transmitter-IR leds one by one with Vcc by 500 ohms resistor. This will power up the IR led to emit IR-rays towards the surface.

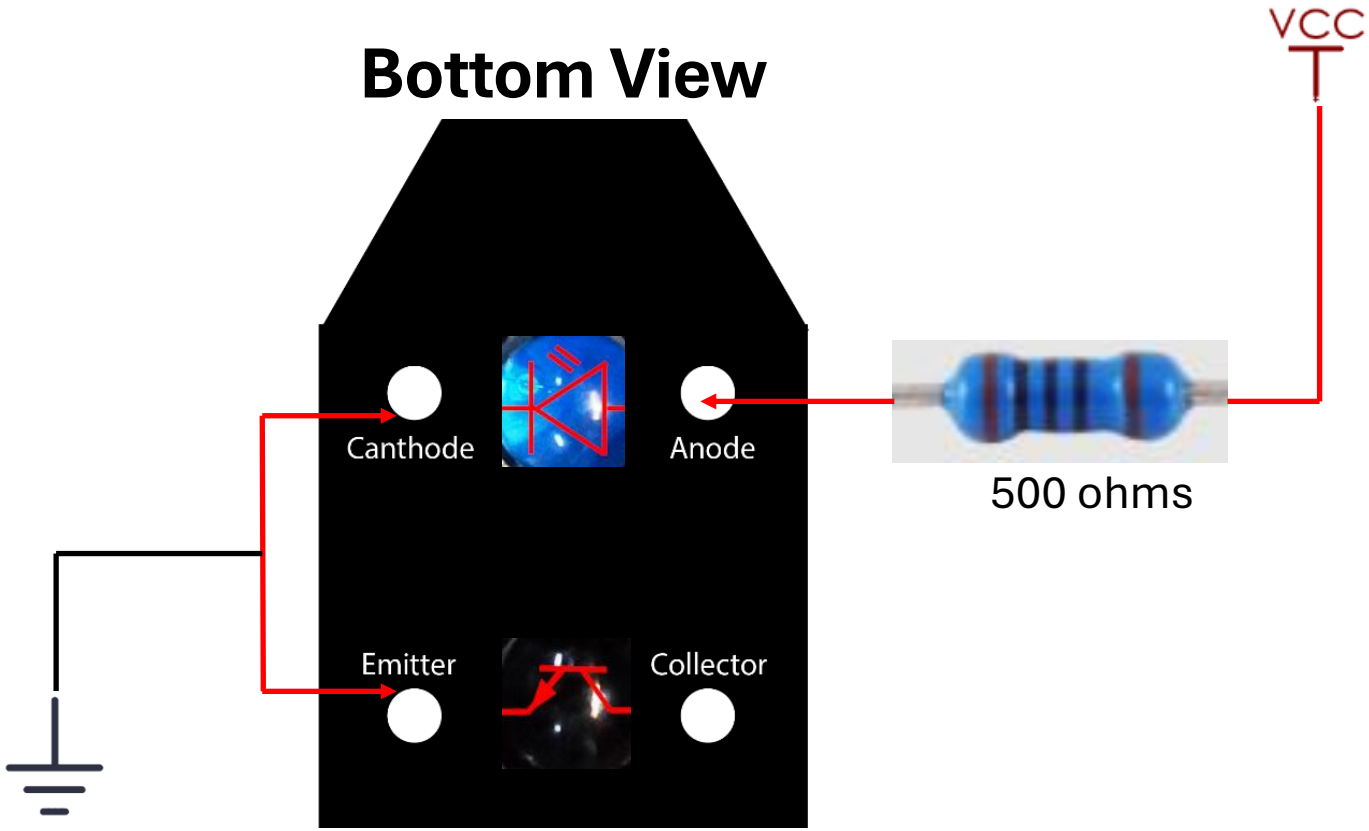


Connect the anode of all the transmitter IR leds with Vcc by a 500 ohms resistor.

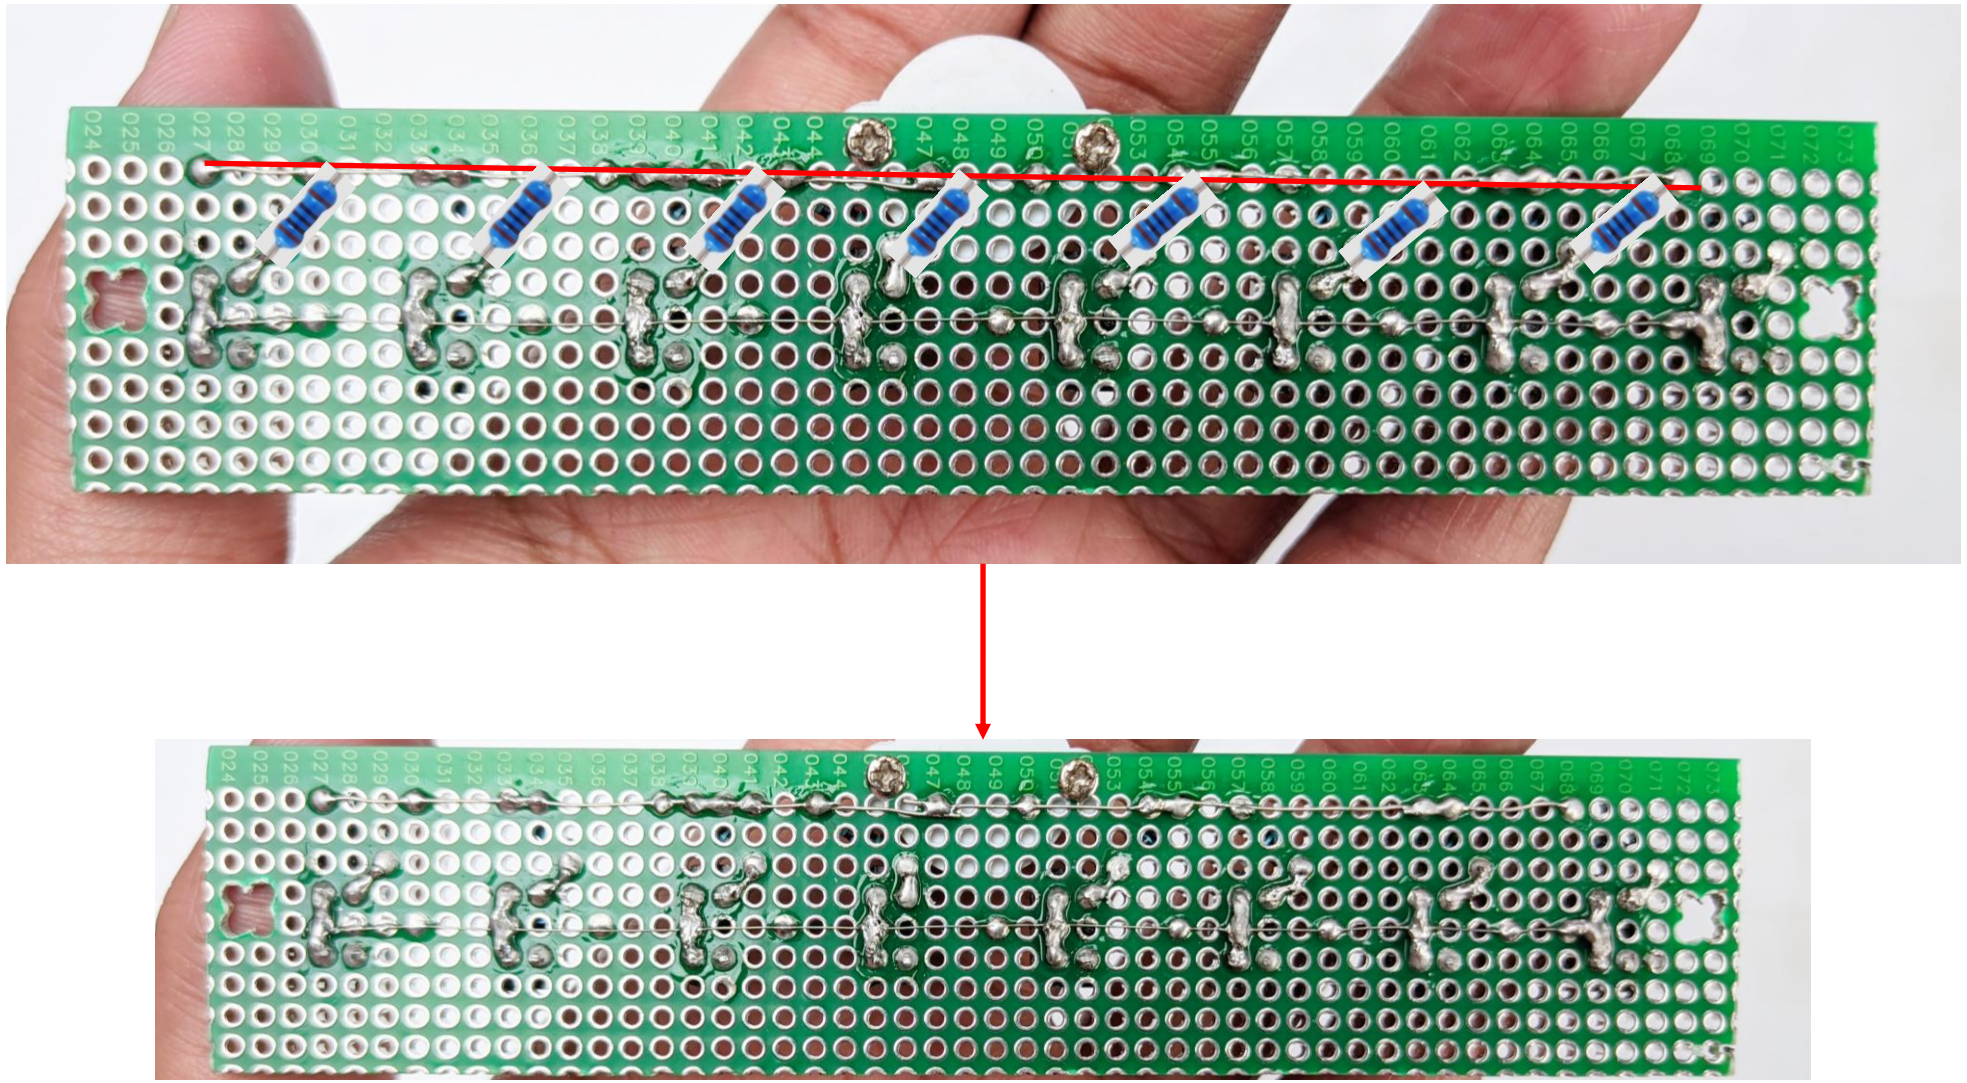



Connect the collector of all receiver
one by one with Vcc by 4.7k ohms resistor.

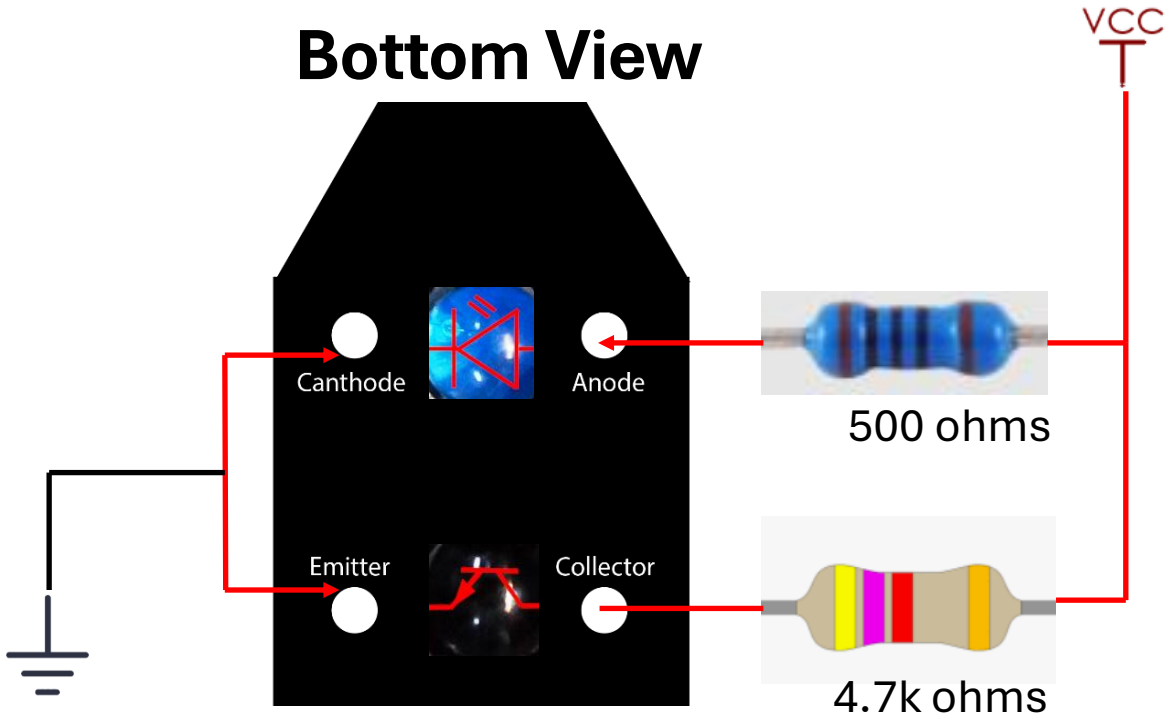

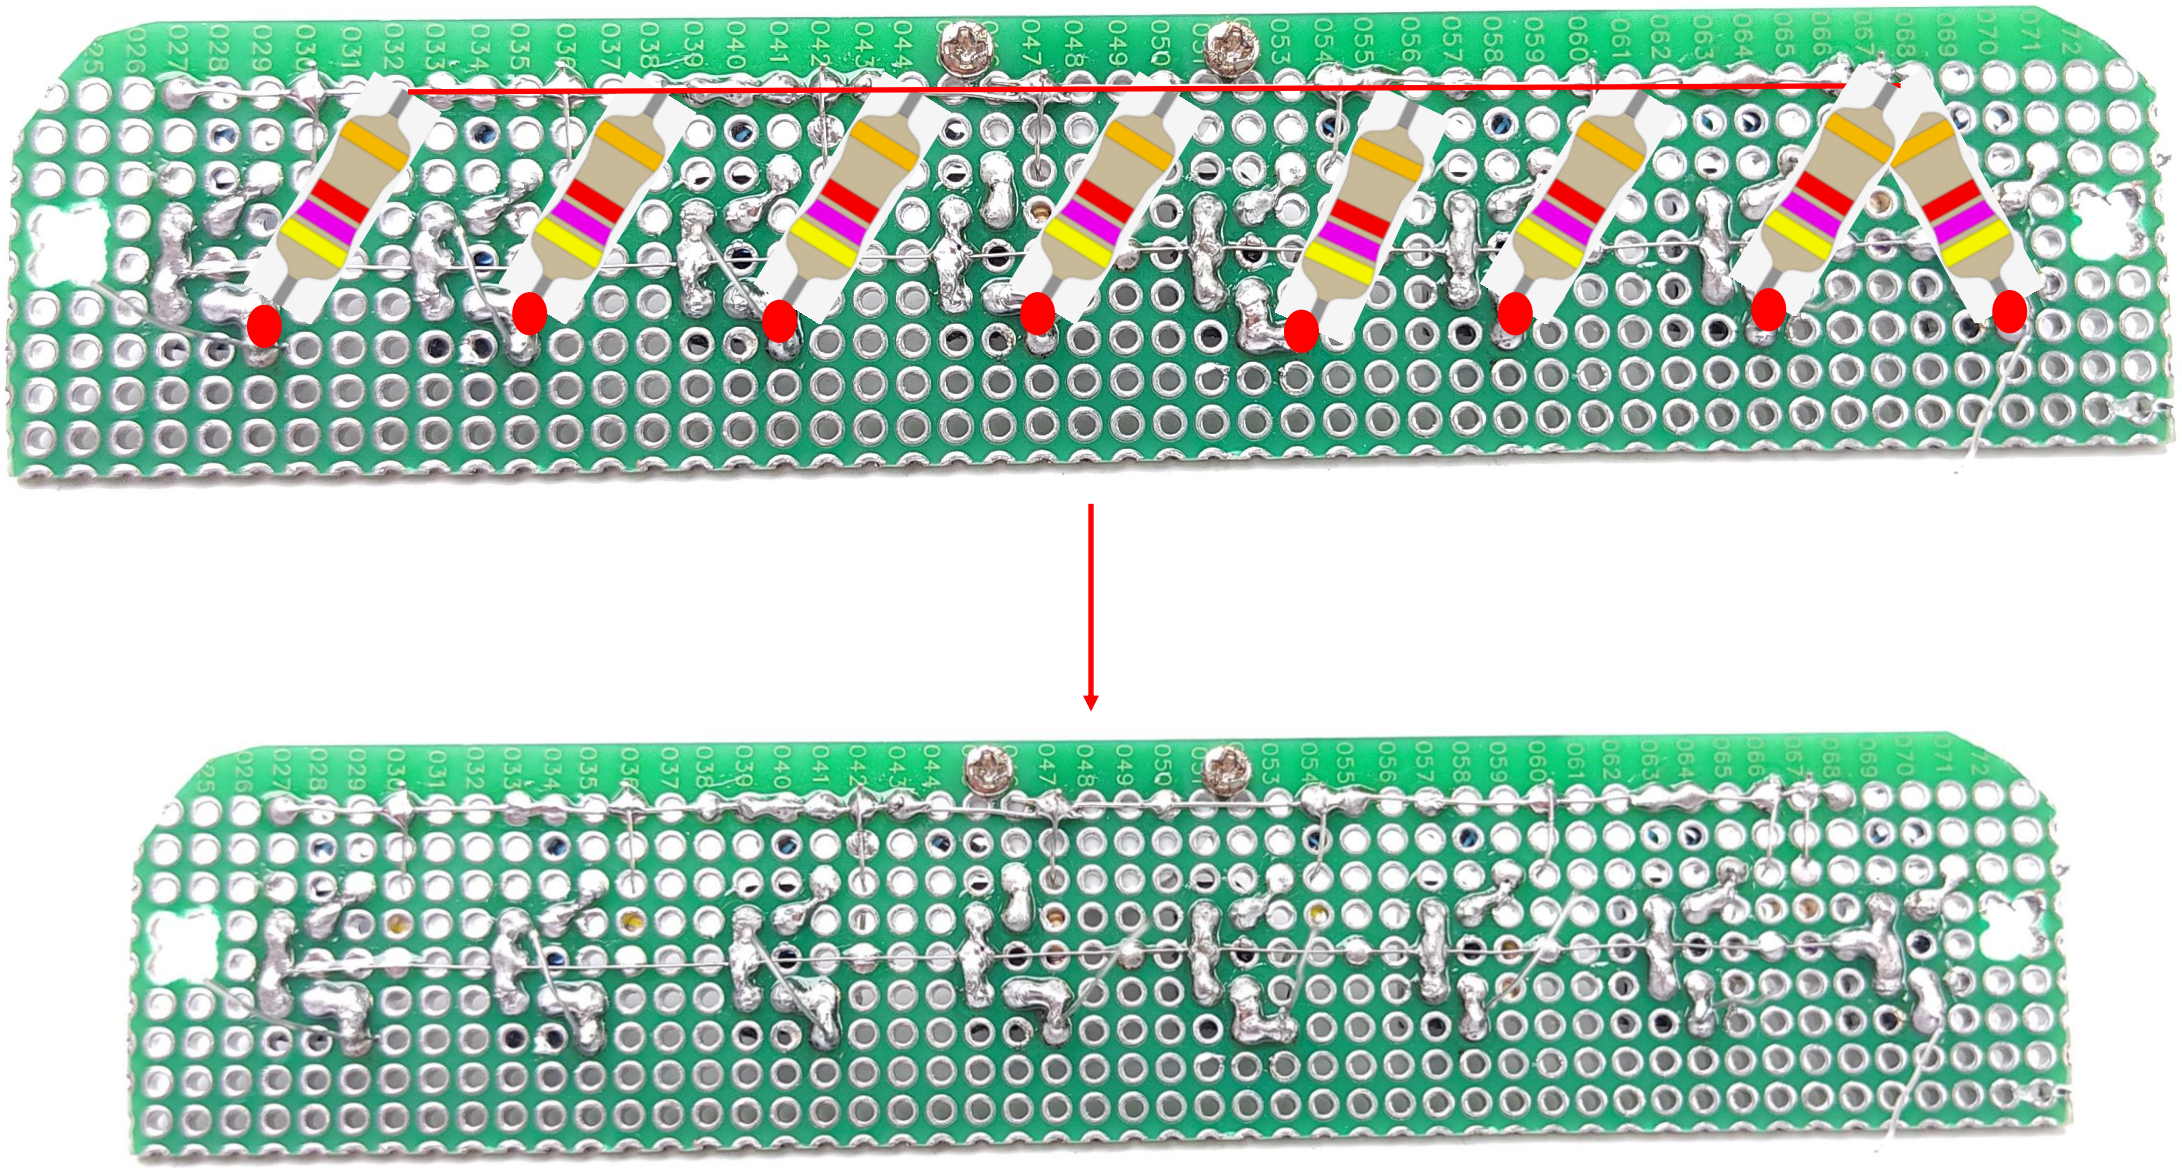


Signal output will be taken from collector of receiver

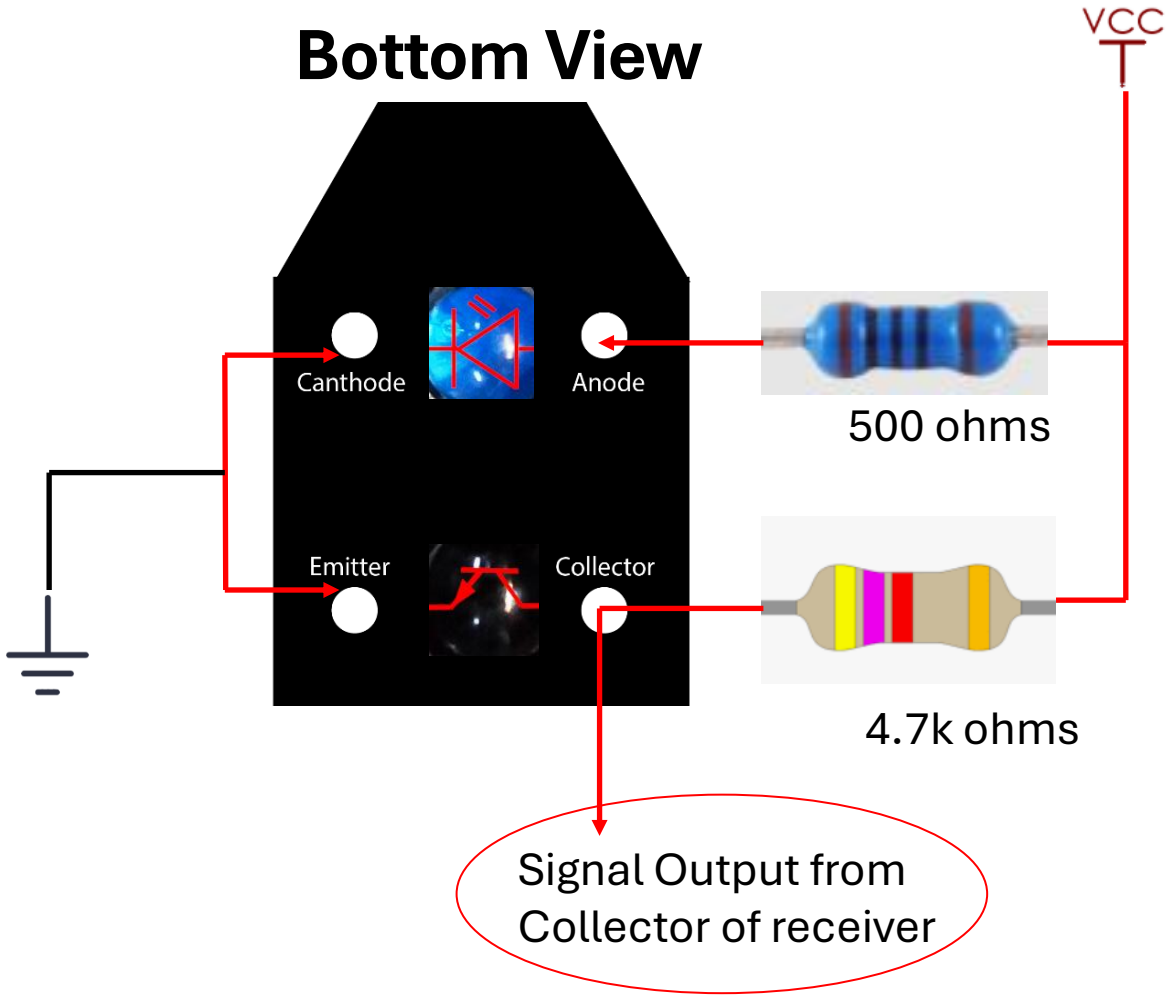

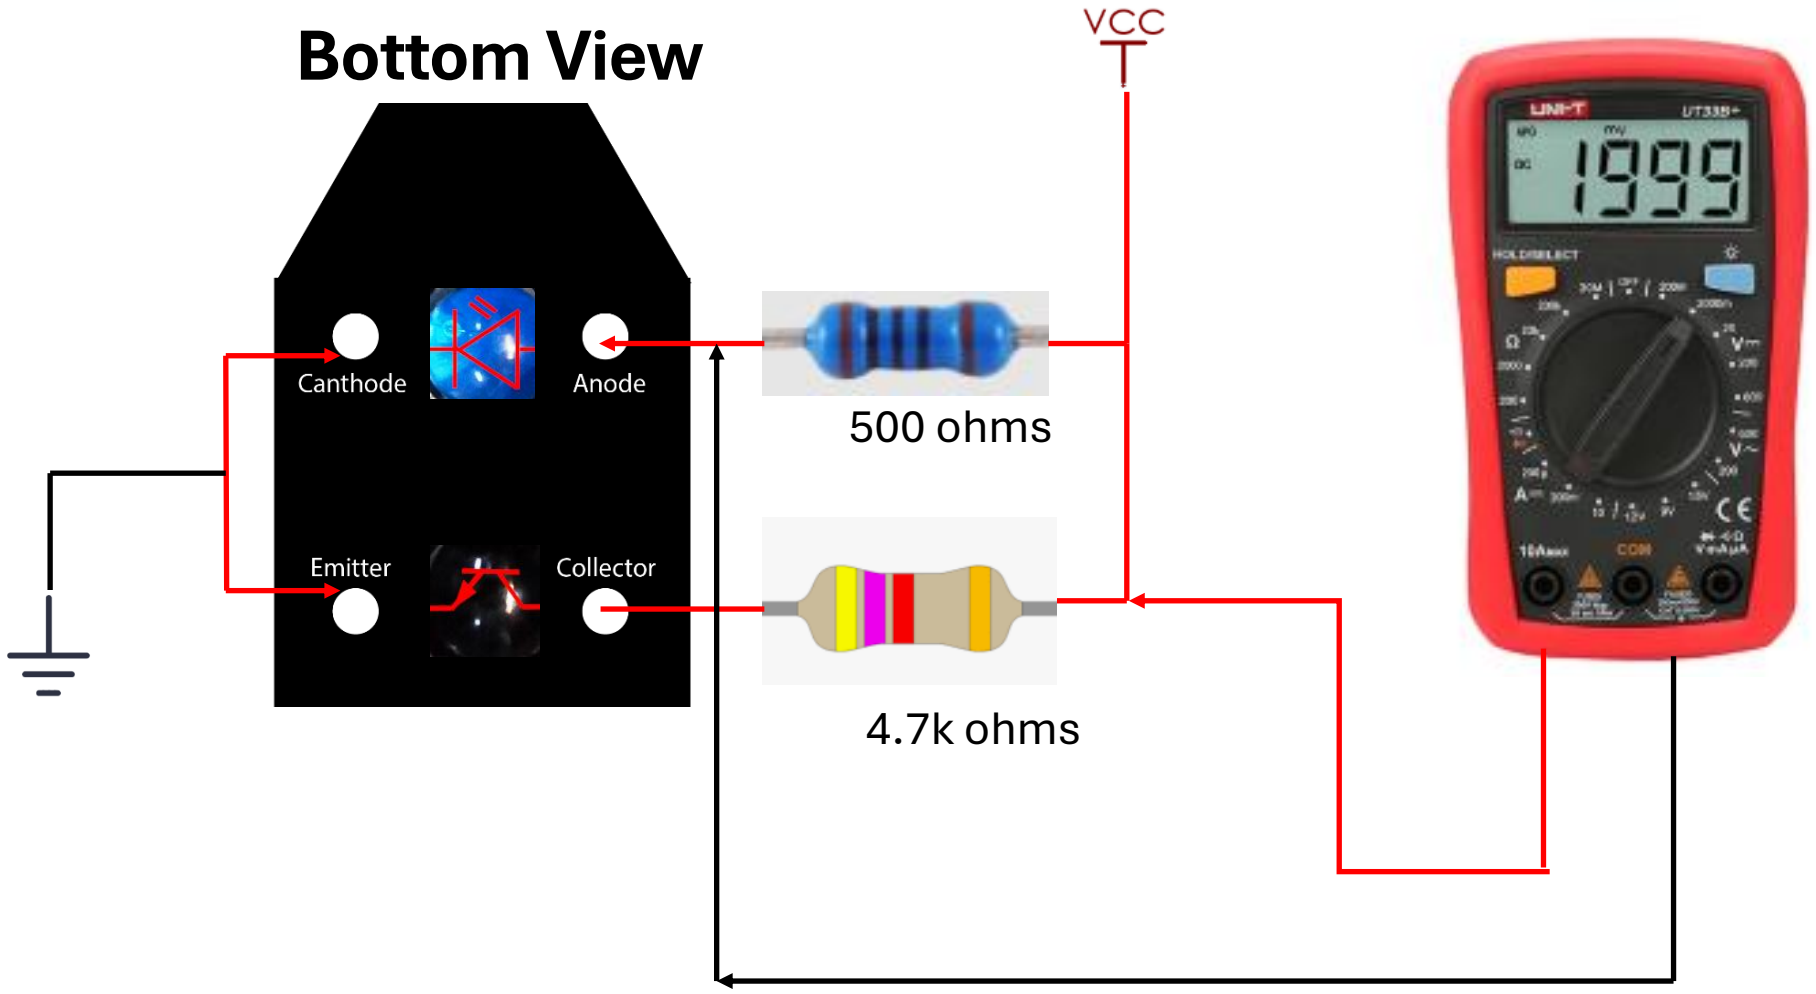
Bottom View
VCC
Canthode
Anode
Emitter
Collector
500 ohms
4.7k ohms
UNI-T
UT33B+
1999

Final Pinout Mapping

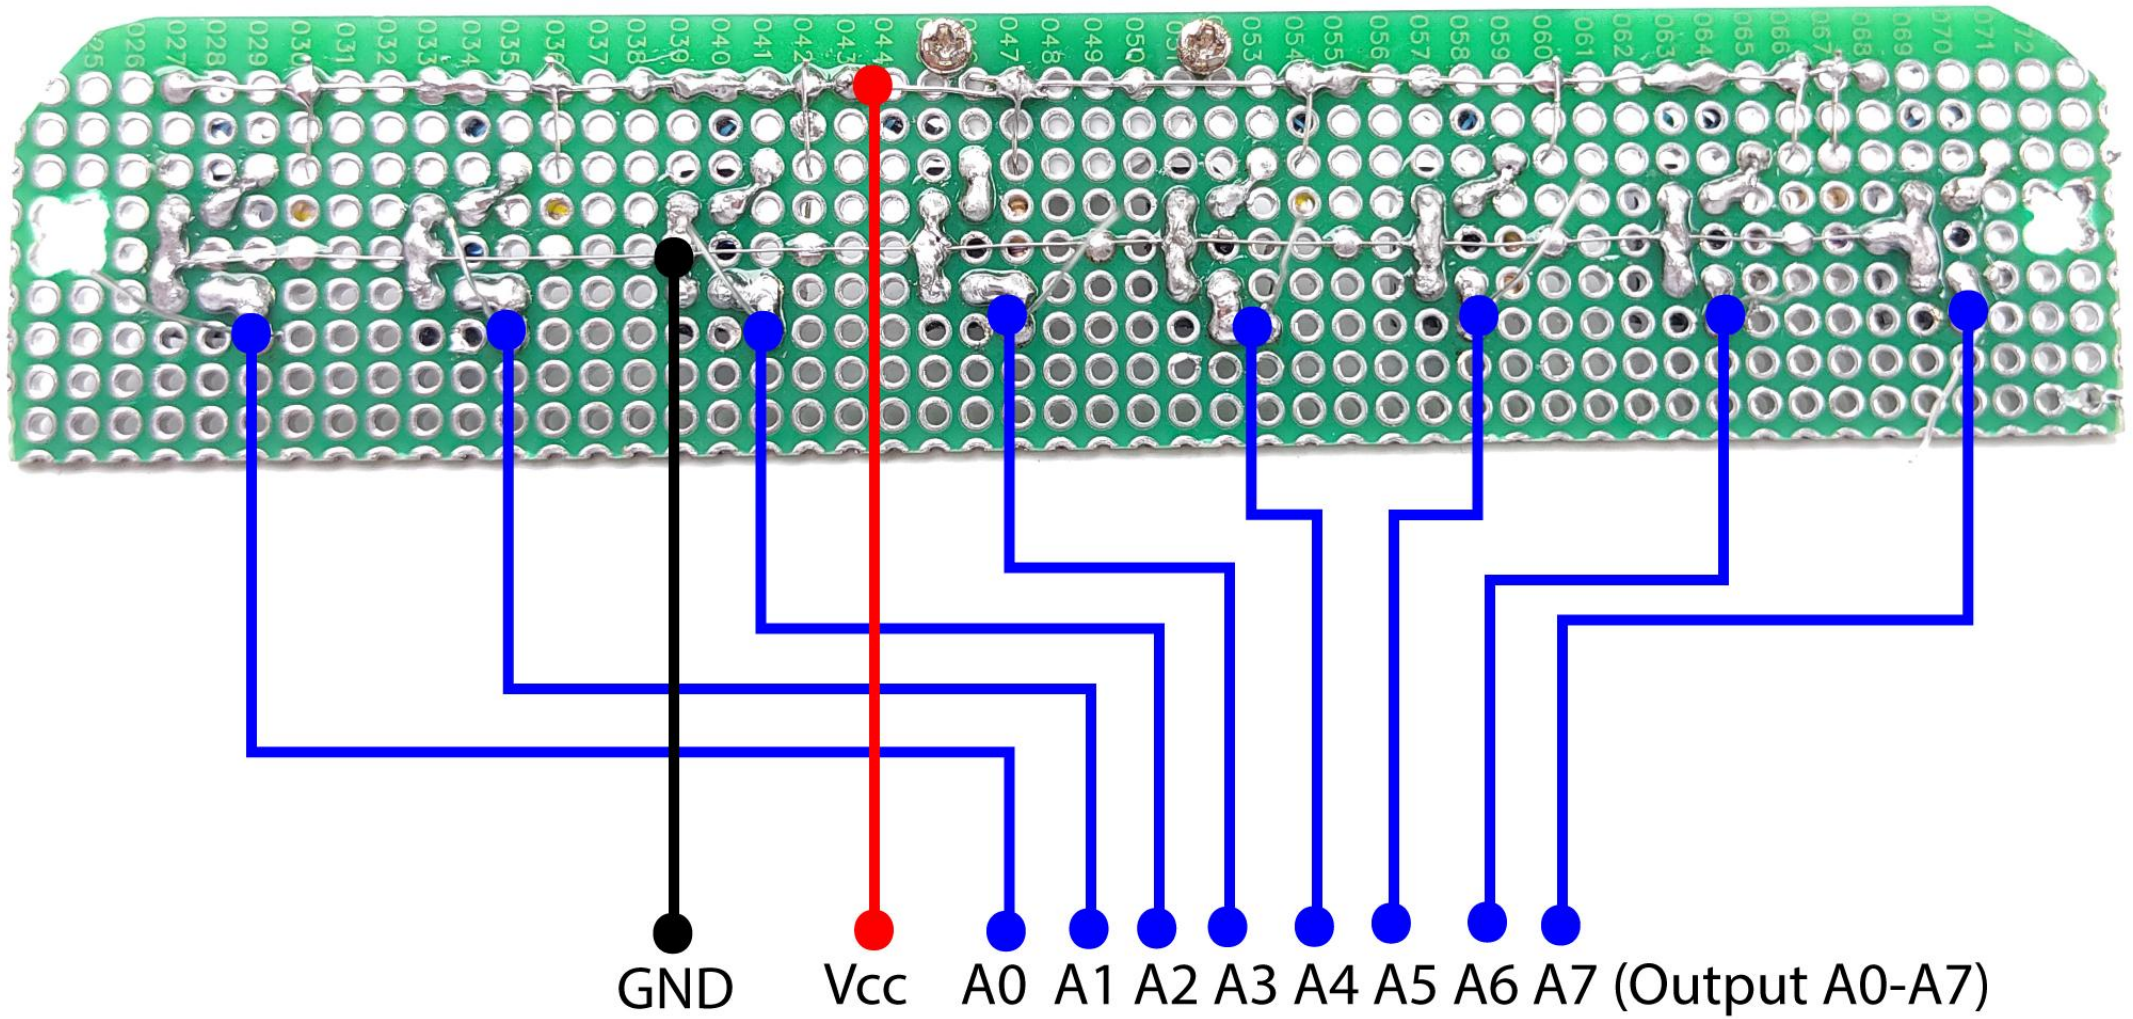

Final Top and Bottom Side

