

One remaining check: R18 supply or control?


V064-V075 is confirmed. V064-V070 is still unreported. Seven capacitor comparisons gave OL; that search is stopped.

Battery and programmer disconnected. Report actual resistance, OL or changing. Compare near-zero readings with your probe/contact baseline and reverse probes to check. A beep alone is not proof of a direct connection.

Test	Fixed probe	Moving probe	What this tests	Reading / reversed if low
B3	V064	V070	Test the older R18-to-VDD assumption	_____

Why this pair: V075 now has a confirmed regulated supply connection in the Q7 region. The photo suggests Q7/R19 may form a supply switch, with R18 carrying a control signal. B3 distinguishes that possibility from the older R18 supply assumption; it is not a predicted hit.

A - V064: known regulated VDD

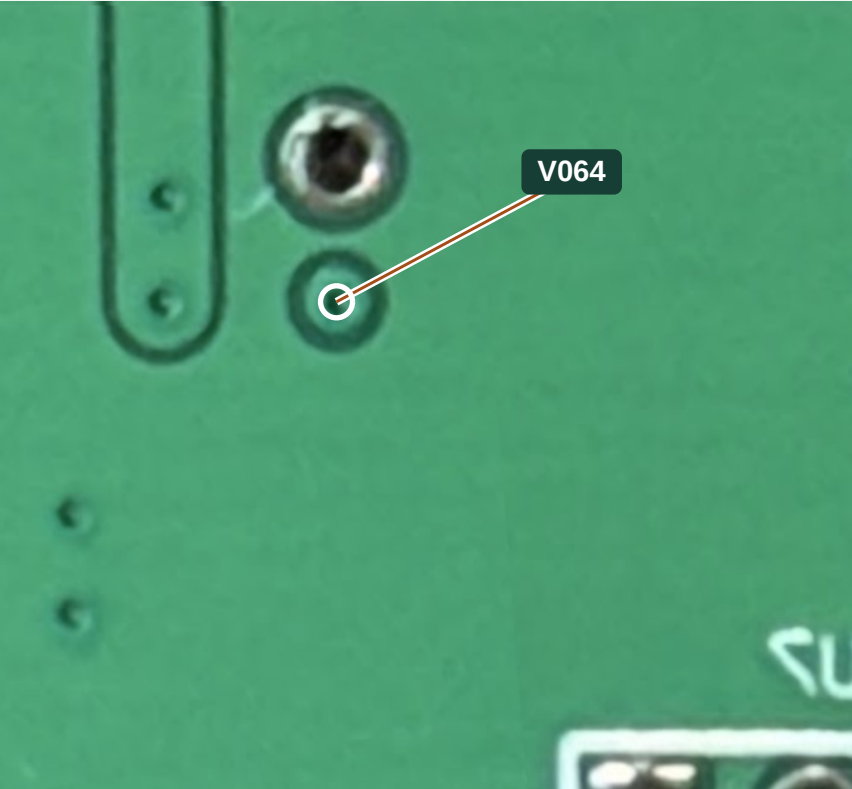

B - V070: free end of R18



Right image: V075 is shown only as a completed-test landmark. Measure V070 for B3. A direct result supports its supply assignment; OL favors checking a control route. Neither result alone proves the Q7 pin functions.

Rear mosaic is already mirrored to match the front. Circles mark vias; leaders are annotations, not traces. Compare landmarks and use the paired photo locator to zoom. Very low resistance can include an inductor or zero-ohm link.

No more capacitor sweeps: seven tested pairs are excluded; the three untested pairs and AC coupling remain unknown.