


Pool Room — Nine Layout Options

Overview & contents — letters are names, not rankings; columns group where the tables sit: left · center · right

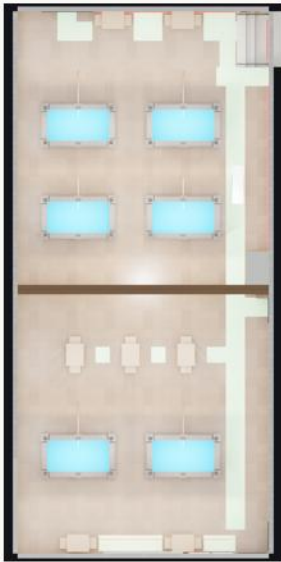


C. left 4+2

p. 2




A. center 2x3

p. 5

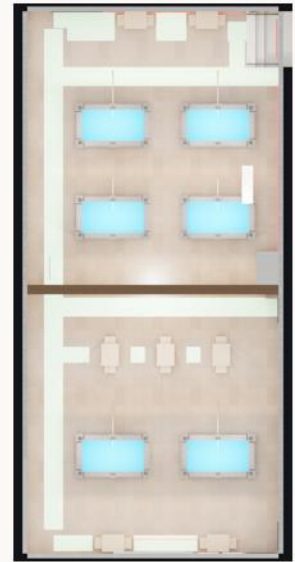


D. right 4+2

p. 8

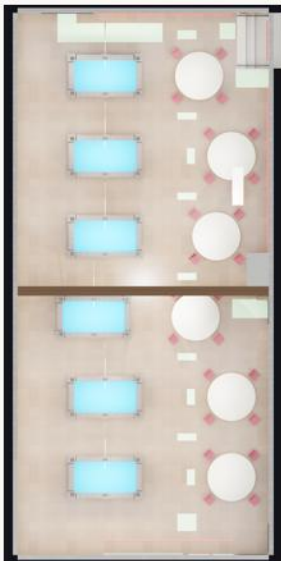


H. west 1x6

p. 3

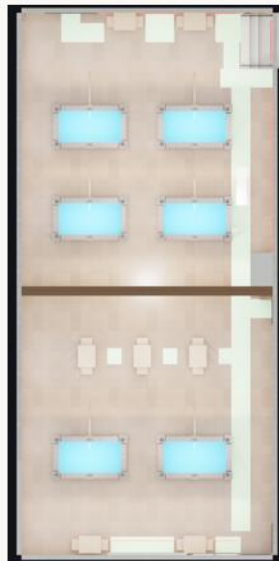


B. center 4+2

p. 6

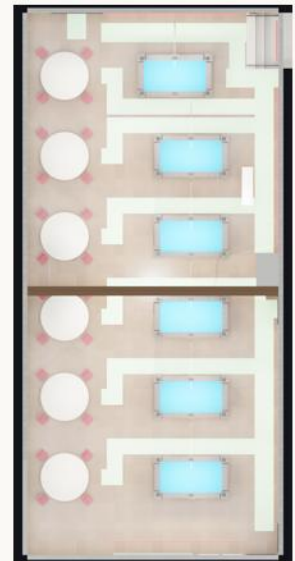


F. east 1x6

p. 9

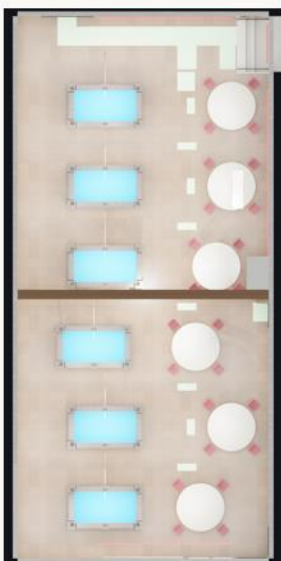


I. west 1x6 low

p. 4

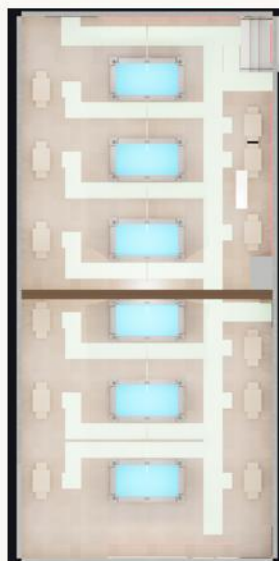

E. center 1x6

p. 7

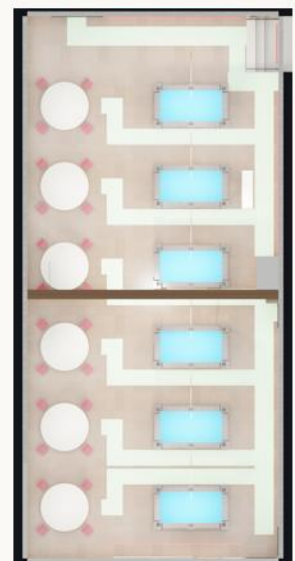


G. east 1x6 low


p. 10

C · Four On Top — Turned Left — left 4+2

The turned pattern slid left

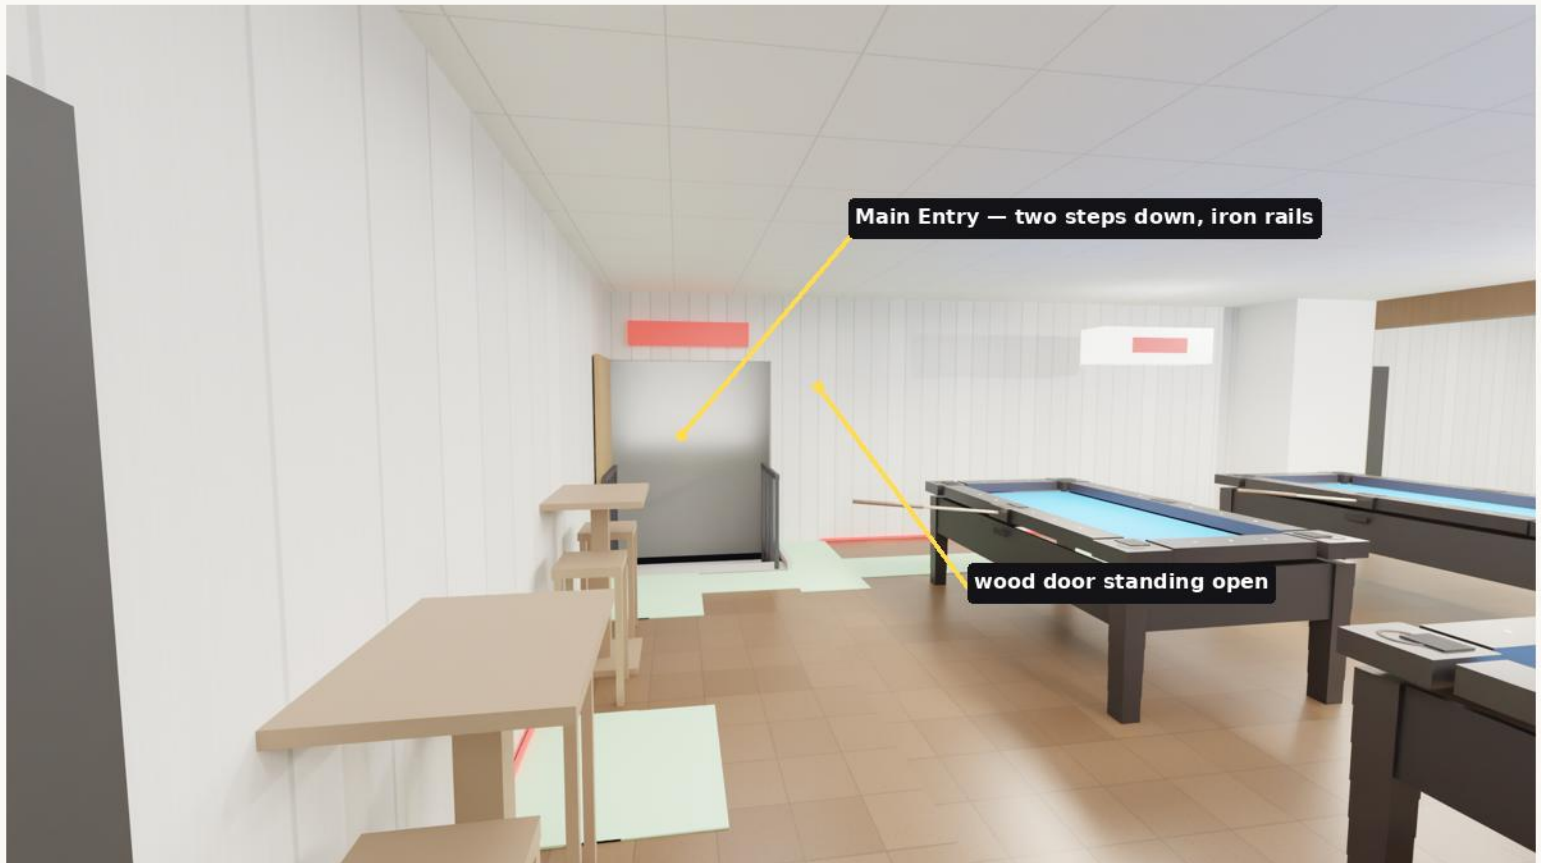


Inside the room at the southwest end, eye level, looking east toward the Main Entry

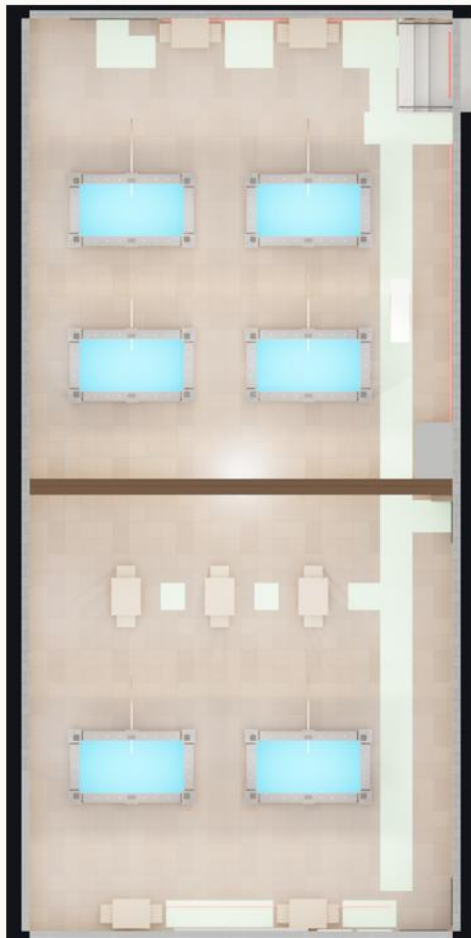

Overhead render

Pool Room — Four On Top — Turned Left

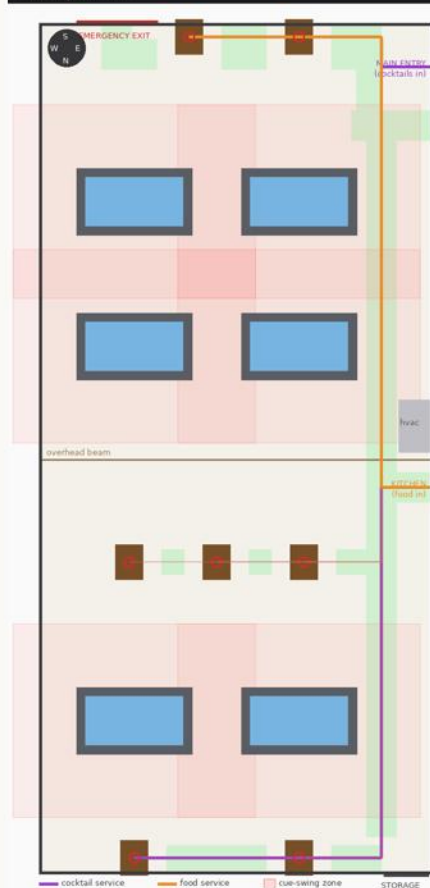


Service-flow diagram

In brief

- Both columns slide toward the left wall: the whole east side becomes service and standing room with full end swings.
- FLAG: the west end swings run hard against the wall — the cost of the slide.
- Cue room around the tables: most sides get about 47"; the shortest clearance is 37".

Tables single-file west; a round beside every table east




- Every table gets its own five-foot round at matching height — all six, per the brief.
- FLAG: the southernmost round crowds the Main Entry approach beside the stair rail.
- FLAG: one round sits partially in front of the kitchen door — accepted to keep its table paired.
- Cue room around the tables: most sides get about 55"; the shortest clearance is 39".

I · West Line — Shifted Down — west 1x6 low

The west line slid toward the bottom wall




Inside the room at the southwest end, eye level, looking east toward the Main Entry

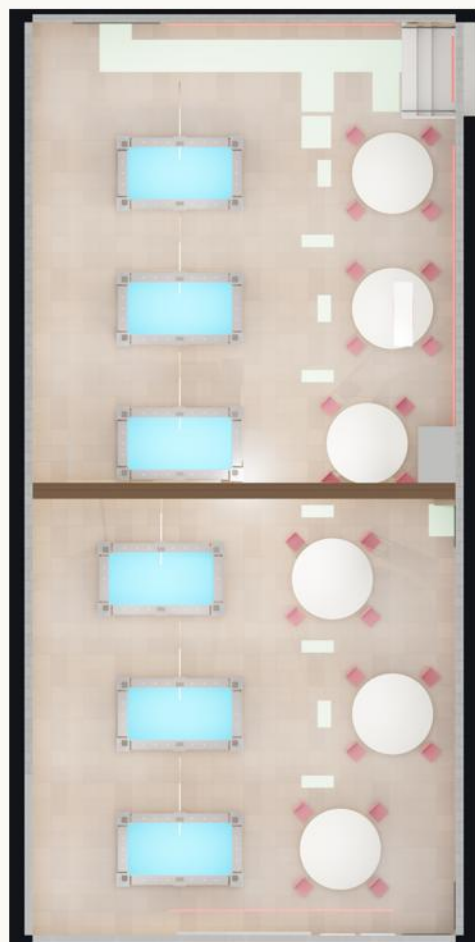

Overhead render

Pool Room — West Line — Shifted Down

The west line slid toward the bottom wall

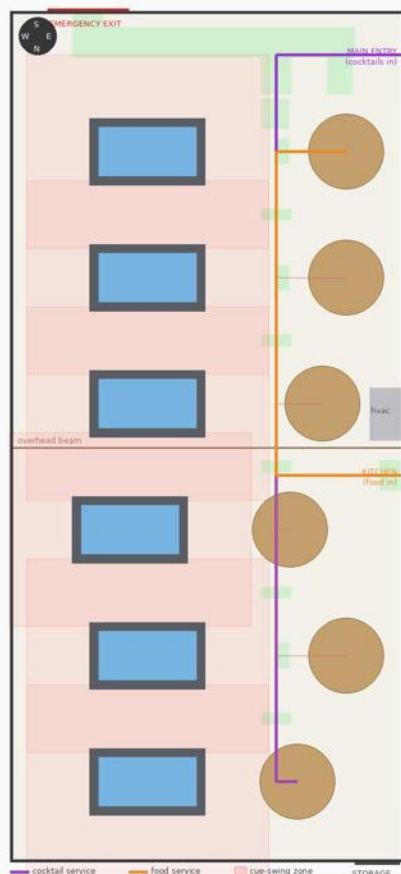


Service-flow diagram

In brief


- The entry end frees up: the sixth round reaches the east wall like the rest instead of pulling far inboard (its chairs still graze the approach corner).
- The third round pulls inboard to keep the kitchen door's wall approach clear; kitchen service still threads a squeeze between two rounds' chairs.
- FLAG: the bottom table's end swing runs tight against the bottom wall — the cost of the slide.
- Cue room around the tables: most sides get about 55"; the shortest clearance is 41".

A • Four On Top — center 2x3


Six tables; four rounds and a center fifth on the north end

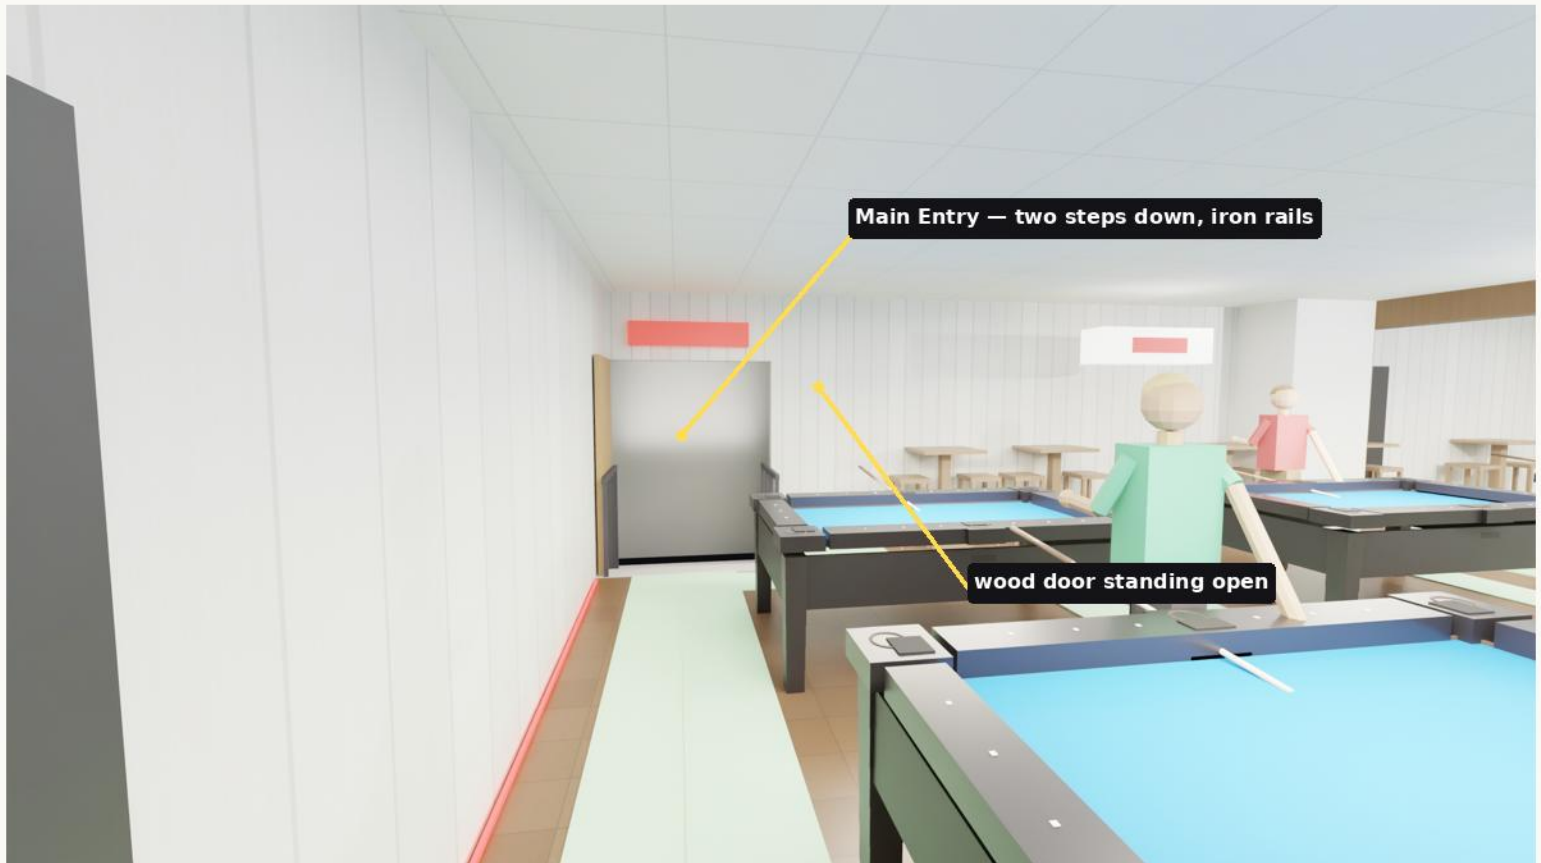

Inside the room at the southwest end, eye level, looking east toward the Main Entry

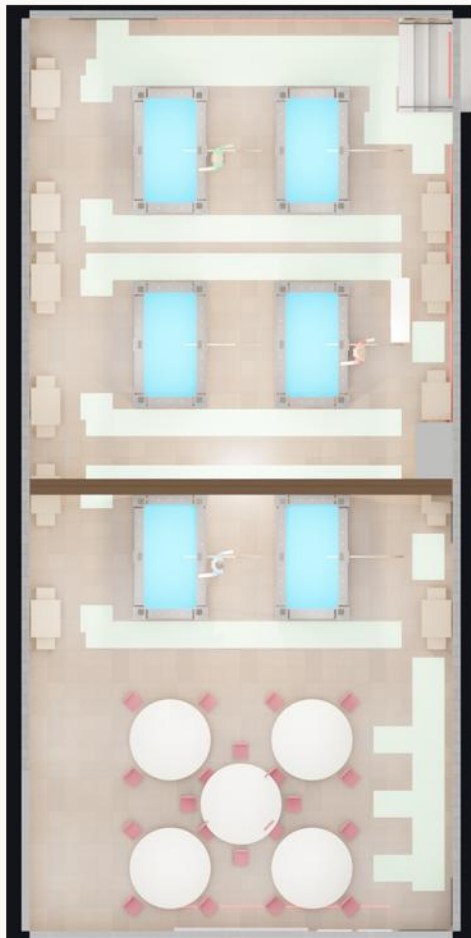

Overhead render

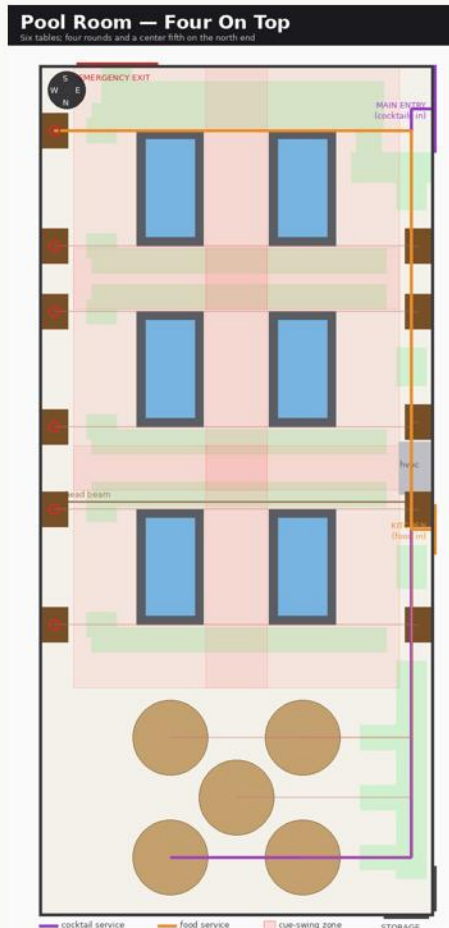

Service-flow diagram

In brief

- Four aligned rounds around a center fifth — one big social cluster that doubles as a tournament gallery facing the nearest table row.
- Wall two-tops flank every table row on both walls.
- The cluster runs deliberately tight, and the two-top by the kitchen door partially fronts it — both accepted.
- Cue room around the tables: most sides get about 60"; the shortest clearance is 56".

B · Four On Top — Turned — center 4+2


The same pattern with every table rotated sideways



Main Entry — two steps down, iron rails

wood door standing open


Inside the room at the southwest end, eye level, looking east toward the Main Entry

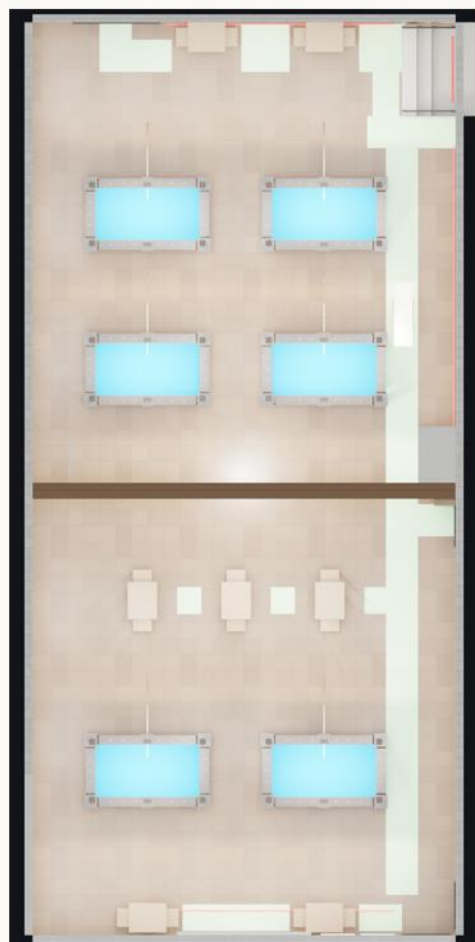

Overhead render

Pool Room — Four On Top — Turned

The same pattern with every table rotated sideways

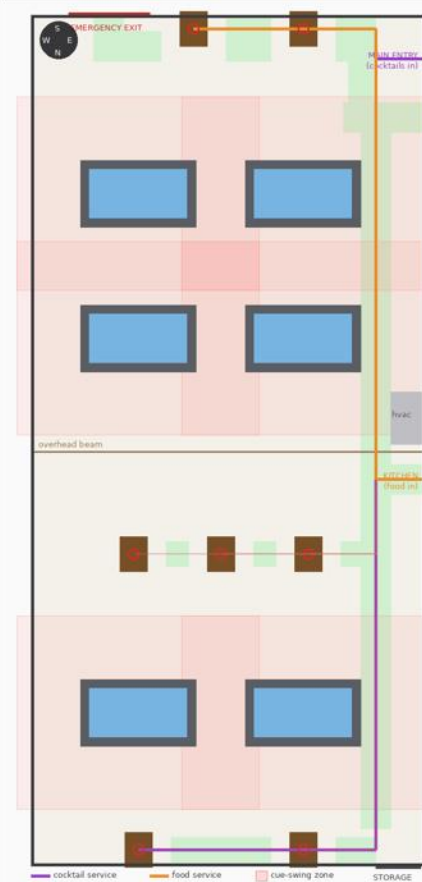


Service-flow diagram

In brief

- Four tables in a block at the top, two at the bottom, all turned ninety degrees.
- Two-top bands ride the top wall, the seam between the clusters, and the bottom wall — every table has seating at arm's reach.
- FLAG: the rotated ends run tight side-to-side; the west and center aisles are the practical maximum.
- Cue room around the tables: most sides get about 47"; the shortest clearance is 47".

E · Center Line — center 1×6

Six tables turned sideways, end-to-end down the middle

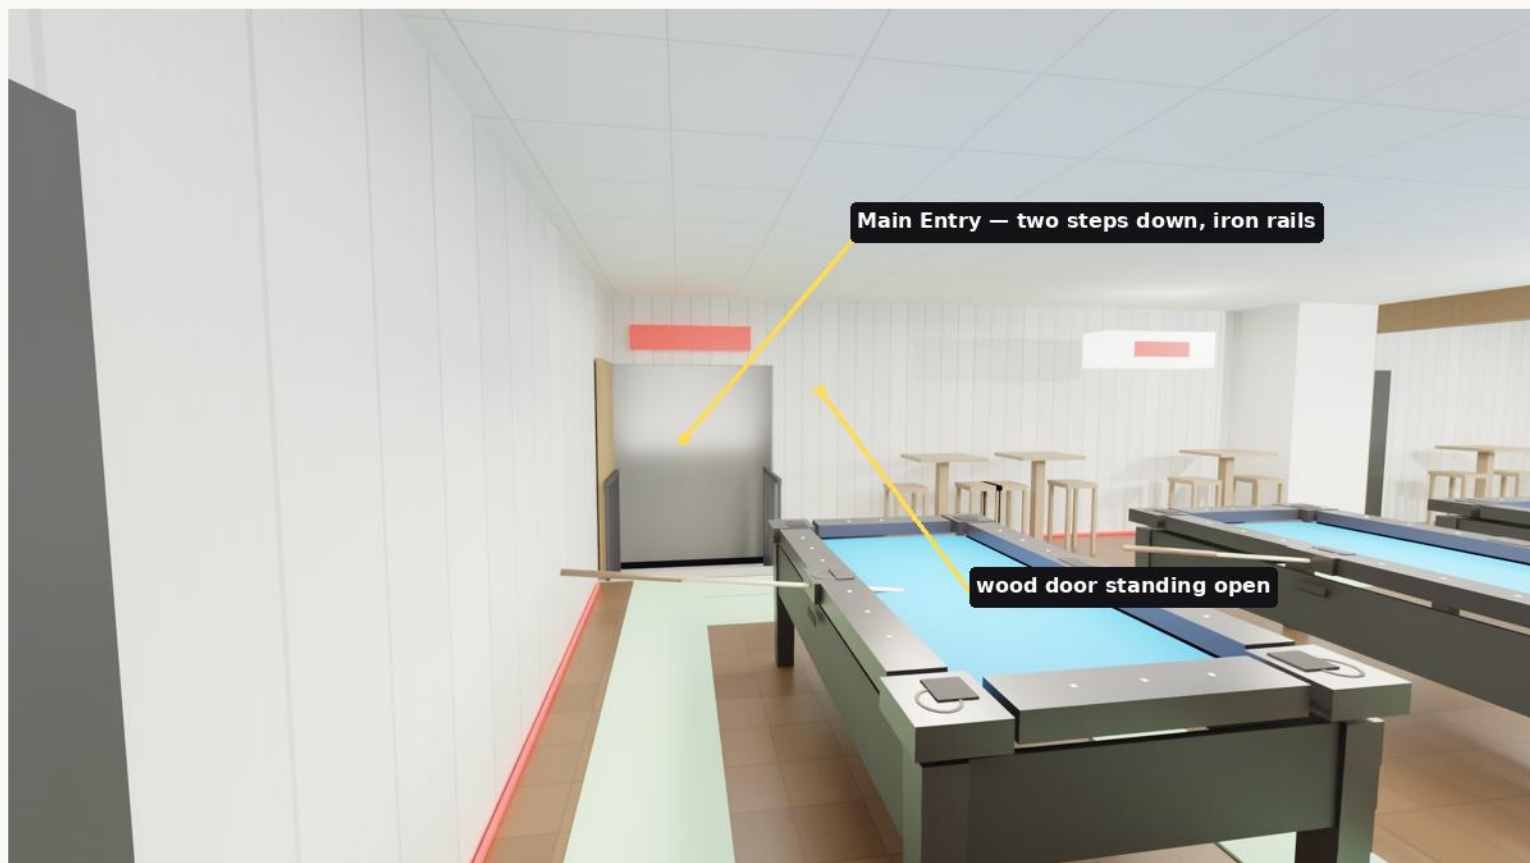


Inside the room at the southwest end, eye level, looking east toward the Main Entry



Overhead render

Pool Room — Center Line

the tables turned sideways, end-to-end down the middle

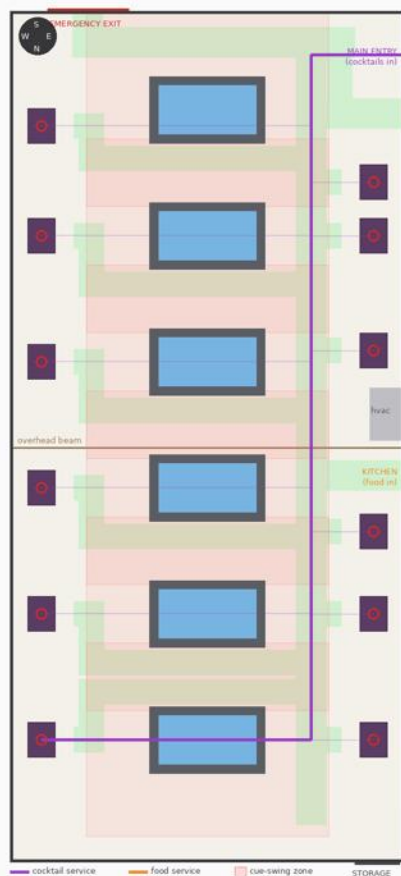


Service-flow diagram

In brief


- Every table on display from the full-length side aisles.
- The service lane runs inboard, between the table ends and the east wall tops — the wall lane pinched.
- Side-to-side swings between neighbours run tight; the table ends get full room.
- Cue room around the tables: most sides get about 74"; the shortest clearance is 55".

D • Four On Top — Turned Right — right 4+2

The turned pattern slid right

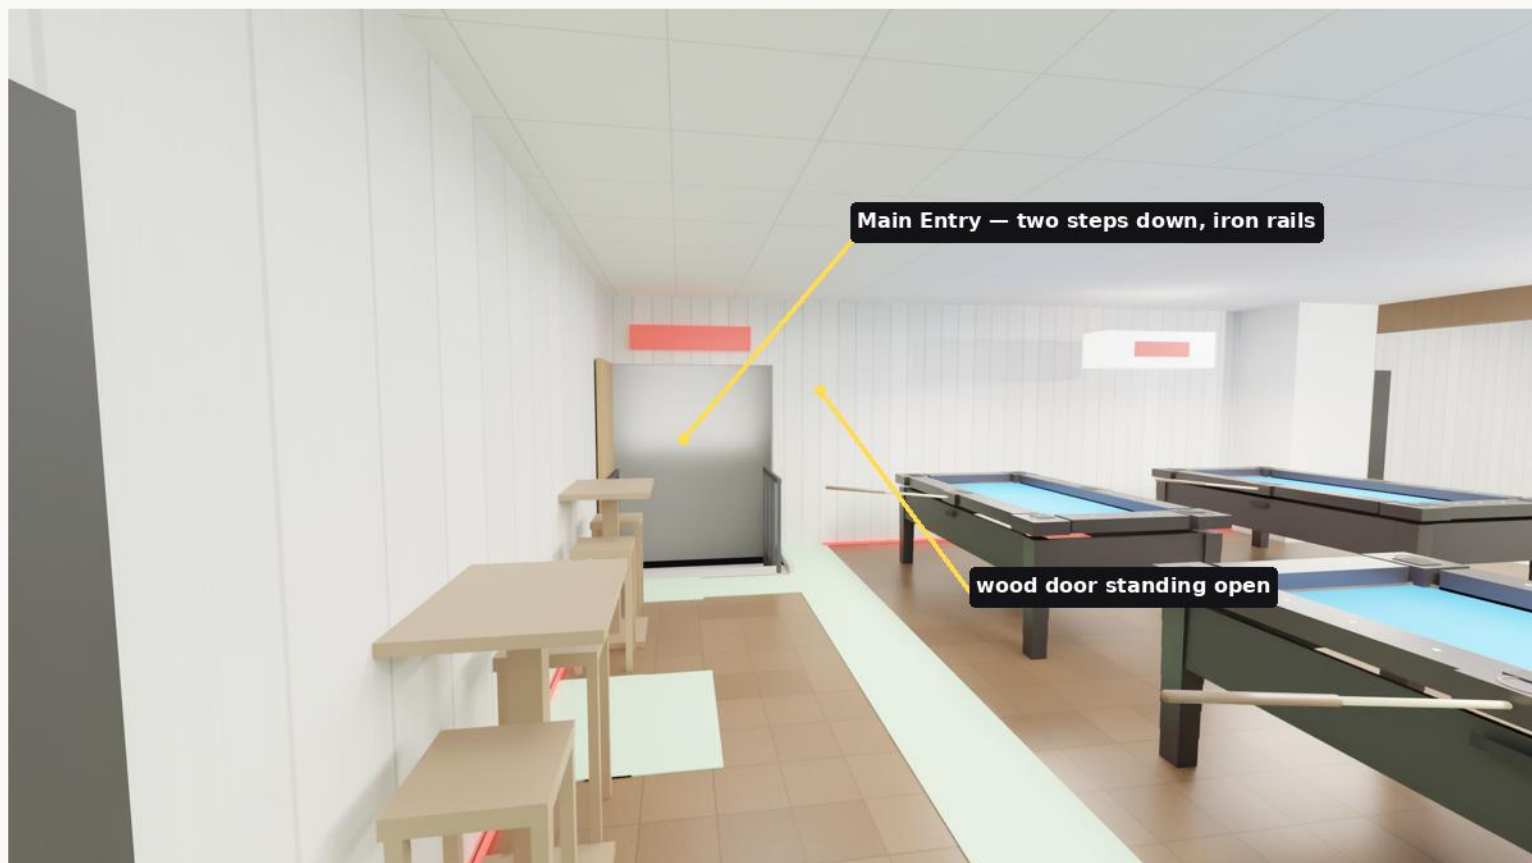


Inside the room at the southwest end, eye level, looking east toward the Main Entry

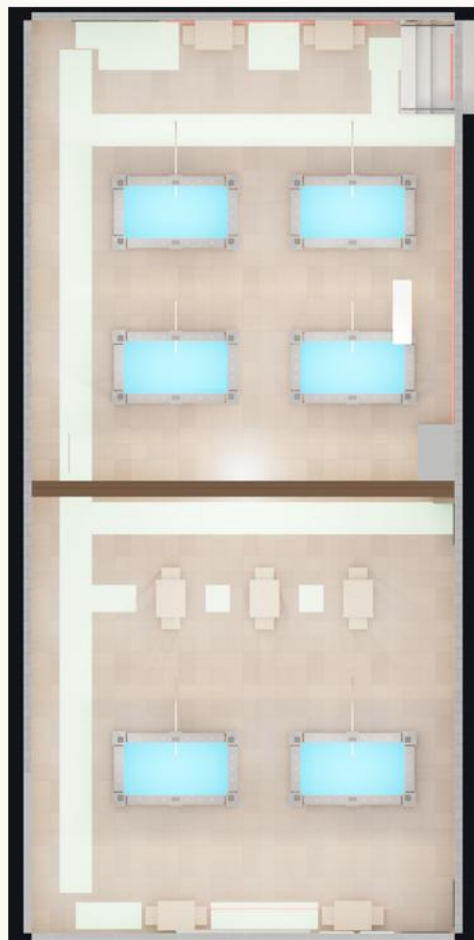

Overhead render

Pool Room — Four On Top — Turned Right

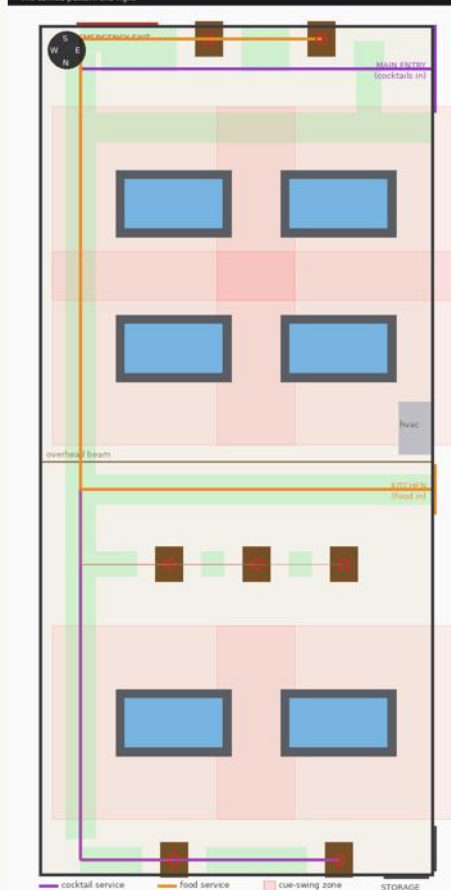


Service-flow diagram

In brief

- Both columns slide toward the right wall, as far as the chase and entry well allow; the west side becomes service and standing room with full end swings.
- FLAG: the east end swings run hard toward the wall — the cost of the slide.
- Cue room around the tables: most sides get about 47"; the shortest clearance is 37".

F · East Line + West Lounge — east 1x6


Tables single-file on the east; six aligned rounds west

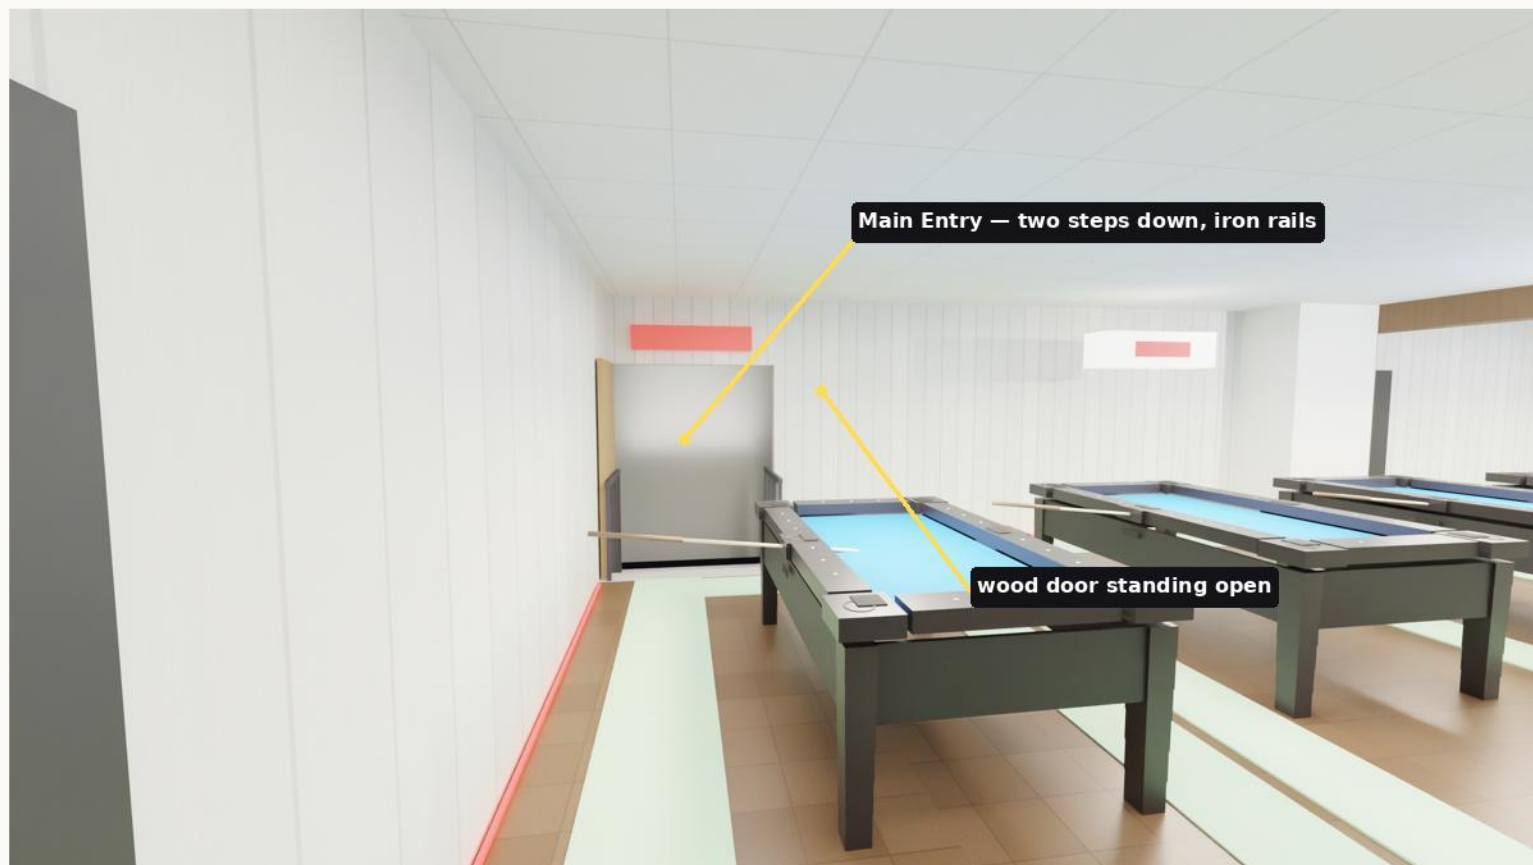

Main Entry — two steps down, iron rails

wood door standing open


Inside the room at the southwest end, eye level, looking east toward the Main Entry

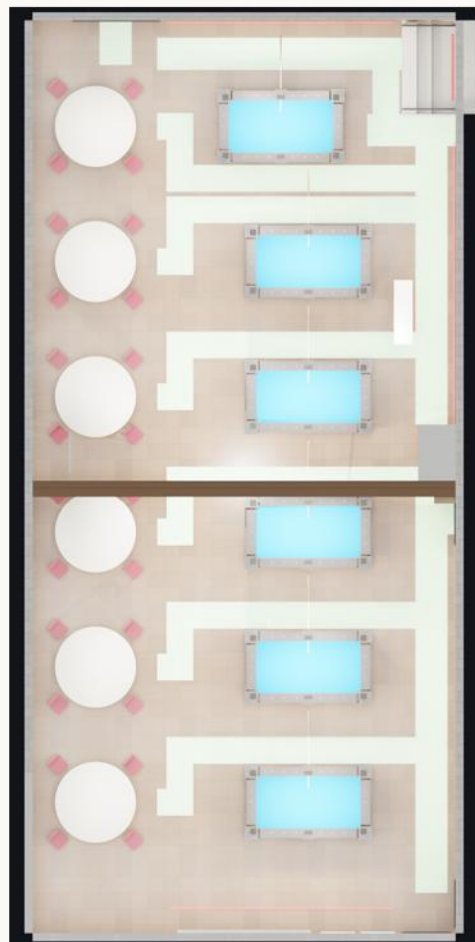

Overhead render

Pool Room — East Line + West Lounge

Tables single-file on the east; six aligned rounds west

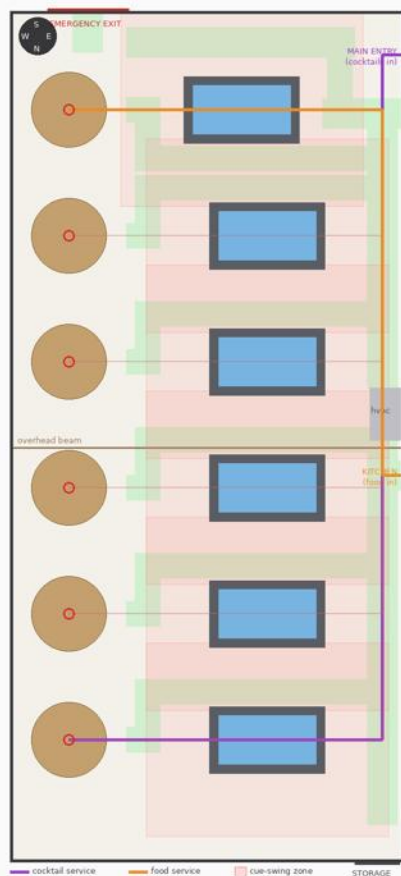


Service-flow diagram

In brief


- Six rounds in one line down the west side, each on its table's centerline.
- FLAG: the southernmost round narrows the Emergency Exit approach — the walk bends around its chairs.
- Every delivery crosses the table line — hospitality sits opposite the doors.
- Cue room around the tables: most sides get about 55"; the shortest clearance is 55".

G · East Line — Shifted Down — east 1x6 low

The east line slid toward the bottom wall

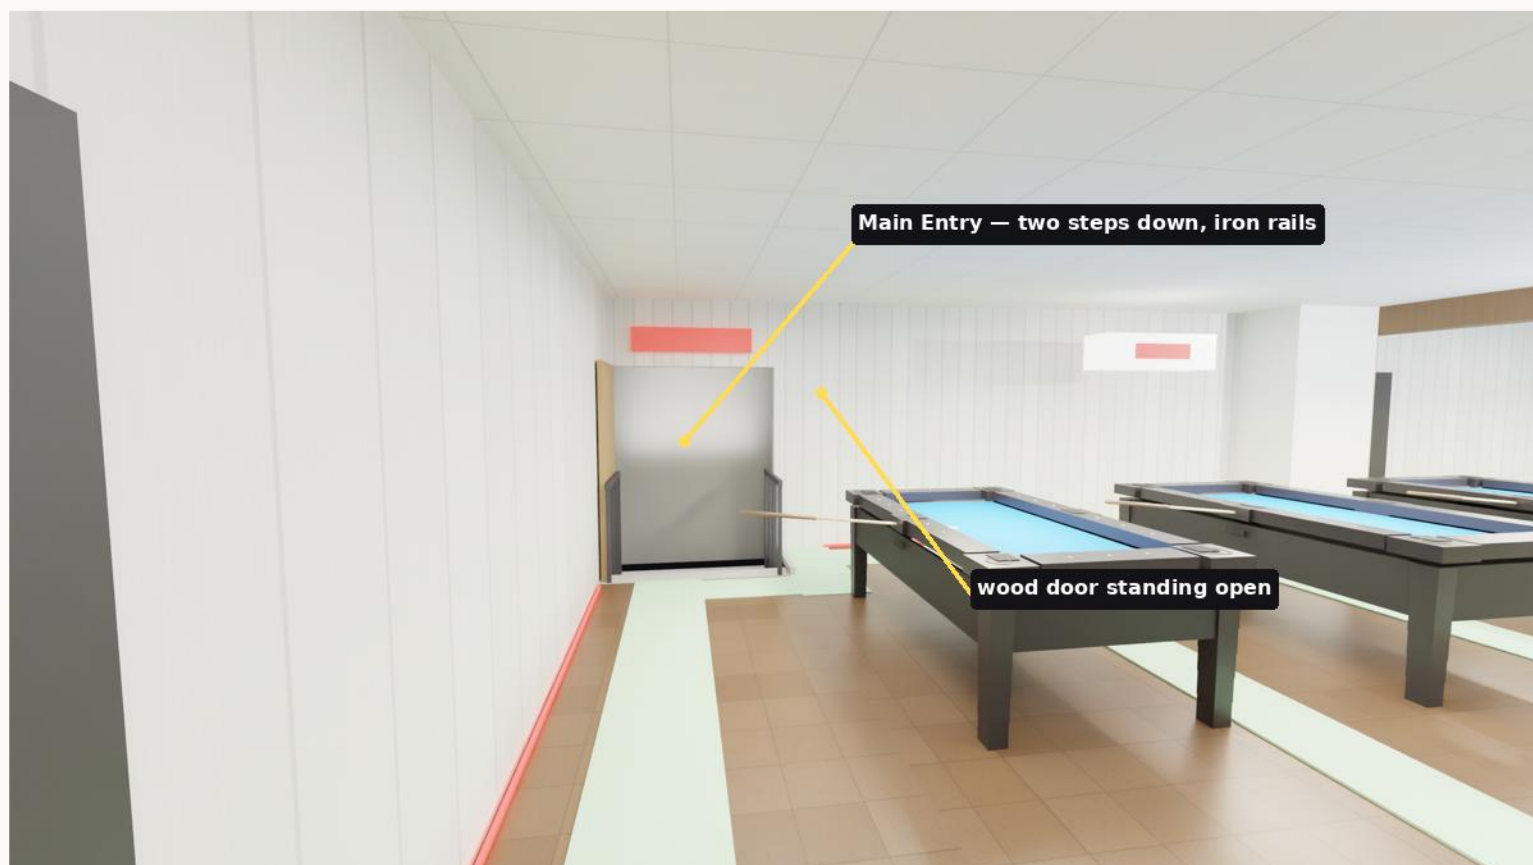


Inside the room at the southwest end, eye level, looking east toward the Main Entry

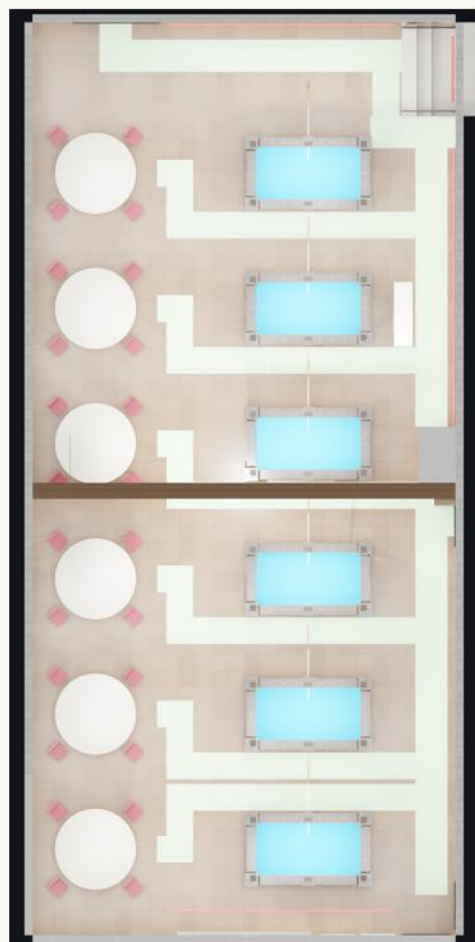

Overhead render

Pool Room — East Line — Shifted Down

The east line slid toward the bottom wall

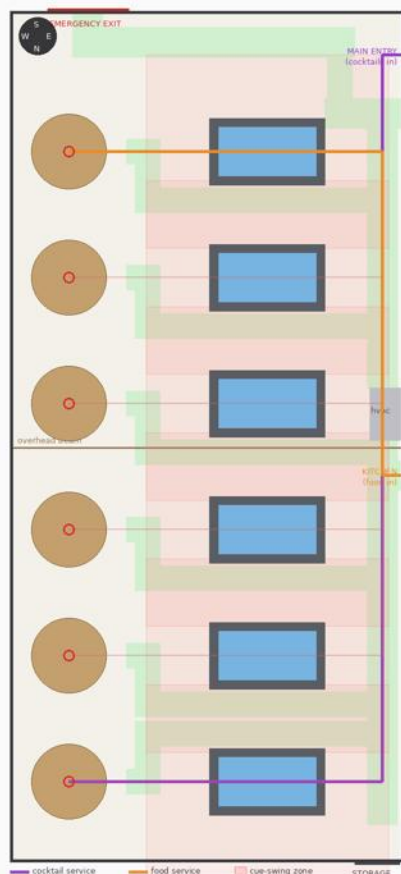

Service-flow diagram

In brief

- The top table rejoins the straight line and every compromise at the entry end dissolves — all six rounds sit on their centerlines at the wall, clear of the exit approach.
- FLAG: the bottom table's end swing runs tight against the bottom wall — the cost of the slide.
- Cue room around the tables: most sides get about 55"; the shortest clearance is 43".

Closing thoughts — if this, then that

The room decides nothing; the house's priorities do. Read these as directions, not verdicts.

If bar and kitchen revenue leads

Four On Top (A) — by far the most seated hospitality, a two-top at every row end, and it flips to a banquet for free. Runner-up: any of the line layouts (F-I).

If serious play leads

Center Line (E) — every table on display with the roomiest typical clearance in the set, at the price of tight side-to-side between neighbours; A is the classic-room alternative with the fewest compromised sides.

If service simplicity leads

West Line (H, I) — zero cue-crossing service conflicts and the shortest food runs anywhere: hospitality sits along the service wall.

If a clear, welcoming entry leads

The shifted lines (G, I) — the whole line slides away from the entrance, so the door end opens up and every entry-side compromise dissolves; G audits cleanest of the whole set.

If the clustered showroom look leads

The turned trio (B, C, D) — four tables in a block reads dramatic from the door and every cluster gets its own seating band; accept the tightest end swings and the thinnest seating in the set.

If events and spectating lead

Four On Top (A) — the five-round cluster doubles as a gallery facing the nearest row; East Line (F, G) seats a watching row the full length of the room.

If nothing is settled yet

Hold A and one line layout (G or I) as the short list: they bracket the trade-space — maximum hospitality vs maximum play-and-service clarity — and both pass every safety and walking audit.