


# Pool Room — Nine Layout Options

Overview & contents — letters are names, not rankings; columns group where the tables sit: left · center · right

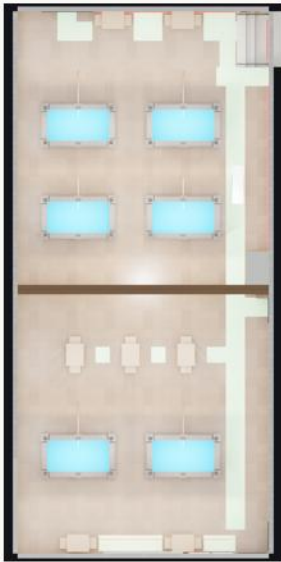


**C. left 4+2**

p. 2




**A. center 2x3**

p. 5

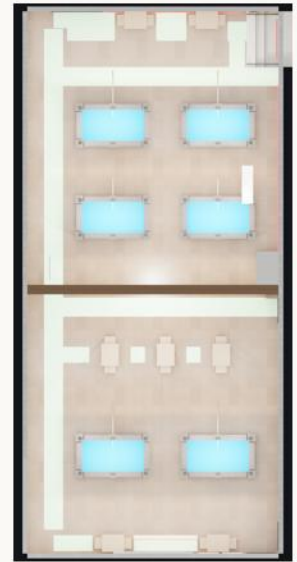


**D. right 4+2**

p. 8

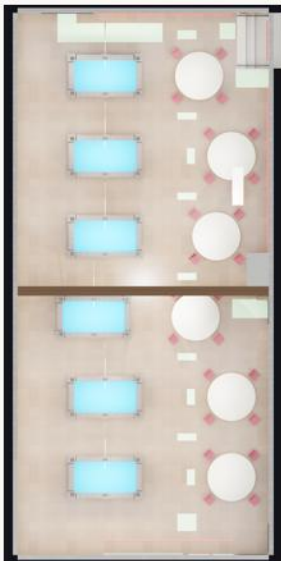


**H. west 1x6**

p. 3

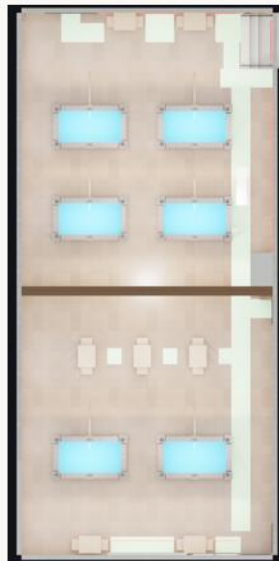


**B. center 4+2**

p. 6

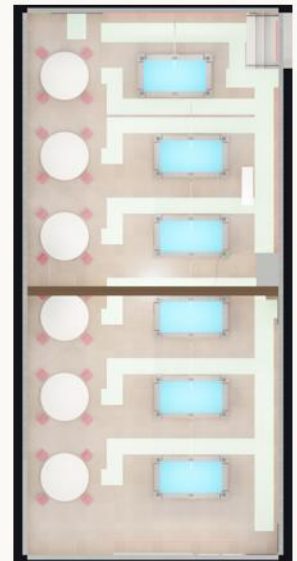


**F. east 1x6**

p. 9

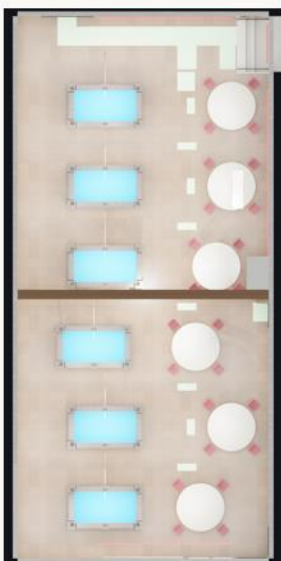


**I. west 1x6 low**

p. 4

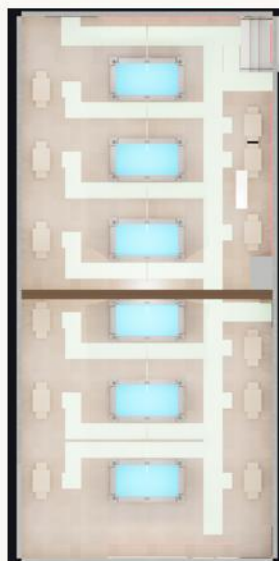

**E. center 1x6**

p. 7

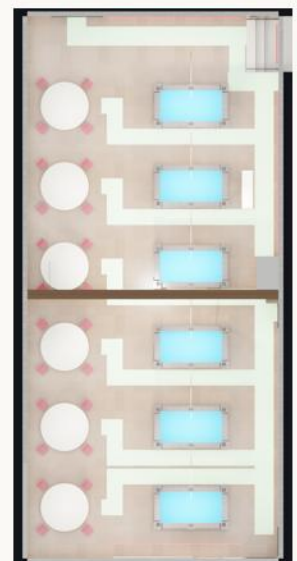


**G. east 1x6 low**

p. 10

# C · Four On Top — Turned Left — left 4+2


The turned pattern slid left

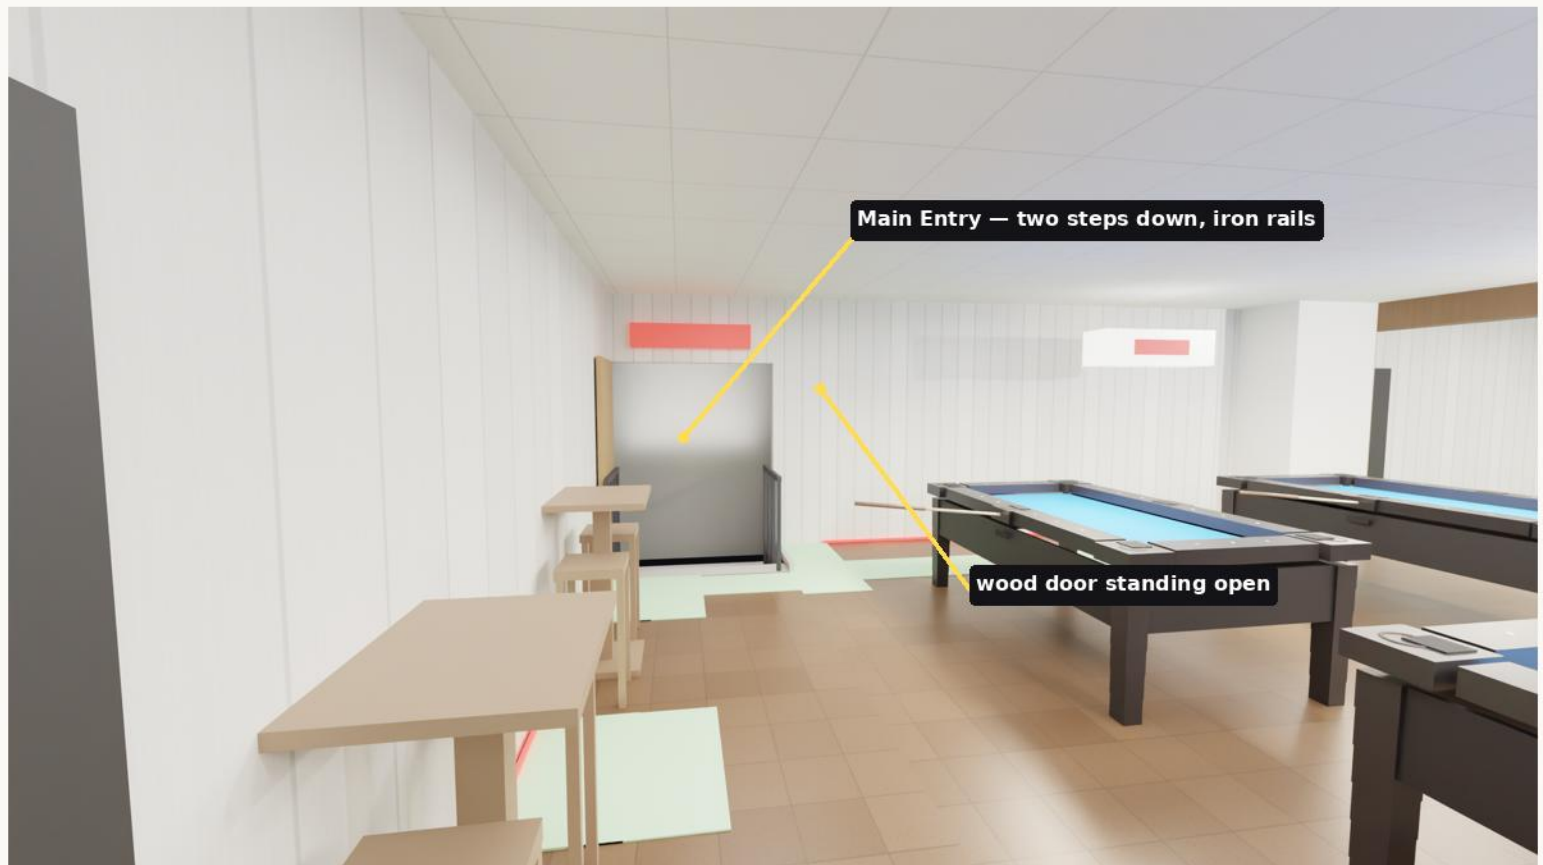

Main Entry — two steps down, iron rails


wood door standing open

Inside the room at the southwest end, eye level, looking east toward the Main Entry

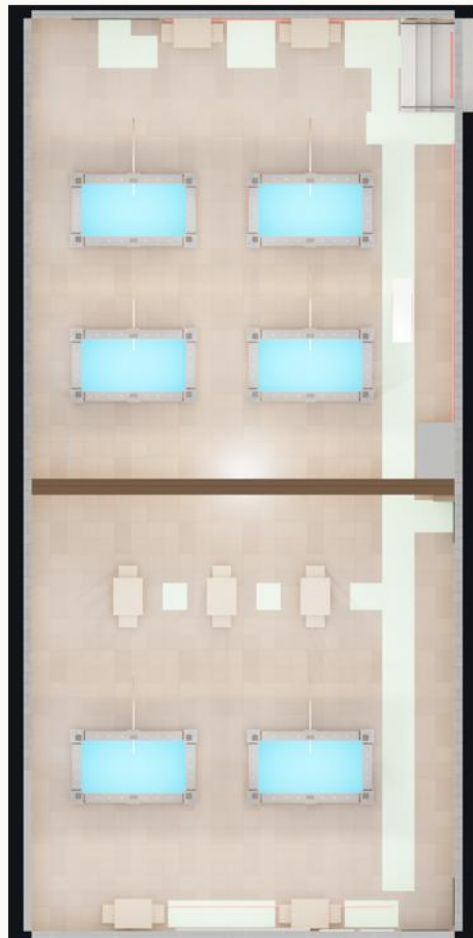

Overhead render

## Pool Room — Four On Top — Turned Left

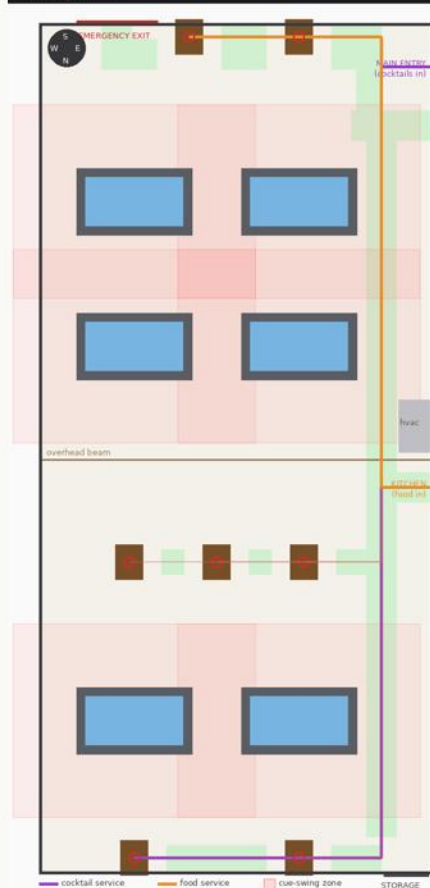

Service-flow diagram

## Pros

- Both columns slide toward the left wall: the whole east side becomes service and standing room with full end swings.

## Cons

- the west end swings run hard against the wall — the cost of the slide.


Cue room: most sides about 47";  
shortest clearance 37".

# H · West Line + Wall Rounds — west 1x6


Tables single-file west; a round beside every table east



Inside the room at the southwest end, eye level, looking east toward the Main Entry

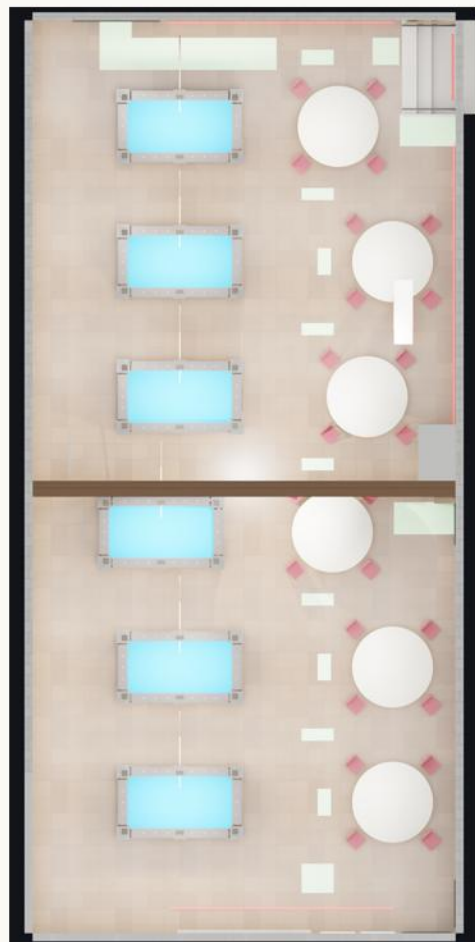

Overhead render

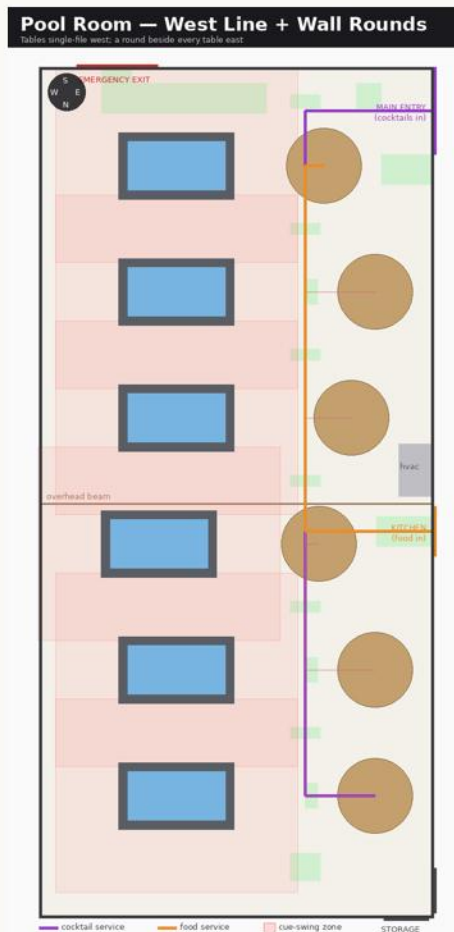

Service-flow diagram

## Pros

- Every table gets its own five-foot round at matching height — all six, per the brief.

## Cons

- the southernmost round crowds the Main Entry approach beside the stair rail.
- one round sits partially in front of the kitchen door — accepted to keep its table paired.

Cue room: most sides about 55"; shortest clearance 39".




# I · West Line — Shifted Down — west 1x6 low

The west line slid toward the bottom wall




Inside the room at the southwest end, eye level, looking east toward the Main Entry

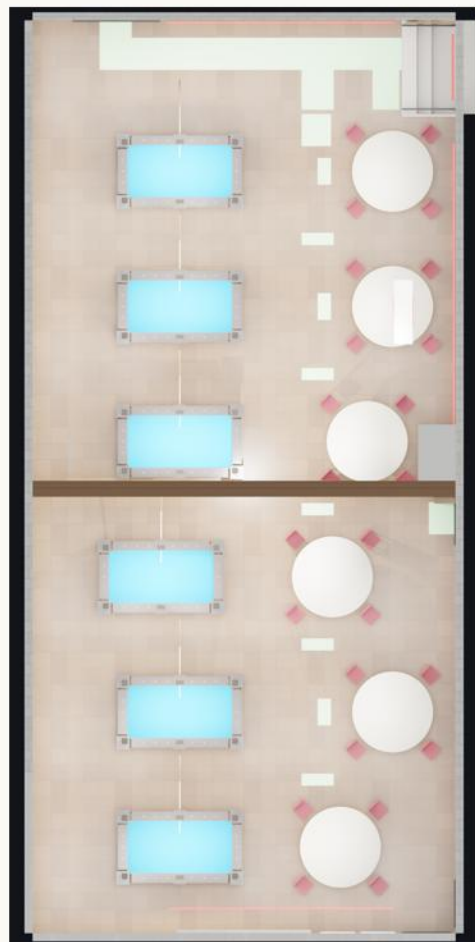

Overhead render

## Pool Room — West Line — Shifted Down

The west line slid toward the bottom wall

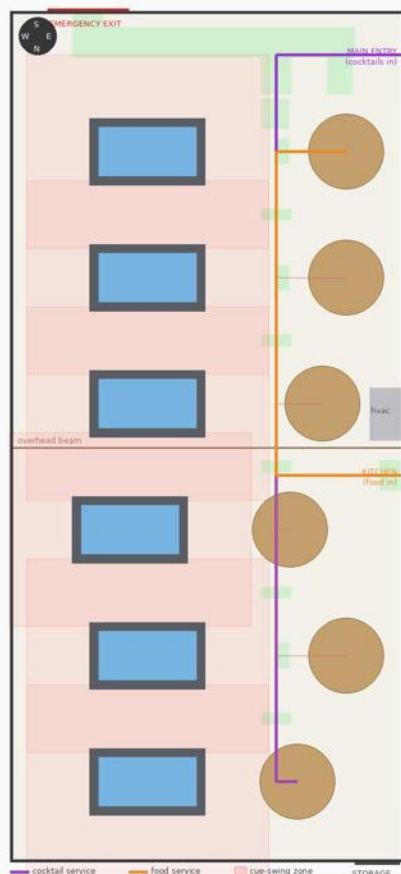

Service-flow diagram

## Pros

- The entry end frees up: the sixth round reaches the east wall like the rest instead of pulling far inboard (its chairs still graze the approach corner).


## Cons

- The third round pulls inboard to keep the kitchen door's wall approach clear; kitchen service still threads a squeeze between two rounds' chairs.
- the bottom table's end swing runs tight against the bottom wall — the cost of the slide.


Cue room: most sides about 55"; shortest clearance 41".

# A • Four On Top — center 2x3


Six tables; four rounds and a center fifth on the north end

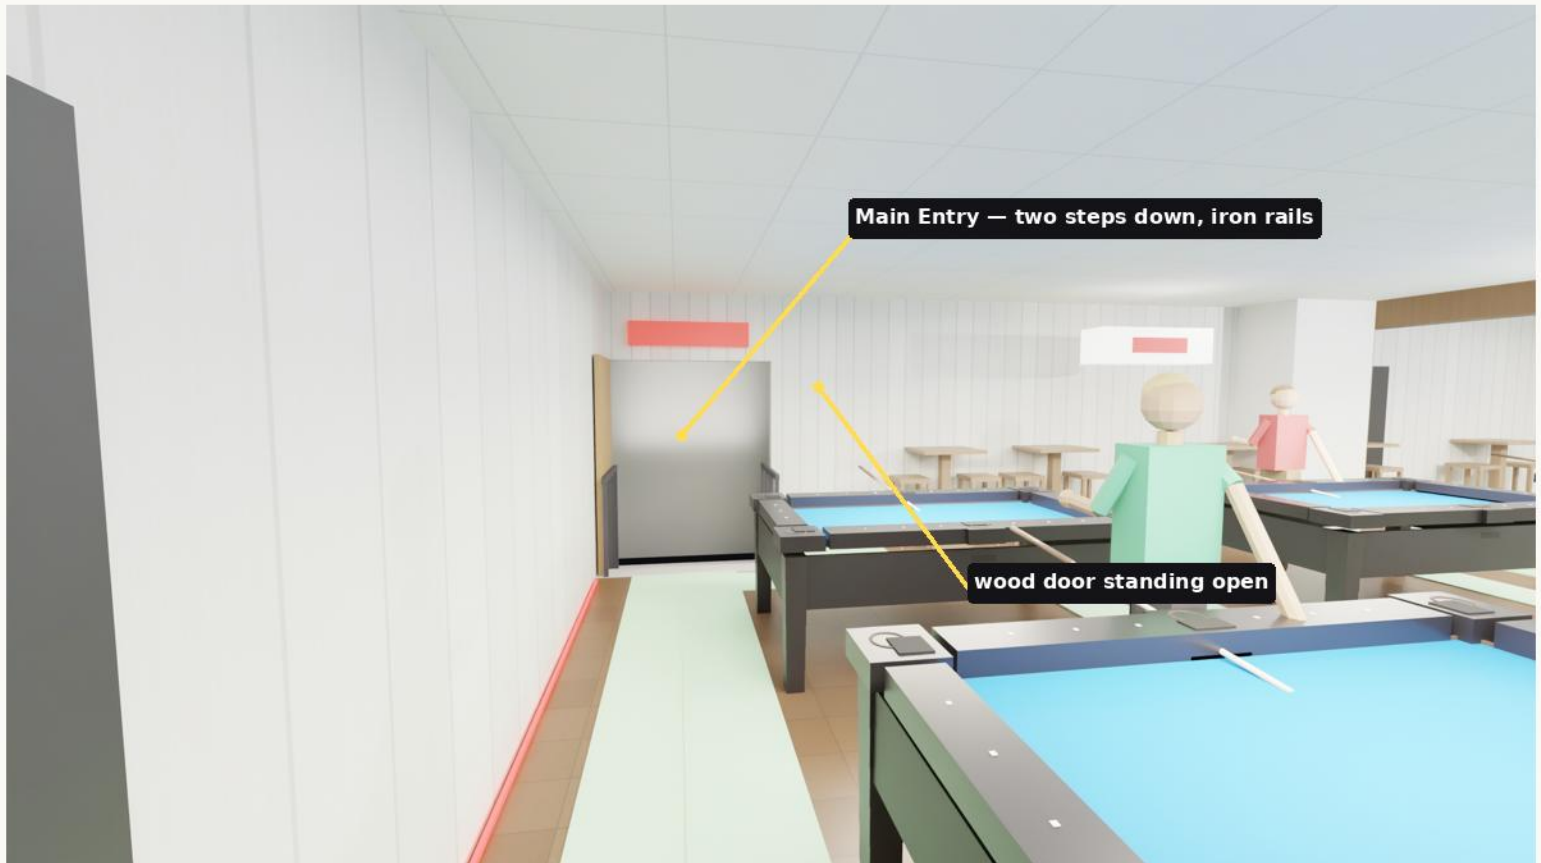

Inside the room at the southwest end, eye level, looking east toward the Main Entry

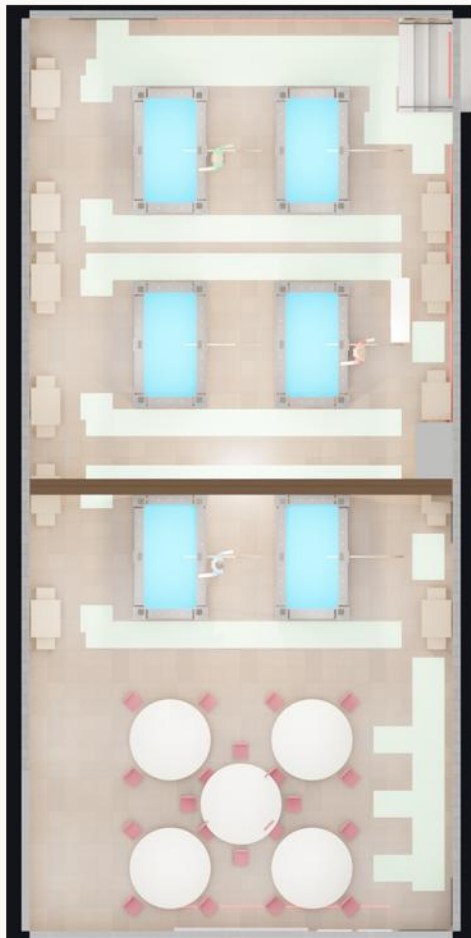

Overhead render

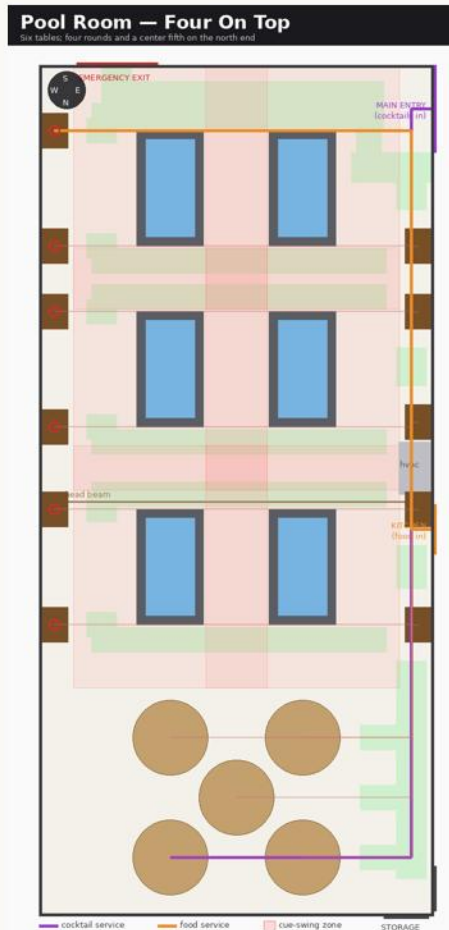

Service-flow diagram

## Pros

- Four aligned rounds around a center fifth — one big social cluster that doubles as a tournament gallery facing the nearest table row.
- Wall two-tops flank every table row on both walls.

## Cons

- The cluster runs deliberately tight, and the two-top by the kitchen door partially fronts it — both accepted.


Cue room: most sides about 60"; shortest clearance 56".

# B · Four On Top — Turned — center 4+2


The same pattern with every table rotated sideways



Inside the room at the southwest end, eye level, looking east toward the Main Entry

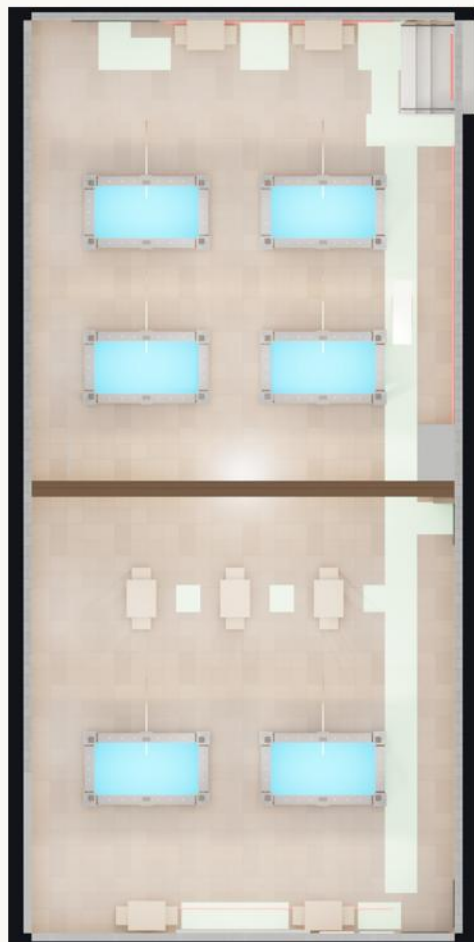

Overhead render

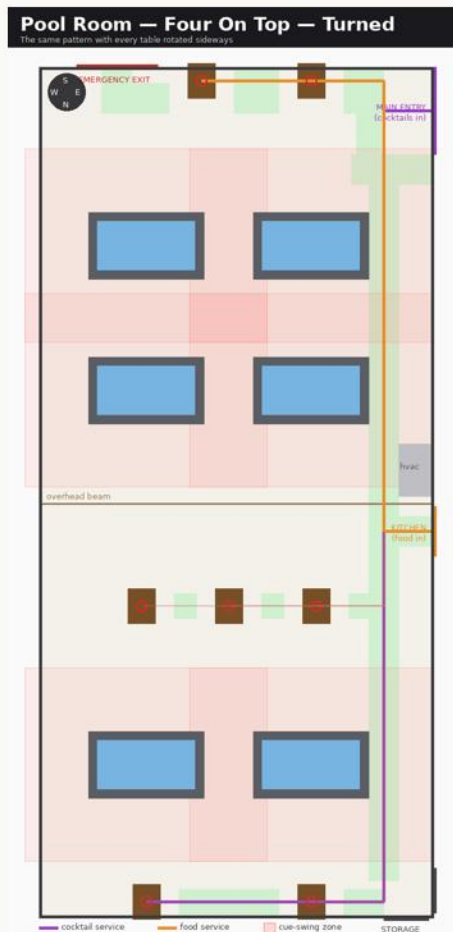

Service-flow diagram

## Pros

- Four tables in a block at the top, two at the bottom, all turned ninety degrees.
- Two-top bands ride the top wall, the seam between the clusters, and the bottom wall — every table has seating at arm's reach.

## Cons


- the rotated ends run tight side-to-side; the west and center aisles are the practical maximum.

Cue room: most sides about 47"; shortest clearance 47".



# E · Center Line — center 1x6

Six tables turned sideways, end-to-end down the middle

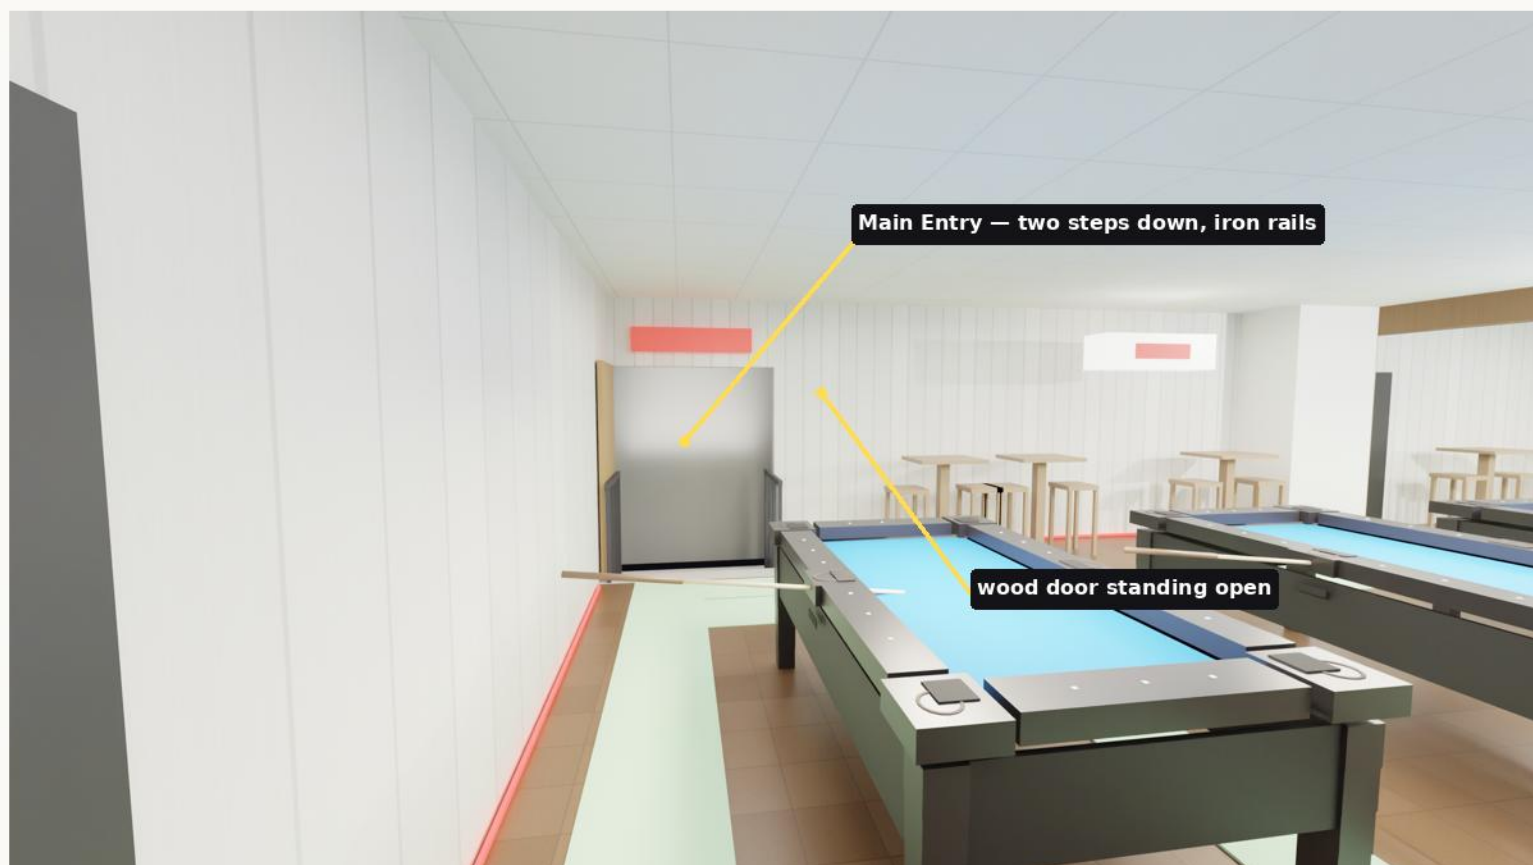

Main Entry — two steps down, iron rails

wood door standing open


Inside the room at the southwest end, eye level, looking east toward the Main Entry



Overhead render

## Pool Room — Center Line

Six tables turned sideways, end-to-end down the middle

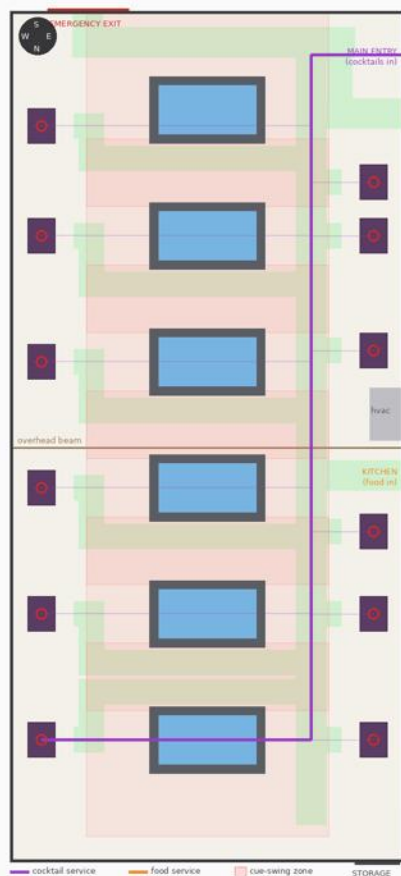

Service-flow diagram

## Pros

- Every table on display from the full-length side aisles.
- The service lane runs inboard, between the table ends and the east wall tops — the wall lane pinched.


## Cons

- Side-to-side swings between neighbours run tight; the table ends get full room.

Cue room: most sides about 74"; shortest clearance 55".

# D • Four On Top — Turned Right — right 4+2


The turned pattern slid right

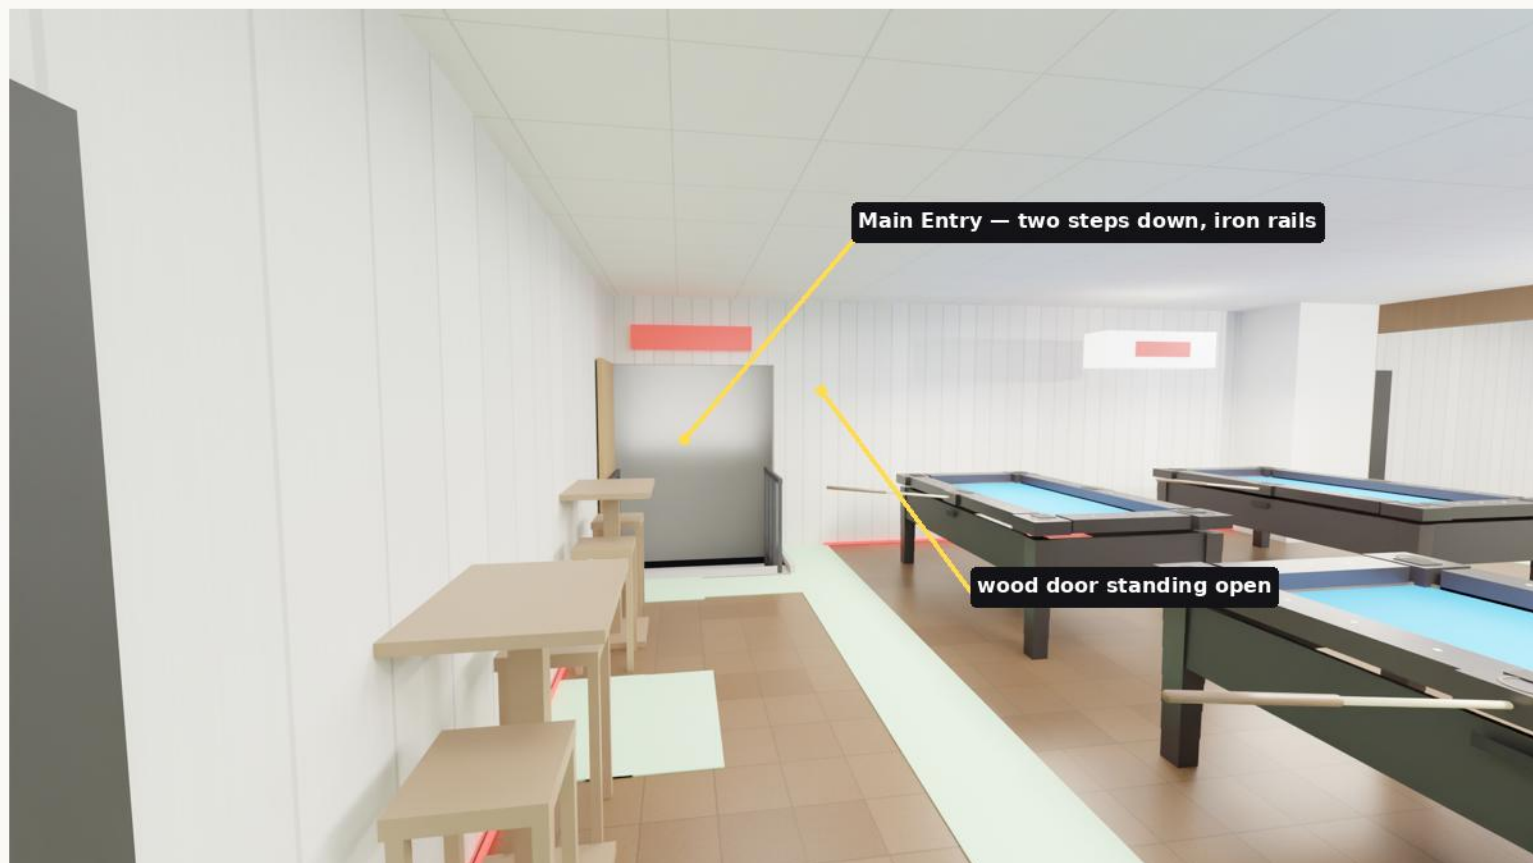

Main Entry — two steps down, iron rails


wood door standing open

Inside the room at the southwest end, eye level, looking east toward the Main Entry

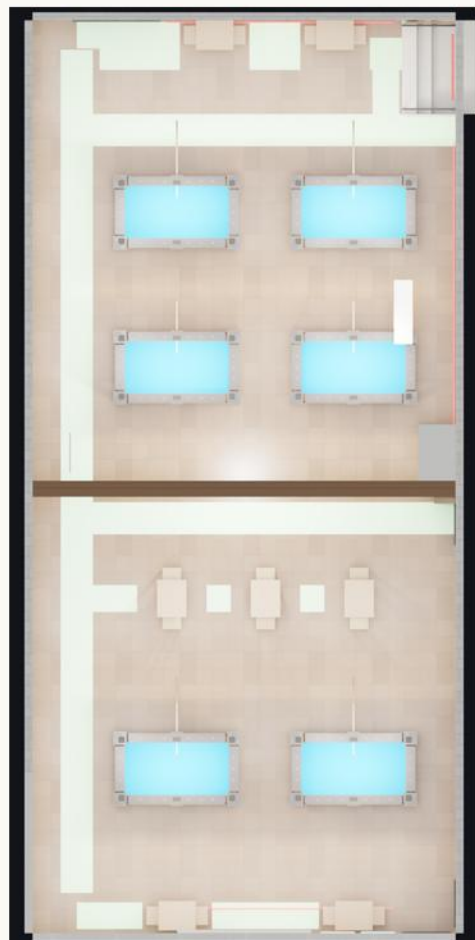

Overhead render

## Pool Room — Four On Top — Turned Right

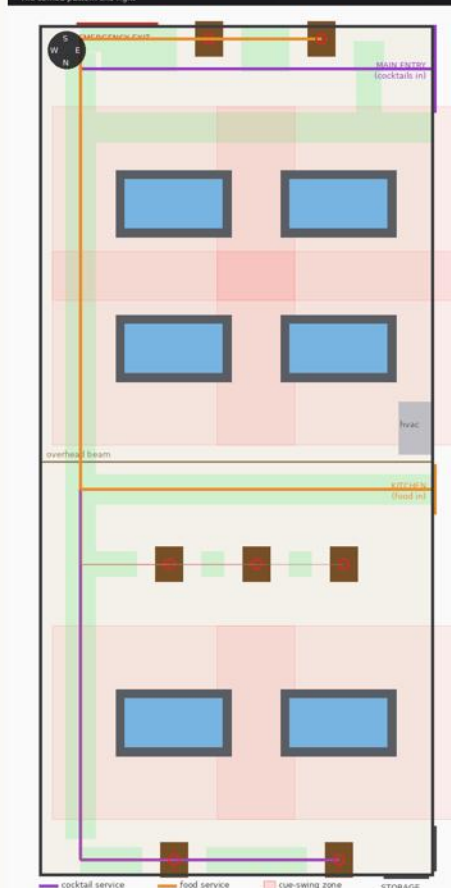

Service-flow diagram

## Pros

- Both columns slide toward the right wall, as far as the chase and entry well allow; the west side becomes service and standing room with full end swings.

## Cons


- the east end swings run hard toward the wall — the cost of the slide.

Cue room: most sides about 47";  
shortest clearance 37".



# F · East Line + West Lounge — east 1x6


Tables single-file on the east; six aligned rounds west

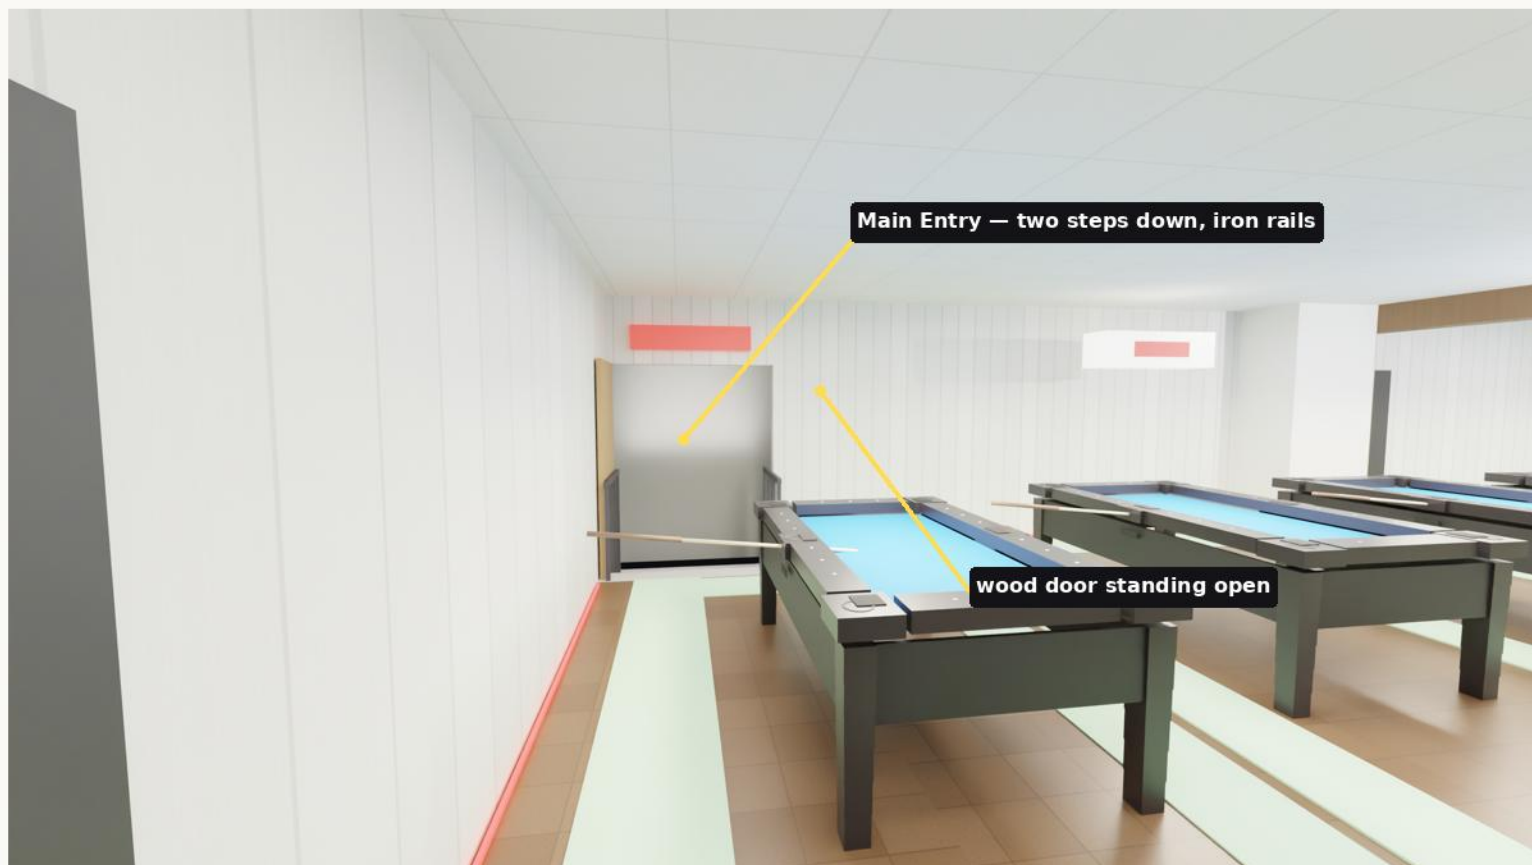

Inside the room at the southwest end, eye level, looking east toward the Main Entry



Overhead render

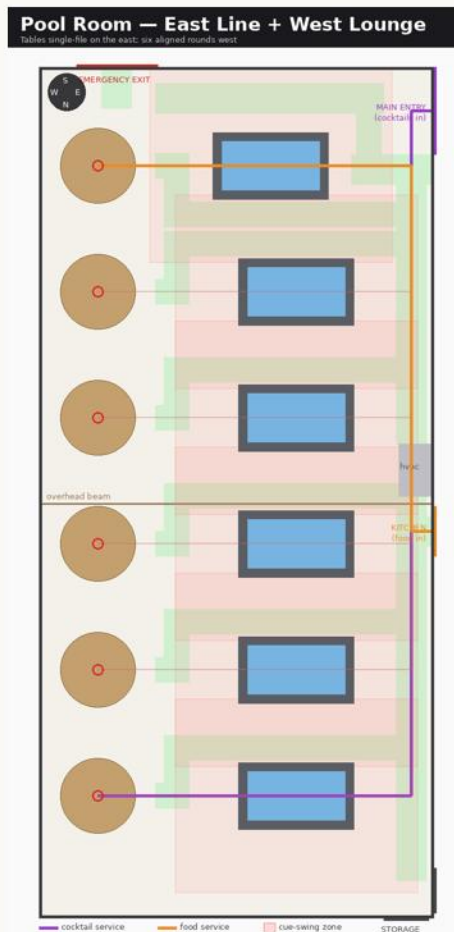

Service-flow diagram

## Pros

- Six rounds in one line down the west side, each on its table's centerline.


## Cons

- the southernmost round narrows the Emergency Exit approach — the walk bends around its chairs.
- Every delivery crosses the table line — hospitality sits opposite the doors.


Cue room: most sides about 55"; shortest clearance 55".

# G · East Line — Shifted Down — east 1x6 low


The east line slid toward the bottom wall

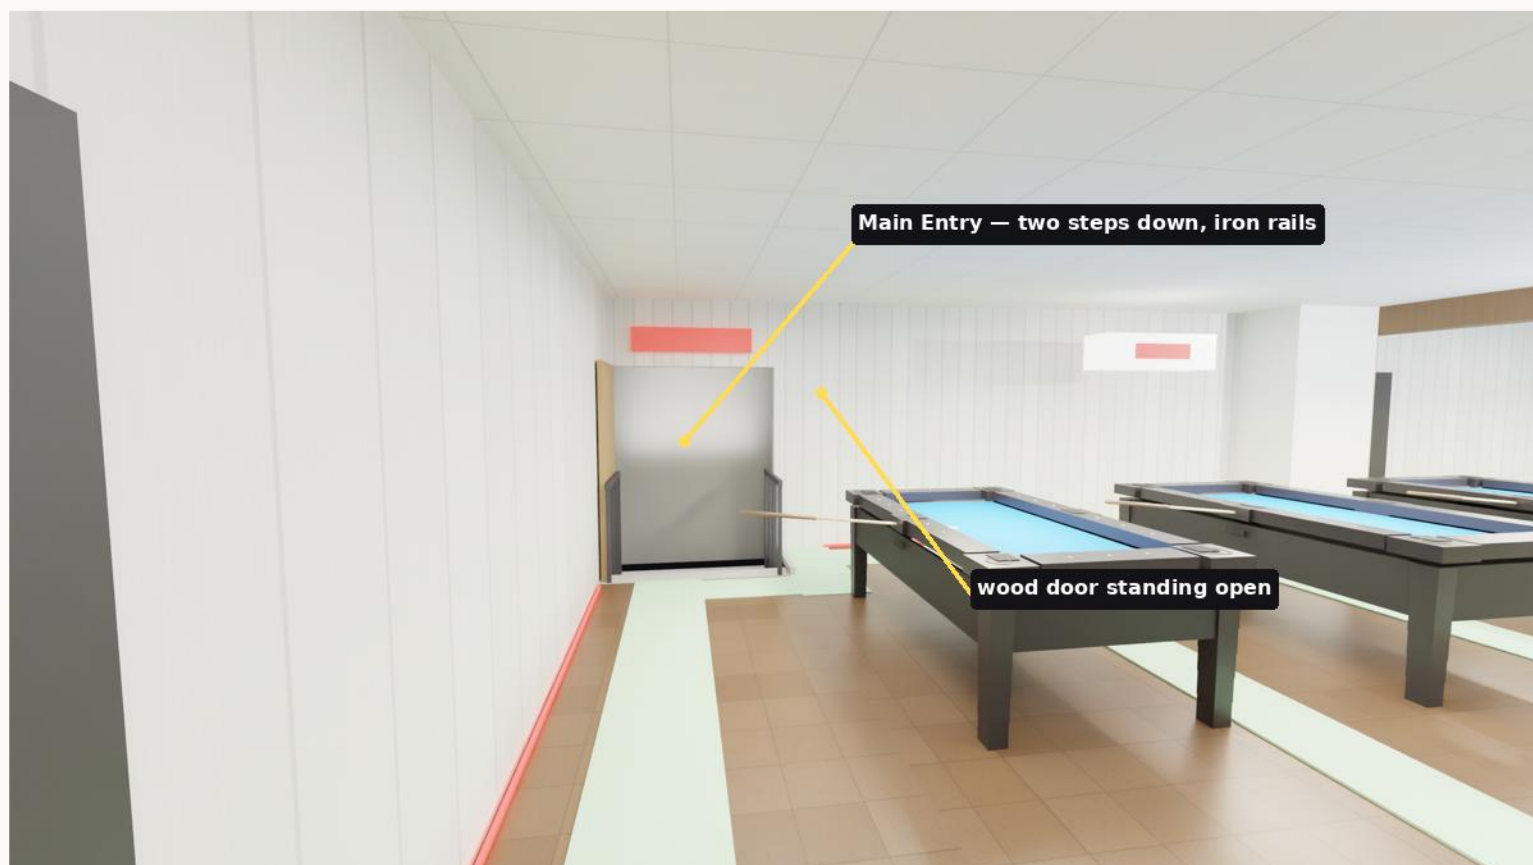

Inside the room at the southwest end, eye level, looking east toward the Main Entry

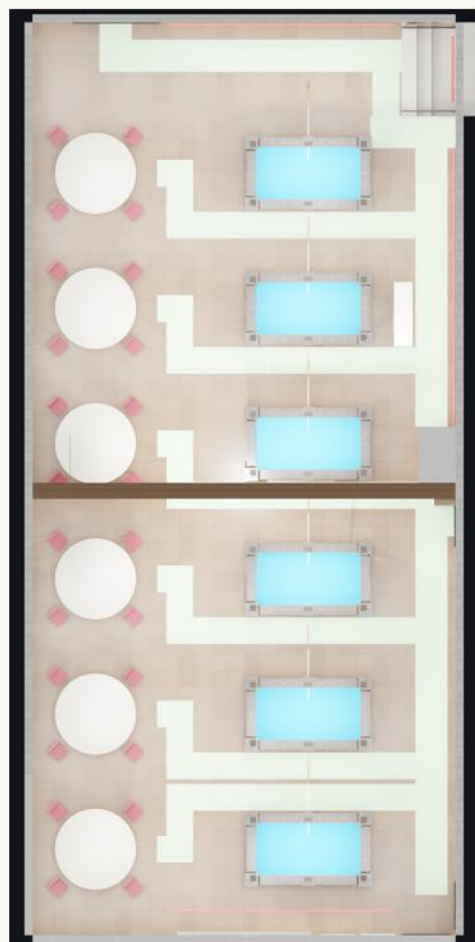

Overhead render

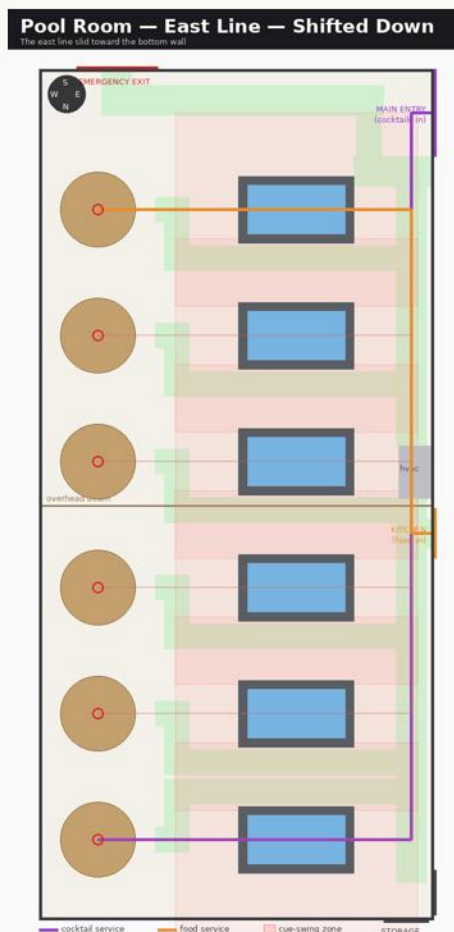

Service-flow diagram

## Pros

- The top table rejoins the straight line and every compromise at the entry end dissolves — all six rounds sit on their centerlines at the wall, clear of the exit approach.

## Cons

- the bottom table's end swing runs tight against the bottom wall — the cost of the slide.

Cue room: most sides about 55";  
shortest clearance 43".

# Closing thoughts — if this, then that

The room decides nothing; the house's priorities do. Read these as directions, not verdicts.

## If bar and kitchen revenue leads

Four On Top (A) — by far the most seated hospitality, a two-top at every row end, and it flips to a banquet for free. Runner-up: any of the line layouts (F-I).

## If serious play leads

Center Line (E) — every table on display with the roomiest typical clearance in the set, at the price of tight side-to-side between neighbours; A is the classic-room alternative with the fewest compromised sides.

## If service simplicity leads

West Line (H, I) — zero cue-crossing service conflicts and the shortest food runs anywhere: hospitality sits along the service wall.

## If a clear, welcoming entry leads

The shifted lines (G, I) — the whole line slides away from the entrance, so the door end opens up and every entry-side compromise dissolves; G audits cleanest of the whole set.

## If the clustered showroom look leads

The turned trio (B, C, D) — four tables in a block reads dramatic from the door and every cluster gets its own seating band; accept the tightest end swings and the thinnest seating in the set.

## If events and spectating lead

Four On Top (A) — the five-round cluster doubles as a gallery facing the nearest row; East Line (F, G) seats a watching row the full length of the room.

## If nothing is settled yet

Hold A and one line layout (G or I) as the short list: they bracket the trade-space — maximum hospitality vs maximum play-and-service clarity — and both pass every safety and walking audit.

## Impact at a glance

|                 | Play room | Hosp. \$ | Service | Walking | Entry/egress | Flip |
|-----------------|-----------|----------|---------|---------|--------------|------|
| A. center 2×3   | +         | +        | —       | •       | +            | +    |
| B. center 4+2   | •         | —        | •       | •       | +            | •    |
| C. left 4+2     | —         | —        | •       | •       | +            | •    |
| D. right 4+2    | —         | —        | •       | •       | +            | •    |
| E. center 1×6   | •         | —        | —       | +       | +            | +    |
| F. east 1×6     | •         | +        | —       | +       | —            | —    |
| G. east 1×6 low | —         | +        | —       | +       | +            | —    |
| H. west 1×6     | —         | +        | +       | •       | —            | —    |
| I. west 1×6 low | —         | +        | +       | •       | —            | —    |

Every figure behind these pages is computed from the room geometry — capacities, cue room, walking widths, egress, and the revenue proxy (a peak-hour comparator at placeholder margins, not a forecast). Assumptions and per-metric conventions: [analysis/scorecards.md](#) · live re-ranking: the interactive decision deck.