

Overview

If this, then that — the room decides nothing; the house's priorities do. Read these as directions, not verdicts.

If bar and kitchen revenue leads

Four On Top (D) — by far the most seated hospitality, a two-top at every row end, and it flips to a banquet for free. Runner-up: any of the line layouts (B, C, H, I).

If serious play leads

Center Line (F) — every table on display with the roomiest typical clearance in the set, at the price of tight side-to-side between neighbours; D is the classic-room alternative with the fewest compromised sides.

If service simplicity leads

West Line (B, C) — zero cue-crossing service conflicts and the shortest food runs anywhere: hospitality sits along the service wall.

If a clear, welcoming entry leads

The shifted lines (C, I) — the whole line slides away from the entrance, so the door end opens up and every entry-side compromise dissolves; I audits cleanest of the whole set.

If the clustered showroom look leads

The turned trio (A, E, G) — four tables in a block reads dramatic from the door and every cluster gets its own seating band; accept the tightest end swings and the thinnest seating in the set.

If events and spectating lead

Four On Top (D) — the five-round cluster doubles as a gallery facing the nearest row; East Line (H, I) seats a watching row the full length of the room.

If nothing is settled yet

Hold D and one line layout (C or I) as the short list: they bracket the trade-space — maximum hospitality vs maximum play-and-service clarity — and both pass every safety and walking audit.


Impact at a glance

	Play room	Hosp. \$	Service	Walking	Entry/egress	Flip
A. left 4+2	—	—	•	•	+	•
B. west 1x6	—	+	+	•	—	—
C. west 1x6 low	—	+	+	•	—	—
D. center 2x3	+	+	—	•	+	+
E. center 4+2	•	—	•	•	+	•
F. center 1x6	•	—	—	+	+	+
G. right 4+2	—	—	•	•	+	•
H. east 1x6	•	+	—	+	—	—
I. east 1x6 low	—	+	—	+	+	—

Every figure behind these pages is computed from the room geometry — capacities, cue room, walking widths, egress, and the revenue proxy (a peak-hour comparator at placeholder margins, not a forecast). Assumptions and per-metric conventions: analysis/scorecards.md · live re-ranking: the interactive decision deck.

Pool Room — Nine Layout Options

Contents — letters read in presentation order; columns group where the tables sit: left · centered · right

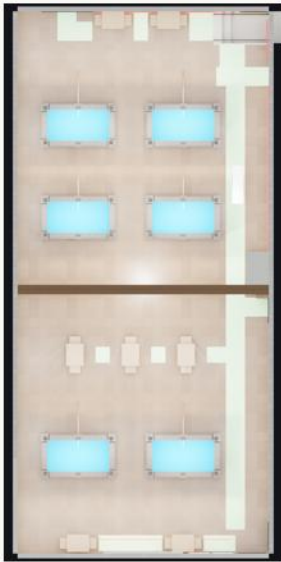


A. left 4+2

p. 3




D. center 2x3

p. 6

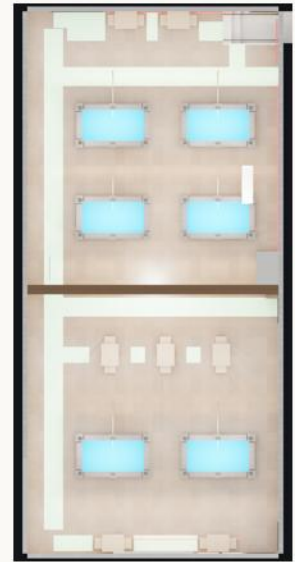


G. right 4+2

p. 9

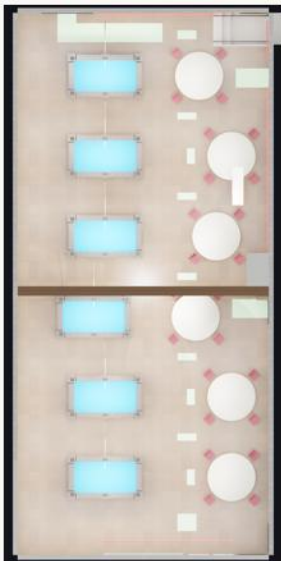


B. west 1x6

p. 4

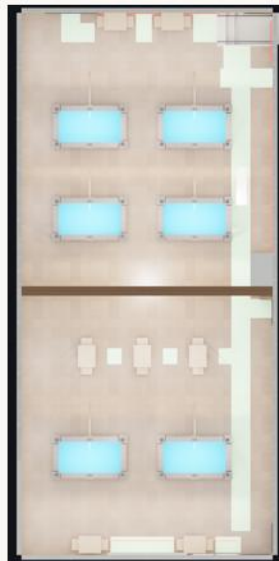


E. center 4+2

p. 7

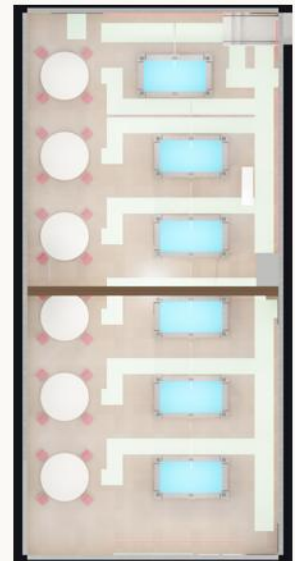


H. east 1x6

p. 10

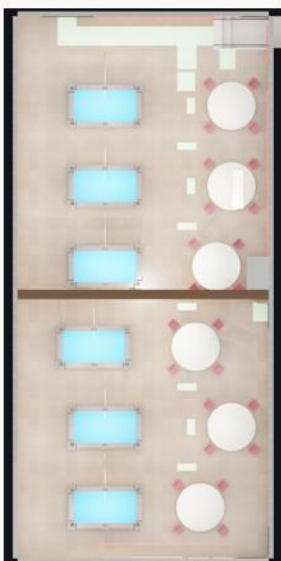


C. west 1x6 low

p. 5

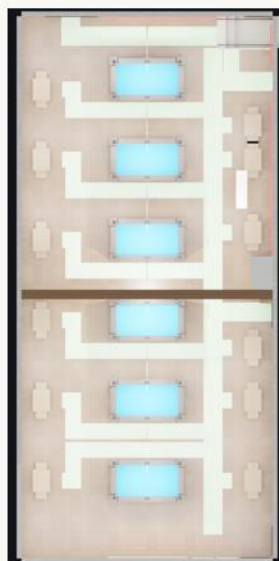

F. center 1x6

p. 8

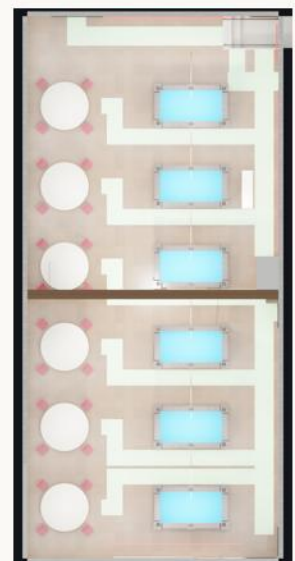

I. east 1x6 low

p. 11

A • Four On Top — Turned Left — left 4+2

The turned pattern slid left



entry end: west → Main Entry



west wall → east



east wall → west



north wall → south



south wall → north



NW corner → SE



NE corner → SW




SW corner → NE




SE corner → NW

Nine eye-level sightlines — the entry view, the four side-to-side views, and the four corner-to-corner views

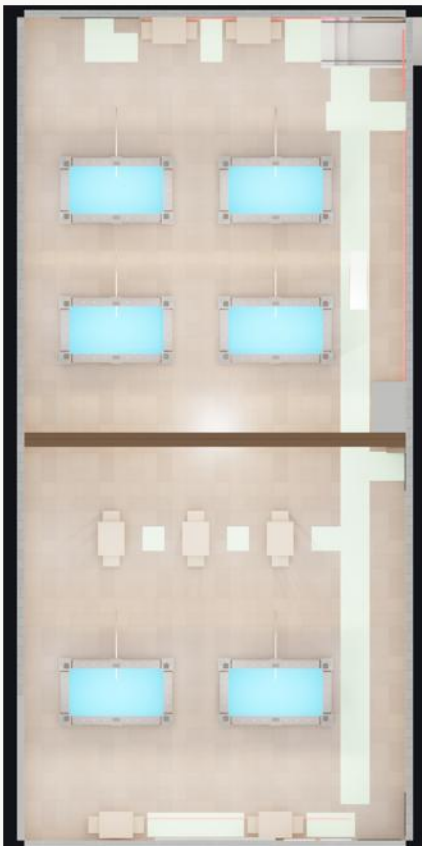

Overhead render

Pool Room — Four On Top — Turned Left

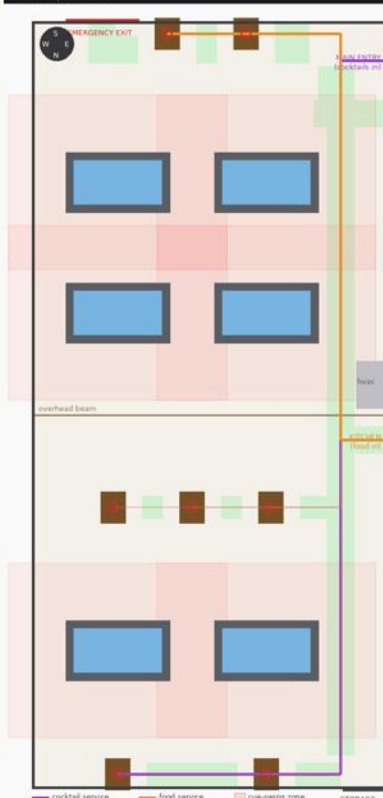

Service-flow diagram

Pros

- Both columns slide toward the left wall: the whole east side becomes service and standing room with full end swings.

Cons

- The west end swings run hard against the wall — the cost of the slide.

Cue room: most sides about 47"; shortest clearance 37".

B · West Line + Wall Rounds — west 1×6

Tables single-file west; a round beside every table east



entry end: west → Main Entry



west wall → east



east wall → west



north wall → south



south wall → north



NW corner → SE



NE corner → SW




SW corner → NE



SE corner → NW


Nine eye-level sightlines — the entry view, the four side-to-side views, and the four corner-to-corner views

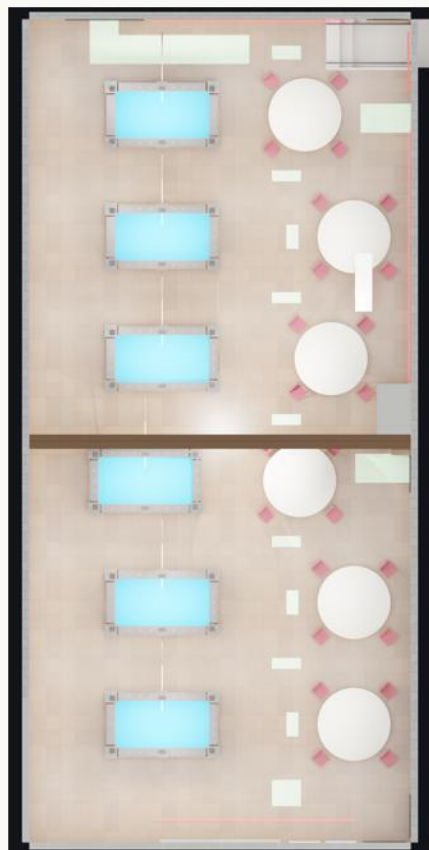

Overhead render

Pool Room — West Line + Wall Rounds

Tables single-file west; a round beside every table east

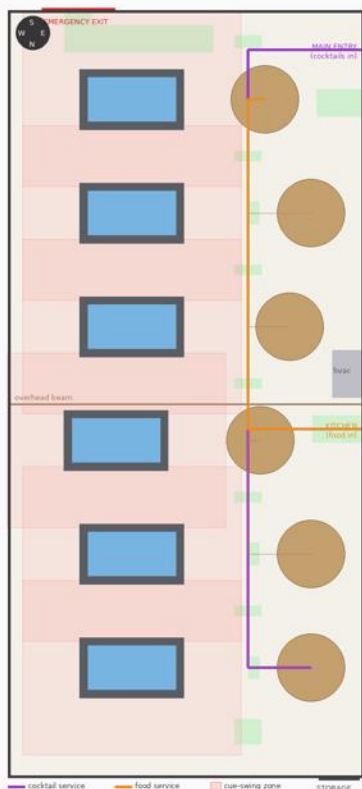

Service-flow diagram

Pros

- Every table gets its own five-foot round at matching height — all six, per the brief.

Cons

- The southernmost round crowds the Main Entry approach beside the stair rail.
- One round sits partially in front of the kitchen door — accepted to keep its table paired.

Cue room: most sides about 55"; shortest clearance 39".

C · West Line — Shifted Down — west 1x6 low

The west line slid toward the bottom wall



entry end: west → Main Entry



west wall → east



east wall → west



north wall → south



south wall → north



NW corner → SE



NE corner → SW




SW corner → NE



SE corner → NW


Nine eye-level sightlines — the entry view, the four side-to-side views, and the four corner-to-corner views

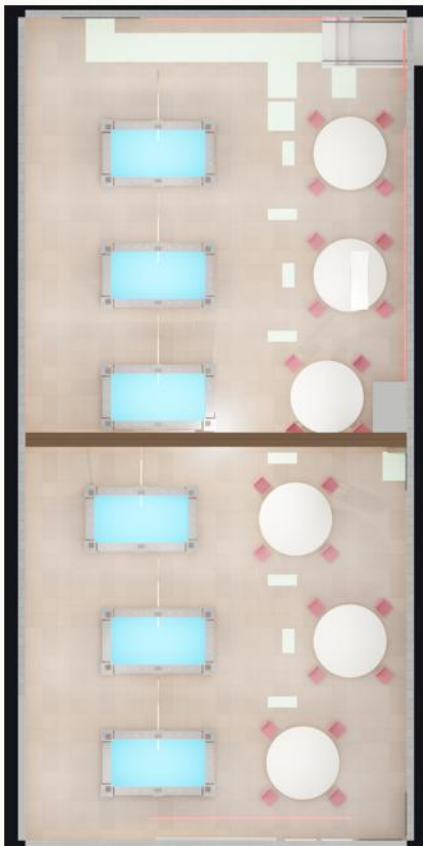

Overhead render

Pool Room — West Line — Shifted Down

The west line slid toward the bottom wall

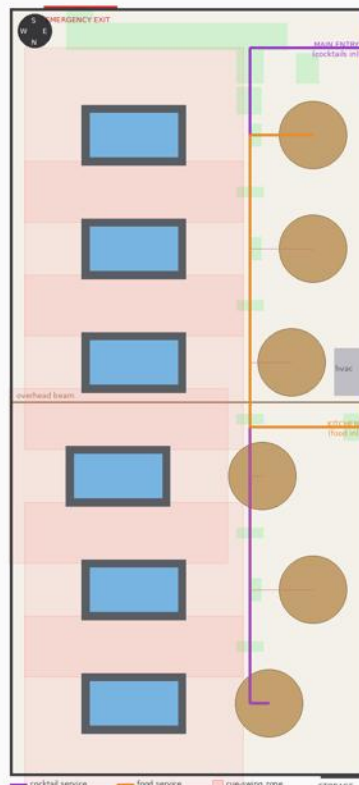

Service-flow diagram

Pros

- The entry end frees up: the sixth round reaches the east wall like the rest instead of pulling far inboard (its chairs still graze the approach corner).

Cons

- The third round pulls inboard to keep the kitchen door's wall approach clear; kitchen service still threads a squeeze between two rounds' chairs.
- The bottom table's end swing runs tight against the bottom wall — the cost of the slide.

Cue room: most sides about 55"; shortest clearance 41".

D • Four On Top — center 2x3

Six tables; four rounds and a center fifth on the north end



entry end: west → Main Entry



west wall → east



east wall → west



north wall → south



south wall → north



NW corner → SE



NE corner → SW



SW corner → NE



SE corner → NW


Nine eye-level sightlines — the entry view, the four side-to-side views, and the four corner-to-corner views



Overhead render

Pool Room — Four On Top

Six tables; four rounds and a center fifth on the north end

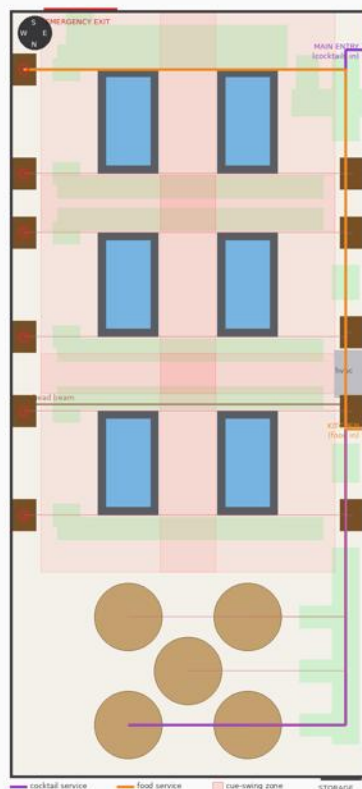

Service-flow diagram

Pros

- Four aligned rounds around a center fifth — one big social cluster that doubles as a tournament gallery facing the nearest table row.
- Wall two-tops flank every table row on both walls.


Cons

- The cluster runs deliberately tight, and the two-top by the kitchen door partially fronts it — both accepted.

Cue room: most sides about 60"; shortest clearance 56".

E · Four On Top — Turned — center 4+2


The same pattern with every table rotated sideways

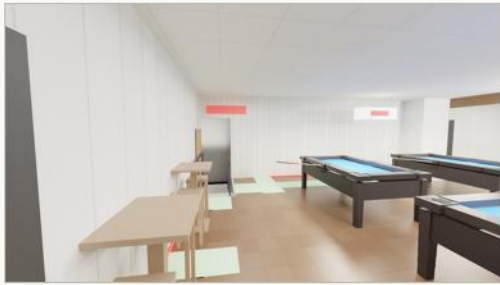

entry end: west → Main Entry



west wall → east

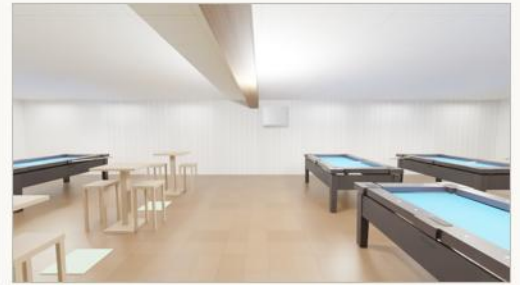

east wall → west



north wall → south



south wall → north



NW corner → SE



NE corner → SW




SW corner → NE



SE corner → NW


Nine eye-level sightlines — the entry view, the four side-to-side views, and the four corner-to-corner views

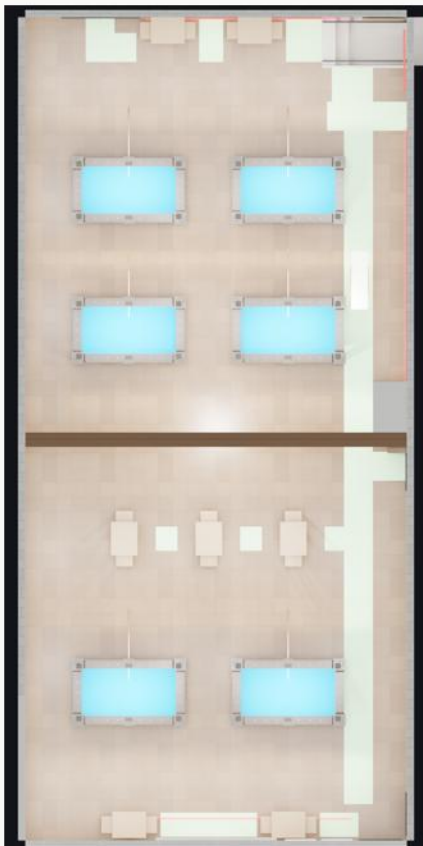

Overhead render

Pool Room — Four On Top — Turned

The same pattern with every table rotated sideways

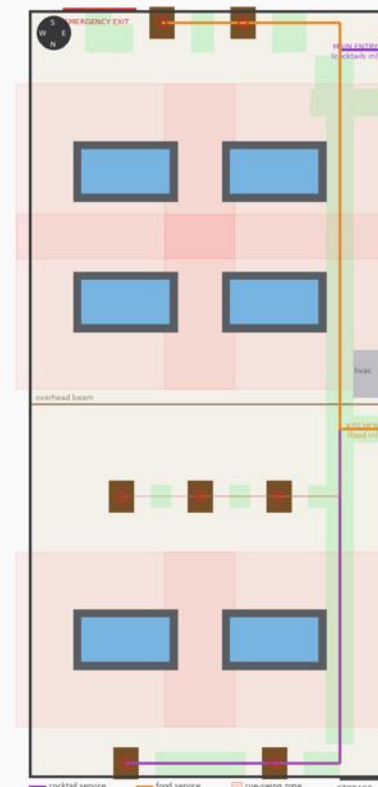

Service-flow diagram

Pros

- Four tables in a block at the top, two at the bottom, all turned ninety degrees.
- Two-top bands ride the top wall, the seam between the clusters, and the bottom wall — every table has seating at arm's reach.


Cons

- The rotated ends run tight side-to-side; the west and center aisles are the practical maximum.

Cue room: most sides about 47"; shortest clearance 47".

F · Center Line — center 1x6

Six tables turned sideways, end-to-end down the middle

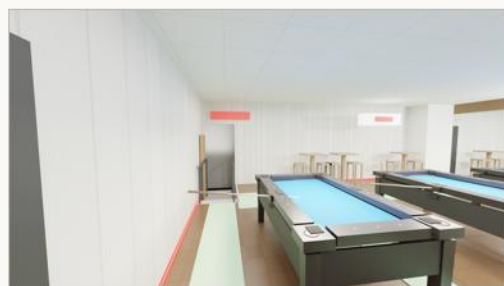

entry end: west → Main Entry



west wall → east



east wall → west



north wall → south



south wall → north



NW corner → SE



NE corner → SW




SW corner → NE



SE corner → NW


Nine eye-level sightlines — the entry view, the four side-to-side views, and the four corner-to-corner views

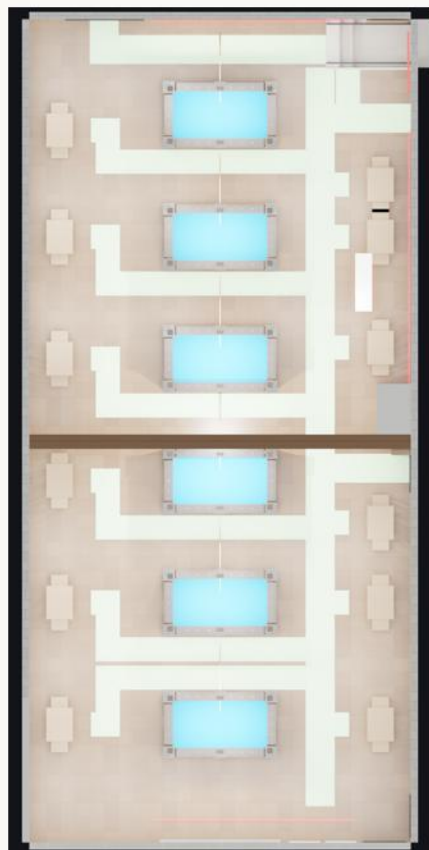

Overhead render

Pool Room — Center Line

Six tables turned sideways, end-to-end down the middle

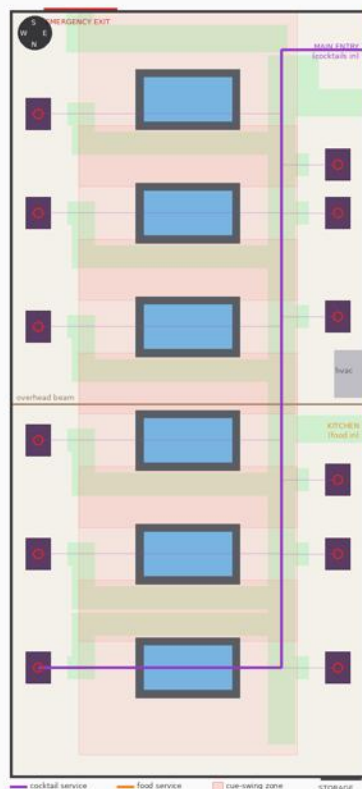

Service-flow diagram

Pros

- Every table on display from the full-length side aisles.
- The service lane runs inboard, between the table ends and the east wall tops — the wall lane pinched.

Cons

- Side-to-side swings between neighbours run tight; the table ends get full room.

Cue room: most sides about 74"; shortest clearance 55".

G · Four On Top — Turned Right — right 4+2

The turned pattern slid right



entry end: west → Main Entry



west wall → east



east wall → west



north wall → south



south wall → north



NW corner → SE



NE corner → SW




SW corner → NE




SE corner → NW

Nine eye-level sightlines — the entry view, the four side-to-side views, and the four corner-to-corner views

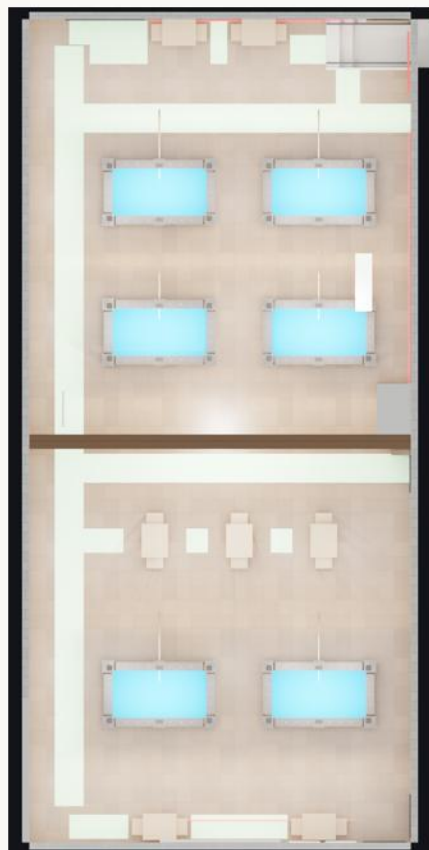

Overhead render

Pool Room — Four On Top — Turned Right

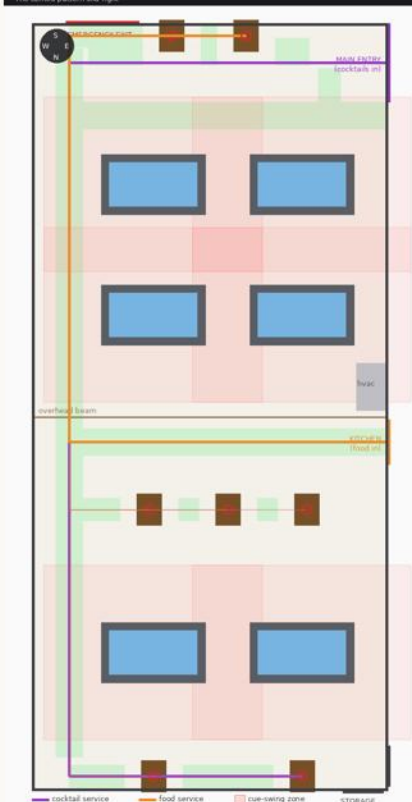

Service-flow diagram

Pros

- Both columns slide toward the right wall, as far as the chase and entry well allow; the west side becomes service and standing room with full end swings.

Cons

- The east end swings run hard toward the wall — the cost of the slide.

Cue room: most sides about 47"; shortest clearance 37".

H · East Line + West Lounge — east 1x6

Tables single-file on the east; six aligned rounds west



entry end: west → Main Entry



west wall → east



east wall → west



north wall → south



south wall → north



NW corner → SE



NE corner → SW



SW corner → NE



SE corner → NW


Nine eye-level sightlines — the entry view, the four side-to-side views, and the four corner-to-corner views



Overhead render

Pool Room — East Line + West Lounge

Tables single-file on the east; six aligned rounds west

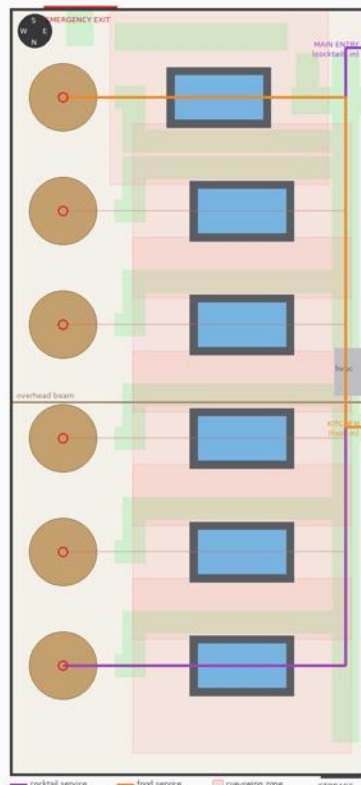

Service-flow diagram

Pros

- Six rounds in one line down the west side, each on its table's centerline.

Cons

- The southernmost round narrows the Emergency Exit approach — the walk bends around its chairs.
- Every delivery crosses the table line — hospitality sits opposite the doors.

Cue room: most sides about 55"; shortest clearance 55".

I · East Line — Shifted Down — east 1x6 low

The east line slid toward the bottom wall



entry end: west → Main Entry



west wall → east



east wall → west



north wall → south



south wall → north



NW corner → SE



NE corner → SW




SW corner → NE



SE corner → NW


Nine eye-level sightlines — the entry view, the four side-to-side views, and the four corner-to-corner views

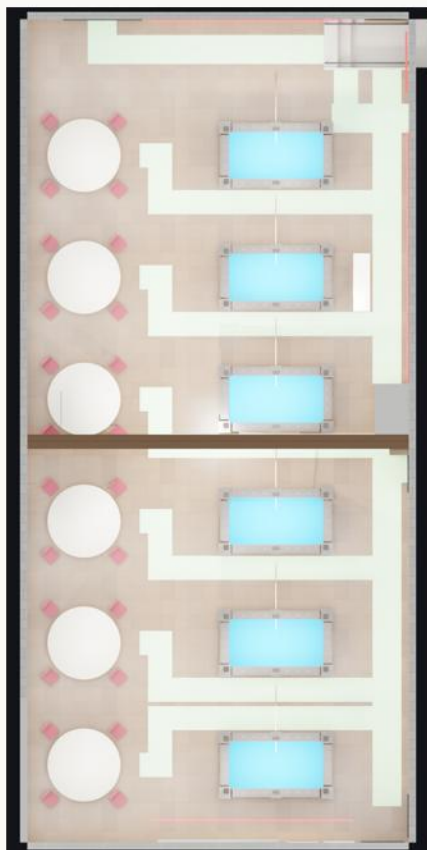

Overhead render

Pool Room — East Line — Shifted Down

The east line slid toward the bottom wall

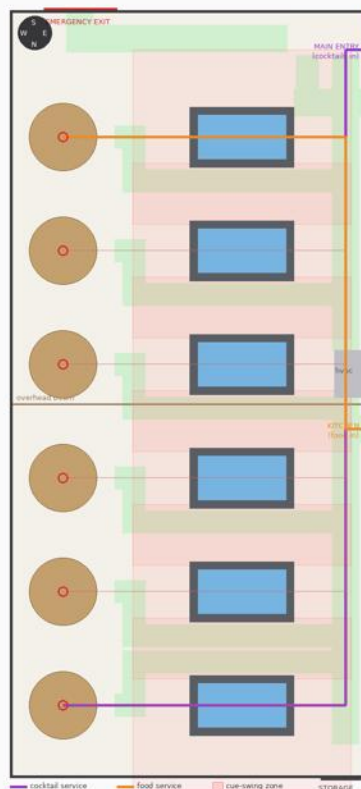

Service-flow diagram

Pros

- The top table rejoins the straight line and every compromise at the entry end dissolves — all six rounds sit on their centerlines at the wall, clear of the exit approach.

Cons

- The bottom table's end swing runs tight against the bottom wall — the cost of the slide.

Cue room: most sides about 55"; shortest clearance 43".

Walk it — then weigh it

A first-person walkthrough of all nine layouts, and an interactive deck that re-ranks them live — any browser, no install

WALK IT



scan to open

<https://kevinelong.github.io/pool-room-blender/walk.html>

WEIGH THE OPTIONS



scan to open

<https://kevinelong.github.io/pool-room-blender/deck.html>

What to expect

- The walkthrough opens on a gallery of all nine layouts — one overhead view each, lettered A through I with its short name. Click any card to jump straight into that room.
- By default an auto-tour walks in through the Main Entrance steps, loops the whole room on a collision-checked path, walks back out, and fades to the next layout — A through I, then it starts over.
- Click the 3-D view to take the controls: WASD or arrow keys to walk, mouse to look, Shift to hurry, Esc to hand back to the tour. You collide with every table, round, and chair — walk the aisles the servers would.
- The decision deck holds every computed number in one comparison matrix. Set the weights to what the house values — play, hospitality, service, events — and watch the nine layouts re-rank live. Presets cover the common priorities.
- Both pages are single self-contained files: they load instantly, work offline, and live in the repository under docs/. The walkthrough also carries this PDF as a download.

Share this study — one-tap download page for this PDF and the one-page top-down sheet:

https://kevinelong.github.io/pool-room-blender/get_pdf.html