

0001. A 1211 halon fire-extinguisher can be used for ;

1. a paper fire.
2. a fabric fire.
3. an electric fire.
4. a wood fire.
5. a hydrocarbon fire.

The combination regrouping all the correct statements is ;

- a) 2 , 4 , 5.
- b) 1 , 2 , 3 , 4 , 5.
- c) 2 , 3 , 4.
- d) 1 , 3 , 5.

Answer ;

b) 1 , 2 , 3 , 4 , 5.

0002. A braking action of 0.25 and below reported on a SNOWTAM is ;

- a) medium.
- b) unreliable.
- c) poor.
- d) good.

Answer ;

c) poor.

Açıklama ;

Ölçülen katsayı	Tahmini frenleme hareketi	Kod
0.40 ve üzeri	İyi	5
0.39 – 0.36	Orta ve iyi	4
0.35 – 0.30	Orta	3
0.29 – 0.26	Orta ve zayıf	2
0.25 ve altı	Zayıf	1

0003. A category I precision approach (CAT I) has ;

- a) a decision height equal to at least 200 ft.
- b) no decision height.
- c) a decision height equal to at least 50 ft.
- d) a decision height equal to at least 100 ft.

Answer ;

a) a decision height equal to at least 200 ft.

Açıklama ;

CAT I Minimaları				
Karar Yüksekliği (Not 7)	Kolaylıklar / RVR (Not 5)			
	Tam (Not 1 ve 6)	Orta Seviye (Not 2 ve 6)	Temel (Not 3 ve 6)	Yok (Not 4 ve 6)
200 ft	550 m	700 m	800 m	1000 m
201 – 250 ft	600 m	700 m	800 m	1000 m
251 – 300 ft	650 m	800 m	900 m	1200 m
301 ft ve üstü	800 m	900 m	1000 m	1200 m

Not 1 : Tüm kolaylıklar ; pist işaretleri , 720 m veya daha fazla yüksek yoğunluk/orta yoğunluklu yaklaşma ışıkları (HI/MI) , pist kenar ışıkları , pist eşik ışıkları ve pist sonu ışıklarından oluşur. Işıklar açık olmalıdır.

Not 2 : Orta seviyeli kolaylıklar ; pist işaretleri , 420-719 m yüksek yoğunluk/orta yoğunluklu yaklaşma ışıkları , pist kenar ışıkları , pist eşik ışıkları ve pist sonu ışıklarından oluşur. Işıklar açık olmalıdır.

Not 3 : Temel kolaylıklar ; pist işaretleri , 420 metreden daha az yüksek yoğunluk/orta yoğunluklu yaklaşma ışıkları , düşük yoğunlukta herhangi bir mesafede yaklaşma ışıkları , pist kenar ışıkları , pist eşik ışıkları ve pist sonu ışıklarından oluşur. Işıklar açık olmalıdır.

Not 4 : Yaklaşma ışıkları olmayan kolaylıklar ; pist işaretleri , pist kenar ışıkları , pist eşik ışıkları , pist sonu ışıkları veya başka ışıkların olmamasını belirtir.

Not 5 : Yukarıdaki rakamlar ; hem RVR'a göre dönüştürülen meteorolojik görüş ve hem de yayınlanmış RVR'dir.

Not 6 : Tablo , 4 derece ve daha aşağı süzülüş açısı eğimi ile geleneksel yaklaşımlara uygulanır.

Not 7 : Tablo 5'te belirtilen DH , karar yüksekliğinin ilk hesaplanmasıyla ilgilidir. İlgili RVR seçildiğinde , operasyonel prosedürler için yapılabilen en yakın 10 ft'e yuvarlamaya gerek yoktur.

0004. A category I precision approach (CAT I) is an approach which may be carried out with a runway visual range of at least ;
- 550 m.
 - 350 m.
 - 500 m.
 - 800 m.

Answer ;

a) 550 m.

Açıklama ;

Soru 0003'ün açıklamasına bakınız.

0005. A category II precision approach (CAT II) is an approach with ;
- no decision height.
 - a decision height of at least 100 ft.
 - a decision height of at least 50 ft.
 - a decision height of at least 200 ft.

Answer ;

b) a decision height of at least 100 ft.

Açıklama ;

CAT II minimaları		
Karar Yüksekliği	Karar yüksekliği altına otomatik bağlantılı (Not 1)	
	RVR (Uçak Kategorisi A , B ve C)	RVR (Uçak Kategorisi D)
100 ft – 120 ft	300 m	300 m (Not 2) / 350 m
121 ft – 140 ft	400 m	400 m
141 ft ve üzeri	450 m	450 m

Not 1 : Tablodaki Karar Yüksekliği altına otomatik-bağlantılı teriminin anlamı (AUTO-COUPLED TO BELOW DH) uygulanabilir karar yüksekliğinin %80'inden daha fazla olmayan bir yükseklikten aşağıda sürekli olarak otomatik uçuş kontrol sisteminin kullanımıdır. Böylelikle havacılık gereklilikleri , otomatik uçuş kontrol sistemi için minimum yükseklik yoluyla uygulanan karar yüksekliğini etkileyebilir.

Not 2 : 300 metre , otomatik iniş uygulanan Kategori D uçakları için kullanılabilir.

0006. A category III A precision approach (CAT III A) is an approach which may be carried out with a runway visual range of at least ;

- 100 m.
- 250 m.
- 50 m.
- 200 m.

Answer ;

d) 200 m.

Açıklama ;

CAT III minimaları					
		Uçuş Kontrol Sistemi / RVR (metre)			
		Fail passive	Fail operasyonel		
			Roll-out kontrol sistemi olmadan	Roll-out guidance veya kontrol sistemiyle beraber	
Yaklaşma kategorisi	Karar yüksekliği (ft)			Fail passive	Fail operasyonel
IIIA	100 ft'ten az	200 m (not 1)	200 m	200 m	200 m
IIIB	50 ft'ten az	yetkili değil	yetkili değil	125 m	75 m
IIIC	karar yüksekliği yok	yetkili değil	yetkili değil	yetkili değil	75 m

Not 1 : 300 metreden az gerçek RVR değerli operasyonlar için DH veya altındaki irtifalarda oto pilot arızası pas geçmeyi gerektirir.

0007. A category III B precision approach (CAT III B) is an approach which may be carried out with a runway visual range of at least ;

- a) 150 m.
- b) 250 m.
- c) 200 m.
- d) 75 m.

Answer ;

d) 75 m.

Açıklama ;

Soru 0006'nın açıklamasına bakınız.

0008. A category A aircraft can carry out an indirect approach followed by a visual manoeuvre only if the horizontal visibility is higher than or equal to ;

- a) 3600 m.
- b) 2400 m.
- c) 1500 m.
- d) 1600 m.

Answer ;

c) 1500 m.

Açıklama ;

Turlu yaklaşımda , işletici tarafından kullanılan en düşük minimalar şu şekildedir ;

Uçak Kategorisi	A	B	C	D
MDH	400 ft	500 ft	600 ft	700 ft
Minimum meteorolojik görüş	1500 m	1600 m	2400 m	3600 m

0009. A category B aeroplane can carry out a circling approach only if the meteorological visibility is higher than or equal to ;

- a) 3600 m.
- b) 2400 m.
- c) 1600 m.
- d) 1500 m.

Answer ;

c) 1600 m.

Açıklama ;

Soru 0008'in açıklamasına bakınız.

0010. A category C aeroplane can carry out a circling approach only if the meteorological visibility is higher than or equal to ;

- a) 3600 m.
- b) 1500 m.
- c) 1600 m.
- d) 2400 m.

Answer ;

d) 2400 m.

Açıklama ;

Soru 0008'in açıklamasına bakınız.

0011. A category D aeroplane can carry out a circling approach only if the meteorological visibility is higher than or equal to ;

- a) 3600 m.
- b) 2400 m.
- c) 1500 m.
- d) 1600 m.

Answer ;

a) 3600 m.

Açıklama ;

Soru 0008'in açıklamasına bakınız.

0012. A check on the operation of the SELCAL equipment during a transatlantic flight using the OTS (Organised Track System) must be done ;

- a) at or prior entering the oceanic airspace.
- b) as soon as possible after entering the NAT region.
- c) on ATC request only.
- d) within 15 minutes after crossing the oceanic airspace boundary.

Answer ;

- a) at or prior entering the oceanic airspace.**
-

0013. A class A fire is a fire of ;

- a) solid material , generally of organic nature.
- b) metal or gas or chemical (special fires).
- c) electrical origin.
- d) liquid or liquefiable solid.

Answer ;

- a) solid material , generally of organic nature.**

Açıklama ;

Günümüzde kullanılan yangın sınıflandırmalarından Sınıf A ; Kolayca tutuşabilen katı maddeleri içeren yangındır , su söndürücüsü kullanılarak en iyi söndürme elde edilir.

0014. A class B fire is a fire of ;

- a) electrical source fire.
- b) special fire ; metal , gas , chemical product.
- c) liquid or liquefiable solid.
- d) solid material usually of organic nature.

Answer ;

- c) liquid or liquefiable solid.**

Açıklama ;

Günümüzde kullanılan yangın sınıflandırmalarından Sınıf B ; Kolayca tutuşabilen sıvı maddeler ve sıvılaştırılabilir katı maddelerle ilgili yangındır.

0015. A CO₂ fire extinguisher can be used for ;

- 1. a paper fire.
- 2. a hydrocarbon fire.
- 3. a fabric fire.
- 4. an electrical fire.
- 5. a wood fire.

The combination regrouping all the correct statements is ;

- a) 2 , 3 , 4.
- b) 1 , 3 , 5.
- c) 2 , 4 , 5.
- d) 1 , 2 , 3 , 4 , 5.

Answer ;

- d) 1 , 2 , 3 , 4 , 5.**
-

0016. A commander shall not take-off for an IFR flight unless information is available indicating that the expected weather conditions at the destination and/or required alternate aerodrome(s) are ;

- a) at the estimated time of arrival , at or above the planning minima.
- b) during a period from 1 hour before to 1 hour after the estimated time of arrival at the aerodrome , at or above the planning minima.
- c) at the estimated time of arrival better than the minimum conditions required for aerodrome use.
- d) at the estimated time of arrival , and for a reasonable period before and after such a predicted time , equal to or better than the minimum conditions required for aerodrome use.

Answer ;

- b) during a period from 1 hour before to 1 hour after the estimated time of arrival at the aerodrome , at or above the planning minima.**
-

- 0017.** A commercial aeroplane is scheduled to be operated at FL 390 and has the following characteristics ;
Maximum approved passenger seating configuration = 230
Number of seats on board = 200
Scheduled number of passengers on board = 180

The minimum number of oxygen dispensing units provided in the aeroplane cabin compartment should be ;

- a) 180.
- b) 230.
- c) 220.
- d) 200.

Answer ;

c) 220.

- 0018.** A crew member is allowed to carry safety matches ;

- 1. on himself.
- 2. in his hand baggage.
- 3. in his checked baggage.
- 4. for his own use.

The combination regrouping all the correct statements is ;

- a) 1 , 2 , 3 , 4.
- b) 2 , 3.
- c) 1 , 2 , 4.
- d) 1 , 4.

Answer ;

d) 1 , 4.

- 0019.** A dry-chemical type fire extinguisher is fit to fight ;

- 1. class A fires.
- 2. class B fires.
- 3. electrical source fires.
- 4. special fires ; metals , gas , chemicals.

Which of the following combinations contains all of the correct statements ?

- a) 1 , 2 , 3.
- b) 2 , 4.
- c) 3 , 4.
- d) 1 , 2 , 3 , 4.

Answer ;

d) 1 , 2 , 3 , 4.

- 0020.** A fast decompression is recognizable by the following elements ;

- 1. mist in the cabin.
- 2. blast towards the exterior of the aircraft.
- 3. expansion of body gases.
- 4. blast of air released violently from the lungs.

The combination regrouping all the correct statements is ;

- a) 1 , 4.
- b) 2 , 3 , 4.
- c) 1 , 2 , 3.
- d) 1 , 2 , 3 , 4.

Answer ;

d) 1 , 2 , 3 , 4.

- 0021.** A fire occurs in a wheel and immediate action is required to extinguish it. The safest extinguishant to use is ;

- a) foam.
- b) water.
- c) dry powder.
- d) CO₂ (carbon dioxide).

Answer ;

c) dry powder.

0022. A flight is to depart from an airport with runways 09 and 27. Surface wind is 270/05 , an inversion is reported at 300 feet with turbulence and wind shear. The wind just above the inversion is 090/30. What is the safest departure procedure ?

- a) Depart runway 27 with maximum throttle during the passage through the inversion.
- b) Depart runway 09 with a tailwind.
- c) Take-off is not possible under these conditions.
- d) Depart runway 27 with as steep an ascent as possible.

Answer ;

- b)** Depart runway 09 with a tailwind.
-

0023. A flight via the SHANNON-GANDER great circle with no MNPS certification can be planned ;

- a) outside OTS validity hours.
- b) at FL290.
- c) at a Mach number of 0.70 or less.
- d) at FL280 or less.

Answer ;

- d)** at FL280 or less.
-

0024. A halon fire-extinguisher should be used on a fire of ;

- 1. paper , fabric , plastic.
- 2. flammable liquids.
- 3. flammable gases.
- 4. metals.

The combination regrouping all the correct statements is ;

- a) 1 , 2 , 3.
- b) 1 , 2 , 4.
- c) 2 , 3 , 4.
- d) 1 , 2 , 3 , 4.

Answer ;

- a)** 1 , 2 , 3.
-

0025. A hand water fire-extinguisher should be used on a fire of ;

- a) flammable liquids.
- b) paper , fabric , carpet.
- c) metals.
- d) flammable gases.

Answer ;

- b)** paper , fabric , carpet.
-

0026. A jet aircraft is certified for the carriage of 120 passengers. 42 passenger are on board and the expected Flight Level on route Paris-Alger is FL 330. The first aid oxygen to be on board at departure shall provide breathing supply for at least ;

- a) 3 passengers for the entire flight after cabin depressurization at cabin altitude between 10.000 and 14.000 ft.
- b) 1 passengers for the entire flight after cabin depressurization at cabin altitude between 10.000 and 14.000 ft.
- c) 1 passengers for the entire flight after cabin depressurization at cabin altitude of more than 8.000 ft.
- d) no first aid required.

Answer ;

- c)** 1 passengers for the entire flight after cabin depressurization at cabin altitude of more than 8.000 ft.
-

0027. A life jacket is mandatory for each person on board an aeroplane when flying over water at a distance from the shore of more than ;

- a) 50 NM.
- b) 400 NM.
- c) 200 NM.
- d) 100 NM.

Answer ;

- a)** 50 NM.
-

0028. A list of dangerous goods , which may not be transported by air , can be found in ;

- a) the technical instructions for the safe transport of dangerous goods by air.
- b) Annex 18 to the Chicago Convention.
- c) Annex 6 to the Chicago Convention.
- d) the shipper's declaration for dangerous goods.

Answer ;

- a)** the technical instructions for the safe transport of dangerous goods by air.
-

0029. A minimum time track is a ;
- a) track determined according to wind conditions.
 - b) rhumb line.
 - c) spherical capable flight segment.
 - d) great circle track.

Answer ;

- a) track determined according to wind conditions.
-

0030. A passenger is allowed to carry match-boxes ;
- 1. on himself/herself.
 - 2. in his/her hand luggage.
 - 3. in his/her checked luggage.
- The combination regrouping all the correct statements is ;
- a) 1.
 - b) 2 , 3.
 - c) 1 , 2 , 3.
 - d) 1 , 2.

Answer ;

- a) 1.
-

0031. A piece of equipment on your public transport aircraft fails while taxiing to the holding point. The reference document you use in the first place to decide on the procedure to follow is ;
- a) the minimum equipment list.
 - b) the flight record.
 - c) the operations manual's chapter "Abnormal and Emergency Procedures".
 - d) the JAR OPS.

Answer ;

- c) the operations manual's chapter "Abnormal and Emergency Procedures".
-

0032. A piece of equipment on your public transport aircraft fails while you are still parked. The reference document you use to decide on the procedure to follow is ;
- a) the flight manual.
 - b) the JAR OPS.
 - c) the minimum equipment list.
 - d) the operations manual's chapter "Abnormal and Emergency procedures".

Answer ;

- c) the minimum equipment list.
-

0033. A pilot whose aircraft does not have MNPS certification has to fly via the SHANNON-GANDER great circle. The flight can be planned ;
- a) at FL 280 or less.
 - b) at FL 290.
 - c) at a Mach number of 0.70 or less.
 - d) outside scheduled flight times.

Answer ;

- a) at FL 280 or less.
-


0034. A pilot is using a polar stereographic chart whose grid is parallel to the zero meridian , with Grid North in the direction of the North geographic pole. In polar regions , the pilot stops navigation in free-gyro mode after leaving the 6 microteslas zone , and the grid heading controlled by information from the inertial navigation system (INS) is 045°. After switching to “magnetic mode” , the compass heading is 220°. The INS position at this moment is 76°N 180°W. The magnetic variation on the chart is 10°E. The compass deviation at this heading is ;

- a) +15°.
- b) +5°.
- c) -5°.
- d) -15°.

Answer ;

c) -5°.

Çözüm ;

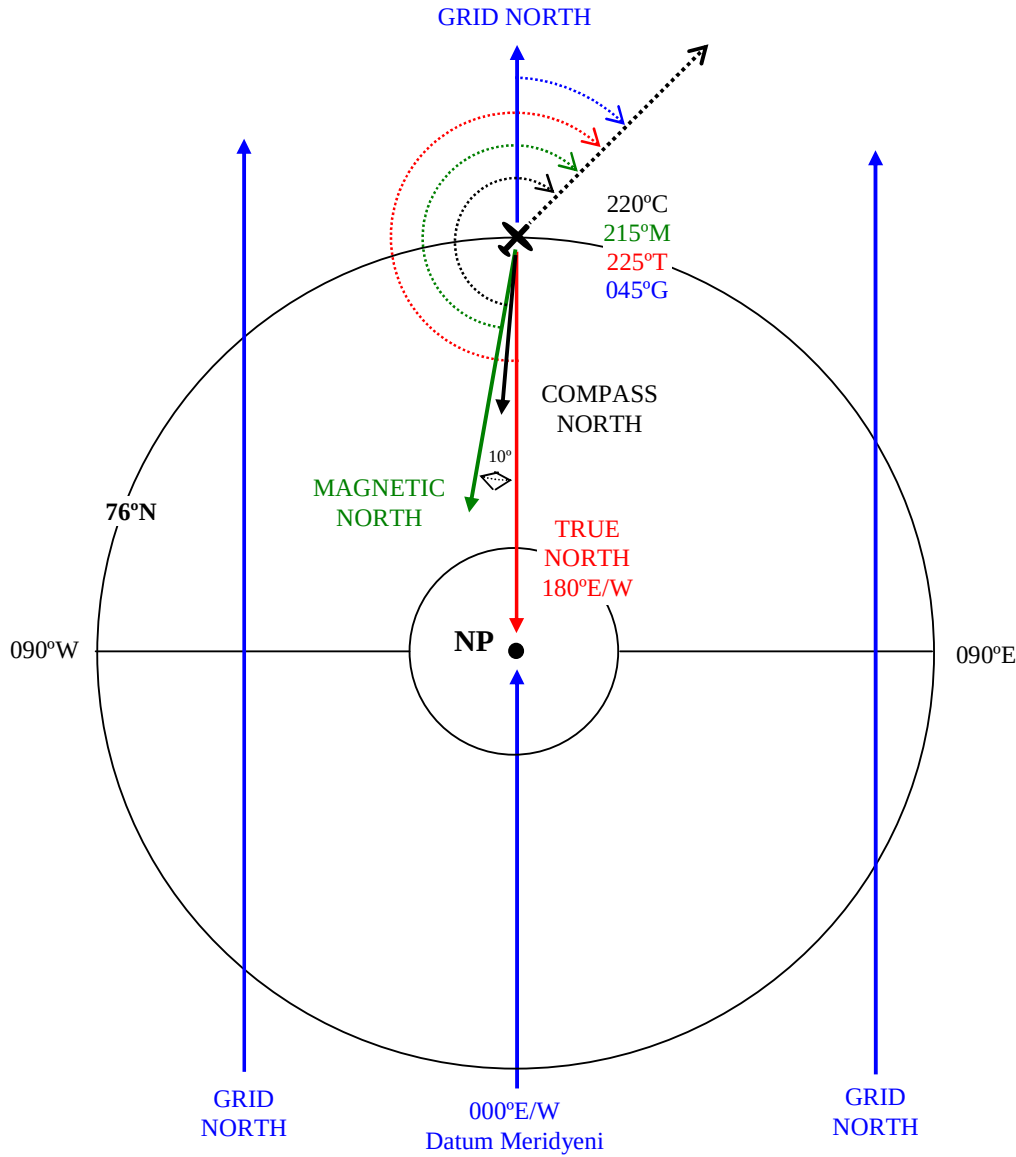

Answer:Aircraft position is 76°N 180°W, GRID heading 045°G

$G = T \pm \text{Convergency}$, so we can rearrange, $T = G \pm \text{Convergency}$

With the GRID aligned to the zero meridian, Convergency = Aircraft longitude = 180

So, $T = 045 \pm 180 = 225^\circ\text{T}$ or 135°T (draw the diagram to confirm)

True Heading 225°T , VARIATION 10E, so Magnetic Heading = 215°M

In the 6 microteslas zone the MAG compass is no good – you will be in DG (gyro) mode, when you leave the 6 microteslas zone, you switch back to MAG mode.

When you switch back to MAGNETIC MODE, the compass heading is 220°M , the compass will now align correctly to 215°M , in other words, -5°


0035. A polar stereographic chart has a grid printed over it which is parallel to the meridian 054°W , with Grid North in the direction of the North geographic pole. An aircraft is following a true course of 330°. At position 80°N 140°E , its grid heading (GH) with this system will be ;

- a) 136°.
- b) 164°.
- c) 276°.
- d) 316°.

Answer ;

- a) 136°.

Çözüm ;

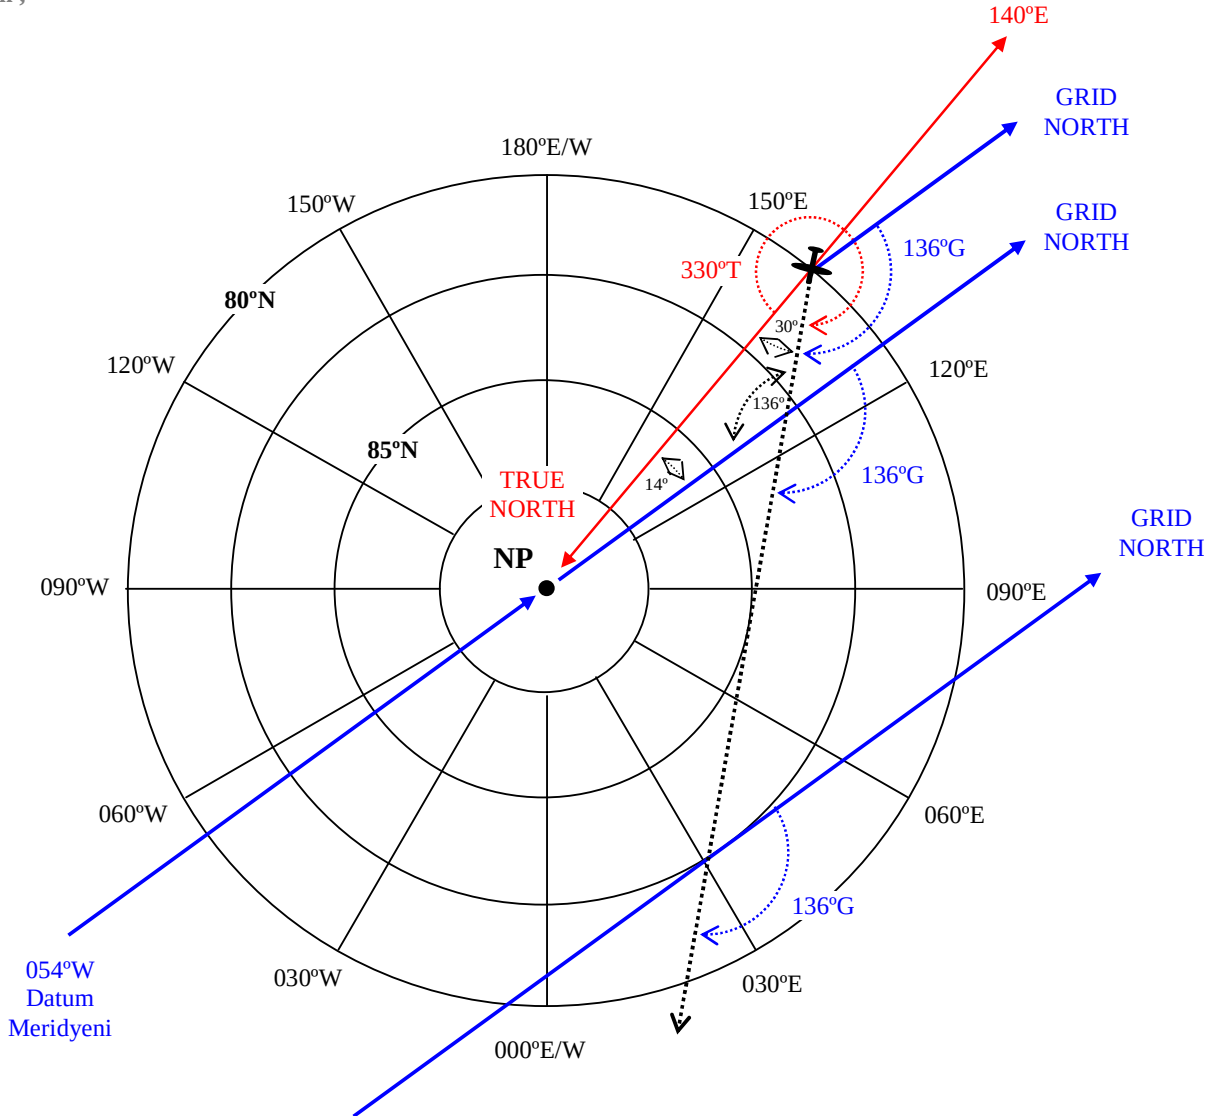

İlk olarak sorudaki verilere göre Grid Kuzey'i 054°W meridyenine Kuzey Kutbu yönünde oryantasyonu yapılmış polar stereografik diagram oluşturulmalıdır. Uçağın pozisyonu olan 80°N 140°E ve Gerçek Kuzey'e göre rotası olan 330°T diagramda işaretlendikten sonra oluşan üçgenin iç açıları işaretlenir. Direkt olarak görüldüğü gibi uçağın Grid rotası 136°G olarak bulunur.

Diğer bir çözüm şekli olarak Convergency açısı üzerinden işlem yapılabilir. Convergency (Birleşme) , Datum meridyeni ile , bearing ölçümünün yapılacağı noktadaki lokal meridyen arasındaki farktır ve normal olarak Convergency'nin yönü Lokal meridyen üzerinde Grid North'dan True North'a doğrudur.. Datum meridyeni 054° ve Lokal meridyen 140°E/W olduğuna göre ; Convergency = $360^\circ - 140^\circ - 40^\circ = 166^\circ$ ve yönü W'dir.

Convergency West = True Track Best
Convergency East = True Track Least

Grid track = True track + Convergency

Grid track = $330^\circ + 166^\circ = 496^\circ$

Grid track = $496^\circ - 360^\circ = 136^\circ$ olarak bulunur.

0036. A polar track is a track part of which is included in an area where the horizontal component of the earth magnetic field is less than ;

- a) 6 micro-tesla.
- b) 38 micro tesla.
- c) 10 micro-tesla.
- d) 17 micro-tesla.

Answer ;

a) 6 micro-tesla.

0037. A public address system is required to operate an aeroplane whose maximum approved passenger seating configuration is greater than ;

- a) 30.
- b) 9.
- c) 19.
- d) 61.

Answer ;

c) 19.

0038. A public transport aeroplane is intended to be operated at FL 370. The cabin is fitted with 180 passenger seats. The minimum number of cabin oxygen masks (dispensing units) required for this aeroplane is ;

- a) 270 (150% of the seating capacity).
- b) 240 (one additional mask per seat block).
- c) 210 (one additional mask per seat row).
- d) 198 (110% of the seating capacity).

Answer ;

d) 198 (110% of the seating capacity).

0039. A public transport aircraft is intended to be operated at FL 390. The total number of oxygen masks (dispensing units and outlets) in the cabin must be at least the same as the total number of ;

- a) passengers.
- b) seats exceeded by 10%.
- c) passengers exceeded by 10%.
- d) seats.

Answer ;

b) seats exceeded by 10%.

0040. A public transport passengers aeroplane , with a seating configuration of more than 61 seats , must have in its passenger compartment(s) , at least 3 hand fire-extinguishers including ;

- a) no halon fire-extinguisher.
- b) 3 halon fire-extinguishers or equivalent.
- c) 2 halon fire-extinguishers or equivalent.
- d) 1 halon fire-extinguisher or equivalent.

Answer ;

c) 2 halon fire-extinguishers or equivalent.

0041. A runway covered with 4 mm thick water , is said to be ;

- a) damp.
- b) flooded.
- c) contaminated.
- d) wet.

Answer ;

c) contaminated.

0042. A runway is considered to be contaminated when its surface is covered more than ;

- a) 15% with melted snow.
- b) 25% with compacted snow.
- c) 20% with melted snow.
- d) 10% with ice.

Answer ;

b) 25% with compacted snow.

0043. A slow decompression may be caused by ;

- 1. a leak in a doorseal during normal pressurised flight.
- 2. loss of a cabin window.
- 3. malfunction of all pressurised systems.
- 4. loss of a door.

The combination regrouping all the correct statements is ;

- a) 1 , 3.
- b) 1 , 2 , 3.
- c) 2 , 4.
- d) 1 , 2 , 3 , 4.

Answer ;

a) 1 , 3.

0044. A warning device alerts the crew in case of an excessive cabin altitude. This warning must be triggered on reaching the following altitude ;

- a) 8000 ft (approx. 2400 m).
- b) 10000 ft (approx. 3000 m).
- c) 14000 ft (approx. 4200 m).
- d) 12000 ft (approx. 3600 m).

Answer ;

b) 10000 ft (approx. 3000 m).

0045. A water fire-extinguisher can be used without restriction for ;

- 1. a paper fire.
- 2. a hydrocarbon fire.
- 3. a fabric fire.
- 4. an electrical fire.
- 5. a wood fire.

The combination regrouping all the correct statements is ;

- a) 2 , 4 , 5.
- b) 2 , 3 , 4.
- c) 1 , 3 , 5.
- d) 1 , 2 , 3 , 4 , 5.

Answer ;

c) 1 , 3 , 5.

0046. A water fire-extinguisher (straight jet) can be used on a fire of ;

- 1. solids (fabric , carpet , ...).
- 2. liquids (ether , gasoline , ...).
- 3. gas.
- 4. metals (sodium , ...).

The combination regrouping all the correct statements is ;

- a) 3.
- b) 1.
- c) 3 and 4.
- d) 2.

Answer ;

b) 1.

0047. A windshield wiper or an equivalent device is required at each pilot position in order to operate an aeroplane with a ;

- a) maximum approved passenger configuration of more than 6 seats.
- b) maximum certificated take-off mass of more than 15.000 kg.
- c) maximum approved passenger configuration of more than 9 seats.
- d) maximum certificated take-off mass of more than 5.700 kg.

Answer ;

d) maximum certificated take-off mass of more than 5.700 kg.

0048. Above which flight level do the regulations require a quick donning type of oxygen mask for the flight crew in a pressurized aircraft ?

- a) FL 390.
- b) FL 250.
- c) FL 100.
- d) FL 300.

Answer ;

b) FL 250.

0049. According to Annex 6 , “RNP type” is defined as a containment value expressed as a distance in(i)..... from the intended position within which flights would be for at least(ii)..... of the total flying time.

- a) (i) kilometers , (ii) 95%
- b) (i) nautical miles , (ii) 95%
- c) (i) nautical miles , (ii) 90%
- d) (i) kilometers , (ii) 90%

Answer ;

b) (i) nautical miles , (ii) 95%

0050. According to Annex 6 , what is the definition of an Air Operator Certificate ?

- a) A certificate automatically authorising an operator to carry out domestic air services in any ICAO contracting State.
- b) A certificate needed to carry out specified commercial international air transport operations , but not for domestic commercial flights.
- c) A certificate authorising an operator to carry out specified commercial air transport operations.
- d) A certificate the crew will present to immigration officers , stating that all passengers on board fulfil the visa requirements.

Answer ;

c) A certificate authorising an operator to carry out specified commercial air transport operations.

0051. According to Annex 6 , what is the definition of Required Navigation Performance (RNP) ?

- a) A statement of the navigation performance necessary for operation within a defined airspace.
- b) A statement of the navigation performance required when installing a new navigation aid on the ground.
- c) A statement of the navigation performance necessary during flight tests for a new aircraft type.
- d) A statement of the navigation performance required during a pilot skill test.

Answer ;

a) A statement of the navigation performance necessary for operation within a defined airspace.

0052. According to DOC 4444 (ICAO) , a wake turbulence non-radar separation minima of 2 minutes shall be applied to ;

- a) LIGHT aircraft taking-off behind a MEDIUM aircraft from an intermediate part of the same runway.
- b) MEDIUM aircraft taking-off behind a HEAVY aircraft from an intermediate part of a parallel runway separated by less than 760 m.
- c) LIGHT aircraft landing behind a MEDIUM aircraft.
- d) MEDIUM aircraft landing behind a HEAVY aircraft.

Answer ;

d) MEDIUM aircraft landing behind a HEAVY aircraft.

0053. According to ICAO Annex 17 , following an unlawful interference , who shall take adequate measures for the safety of passengers and crew of an aircraft , until their journey can be continued ? The ;

- a) JAA.
- b) contracting State in which the unlawful interference occurs.
- c) aircraft’s operator.
- d) Commander of the aircraft.

Answer ;

b) contracting State in which the unlawful interference occurs.

0054. According to ICAO Doc 4444 , a wake turbulence non-radar separation minima of 2 minutes shall be applied to ;

- a) MEDIUM aircraft taking-off behind a HEAVY aircraft from an intermediate part of a parallel runway separated by less than 760 m.
- b) LIGHT aircraft taking-off behind a MEDIUM aircraft from an intermediate part of the same runway.
- c) LIGHT aircraft landing behind a MEDIUM aircraft.
- d) MEDIUM aircraft landing behind a HEAVY aircraft.

Answer ;

d) MEDIUM aircraft landing behind a HEAVY aircraft.

0055. According to ICAO Doc 8168 , a noise abatement departure procedure is NOT to be initiated at less than ;
- a) 2 000 ft above aerodrome elevation.
 - b) 800 ft above aerodrome elevation.
 - c) 1 000 ft above aerodrome elevation.
 - d) 1 500 ft above aerodrome elevation.

Answer ;

- b) 800 ft above aerodrome elevation.
-

0056. According to ICAO noise abatement procedures during landing ;
- a) shall not prohibit the use of reverse thrust.
 - b) apply in case of visual approaches only.
 - c) apply in case of instrument approaches only.
 - d) prohibit the use of reverse thrust.

Answer ;

- a) shall not prohibit the use of reverse thrust.
-

0057. According to JAR-OPS , a life jacket is mandatory for each person on board a land aeroplane , when flying over water at a distance from the shore of more than ;
- a) 200 NM.
 - b) 100 NM.
 - c) 50 NM.
 - d) 400 NM.

Answer ;

- c) 50 NM.
-

0058. According to JAR-OPS , an aircraft must be equipped with an audio selector panel accessible to each required flight crew member ;
- a) when operating under IFR.
 - b) when operating in controlled airspace.
 - c) at all times when carrying passengers.
 - d) when operating under IFR , or under VFR over routes not navigated by reference to visual landmarks.

Answer ;

- a) when operating under IFR.
-

0059. According to JAR-OPS , an operator shall ensure that each cabin crew member is at least ;
- a) 21 years of age.
 - b) 18 years of age.
 - c) 20 years of age.
 - d) 17 years of age.

Answer ;

- b) 18 years of age.
-

0060. According to JAR-OPS , an operator shall not operate an aircraft in expected or actual icing conditions unless ;
- a) the aircraft is certificated and equipped to operate in icing conditions.
 - b) the aircraft is sprayed with anti-icing fluid before flight.
 - c) the aircraft is sprayed with de-icing fluid before flight.
 - d) the flight is planned so that a change of cruising level can be initiated rapidly.

Answer ;

- a) the aircraft is certificated and equipped to operate in icing conditions.
-

0061. According to JAR-OPS , at least one of the following hand fire extinguishers must be conveniently located on the flight deck ;
- a) a foam fire-extinguisher.
 - b) a halon fire-extinguisher or equivalent.
 - c) a water fire-extinguisher.
 - d) a powder fire-extinguisher.

Answer ;

- b) a halon fire-extinguisher or equivalent.
-

0062. According to JAR-OPS , for a non pressurised aircraft , all required cabin crew members shall be supplied with supplemental oxygen during ;

- a) the entire flight time at pressure altitudes above 13.000 ft.
- b) the entire flight time after 30 minutes at pressure altitudes greater than 10.000 ft but not exceeding 13.000 ft.
- c) the entire flight time at pressure altitudes above 13.000 ft and for any period exceeding 30 minutes at pressure altitudes above 10.000 ft but not exceeding 13.000 ft.
- d) the entire flight time at pressure altitudes above 10.000 ft.

Answer ;

- c)** the entire flight time at pressure altitudes above 13.000 ft and for any period exceeding 30 minutes at pressure altitudes above 10.000 ft but not exceeding 13.000 ft.
-

0063. According to JAR-OPS , for a non pressurised aircraft , the supplemental oxygen is ;

- a) therapeutical oxygen specially carried for certain passengers.
- b) used for protection against smoke and carbon dioxide.
- c) available fo supply to passengers for physiological reasons.
- d) required to operate at pressure altitudes above 10.000 ft.

Answer ;

- d)** required to operate at pressure altitudes above 10.000 ft.
-

0064. According to JAR-OPS , if a piece of equipment on your aircraft becomes inoperative while you are still parked , before making the decision to proceed the reference document used is ;

- a) the Operations Manual under the heading “Abnormal and Emergency procedures”.
- b) the flight manual.
- c) the JAR OPS.
- d) the Operations Manual under the heading “MEL”.

Answer ;

- d)** the Operations Manual under the heading “MEL”.
-

0065. According to JAR-OPS , in establishing the aerodrome operating minima which will apply to any particular operation , an operator must take full account of ;

- 1. equipment available on the aircraft.
- 2. dimensions and characteristics of the runways.
- 3. composition of the flight crew.
- 4. obstacles in the vicinity of approach and missed approach areas.
- 5. facilities for determining and communicating the weather conditions.

The combination regrouping all the correct statements is ;

- a) 1 , 2 , 3 , 4 , 5.
- b) 1 , 2 , 4 , 5.
- c) 2 , 4 , 5.
- d) 2 , 3 , 5.

Answer ;

- a)** 1 , 2 , 3 , 4 , 5.
-

0066. According to JAR-OPS , on an IFR flight a commander shall not commence take-off unless the expected weather conditions at the destination and/or required alternate aerodrome(s) are at or above ;

- a) the planning minima , during a period from 1 hour before to 1 hour after the estimated time of arrival at the aerodrome.
- b) the planning minima , at the estimated time of arrival.
- c) the aerodrome operating minima , at the estimated time of arrival , and for a reasonable period before and after such a predicted time.
- d) the aerodrome operating minima , during a period from 1 hour before to 1 hour after the estimated time of arrival at the aerodrome.

Answer ;

- a)** the planning minima , during a period from 1 hour before to 1 hour after the estimated time of arrival at the aerodrome.
-

0067. According to JAR-OPS , “pre-flight inspection” is the inspection carried out ;

- a) before flight to ensure that the aircraft is fit for the intended flight including defect rectification.
- b) by the fuel company to ensure that the aircraft is prepared for refuelling.
- c) before flight to ensure that the aircraft is fit for the intended flight. It does not include defect rectification.
- d) by the caterer to ensure that the aircraft is prepared with meals an beverages necessary for the flight.

Answer ;

- c)** before flight to ensure that the aircraft is fit for the intended flight. It does not include defect rectification.
-

- 0068.** According to JAR-OPS , the commander shall not commence take-off ;
- a) unless the external surfaces are free from any ice contamination greater than 5 mm.
 - b) unless the external surfaces are clear of any deposit , except as permitted by Aircraft Flight Manual.
 - c) even if the ice contamination does not exceed the mass and balance limits.
 - d) unless the external surfaces are still covered with anti-icing fluid and the aircraft is not to be operated in forecasted icing conditions greater than moderate icing.

Answer ;

- b)** unless the external surfaces are clear of any deposit , except as permitted by Aircraft Flight Manual.

- 0069.** According to JAR-OPS , the Minimum Equipment List of an aircraft is found in the ;

- a) flight manual.
- b) flight record.
- c) JAR OPS.
- d) operations manual.

Answer ;

- d)** operations manual.

- 0070.** According to JAR-OPS , the minimum number of hand fire-extinguishers to be located in the passenger compartment of an aircraft with a maximum approved passenger seating configuration of 31 is ;

- a) 0.
- b) 2.
- c) 3.
- d) 1.

Answer ;

- b)** 2.

Açıklama ;

Onaylı maksimum yolcu oturma düzenlemesi	Söndürücü sayısı
7 – 30 arası	1
31 – 60 arası	2
61 – 200 arası	3
201 – 300 arası	4
301 – 400 arası	5
401 – 500 arası	6
501 – 600 arası	7
601 ve daha fazla	8

- 0071.** According to JAR-OPS , which of the following is the correct definition of “wet lease” ?

- a) The aircraft is leased from a non-JAA operator.
- b) The aircraft is operated overseas.
- c) The aircraft is operated under the AOC of the lessee.
- d) The aircraft is operated under the AOC of the lessor.

Answer ;

- d)** The aircraft is operated under the AOC of the lessor.

Açıklama ;

Wet Lease : Uçağın , kiraya verenin AOC’ si çerçevesinde kullanıldığı kiralama şekli ifade etmektedir.

0072. According to JAR-OPS 1 , a Category I operation is a precision instrument approach and landing with a decision height (DH) not lower than(i)..... and with a runway visual range (RVR) not less than(ii).....

- a) (i) 200 ft , (ii) 550 m.
- b) (i) 100 ft , (ii) 550 m.
- c) (i) 200 ft , (ii) 350 m.
- d) (i) 100 ft , (ii) 350 m.

Answer ;

- a) (i) 200 ft , (ii) 550 m.

Açıklama ;

CAT I Minimaları				
Karar Yüksekliği (Not 7)	Kolaylıklar / RVR (Not 5)			
	Tam (Not 1 ve 6)	Orta Seviye (Not 2 ve 6)	Temel (Not 3 ve 6)	Yok (Not 4 ve 6)
200 ft	550 m	700 m	800 m	1000 m
201 – 250 ft	600 m	700 m	800 m	1000 m
251 – 300 ft	650 m	800 m	900 m	1200 m
301 ft ve üstü	800 m	900 m	1000 m	1200 m

- Not 1 :** Tüm kolaylıklar ; pist işaretleri , 720 m veya daha fazla yüksek yoğunluk/orta yoğunluklu yaklaşma ışıkları (HI/MI) , pist kenar ışıkları , pist eşik ışıkları ve pist sonu ışıklarından oluşur. Işıklar açık olmalıdır.
- Not 2 :** Orta seviyeli kolaylıklar ; pist işaretleri , 420-719 m yüksek yoğunluk/orta yoğunluklu yaklaşma ışıkları , pist kenar ışıkları , pist eşik ışıkları ve pist sonu ışıklarından oluşur. Işıklar açık olmalıdır.
- Not 3 :** Temel kolaylıklar ; pist işaretleri , 420 metreden daha az yüksek yoğunluk/orta yoğunluklu yaklaşma ışıkları , düşük yoğunlukta herhangi bir mesafede yaklaşma ışıkları , pist kenar ışıkları , pist eşik ışıkları ve pist sonu ışıklarından oluşur. Işıklar açık olmalıdır.
- Not 4 :** Yaklaşma ışıkları olmayan kolaylıklar ; pist işaretleri , pist kenar ışıkları , pist eşik ışıkları , pist sonu ışıkları veya başka ışıkların olmamasını belirtir.
- Not 5 :** Yukarıdaki rakamlar ; hem RVR'a göre dönüştürülen meteorolojik görüş ve hem de yayınlanmış RVR'dir.
- Not 6 :** Tablo , 4 derece ve daha aşağı süzülüş açısı eğimi ile geleneksel yaklaşımlara uygulanır.
- Not 7 :** Tablo 5'te belirtilen DH , karar yüksekliğinin ilk hesaplanmasıyla ilgilidir. İlgili RVR seçildiğinde , operasyonel prosedürler için yapılabilen en yakın 10 ft'e yuvarlamaya gerek yoktur.

0073. According to JAR-OPS 1 , a category IIIA precision approach (CAT IIIA) is an approach which may be carried out with a runway visual range of at least ;

- a) 200 m.
- b) 50 m.
- c) 250 m.
- d) 100 m.

Answer ;

- a) 200 m.

Açıklama ;

CAT III minimaları					
		Uçuş Kontrol Sistemi / RVR (metre)			
		Fail passive	Fail operasyonel		
			Roll-out kontrol sistemi olmadan	Roll-out guidance veya kontrol sistemiyle beraber	
Yaklaşma kategorisi	Karar yüksekliği (ft)			Fail passive	Fail operasyonel
IIIA	100 ft'ten az	200 m (not 1)	200 m	200 m	200 m
IIIB	50 ft'ten az	yetkili değil	yetkili değil	125 m	75 m
IIIC	karar yüksekliği yok	yetkili değil	yetkili değil	yetkili değil	75 m

- Not 1 :** 300 metreden az gerçek RVR değerli operasyonlar için DH veya altındaki irtifalarda oto pilot arızası pas geçmeyi gerektirir.

0074. According to JAR-OPS 1 , a category IIIB precision approach (CAT IIIB) is an approach which may be carried out with a runway visual range of at least ;

- a) 150 m.
- b) 75 m.
- c) 200 m.
- d) 250 m.

Answer ;

b) 75 m.

Açıklama ;

Soru 0073'ün açıklamasına bakınız.

0075. According to JAR-OPS 1 , a windshield wiper or equivalent means to maintain a clear portion of the windshield during precipitation is required at each pilot station to operate an aeroplane with a ;

- a) maximum approved passenger seating configuration is greater than 9.
- b) maximum certificated take-off mass is greater than 15.000 kg.
- c) maximum approved passenger seating configuration is greater than 30 after January 1st , 2000.
- d) maximum certificated take-off mass is greater than 5.700 kg.

Answer ;

d) maximum certificated take-off mass is greater than 5.700 kg.

0076. According to JAR-OPS 1 , an aeroplane whose maximum approved passenger seating configuration is 200 must be equipped with ;

- a) 3 hand fire extinguishers in the passenger compartment.
- b) 7 hand fire extinguishers in the passenger compartment.
- c) 5 hand fire extinguishers in the passenger compartment.
- d) 4 hand fire extinguishers in the passenger compartment.

Answer ;

a) 3 hand fire extinguishers in the passenger compartment.

0077. According to JAR-OPS 1 , an operator must select a take-off alternate ;

- a) for an IFR flight with a single-engine aeroplane.
- b) when conducting a flight over water of more than 2 hours or 400 NM , whichever is the lesser.
- c) if it would not be possible to return to the aerodrome of departure for meteorological or performance reasons.
- d) when the flight duration exceeds 6 hours.

Answer ;

c) if it would not be possible to return to the aerodrome of departure for meteorological or performance reasons.

Açıklama ;

Kalkış yedek meydanı (Take-off alternate) : Uçağın eğer kalkış yaptığı meydana tekrar inmesi meteorolojik şartlar veya performans kriterleri nedeniyle mümkün olmayacaksa , “alternate” olarak seçilmiş meydana.

0078. According to JAR-OPS 1 , an operator shall not operate across areas in which search and rescue would be especially difficult , unless it is equipped with ;

- 1. signalling equipment.
- 2. at least one ELT.
- 3. at least 2 ELTs.
- 4. additional survival equipment for the route to be flown.

The combination regrouping all the correct statements is ;

- a) 1 , 3 , 4.
- b) 1 , 4.
- c) 2 , 4.
- d) 1 , 2 , 4.

Answer ;

d) 1 , 2 , 4.

0079. According to JAR-OPS 1 , an operator shall not operate an aeroplane with a maximum approved passenger seating configuration of more than(i)..... , and when carrying(ii)..... or more passengers , unless at least one cabin crew is included.

- a) (i) 19 , (ii) one
- b) (i) 9 , (ii) five
- c) (i) 15 , (ii) five
- d) (i) 9 , (ii) one

Answer ;

a) (i) 19 , (ii) one

0080. According to JAR OPS 1 and assuming the following circumstances ; for a category A airplane and aerodrome equipped with runway edge lighting and centre line lighting and multiple RVR information. An acceptable alternate aerodrome is available , the minimum RVR/Visibility required for take-off ;

- a) 300 m.
- b) 200 m.
- c) 250 m.
- d) 150 m.

Answer ;

d) 150 m.

0081. According to JAR-OPS 1 , following a decompression , the maximum pressure altitude at which each member of the flight crew on flight deck duty are able to fly with no supplemental oxygen with no flight time limitation is ;

- a) 10.000 ft.
- b) 13.000 ft.
- c) 8.000 ft.
- d) 15.000 ft.

Answer ;

a) 10.000 ft.

0082. According to JAR-OPS 1 , for aeroplanes with a maximum certificated take-off mass over 5700 kg , flight data recorders shall be capable of retaining the data recorded during at least the last ;

- a) 10 flights.
- b) 25 flights.
- c) 25 hours of operation.
- d) 30 hours of operation.

Answer ;

c) 25 hours of operation.

0083. According to JAR-OPS 1 , for operations under IFR or at night the minimum flight crew is 2 pilots for ;

- a) all turbo-propeller aeroplanes and for all turbo-jet aeroplanes with a maximum approved passenger seating configuration of more than 9.
- b) all turbo-propeller aeroplanes with a maximum approved passenger seating configuration of more than 19 and for all turbo-jet aeroplanes.
- c) all turbo-propeller aeroplanes with a maximum approved passenger seating configuration of more than 9 and for all turbo-jet aeroplanes.
- d) all turbo-propeller aeroplanes and for all turbo-jet aeroplanes.

Answer ;

c) all turbo-propeller aeroplanes with a maximum approved passenger seating configuration of more than 9 and for all turbo-jet aeroplanes.

0084. According to JAR-OPS 1 , for two-engined aeroplanes in Performance class B or C without an ETOPS approval , the maximum distance from an adequate aerodrome is the distance flown in(i)..... minutes at the one-engine-inoperative cruise speed , or(ii).... NM.

- a) (i) 60 , (ii) 200
- b) (i) 120 , (ii) 200
- c) (i) 60 , (ii) 300
- d) (i) 120 , (ii) 300

Answer ;

d) (i) 120 , (ii) 300

0085. According to JAR-OPS 1 , oxygen masks for use by flight crew members shall be a quick donning type of mask , in pressurised aeroplanes operating at pressure altitudes above ;

- a) 41.000 ft.
- b) 25.000 ft.
- c) 39.000 ft.
- d) 10.000 ft.

Answer ;

b) 25.000 ft.

- 0086.** According to JAR-OPS 1 , planning minima for a destination aerodrome with an applicable precision approach procedure is ;
- a) RVR / visibility specified in accordance with JAR-OPS 1.225 , Aerodrome Operating Minima.
 - b) Non-precision minima plus 200 ft/1000 m.
 - c) Non-precision minima.
 - d) RVR / visibility and ceiling at or above DH specified in accordance with JAR-OPS 1.225 , Aerodrome Operating Minima.

Answer ;

- a) RVR / visibility specified in accordance with JAR-OPS 1.225 , Aerodrome Operating Minima.

- 0087.** According to JAR-OPS 1 Subpart K , in an aeroplane with a maximum configuration of more than 19 passengers , the door between the passenger compartment and the flight deck compartment shall have locking means ;

- a) capable of being remotely locked from either inside or outside the flight deck compartment.
- b) to prevent passengers from opening it without permission of a member of the flight crew.
- c) capable of being locked only from outside the flight deck compartment.
- d) capable of being remotely locked by cabin crew from outside the flight deck compartment.

Answer ;

- b) to prevent passengers from opening it without permission of a member of the flight crew.

- 0088.** According to JAR-OPS 1 terminology , a runway is considered damp when the runway surface is ;

- a) covered with water up to 1 mm deep.
- b) not dry , and the surface appears reflective.
- c) covered with water up to 3 mm deep.
- d) not dry , but when the moisture on it does not give it a shiny appearance.

Answer ;

- d) not dry , but when the moisture on it does not give it a shiny appearance.

- 0089.** According to JAR-OPS 1 , the lowest minima to be used by an operator for circling with a category A aeroplane is a meteorological visibility of ;

- a) 1500 m
- b) 2400 m
- c) 3600 m
- d) 1600 m

Answer ;

- a) 1500 m

Açıklama ;

Turlu yaklaşımda , işletici tarafından kullanılan en düşük minimalar şu şekildedir ;

Uçak Kategorisi	A	B	C	D
MDH	400 ft	500 ft	600 ft	700 ft
Minimum meteorolojik görüş	1500 m	1600 m	2400 m	3600 m

- 0090.** According to JAR-OPS 1 , the lowest minima to be used by an operator for circling with a category B aeroplane is a meteorological visibility of ;

- a) 1600 m
- b) 2400 m
- c) 1500 m
- d) 3600 m

Answer ;

- a) 1600 m

Açıklama ;

Soru 0089'un açıklamasına bakınız.

- 091.** According to JAR-OPS 1 , the lowest minima to be used by an operator for circling with a category C aeroplane is a meteorological visibility of ;

- a) 3600 m
- b) 2400 m
- c) 1500 m
- d) 1600 m

Answer ;

- b) 2400 m

Açıklama ;

Soru 0089'un açıklamasına bakınız.

0092. According to JAR-OPS 1 , the lowest minima to be used by an operator for circling with a category D aeroplane is a meteorological visibility of ;

- a) 2400 m
- b) 3600 m
- c) 1500 m
- d) 1600 m

Answer ;

b) 3600 m

Açıklama ;

Soru 0089'un açıklamasına bakınız.

0093. According to JAR-OPS 1 , the minimum number of crash axes or crowbars on board an aeroplane , whose maximum approved passenger seating configuration is 200 , is ;

- a) 2.
- b) 4.
- c) 3.
- d) 1.

Answer ;

d) 1.

0094. According to JAR-OPS 1 , the minimum number of crash axes or crowbars on board an aeroplane , whose maximum approved passenger seating configuration is more than 200 , is ;

- a) 2.
- b) 1.
- c) 3.
- d) 4.

Answer ;

a) 2.

0095. According to JAR-OPS 1 , the recent experience conditions of a commander assigned to a flight on an aeroplane by an operator must not be less than ;

- a) 6 take-offs and 6 landings during the last 6 months.
- b) 3 take-offs and 3 landings as pilot flying on the same type of aeroplane or approved simulator , of the aeroplane type to be used , in the preceding 90 days.
- c) 6 take-offs and 6 landings as pilot flying on the same type of aeroplane or approved simulator , of the aeroplane type to be used.
- d) 3 take-offs and 3 landings on this type of aeroplane during the last 6 months.

Answer ;

b) 3 take-offs and 3 landings as pilot flying on the same type of aeroplane or approved simulator , of the aeroplane type to be used , in the preceding 90 days.

0096. According to JAR-OPS 1 , the selection of a destination alternate is NOT required when ;

- a) the destination is isolated and no adequate destination alternate exists.
- b) you have an adequate take-off alternate.
- c) the destination aerodrome has an ILS approach for each runway.
- d) the duration of the planned flight does not exceed 8 hours and the weather forecast calls for VMC conditions at the destination aerodrome.

Answer ;

a) the destination is isolated and no adequate destination alternate exists.

0097. According to JAR-OPS 1 , what is the planning minima for a destination aerodrome , if it is equipped with a non-precision approach only ?

- a) RVR / visibility specified in accordance with JAR-OPS 1.225.
- b) RVR / visibility specified in accordance with JAR-OPS 1.225 , and the ceiling at or above MDH.
- c) Circling minima.
- d) Non-precision minima (RVR and the ceiling at or above MDH) plus 200 ft/1000 m.

Answer ;

b) RVR / visibility specified in accordance with JAR-OPS 1.225 , and the ceiling at or above MDH.

Açıklama ;

Soru 0098'in açıklamasına bakınız.

- 0098.** According to JAR-OPS 1 , what is the planning minima for a destination alternate with a CAT I approach available ?
- a) RVR according to Cat I.
 - b) Non-precision minima (RVR and the ceiling at or above MDH) plus 200 ft/1000 m.
 - c) Non-precision minima (RVR and the ceiling at or above MDH).
 - d) Circling minima.

Answer ;

- c) Non-precision minima (RVR and the ceiling at or above MDH).**

Açıklama ;

Meteorolojik raporlar , ETA'dan 1 saat önce ve 1 saat sonrası için planlanan minimalar aşağıdaki tabloya göre olmalıdır ;

YAKLAŞMA TİPİ	PLANLAMA MİNİMASI
Cat II ve III	Cat I (not 1)
Cat I	Hassas olmayan (not 1 ve 2)
Hassas olmayan	Hassas olmayan (not 1 ve 2) + 200 ft/1000 m
Meydan turlu	Meydan turlu

Not 1 : Uygun RVR.

Not 2 : Tavan , MDH'ye eşit veya üzerinde.

- 0099.** According to JAR-OPS 1 , what is the planning minima for a destination alternate with a CAT II approach available ?

- a) Non-precision minima.
- b) RVR according to Cat I.
- c) Non-precision minima plus 200 ft/1000 m.
- d) Circling minima.

Answer ;

- b) RVR according to Cat I.**

Açıklama ;

Soru 0098'in açıklamasına bakınız.

- 0100.** According to JAR-OPS 1 , what is the planning minima for a destination alternate with a non-precision approach available ?

- a) Non-precision minima (RVR and the ceiling at or above MDH).
- b) Non-precision minima (RVR and the ceiling at or above MDH) plus 200 ft/1000 m.
- c) Circling minima
- d) RVR according to Cat I.

Answer ;

- b) Non-precision minima (RVR and the ceiling at or above MDH) plus 200 ft/1000 m.**

Açıklama ;

Soru 0098'in açıklamasına bakınız.

- 0101.** According to JAR-OPS 1 , what minimum navigation equipment is required for operations under IFR , or under VFR over routes not navigated by reference to visual landmarks ?

- a) One VOR receiving system , one ADF system.
- b) One VOR receiving system , one ADF system , one DME.
- c) One VOR receiving system , one ADF system , two DMEs.
- d) One VOR receiving system , one DME.

Answer ;

- b) One VOR receiving system , one ADF system , one DME.**

- 0102.** According to JAR-OPS 1 , who is responsible for establishing Aerodrome Operating Minima for each aerodrome planned to be used for commercial purposes ?

- a) The State Authority.
- b) The Operator.
- c) The designated local aerodrome authority.
- d) The Commander.

Answer ;

- b) The Operator.**

0103. According to JAR-OPS 1 , without an ETOPS approval , the maximum distance from an adequate aerodrome for two-engined aeroplanes in Performance Class A , with a maximum approved passenger seating configuration of 20 or more , is the distance flown in minutes at the on.

- a) 30
- b) 60
- c) 120
- d) 90

Answer ;

b) 60

Açıklama ;

ETOPS onayı olmayan iki motorlu A sınıfı uçaklardan aşağıda belirtilenler , planlanan rotada eğer tek motor seyahat sürati ile 60 dakikada ulaşılabilir uygun bir meydana ulaşma imkanı yok ise uçuş planlamayacaklardır ;
– maksimum onaylanmış koltuk sayısı 20 ya da daha fazla olanlar , veya
– maksimum kalkış ağırlığı 45.360 kg veya daha fazla olanlar.

0104. According to JAR-OPS 1 , without an ETOPS approval , the maximum distance from an adequate aerodrome for two-engined aeroplanes in Performance Class A , with a maximum take-off mass of 45360 kg or more , is the distance flown in minutes at the on.

- a) 60
- b) 90
- c) 120
- d) 30

Answer ;

a) 60

Açıklama ;

Soru 0103'ün açıklamasına bakınız.

0105. According to North Atlantic MNPSA Operations Manual , what is the transponder code to be selected continuously 30 min after entry into NAT airspace ?

- a) Code 7500.
- b) Code 7000.
- c) Code 2000.
- d) The last assigned code prior to entry into NAT airspace.

Answer ;

c) Code 2000.

0106. According to the JAR-OPS requirement , the route of a twin-engine aircraft , non ETOPS , with a maximum certificated take-off mass exceeding 45360 kg or a maximum seating configuration of 20 passengers or more must be planned in such a way that on one engine an adequate aerodrome can be reached within ;

- a) 90 minutes at the cruise speed , one engine inoperative.
- b) 60 minutes at the cruise speed , one engine inoperative.
- c) 120 minutes at the cruise speed , one engine inoperative.
- d) 30 minutes at the cruise speed , one engine inoperative.

Answer ;

b) 60 minutes at the cruise speed , one engine inoperative.

Açıklama ;

Soru 0103'ün açıklamasına bakınız.

0107. According to the JAR-OPS requirements , an IFR flight with no alternate aerodrome can be undertaken only if the minimum weather conditions (VMC) are effective for at least ;

- a) 3 hours before to at least 1 hour after the expected time of arrival.
- b) 2 hours before to at least 2 hours after the expected time of arrival.
- c) 3 hours before to at least 3 hours after the expected time of arrival.
- d) 1 hour before to at least 1 hour after the expected time of arrival.

Answer ;

d) 1 hour before to at least 1 hour after the expected time of arrival.

Açıklama ;

Meteorolojik raporlara göre uçağın gideceği meydana varış tahminisinden (ETA) önceki 1 saat ve sonrasındaki 1 saat için belirtilen hava şartları uygulanabilir minimumların üzerinde ise , IFR bir uçuş için eğer herhangi bir yedek meydan seçilmeyebilir.

0108. According to the JAR OPS 1 , when a commercial transport passenger aircraft is equipped with a door in the flight crew compartment area , this door must include ;

- a) a device preventing the flight crew from being locked in the cockpit.
- b) a sealing system which , in case of depressurisation in the compartment area allows the maintenance of the pressure in the cockpit for as long as possible.
- c) a locking system to prevent any unauthorized access.
- d) distinctive red or yellow coloured markings indicating the access area (in case of a blocked door).

Answer ;

c) a locking system to prevent any unauthorized access.

0109. According to the recommended noise abatement procedures contained in the ICAO PANS OPS 8168 Volume I part V , data available indicates that the procedure which results in noise relief during the part of the procedure close to the airport ;

- a) is procedure B.
- b) depends on the wind component.
- c) is procedure A.
- d) is either procedure A or B , because there is not dif difference in noise distribution.

Answer ;

a) is procedure B.

Açıklama ;

Soru 0110'un açıklamasına bakınız.


0110. According to the recommended “noise abatement take-off and climb procedure” NADP2 , established in ICAO Doc 8168 , acceleration and flaps/slats retraction is initiated ;

- a) not below 1 000 ft.
- b) not below 800 ft.
- c) at 3 000 ft.
- d) at 1 500 ft.

Answer ;

b) not below 800 ft.

Açıklama ;

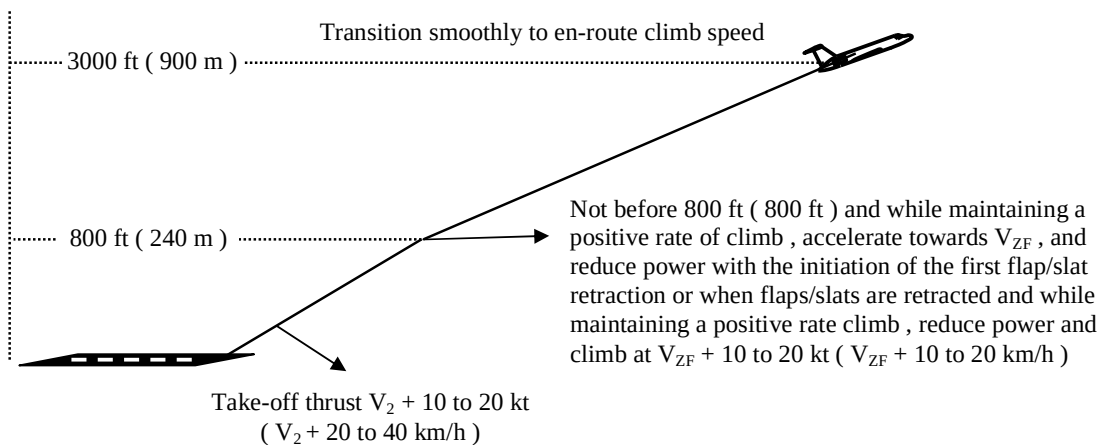

NADP 2

0111. According with DOC 4444 (ICAO) , a wake turbulence non-radar separation minima of 3 minutes shall be applied ;

- a) to a departing MEDIUM aircraft following a HEAVY aircraft arrival when operating on a runway with a displaced landing threshold.
- b) Between a LIGHT aircraft and a MEDIUM aircraft making a missed approach and the LIGHT aircraft utilizing an opposite-direction runway for take-off.
- c) to LIGHT aircraft taking-off behind a MEDIUM aircraft from an intermediate part of a parallel runway separated by less than 760 m.
- d) to an arriving LIGHT aircraft following a MEDIUM aircraft departure when operating on a runway with a displaced landing threshold , if the projected flight paths are expected to cross.

Answer ;

c) to LIGHT aircraft taking-off behind a MEDIUM aircraft from an intermediate part of a parallel runway separated by less than 760 m.

Açıklama ;

Soru 0112'nin açıklamasına bakınız.

- 0112.** According with DOC 4444 (ICAO) , a wake turbulence non-radar separation minima of 3 minutes shall be applied to ;
- LIGHT aircraft taking-off behind a MEDIUM aircraft when aircraft are using the same runway.
 - LIGHT aircraft landing behind a MEDIUM aircraft.
 - MEDIUM aircraft landing behind a HEAVY aircraft.
 - LIGHT aircraft taking-off behind a MEDIUM aircraft from a parallel runway separated by less than 760 m (using whole runway).

Answer ;

- b)** LIGHT aircraft landing behind a MEDIUM aircraft.

Açıklama ;

Wake Turbulence ayırmaları – İniş			
Öndeki uçak	Arkadaki uçak	Ayırma (mesafe)	Ayırma (zaman)
HEAVY	HEAVY	4 NM	2 dakika
HEAVY	MEDIUM	5 NM	2 dakika
HEAVY	LIGHT	6 NM	3 dakika
MEDIUM	HEAVY	3 NM	2 dakika
MEDIUM	MEDIUM	3 NM	2 dakika
MEDIUM	LIGHT	5 NM	3 dakika
LIGHT	HEAVY	3 NM	2 dakika
LIGHT	MEDIUM	3 NM	2 dakika
LIGHT	LIGHT	3 NM	2 dakika
Ters piste inildiği durumlarda 2 dakika			
Not : Bu ayırma minimumları ; – Aynı piste yaklaşan uçaklar arasında , – Aralarındaki mesafe 760 metreden az olan paralel pistlere yaklaşan uçaklar arasında , ve – Havada , öndeki uçak ile bu uçağın uçuş hattını 1000 feet’den az bir seviye farkı ile kat eden arkadaki uçak arasında uygulanır.			

Wake Turbulence ayırmaları – Kalkış		
Öndeki uçak	Arkadaki uçak	Ayırma (zaman)
HEAVY	HEAVY	2 dakika
HEAVY	MEDIUM	2 dakika
HEAVY	LIGHT	2 dakika
MEDIUM	HEAVY	2 dakika
MEDIUM	MEDIUM	2 dakika
MEDIUM	LIGHT	2 dakika
LIGHT	HEAVY	2 dakika
LIGHT	MEDIUM	2 dakika
LIGHT	LIGHT	2 dakika
Kavşak kalkışlarında (Intersection Take-off) 3 dakika		
Ters pistten kalkıldığı durumlarda 2 dakika		
Not : Bu ayırma minimumları ; – Aynı pistten kalkan uçaklar arasında , – Aralarındaki mesafe 760 metreden az olan paralel pistlerden kalkan uçaklar arasında uygulanır.		

0113. According with DOC 4444 (ICAO) , a wake turbulence radar separation minima of 9.3 km (5.0 NM) shall be applied when a ;

- MEDIUM aircraft is crossing behind a MEDIUM aircraft , at the same altitude or less than 300 m (1 000 ft)
- HEAVY aircraft is crossing behind a HEAVY aircraft , at the same altitude or less than 300 m (1 000 ft)
- LIGHT aircraft is crossing behind a HEAVY aircraft , at the same altitude or less than 300 m (1 000 ft)
- LIGHT aircraft is crossing behind a MEDIUM aircraft , at the same altitude or less than 300 m (1 000 ft)

Answer ;

- d)** LIGHT aircraft is crossing behind a MEDIUM aircraft , at the same altitude or less than 300 m (1 000 ft)

Açıklama ;

Soru 0112’nin açıklamasına bakınız.

0114. According with the “noise abatement take-off and climb procedure B”, as established in ICAO PANS OPS 8168 - Ops Volume 1 , part V , aircraft must climb at $V_2 + 10$ to 20 kt , until reaching ;

- a) 1 500 ft
- b) 3 000 ft
- c) 1 000 ft
- d) 500 ft

Answer ;

c) 1 000 ft

0115. Aeroplane wake turbulence during take off starts when ;

- a) the nose wheel lifts off the runway.
- b) slats and flaps are extended only.
- c) out of ground effect.
- d) the take off roll commences.

Answer ;

a) the nose wheel lifts off the runway.

0116. After a landing , with overweight and overspeed conditions , the tyres and brakes are extremely hot. The fireguards should approach the landing gear tyres ;

- a) under no circumstances.
- b) from any side.
- c) only from left or right side.
- d) only from front or rear side.

Answer ;

d) only from front or rear side.

0117. After an accident , the operator of an aircraft equipped with a flight recorder must keep the original recordings for a minimum period of ;

- a) 30 days.
- b) 60 days.
- c) 45 days.
- d) 90 days.

Answer ;

b) 60 days.

0118. After anti-icing has been completed , a pre-departure inspection reveals presence of frost , ice or snow. The correct action is to ;

- a) complete departure provided that the recommended anti-icing holdover (protection) time for the prevailing conditions and type of fluid used has not been exceeded.
- b) carry out a new de-icing/anti-icing procedure.
- c) switch on all the aircraft anti-icing and de-icing systems and leave on until clear of icing conditions when airborne.
- d) complete departure as soon as possible to reduce the possibility of further contamination.

Answer ;

b) carry out a new de-icing/anti-icing procedure.

0119. After take-off , an aeroplane is subjected to windshear with a decreasing head wind. In the absence of a pilot action , the aircraft ;

- 1. flies above the climb-out path.
- 2. flies below the climb-out path.
- 3. has an increasing true airspeed.
- 4. has a decreasing true airspeed.

The combination of correct statements is ;

- a) 2 , 4.
- b) 1 , 4.
- c) 2 , 3.
- d) 1 , 3.

Answer ;

a) 2 , 4.

0120. Air traffic services may require an aircraft to report position when flying east-west , north of 70°N between 10°W and 50°W , every ;

- a) 15° of longitude.
- b) 10° of longitude.
- c) 20° of longitude.
- d) 5° of longitude.

Answer ;

c) 20° of longitude.

0121. Air traffic services may require an aircraft to report position when flying east-west , south of 70°N between 5°W and 65°W , every ;

- a) 20° of longitude.
- b) 5° of longitude.
- c) 10° of longitude.
- d) 15° of longitude.

Answer ;

c) 10° of longitude.

0122. Aircraft may operate in MNPS airspace along a number of special routes , if the aircraft is equipped with at least ;

- a) three Inertial Navigation System (INS).
- b) two independent Long Range Navigation Systems (LRNS).
- c) one Long Range Navigation System (LNRS).
- d) two Inertial Navigation Systems (INS).

Answer ;

c) one Long Range Navigation System (LNRS).

0123. All aeroplanes which individual certificates of airworthiness were issued after 1 June 1990 must be fitted with a flight data recorder when their maximum certificated take-off mass is greater than ;

- a) 5 700 kg.
- b) 14 000 kg.
- c) 20 000 kg.
- d) 27 000 kg.

Answer ;

a) 5 700 kg.

0124. An aeroplane is intended to be operated at FL370. In accordance with JAR-OPS 1 , the number of cabin oxygen masks (dispensing units) required is at least ;

- a) 100% of the seating capacity plus one additional mask per seat row.
- b) 150% of the seating capacity.
- c) 110% of the seating capacity.
- d) 100% of the seating capacity plus one additional mask per seat block.

Answer ;

c) 110% of the seating capacity.

0125. An aeroplane is intended to be operated at FL 390.

Given that ;

Maximum approved passenger seating configuration = 230

Number of seats on board = 200

Scheduled number of passengers on board = 180

According to JAR-OPS 1 , the minimum required number of cabin oxygen masks (dispensing units) shall be ;

- a) 180.
- b) 230.
- c) 200.
- d) 220.

Answer ;

d) 220.

0126. An aeroplane is operated over water at a distance of 340 NM away from an aerodrome where an emergency landing could be performed. Normal cruising speed is 180 kt. One engine out airspeed is 155 kt , and it is capable to join the diversion aerodrome.

- a) The regulation does not require life jackets or rafts to be taken on board in this particular case.
- b) Life jackets and rafts must be available for all occupants.
- c) Life rafts must be available for all occupants.
- d) Life jackets must be available for all occupants.

Answer ;

d) Life jackets must be available for all occupants.

0127. An aeroplane suffers an explosive decompression at an altitude of 31.000 ft. What is the initial action by the operating crew ?
- place the seat belts sign to ON.
 - transmit a MAYDAY message.
 - disconnect the autopilot.
 - to put on oxygen masks.

Answer ;

d) to put on oxygen masks.

0128. An aeroplane which has a maximum certificated take-off mass over 5700 kg , shall be equipped with a cockpit voice recorder capable of retaining information recorded during at least the last ;

- 30 minutes or 1 hour of its operation , depending upon the date of the first issue of its individual Certificate of Airworthiness.
- 30 minutes or 2 hours of its operation , depending upon the date of the first issue of its individual Certificate of Airworthiness.
- 20 hours of its operation.
- 25 hours of its operation.

Answer ;

b) 30 minutes or 2 hours of its operation , depending upon the date of the first issue of its individual Certificate of Airworthiness.

0129. An aeroplane whose maximum approved configuration is 200 passenger seats must be equipped with ;

- 5 hand fire extinguishers in the passenger compartment.
- 4 hand fire extinguishers in the passenger compartment.
- 3 hand fire extinguishers in the compartment.
- 7 hand fire extinguishers in the passenger compartment.

Answer ;

c) 3 hand fire extinguishers in the compartment.

Açıklama ;

Onaylı maksimum yolcu oturma düzenlemesi	Söndürücü sayısı
7 – 30 arası	1
31 – 60 arası	2
61 – 200 arası	3
201 – 300 arası	4
301 – 400 arası	5
401 – 500 arası	6
501 – 600 arası	7
601 ve daha fazla	8

0130. An aeroplane whose maximum approved passenger seating configuration is 7 to 30 seats must be equipped with at least ;

- 4 hand fire-extinguishers conveniently located in the passenger compartment.
- 2 hand fire-extinguishers conveniently located in the passenger compartment.
- 3 hand fire-extinguishers conveniently located in the passenger compartment.
- 1 hand fire-extinguisher conveniently located in the passenger compartment.

Answer ;

d) 1 hand fire-extinguisher conveniently located in the passenger compartment.

Açıklama ;

Soru 0129'un açıklamasına bakınız.

0131. An aeroplane whose maximum approved passenger seating configuration is 31 to 60 seats must be equipped with at least ;

- 2 hand fire-extinguishers conveniently located in the passenger compartment.
- 4 hand fire-extinguishers conveniently located in the passenger compartment.
- 5 hand fire-extinguishers conveniently located in the passenger compartment.
- 3 hand fire-extinguishers conveniently located in the passenger compartment.

Answer ;

a) 2 hand fire-extinguishers conveniently located in the passenger compartment.

Açıklama ;

Soru 0129'un açıklamasına bakınız.

- 0132.** An aeroplane whose maximum approved passenger seating configuration is 61 to 200 seats must be equipped with at least ;
- a) 4 hand fire-extinguishers conveniently located in the passenger compartment.
 - b) 2 hand fire-extinguishers conveniently located in the passenger compartment.
 - c) 5 hand fire-extinguishers conveniently located in the passenger compartment.
 - d) 3 hand fire-extinguishers conveniently located in the passenger compartment.

Answer ;

d) 3 hand fire-extinguishers conveniently located in the passenger compartment.

Açıklama ;

Soru 0129'un açıklamasına bakınız.

- 0133.** An aeroplane whose maximum approved passenger seating configuration is 201 to 300 seats must be equipped with at least ;
- a) 4 hand fire-extinguishers conveniently located in the passenger compartment.
 - b) 3 hand fire-extinguishers conveniently located in the passenger compartment.
 - c) 5 hand fire-extinguishers conveniently located in the passenger compartment.
 - d) 6 hand fire-extinguishers conveniently located in the passenger compartment.

Answer ;

a) 4 hand fire-extinguishers conveniently located in the passenger compartment.

Açıklama ;

Soru 0129'un açıklamasına bakınız.

- 0134.** An aeroplane whose maximum approved passenger seating configuration is 301 to 400 seats must be equipped with at least ;
- a) 3 hand fire-extinguishers conveniently located in the passenger compartment.
 - b) 4 hand fire-extinguishers conveniently located in the passenger compartment.
 - c) 5 hand fire-extinguishers conveniently located in the passenger compartment.
 - d) 6 hand fire-extinguishers conveniently located in the passenger compartment.

Answer ;

c) 5 hand fire-extinguishers conveniently located in the passenger compartment.

Açıklama ;

Onaylı maksimum yolcu oturma düzenlemesi	Söndürücü sayısı
7 – 30 arası	1
31 – 60 arası	2
61 – 200 arası	3
201 – 300 arası	4
301 – 400 arası	5
401 – 500 arası	6
501 – 600 arası	7
601 ve daha fazla	8

- 0135.** An aeroplane whose maximum approved passenger seating configuration is 401 to 500 seats must be equipped with at least ;
- a) 6 hand fire-extinguishers conveniently located in the passenger compartment.
 - b) 5 hand fire-extinguishers conveniently located in the passenger compartment.
 - c) 7 hand fire-extinguishers conveniently located in the passenger compartment.
 - d) 8 hand fire-extinguishers conveniently located in the passenger compartment.

Answer ;

a) 6 hand fire-extinguishers conveniently located in the passenger compartment.

Açıklama ;

Soru 0134'ün açıklamasına bakınız.

- 0136.** An aeroplane whose maximum approved passenger seating configuration is 501 to 600 seats must be equipped with at least ;
- a) 7 hand fire-extinguishers conveniently located in the passenger compartment.
 - b) 5 hand fire-extinguishers conveniently located in the passenger compartment.
 - c) 6 hand fire-extinguishers conveniently located in the passenger compartment.
 - d) 8 hand fire-extinguishers conveniently located in the passenger compartment.

Answer ;

a) 7 hand fire-extinguishers conveniently located in the passenger compartment.

Açıklama ;

Soru 0134'ün açıklamasına bakınız.

0137. An aeroplane whose maximum approved passenger seating configuration is greater than 60 seats must be equipped (including flight deck) with at least ;

- a) 4 HALON 1211 fire-extinguishers or equivalent.
- b) 2 HALON 1211 fire-extinguishers or equivalent.
- c) 3 HALON 1211 fire-extinguishers or equivalent.
- d) 1 HALON 1211 fire-extinguisher or equivalent.

Answer ;

- c) 3 HALON 1211 fire-extinguishers or equivalent.**

Açıklama ;

Soru 0134'ün açıklamasına bakınız.

0138. An aeroplane whose maximum approved passenger seating configuration is greater than 600 seats must be equipped with at least ;

- a) 8 hand fire-extinguishers conveniently located in the passenger compartment.
- b) 6 hand fire-extinguishers conveniently located in the passenger compartment.
- c) 9 hand fire-extinguishers conveniently located in the passenger compartment.
- d) 7 hand fire-extinguishers conveniently located in the passenger compartment.

Answer ;

- a) 8 hand fire-extinguishers conveniently located in the passenger compartment.**

Açıklama ;

Soru 0134'ün açıklamasına bakınız.

0139. An aeroplane with 8 passengers on board is operated at FL 270. The supply of undiluted oxygen carried on board shall be sufficient for at least ;

- a) 2 passengers for the remainder of the flight after cabin depressurisation when the cabin altitude exceeds 10000 ft.
- b) no first aid required.
- c) 1 passenger for the remainder of the flight after cabin depressurisation when the cabin altitude exceeds 14000 ft.
- d) 1 passenger for the remainder of the flight after cabin depressurisation when the cabin altitude exceeds 8000 ft.

Answer ;

- d) 1 passenger for the remainder of the flight after cabin depressurisation when the cabin altitude exceeds 8000 ft.**

0140. An aircraft airworthiness certificate states a maximum of eight occupants (including pilot). The pilot has a passenger load of six adults and two children (5 and 6 years old). The boarding of all passengers is ;

- a) authorized , providing both children are sitting on the same seat and using the same seat belt. No other particular precautions are necessary.
- b) authorized , providing both children are of a similar stature , sitting on the same seat and using the same seat belt with an adult sitting on the seat next to them in order to release their seat belt.
- c) forbidden.
- d) authorized , providing both children are sitting on the same seat , using the same seat belt with an adult sitting on the seat next to them , in order to release their seat belt if necessary.

Answer ;

- c) forbidden.**

0141. An aircraft flies a VOR/DME direct approach for which the operational minima are ;

MDH = 360 feet

Horizontal visibility = 1 500 metres

Visibility given by ATC and received by the crew is 2 500 metres. The pilot may start the final approach

- a) regardless the ceiling given by ATC.
- b) if the ceiling transmitted by ATC and received by the crew is higher than 360 feet.
- c) if the ceiling transmitted by ATC and received by the crew is higher than 240 feet during the day and 360 feet at night.
- d) if the ceiling transmitted by ATC and received by the crew is higher than 240 feet.

Answer ;

- a) regardless the ceiling given by ATC.**
-

0142. An aircraft flying above FL 410 in North Atlantic (NAT) Airspace is unable to continue flight in accordance with its air traffic control clearance , but is able to maintain its assigned level , and due to a total loss of communications capability , cannot obtain a revised clearance from ATC. The aircraft should leave its assigned route or track by turning 90° (90 degrees) to the right of left whenever this is possible , and turn to acquire and maintain in either direction track laterally separated by 30 NM from its assigned route and ;

- a) climb 500 ft or descend 1 000 ft.
- b) climb 1 000 ft or descent 500 ft.
- c) climb or descent 500 ft.
- d) climb or descend 1 000 ft.

Answer ;

- d)** climb or descend 1 000 ft.
-

0143. An aircraft flying at flight level 370 (FL 370) in MNPS Airspace is unable to continue flight in accordance with its air traffic control clearance (degradation of navigational performance requirements , mechanics troubles etc) , but is able to maintain its assigned level (FL 370) , and due to a total loss of communications capability , cannot obtain a revised clearance from ATC. The aircraft should leave its assigned route or track by turning 90° (90 degrees) to the right or left whenever this is possible , and turn to acquire and maintain in either direction a track laterally separated by 30 NM from its assigned route and ;

- a) climb or descent 1 000 ft.
- b) climb 500 ft or descend 1 000 ft.
- c) climb or descent 1 000 ft or descend 500 ft.
- d) climb or descend 500 ft.

Answer ;

- d)** climb or descend 500 ft.
-

0144. An aircraft flying at flight level 370 (FL 370) on MNPS Airspace is unable to continue flight in accordance with its air traffic control clearance (degradation of navigational performance requirements , mechanics troubles etc) , but is able to maintain its assigned level (FL 370) , and due to a total loss of communications capability , could not obtain a revised clearance from ATC. The aircraft should leave its assigned route or track by turning 90° (90 degrees) to the right or left whenever this is possible , and the subsequent action will be , turn to acquire and maintain in either direction a track laterally separated by 15 NM from its assigned route and ;

- a) climb or descent 1 000 ft.
- b) climb or descent 500 ft.
- c) climb or descent 1 000 ft or descend 500 ft.
- d) climb 500 ft or descend 1 000 ft.

Answer ;

- b)** climb or descent 500 ft.
-

0145. An aircraft having undergone an anti-icing procedure and having exceeded the holdover time of the anti-icing fluid ;

- a) need not undergo a new anti-icing procedure for take-off.
- b) must undergo a de-icing procedure before a new application of anti-icing fluid for takeoff.
- c) must only undergo a de-icing procedure for take-off.
- d) must only undergo a new anti-icing procedure for take-off.

Answer ;

- b)** must undergo a de-icing procedure before a new application of anti-icing fluid for takeoff.
-

0146. An aircraft having undergone an anti-icing procedure must be anti-icing fluid free at the latest when ;

- a) it is implementing its own anti-icing devices.
- b) it is rotating (before taking-off).
- c) leaving the icing zone.
- d) releasing the brakes in order to take-off.

Answer ;

- b)** it is rotating (before taking-off).
-

0147. An aircraft leaves point P (60°N 030°W) on a true heading equal to 090° while the gyro compass , which is assumed to be operating perfectly and without an hourly rate corrector unit , indicates 000°. The aircraft arrives at point Q (62°N 010°W) on a true heading equal to 095°. On the journey from P to Q the gyro compass remains in free gyro mode. If the flight lasted 1 hour 30 minutes , the gyro heading at Q will be ;

- a) 334°.
- b) 345°.
- c) 328°.
- d) 003°.

Answer ;

c) 328°.

Çözüm ;

types of error: Earth Rate = $15 \times \sin \text{lat}$ (this is a rate of error) Therefore:

Amount of Earth Rate Error = $15 \sin \text{lat} \times \text{Flight time}$ Latitude Nut = $15 \times \sin \text{lat}$ (this is a rate of error)

Therefore: Amount of Lat Nut error = $15 \sin \text{lat} \times \text{Flight time}$

A correctly set latitude nut corrects for earth rate (look at the +/- table on page 9.3)

Transport wander = Degrees of longitude travelled $\times \sin \text{lat}$

For this question....no hourly correction has been set....ie no latitude nut correction....so we need to calculate Earth Rate and Transport Wander.

Earth Rate = $15 \times \sin 61 \times 1.5 = 20$

Transport wander = $20 \times \sin 61 = 17$

Looking at the +/- table, both these errors are minus errors, so total error is -37.

We start with 090T, 000Gyro

We finish with 095T, so with no error we would expect 005Gyro However, we have -37 of error, $(005 - 37) = 328$.

0148. An aircraft operating within MNPS Airspace is unable to continue flight in accordance with its air traffic control clearance , but is able to maintain its assigned level , and due to a total loss of communications capability , cannot obtain a revised clearance from ATC. The aircraft should leave its assigned route or track by turning 90° (90 degrees) to the right or left whenever this is possible , and turn to acquire and maintain in either direction a track laterally separated by 30 NM from its assigned route and climb 1 000 ft or descend 500 ft , if ;

- a) at FL410.
- b) at FL 430.
- c) above FL 410.
- d) below FL 410.

Answer ;

a) at FL410.

0149. An aircraft operating within MNPS Airspace is unable to continue flight in accordance with its air traffic control clearance , but is able to maintain its assigned level , and due to a total loss of communications capability , cannot obtain a revised clearance from ATC. The aircraft should leave its assigned route or track by turning 90° (90 degrees) to the right or left whenever this is possible , and turn to acquire and maintain in either direction a track laterally separated by 30 NM from its assigned route and climb or descend 500 ft , if ;

- a) at FL 410.
- b) below FL 410.
- c) at FL 430.
- d) above FL 410.

Answer ;

b) below FL 410.

0150. An aircraft which experiences a headwind of 40 kt while making its way towards the centre of a microburst may expect , when crossing the microburst , to face a windshear of ;

- a) 60 kt.
- b) 20 kt.
- c) 80 kt.
- d) 40 kt.

Answer ;

c) 80 kt.

- 0151.** An aircraft whose maximum approved seating configuration is 10 seats must be equipped with ;
- a) two hand fire-extinguishers in the cockpit/flight deck and two hand fire-extinguishers in the passengers compartment.
 - b) one hand fire-extinguisher in the cockpit/flight deck and two hand fire-extinguishers in the passengers compartment.
 - c) one hand fire-extinguisher in the cockpit/flight deck and one hand fire-extinguisher in the passengers compartment.
 - d) three hand fire-extinguishers in the passengers compartment.

Answer ;

- c)** one hand fire-extinguisher in the cockpit/flight deck and one hand fire-extinguisher in the passengers compartment.
-

- 0152.** An engine fire warning will switch on the relevant fire shut off-handle. The fire shut-off handle will be switched off when ;
- a) fire is no longer detected.
 - b) all the fire-extinguishers connected to this engine have been triggered.
 - c) the fire shut-off handle has been pulled.
 - d) the fire-extinguisher has been triggered.

Answer ;

- a)** fire is no longer detected.
-

- 0153.** An operator can operate an aeroplane certificated to JAR25 , across an area in which search and rescue would be especially difficult , without additional survival equipment if it flies away from an area suitable for making an emergency landing at a distance corresponding to no more than ;

- a) 30 minutes at cruising speed.
- b) 120 minutes at cruising speed.
- c) 60 minutes at cruising speed.
- d) 90 minutes at cruising speed.

Answer ;

- d)** 90 minutes at cruising speed.
-

- 0154.** An operator is permitted to use an aircraft with certain items of equipment out of service if this is permitted in ;
- a) the Maintenance Schedule , in the Approval Specifications Section.
 - b) the Minimum Equipment List (MEL) or Master Minimum Equipment List (MMEL).
 - c) the approval conditions for return to service following maintenance.
 - d) JAR-OPS Subpart M.

Answer ;

- b)** the Minimum Equipment List (MEL) or Master Minimum Equipment List (MMEL).
-

- 0155.** An operator must ensure that for the duration of each flight , be kept on the ground , if required ;
- a) a copy of the calculated take-off performances.
 - b) meteorological information.
 - c) mass and balance documentation.
 - d) the calculation of the airborne fuel quantity.

Answer ;

- c)** mass and balance documentation.
-

- 0156.** An operator shall ensure that for the duration of each flight or series of flights , relevant information is preserved on the ground. This includes ;

- a) mass and balance documentation , if required.
- b) a copy of the calculated take-off performance.
- c) the calculation of the airborne fuel quantity.
- d) meteorological information.

Answer ;

- a)** mass and balance documentation , if required.
-

0157. An operator shall ensure that information relevant to the flight is preserved on the ground for the duration of each flight or series of flights. This includes ;

1. appropriate meteorological information.
2. a copy of the operational flight plan and , if required , the mass and balance documentation.
3. copies of the relevant parts of the aircraft technical log.
4. route specific NOTAM documentation if specifically edited by the operator.
5. special loads notification.
6. copies of the day's performances and limitations with completed charts.

The combination regrouping all the correct statements is ;

- a) 2 , 3 , 4 , 5.
- b) 1 , 2 , 3 , 5 , 6.
- c) 2 , 3 , 5.
- d) 2 , 4 , 5.

Answer ;

- a) 2 , 3 , 4 , 5.
-

0158. An operator shall not operate an aeroplane first issued with an individual Certificate of Airworthiness before 1 April 1998 with a maximum certificated take-off mass over 5700 kg , unless it is equipped with a cockpit voice recorder which shall be capable of retaining information recorded during at least the last ;

- a) 25 hours of its operation.
- b) 30 minutes of its operation.
- c) 20 hours of its operation.
- d) 2 hours of its operation.

Answer ;

- b) 30 minutes of its operation.
-

0159. An operator shall not operate an aeroplane first issued with an individual Certificate of Airworthiness on or after 1 April 1998 , which has a maximum certificated take-off mass over 5700 kg , unless it is equipped with a cockpit voice recorder which records ;

1. Voice communications transmitted from or received on the flight deck by radio.
2. The aural environment of the flight deck.
3. The cabin attendants communications in the cabin using the aeroplane's interphone system.
4. Voice communications of flight crew members on the flight deck using the aeroplane's interphone system.
5. Voice or audio signals identifying navigation or approach aids introduced into a headset or speaker.
6. Voice communications of flight crew members on the flight deck using the public address system , if installed.

The combination regrouping all the correct statements is ;

- a) 2 , 3 , 4 , 6.
- b) 2 , 4 , 5 , 6.
- c) 1 , 2 , 3 , 5 , 6.
- d) 1 , 2 , 4 , 5 , 6.

Answer ;

- d) 1 , 2 , 4 , 5 , 6.
-

0160. An operator shall not operate an aeroplane first issued with an individual Certificate of Airworthiness on or after 1 April 1998 , which has a maximum certificated take-off mass over 5700 kg , unless it is equipped with a cockpit voice recorder which shall be capable of retaining information recorded during at least the last ;

- a) 25 hours of its operation.
- b) 2 hours of its operation.
- c) 20 hours of its operation.
- d) 30 minutes of its operation.

Answer ;

- d) 30 minutes of its operation.
-

0161. An operator shall not operate an aeroplane unless it is equipped with a cockpit voice recorder which starts to record automatically ;

- a) prior to the aeroplane moving under its own power until the termination of the flight when the aeroplane is no longer capable of moving under its own power.
- b) prior to the aeroplane moving under its own power until the termination of flight when the parking brake is set.
- c) when the parking brake is released until the termination of flight when the parking brake is set.
- d) when full thrust is applied until the termination of the flight when the aeroplane is no longer capable of moving under its own power.

Answer ;

- a) prior to the aeroplane moving under its own power until the termination of the flight when the aeroplane is no longer capable of moving under its own power.
-

0162. Arriving at the point of entry into MNPS (Minimum Navigation Performance Specification) airspace (except Shanwick Oceanic) and not having yet received the oceanic clearance , the crew ;

- a) returns to base immediately.
- b) keeps flying in accordance with the current flight plan.
- c) carries out a holding pattern.
- d) keeps flying deviating its course by 30 nautical miles from that of the current flight plan.

Answer ;

- b) keeps flying in accordance with the current flight plan.
-

0163. Articles and substances are considered to be dangerous goods if defined as such by ;

- a) the UNO document entitled “Dangerous Goods Regulations”.
- b) JAA.
- c) the IATA document entitled “Regulations governing the transportation of dangerous goods by air”.
- d) the ICAO document entitled “Technical Instructions for the safe transport of dangerous goods by air”.

Answer ;

- d) the ICAO document entitled “Technical Instructions for the safe transport of dangerous goods by air”.
-

0164. As a commander , if you are notified that a package of dangerous goods appears to be damaged , you ;

- a) mention it on the shipper’s declaration.
- b) mention it on the Notification to Captain.
- c) accept it after a visual inspection.
- d) ensure that arrangements are made for its removal.

Answer ;

- d) ensure that arrangements are made for its removal.
-

0165. As a pilot in command , during flight preparation , if you are notified that a dangerous package has been damaged during its loading , you ;

- a) mention it on the shipper’s declaration.
- b) ensure that arrangements are made for its removal.
- c) accept it after a visual inspection.
- d) mention it on the Notification to Captain.

Answer ;

- b) ensure that arrangements are made for its removal.
-

0166. As regards the detection of bird strike hazard , pilots may obtain information on bird strike hazards by means of ;

- 1. ATIS.
- 2. NOTAMs.
- 3. BIRDTAMs.
- 4. Weather radar.
- 5. The report by another crew.

The combination regrouping all the correct statements is ;

- a) 1 , 2 , 5.
- b) 1 , 2 , 3 , 4 , 5.
- c) 2 , 5.
- d) 1 , 3 , 4.

Answer ;

- a) 1 , 2 , 5.
-

0167. Assuming 60 people on board a land aeroplane. The intended track will overfly water for a distance of 80 NM from the shore. According to JAR-OPS 1 , the minimum number of life jackets to be on board is ;

- a) 66.
- b) 0.
- c) None if equipped with life rafts.
- d) 60.

Answer ;

d) 60.

0168. Assuming a multi-engine land aeroplane with 60 persons on board. The cruising speed is 180 kt. The aeroplane is capable of continuing the flight with the critical power-unit becoming inoperative. The track will overfly water for a distance of 380 NM from land which is suitable for making an emergency landing. According to JAR-OPS 1 , the minimum number of life rafts shall be ;

- a) 3 life rafts of 30-seat capacity.
- b) 1 life raft of 30-seat capacity and 2 life rafts of 20-seat capacity.
- c) 2 life rafts of 30-seat capacity.
- d) none , distance being less than 400 NM.

Answer ;

a) 3 life rafts of 30-seat capacity.

0169. Assuming contaminated runway conditions , if an aeroplane's main wheel tyre pressure is 206 psi. , the approximate speed above which dynamic hydroplaning may occur is ;

- a) 80 kt.
- b) 100 kt.
- c) 114 kt.
- d) 129 kt.

Answer ;

d) 129 kt.

Çözüm ;

$$V = 9\sqrt{p}$$

$$V = 9 \times \sqrt{206} = 9 \times 14.352 = 129.168 \approx 129 \text{ kt üzerinde dinamik Hydroplaning başlamaktadır.}$$

NOT : Bu soru ile ilgili detaylı açıklama soru 0239'da yer almaktadır.

0170. Assuming that the operator is approved by his national authorities , carriage of dangerous goods is allowed , provided that ;

- a) the dangerous goods transport document is approved by the national authority prior to each flight.
- b) no passenger and dangerous goods are carried on the same flight.
- c) the operator has certified the dangerous goods.
- d) the operator complies with the technical instructions (ICAO DOC 9284).

Answer ;

d) the operator complies with the technical instructions (ICAO DOC 9284).

0171. Assuming that the operator is approved by his national authorities , carriage of dangerous goods is allowed , provided that ;

- a) the airline is approved to and complies with the technical instructions (ICAO DOC 9284).
- b) no passenger is carried on the same flight.
- c) government permission has been granted and compliance with the technical instructions.
- d) national aviation administration permission has been granted.

Answer ;

a) the airline is approved to and complies with the technical instructions (ICAO DOC 9284).

0172. Astronomic precession ;

- a) causes an apparent wander on the axis of the directional gyro to the right in the southern hemisphere.
- b) causes an apparent wander on the axis of the directional gyro to the left in the southern hemisphere.
- c) is zero at the South pole.
- d) is zero at the North pole.

Answer ;

b) causes an apparent wander on the axis of the directional gyro to the left in the southern hemisphere.

0173. Astronomic precession ;

- a) causes an apparent spin of heading gyro to the right in the southern hemisphere.
- b) is zero at the North pole.
- c) is zero at the South pole.
- d) causes an apparent spin of heading gyro to the left in the southern hemisphere.

Answer ;

d) causes an apparent spin of heading gyro to the left in the southern hemisphere.

0174. Astronomic precession ;
- a) causes the gyro axis to spin to the right in the Northern hemisphere.
 - b) is zero at the South pole.
 - c) causes the gyro axis to spin to the left in the Northern hemisphere.
 - d) is zero at the North pole.

Answer ;

- a) causes the gyro axis to spin to the right in the Northern hemisphere.
-

0175. Astronomic precession ;
- a) is zero at the North pole.
 - b) causes the gyro axis to spin to the left in the Northern hemisphere.
 - c) causes the gyro axis to spin to the left in the Southern hemisphere.
 - d) is zero at the South pole.

Answer ;

- c) causes the gyro axis to spin to the left in the Southern hemisphere.
-

0176. Astronomic precession is ;
- a) zero when the aircraft is on the ground.
 - b) existing whether the aircraft is on the ground or flying.
 - c) depending on the chart used.
 - d) independent of the latitude.

Answer ;

- b) existing whether the aircraft is on the ground or flying.
-

0177. At a given configuration , the wake turbulence of an aeroplane is greater when the aeroplane is ;
- a) light at high airspeed.
 - b) heavy at low airspeed.
 - c) light at low airspeed.
 - d) heavy at high airspeed.

Answer ;

- b) heavy at low airspeed.
-

0178. At any ambient temperature up to +30°C and with a relative humidity as low as 40% , in clear air , free of fog and precipitation , serious carburettor icing ;

- a) cannot occur
- b) can occur at any setting
- c) can occur , but only at full power or cruise settings
- d) can occur , but only at a low power setting

Answer ;

- d) can occur , but only at a low power setting
-

0179. (Refer to Image 2)

The graph below shows aeroplane cruising altitude versus cabin altitude when the aeroplane's pressure altimeter and cabin pressure Controller are set to 1013.2 mb. The graph is used to determine/select cabin altitude appropriate to the aeroplane's cruise altitude, and also, by a combination of the same parameters to determine the differential pressure prevailing at these altitudes.

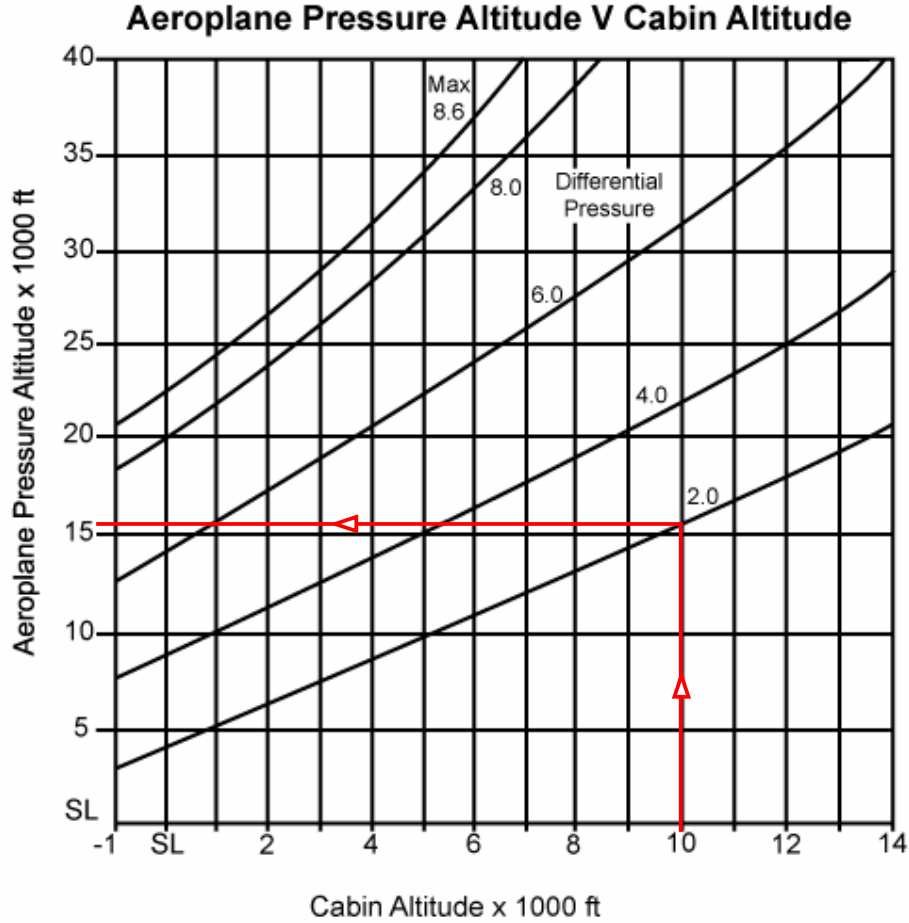


Image 2

At Reference. Due to a cabin pressurisation defect the maximum differential pressure is limited to 2 psi. Assuming you don't want the cabin altitude being greater than 10000 feet , the maximum achievable flight altitude is approximately ;

- a) 15000 ft
- b) 5000 ft
- c) 15100 ft
- d) 12000 ft

Answer;

c) 15100 ft

Çözüm ;

Cabin basınçlandırmasındaki bir arızadan dolayı , diferansiyel basınç maksimum 2 psi olarak limitlidir. Bu durumda cabin irtifasını en fazla 10000 feet olarak tutmak için uçulabilir maksimum irtifa sorulmuştur.

Verilen diagramın alt kısmında yer alan 10'dan (10 x 1000 ft = 10000 ft cabin irtifasını temsil eder) başlayarak yukarıya doğru Differential Pressure çizgilerinde 2.0 psi çizgisine doğru çıkılır. Bu çizgi kesildikten sonra solda yer alan Aeroplane Pressure Altitude (uçulabilecek basınç irtifasını temsil eder) skalasına doğru dik bir hat çizilir. Burada okunan değer yaklaşık olarak 15.1'dir , bu da **15100 ft** anlamına gelir.

0180. (Refer to Image 2)

The graph below shows aeroplane cruising altitude versus cabin altitude when the aeroplane's pressure altimeter and cabin pressure Controller are set to 1013.2 mb. The graph is used to determine/select cabin altitude appropriate to the aeroplane's cruise altitude, and also, by a combination of the same parameters to determine the differential pressure prevailing at these altitudes.

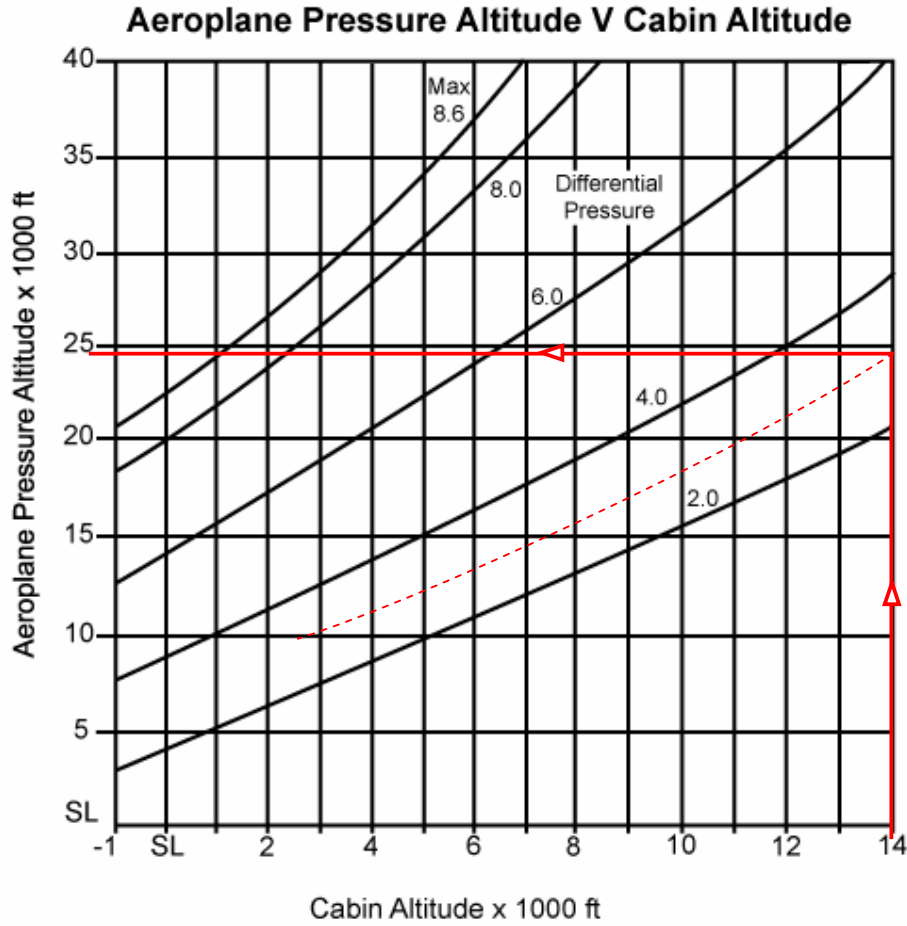


Image 2

At reference. Due to a cabin pressurisation defect the maximum differential pressure is limited to 3 psi. Assuming the oxygen masks will be deployed at 14000 feet , the maximum achievable flight altitude is approximately ;

- a) 27000 ft
- b) 29000 ft
- c) 22500 ft
- d) 24500 ft

Answer ;

d) 24500 ft

Çözüm ;

Cabin basınçlandırmasındaki bir arızadan dolayı , diferansiyel basınç maksimum 3 psi olarak limitlidir. Cabin oksijen maskeleri cabin irtifası 14000 feet olduğunda devreye girmektedir. Buna göre cabin irtifasını maksimum 14000 feet’de tutmak için uçulabilir maksimum irtifa sorulmuştur.

Verilen diagramın alt kısmında yer alan 14’den (14 x 1000 ft = 14000 ft cabin irtifasını temsil eder) başlayarak yukarıya doğru Differential Pressure çizgilerinde 3.0 psi çizgisine (2.0 ve 4.0 psi çizgileri arası) doğru çıkılır. Bu çizgi kesildikten sonra solda yer alan Aeroplane Pressure Altitude (uçulabilecek basınç irtifasını temsil eder) skalasına doğru dik bir hat çizilir. Burada okunan değer yaklaşık olarak 24.5’dir , bu da 24500 ft anlamına gelir.

0181. At the alternate aerodrome , the commander of a turbojet engine aeroplane should have a fuel quantity (final reserve) sufficient for flying during ;

- a) 30 minutes at cruising speed.
- b) 45 minutes at holding flight speed at 1500 ft.
- c) 45 minutes at cruising speed.
- d) 30 minutes at holding flight speed at 1500 ft.

Answer ;

- d) 30 minutes at holding flight speed at 1500 ft.**

0182. At which levels may Reduced Vertical Separation Minimum (RVSM) be used within the NAT region ?

- a) Between FL245 and FL410 inclusive.
- b) Below FL290.
- c) Between FL275 and FL400 inclusive.
- d) Between FL290 and FL410 inclusive.

Answer ;

- d) Between FL290 and FL410 inclusive.**

0183. CO₂ type extinguishers are suitable to fight ;

- 1. class A fires.
- 2. class B fires.
- 3. fires with an electrical origin.
- 4. special fires ; metals , gas , chemical products.

Which of the following combinations contains all the correct statements ;

- a) 1 , 2 , 3.
- b) 2 , 3 , 4.
- c) 1 , 2 , 4.
- d) 1 , 3 , 4.

Answer ;

- a) 1 , 2 , 3.**

0184. DOC 4444 (ICAO) establishes , that wake turbulence separation minima shall be based on a grouping of aircraft types into three categories according to the maximum certificated take-off mass. Heavy (H) Category , are all aircraft types of ;

- a) 136 000 Kg or more.
- b) less than 136 000 Kg but more than 126 000 Kg.
- c) 135 000 Kg or more.
- d) 146 000 Kg or more.

Answer ;

- a) 136 000 Kg or more.**

Açıklama ;

Wake Türbülans Kategorileri	
Kategori	Ağırlık
Light (L)	7.000 kg veya daha hafif
Medium (M)	7.000 – 136.000 kg
Heavy (H)	136.000 kg'dan fazla

0185. Due to a risk of tyre explosions when the brakes are very hot , the landing gear should be approached ;

- a) either from the front or the rear.
- b) from the inboard side.
- c) from any direction.
- d) from the outboard side.

Answer ;

- a) either from the front or the rear.**

0186. Due to risk of tyres explosion , after landing , when the brakes are at a very high temperature , one should approach the landing gear ;

- a) either from aft or fore.
- b) from the inboard side.
- c) from any direction.
- d) sideways.

Answer ;

- a) either from aft or fore.**

0187. During a conventional approach , the Minimum Descent Height (MDA) is referred to the runway threshold altitude and not to the aerodrome altitude if the runway threshold is at more than ;

- a) 4 m (14 ft) below the aerodrome altitude.
- b) 2 m (7 ft) below the aerodrome altitude.
- c) 4 m (14 ft) above the aerodrome altitude.
- d) 2 m (7 ft) above the aerodrome altitude.

Answer ;

b) 2 m (7 ft) below the aerodrome altitude.

0188. During a de-icing / anti-icing procedure carried out in two stages , the holdover time starts ;

- a) at the end of the second stage (anti-icing stage).
- b) at the end of the first stage (de-icing stage).
- c) at the beginning of the first stage (de-icing stage).
- d) at the beginning of the second stage (anti-icing stage).

Answer ;

d) at the beginning of the second stage (anti-icing stage).

0189. During a flight from Europe , scheduled in MNPS (Minimum Navigation Performance Specification) airspace , you expect to cross the 30°W meridian at 1330 UTC , you will normally be ;

- a) in a polar track system.
- b) in a night-time organised track system.
- c) outside the validity period of the organised track system.
- d) in a day-time organised track system.

Answer ;

d) in a day-time organised track system.

0190. During a flight to Europe , planned in MNPS (Minimum Navigation Performance Specification) airspace , you expect to cross the 30°W meridian at 00H30 UTC , you will then normally be ;

- a) within the organised night-time track system.
- b) within the polar track system.
- c) within the organised daytime track system.
- d) out of the validity period of organised flight track system.

Answer ;

d) out of the validity period of organised flight track system.

0191. During a flight to Europe , planned in MNPS (Minimum Navigation Performance Specification) airspace , you expect to cross the 30°W meridian at 11H00 UTC , you will then normally be ;

- a) within the polar track system.
- b) within the organised daytime flight track system.
- c) within the organised night-time flight track system.
- d) outside of the validity period of the organised track system.

Answer ;

d) outside of the validity period of the organised track system.

0192. During a flight to Europe , scheduled in MNPS (Minimum Navigation Performance Specification) airspace , you expect to cross the 30°W meridian at 0300 UTC , you will normally be ;

- a) in a day-time organised track system.
- b) in a night-time organised track system.
- c) outside the validity period of the organised track system.
- d) within the polar track system.

Answer ;

b) in a night-time organised track system.

0193. During a landing approach , the aircraft is subjected to windshear with a decreasing head wind. In the absence of a pilot action , the aircraft ;

1. flies above the glide path
2. flies below the glide path
3. has an increasing true airspeed
4. has a decreasing true airspeed

The combination of correct statements is ;

- a) 2 , 3.
- b) 2 , 4.
- c) 1 , 4.
- d) 1 , 3.

Answer ;

b) 2 , 4.

0194. During a landing approach , the aircraft is subjected to windshear with a decreasing tail wind. In the absence of a pilot action , the aircraft ;

1. flies above the glide path
2. flies below the glide path
3. has an increasing true airspeed
4. has a decreasing true airspeed

The combination of correct statements is ;

- a) 1 , 3.
- b) 1 , 4.
- c) 2 , 3.
- d) 2 , 4.

Answer ;

a) 1 , 3.

0195. During a landing approach , the aircraft is subjected to windshear with an increasing head wind. In the absence of a pilot action , the aircraft ;

1. flies above the glide path
2. flies below the glide path
3. has an increasing true airspeed
4. has a decreasing true airspeed

The combination of correct statements is ;

- a) 1 , 4.
- b) 1 , 3.
- c) 2 , 4.
- d) 2 , 3.

Answer ;

b) 1 , 3.

0196. During a landing approach , the aircraft is subjected to windshear with an increasing tail wind. In the absence of a pilot action , the aircraft ;

1. flies above the glide path
2. flies below the glide path
3. has an increasing true airspeed
4. has a decreasing true airspeed

The combination of correct statements is ;

- a) 2 , 4.
- b) 2 , 3.
- c) 1 , 4.
- d) 1 , 3.

Answer ;

a) 2 , 4.

0197. During a manual approach , the aeroplane is subjected to windshear with a decreasing head wind. In the absence of a pilot action , the aeroplane ;

1. flies above the intended approach path.
2. flies below the intended approach path.
3. has an increasing true airspeed.
4. has a decreasing true airspeed.

The combination of correct statements is ;

- a) 2 , 3.
- b) 1 , 3.
- c) 1 , 4.
- d) 2 , 4.

Answer ;

d) 2 , 4.

0198. During a manual approach , the aeroplane is subjected to windshear with a decreasing tail wind. In the absence of a pilot action , the aeroplane ;

1. flies above the intended approach path.
2. flies below the intended approach path.
3. has an increasing true airspeed.
4. has a decreasing true airspeed.

The combination of correct statements is ;

- a) 2 , 4.
- b) 1 , 3.
- c) 2 , 3.
- d) 1 , 4.

Answer ;

b) 1 , 3.

0199. During a manual approach , the aeroplane is subjected to windshear with an increasing head wind. In the absence of a pilot action , the aeroplane ;

1. flies above the intended approach path.
2. flies below the intended approach path.
3. has an increasing true airspeed.
4. has a decreasing true airspeed.

The combination of correct statements is ;

- a) 2 , 3.
- b) 2 , 4.
- c) 1 , 4.
- d) 1 , 3.

Answer ;

d) 1 , 3.

0200. During a manual approach , the aeroplane is subjected to windshear with an increasing tail wind. In the absence of a pilot action , the aeroplane ;

1. flies above the intended approach path.
2. flies below the intended approach path.
3. has an increasing true airspeed.
4. has a decreasing true airspeed.

The combination of correct statements is ;

- a) 2 , 4.
- b) 2 , 3.
- c) 1 , 4.
- d) 1 , 3.

Answer ;

a) 2 , 4.

0201. During a night flight , an observer located in the cockpit , seeing an aircraft coming from front left on approximate opposite parallel track , will first see the ;


- a) green steady light.
- b) red steady light.
- c) white steady light.
- d) green and white flashing light.

Answer ;

b) red steady light.

Açıklama ;

Gece uçuşu sırasında , kokpitten bakıldığında karşıdan ve hemen hemen uçağın rotasına paralel bir şekilde yaklaşmakta olan bir uçak görülmektedir. Soruda ilk görülecek ışığın hangisi olduğu sorulmuştur.

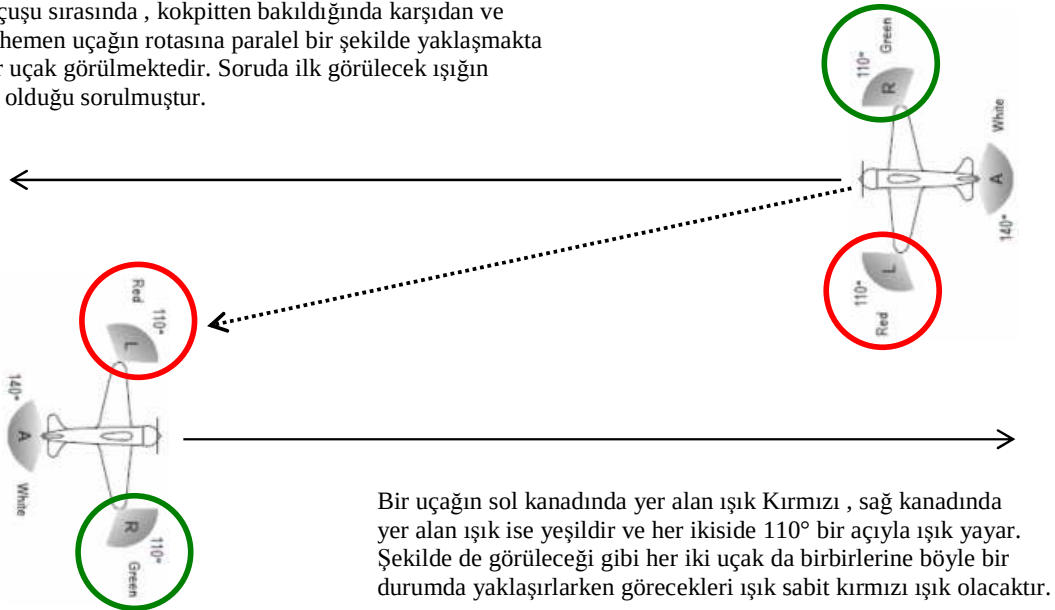

Bir uçağın sol kanadında yer alan ışık Kırmızı , sağ kanadında yer alan ışık ise yeşildir ve her ikisinde 110° bir açıyla ışık yayar. Şekilde de görüleceği gibi her iki uçak da birbirlerine böyle bir durumda yaklaşırlarken görecekları ışık sabit kırmızı ışık olacaktır.

0202. During a night flight , an observer located in the cockpit , seeing an aircraft coming from front right on approximate opposite parallel track , will first see the ;


- a) red light.
- b) white light.
- c) green light.
- d) red and white flashing light.

Answer ;

c) green light.

Açıklama ;

Gece uçuşu sırasında , kokpitten bakıldığında karşıdan ve hemen hemen uçağın rotasına paralel bir şekilde yaklaşmakta olan bir uçak görülmektedir. Soruda ilk görülecek ışığın hangisi olduğu sorulmuştur.

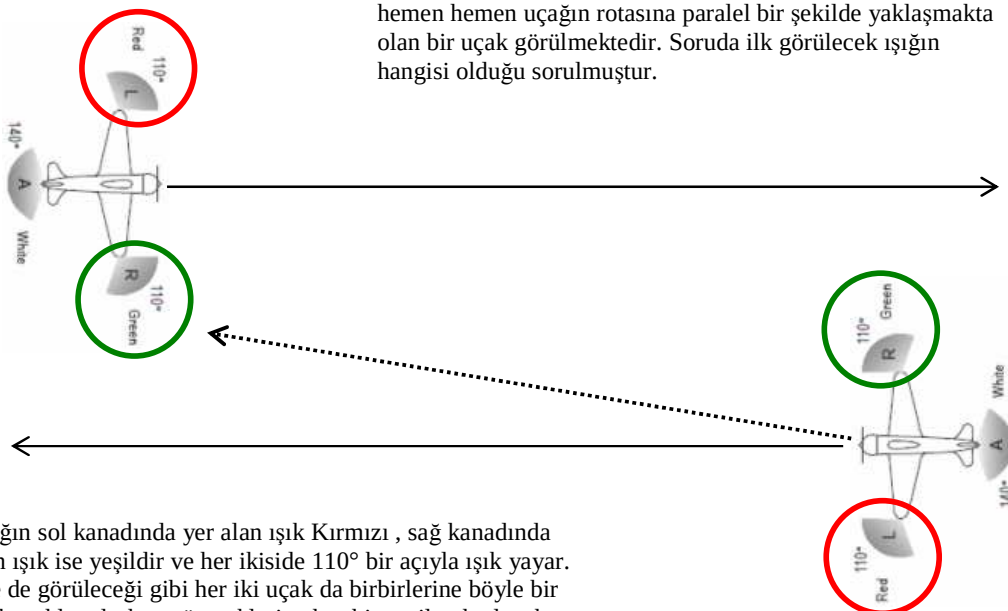

Bir uçağın sol kanadında yer alan ışık Kırmızı , sağ kanadında yer alan ışık ise yeşildir ve her ikisinde 110° bir açıyla ışık yayar. Şekilde de görüleceği gibi her iki uçak da birbirlerine böyle bir durumda yaklaşırlarken görecekları ışık sabit yeşil ışık olacaktır.

0203. During a special VFR flight , the minimum visibility required by JAR OPS is ;

- a) 5.000 meters.
- b) 1.500 meters or more.
- c) 3.000 meters.
- d) 2.500 meters.

Answer ;

b) 1.500 meters or more.

0204. During a transoceanic and polar flight , the chart precession is a rotation in degrees , for a moving aircraft , of the gyro North with respect to the ;

- a) true North for a given chart.
- b) grid North for any chart.
- c) grid North for a given chart.
- d) true North for any chart.

Answer ;

c) grid North for a given chart.

0205. During a transoceanic and polar flight , the transport precession is the rotation in degrees of the gyro North with respect to the ;

- a) magnetic North.
- b) compass North.
- c) grid North.
- d) true North.

Answer ;

d) true North.

0206. During an explosive decompression at flight level 370 (FL 370) , your first action will be ;

- a) to set the transponder to 7700.
- b) to comfort your passengers.
- c) to put on the oxygen mask.
- d) to warn the ATC.

Answer ;

c) to put on the oxygen mask.

0207. During an ILS procedure , if the information transmitted by the appropriate services and received by the crew contains parameters below the crew's operational minimums , the point beyond which the approach must not be continued is ;

- a) the FAF.
- b) the start final descent point (glide slope intersection).
- c) the middle marker.
- d) the outer marker (OM).

Answer ;

d) the outer marker (OM).

0208. During an ILS procedure , if the reported RVR/visibility is less than the applicable minima , the approach shall not be continued beyond ;

- a) the middle marker , or 500 ft above the aerodrome / heliport if there is no middle marker.
- b) the outer maker or equivalent , or 1000 ft above the aerodrome / heliport if there is no outer marker or equivalent.
- c) the FAF , or 1500 ft above the aerodrome / heliport if there is no FAF.
- d) the glide slope intersection.

Answer ;

b) the outer maker or equivalent , or 1000 ft above the aerodrome / heliport if there is no outer marker or equivalent.

- 0209.** During the certification flight tests regarding fuel jettisoning it must be shown that ;
1. Fuel jettisoning system and its operation are free from fire hazard.
 2. The fuel discharges clear of any part of the aeroplane.
 3. Fuel fumes do not enter any part of the aeroplane.
 4. The jettisoning operation does not adversely affect the controllability of the aeroplane.

The combination regrouping all the correct statements is ;

- a) 1 , 3 and 4.
- b) 1 and 4.
- c) 1 , 2 , 3 and 4.
- d) 2 and 3.

Answer ;

- c) 1 , 2 , 3 and 4.**
-

- 0210.** During the flight of two aircraft in MNPS airspace with a leading aircraft flying at higher speed , the longitudinal separation must not be below ;

- a) 5 minutes.
- b) 20 minutes.
- c) 15 minutes.
- d) 10 minutes.

Answer ;

- a) 5 minutes.**
-

- 0211.** During the passenger briefing for a flight requiring life jackets , the passengers shall be instructed to inflate their life jackets ;

- a) immediately on ditching.
- b) when outside the aircraft.
- c) as soon as ditching is prepared.
- d) immediately on the opening of the axis.

Answer ;

- b) when outside the aircraft.**
-

- 0212.** During the winter an aircraft is parked overnight prior to an early morning departure. The crew notice a slight glistening ice deposit on top of the wings or blades which appears translucent. Under these conditions ;

- a) a longer starting procedure will be necessary to warm up the aircraft.
- b) the take off performance of the aircraft will not be affected.
- c) there is no risk of ice accretion.
- d) the aircraft should be sprayed with de-icing fluid of the correct type.

Answer ;

- d) the aircraft should be sprayed with de-icing fluid of the correct type.**
-

- 0213.** Each crew member shall be properly secured by all safety belts AND harnesses provided ;

1. during taxiing.
 2. during take-off.
 3. during landing.
 4. whenever deemed necessary by the commander in the interest of safety.
 5. during other phases of the flight.
- a) 2 , 3 , 4.
 - b) 1 , 2 , 3 , 5.
 - c) 1 , 2 , 3 , 4.
 - d) 2 , 3 , 4 , 5.

Answer ;

- a) 2 , 3 , 4.**
-

0214. Each flight is subject to a preliminary file collecting a certain amount of information. The operator will see that this file is kept on ground. It contains more particularly ;

1. the weather conditions for the day including the weather forecast at destination.
2. one copy of the operational flight plan and , if required , the weight and balance sheet.
3. copies of the relevant parts of the aircraft's materiel report.
4. the en-route NOTAM documentation when specifically issued by the operator.
5. notification for special loadings.
6. for each flight , details of the day's performances and limitations with completed charts.

The combination regrouping all the correct statements is ;

- a) 1 , 3 , 5.
- b) 1 , 2 , 3 , 4 , 5 , 6.
- c) 2 , 3 , 4 , 5.
- d) 2 , 4.

Answer ;

c) 2 , 3 , 4 , 5.

0215. Fire fighting in the toilets must be performed with ;

- a) all available liquids.
- b) all available extinguishers simultaneously.
- c) only the extinguisher corresponding to the toilets.
- d) all available extinguishers in sequence.

Answer ;

b) all available extinguishers simultaneously.

0216. Flight data recorders must keep the data and parameters recorded during at least the last ;

- a) flight.
- b) 30 hours of operation.
- c) 25 hours of operation.
- d) 48 hours of operation.

Answer ;

c) 25 hours of operation.

0217. Flights within NAT region shall be conducted in accordance with IFR when ;

- a) Flying above 3000 ft above ground.
- b) Operating at or above FL 60 or 2000 ft above ground whichever is the higher.
- c) Operating more than 100 NM seaward from the shoreline within controlled airspace.
- d) Operating more than 100 NM seaward from the shoreline within uncontrolled airspace.

Answer ;

b) Operating at or above FL 60 or 2000 ft above ground whichever is the higher.

0218. Following a heavy mass landing on a short runway , you should pay attention to the ;

- a) temperature of the brakes.
- b) temperature of the hydraulic fluid.
- c) pressure of the hydraulic fluid.
- d) pressure of the pneumatic tyres.

Answer ;

a) temperature of the brakes.

0219. Following a landing with overweight and overspeed conditions , the tyres and brakes are extremely hot. For safety reasons , the landing gear wheels should be approached ;

- a) from front or rear side.
- b) from left or right side.
- c) under no circumstances.
- d) from any side.

Answer ;

a) from front or rear side.

0220. Following an act of unlawful interference on board an aircraft , the commander should submit a report to ;

- a) the Authority of the State within which the aircraft is operating at the time of the unlawful interference.
- b) both the local authority and the Authority of the State of the operator.
- c) the local authority only.
- d) the Authority of the State of the operator only.

Answer ;

b) both the local authority and the Authority of the State of the operator.

0221. Following an emergency landing which will need an escape from the aircraft , you will ;
1. remain on the runway.
 2. clear the runway using the first available taxiway.
 3. keep one engine or the APU running in order to maintain the electrical power supply on.
 4. turn off all systems.

The combination regrouping all the correct statements is ;

- a) 1 , 4.
- b) 2 , 3.
- c) 2 , 4.
- d) 1 , 3.

Answer ;

- a) 1 , 4.
-

0222. Following an explosive decompression , if you are using an oxygen diluter demand system , the regulator controls the amount of air that is mixed with pure oxygen when the supply selector is at the “normal” position. At what approximate altitude will the regulator supply to the mask become pure oxygen only ?

- a) 8.000 ft.
- b) 14.000 ft.
- c) 25.000 ft.
- d) 32.000 ft.

Answer ;

- d) 32.000 ft.
-

0223. Following an explosive decompression , the maximum altitude without oxygen supply at which flight crew efficiency is not impaired is ;

- a) 2.500 ft.
- b) 8.000 ft.
- c) 25.000 ft.
- d) 14.000 ft.

Answer ;

- b) 8.000 ft.
-

0224. For a given aeroplane , the wake turbulence increases when the aeroplane has a ;

- a) low mass and low airspeed.
- b) high mass and high airspeed.
- c) low mass and high airspeed.
- d) high mass and low airspeed.

Answer ;

- d) high mass and low airspeed.
-

0225. For a given ambient temperature and type of de-icing fluid , in which of the following conditions will the holdover (protection) time be the shortest ?

- a) Freezing fog.
- b) Steady snow.
- c) Frost.
- d) Freezing rain.

Answer ;

- d) Freezing rain.
-

0226. For a non pressurised aircraft , 100% of passengers shall be supplied with supplemental oxygen during ;

- a) the entire flight time at pressure altitudes above 13 000 ft.
- b) the entire flight time at pressure altitudes above 13 000 ft and for any period exceeding 30 minutes at pressure altitudes above 10 000 ft but not exceeding 13 000 ft.
- c) the entire flight time after 30 minutes at pressure altitudes greater than 10 000 ft but not exceeding 13 000 ft.
- d) the entire flight time at pressure altitudes above 10 000 ft.

Answer ;

- a) the entire flight time at pressure altitudes above 13 000 ft.
-

0227. For a non pressurised aircraft , all occupants of flight deck seats on flight deck duty shall be supplied with supplemental oxygen during ;

- a) the entire flight time after 30 minutes at pressure altitudes greater than 10 000 ft but not exceeding 13 000 ft.
- b) the entire flight time at pressure altitudes above 13 000 ft and for any period exceeding 30 minutes at pressure altitudes above 10 000 ft but not exceeding 13 000 ft.
- c) the entire flight time at pressure altitudes above 13 500 ft.
- d) the entire flight time at pressure altitudes above 10 000 ft.

Answer ;

- d) the entire flight time at pressure altitudes above 10 000 ft.
-

0228. For a non pressurised aircraft , all required cabin crew members shall be supplied with supplemental oxygen during ;

- a) the entire flight time after 30 minutes at pressure altitudes greater than 10 000 ft but not exceeding 13 000 ft.
- b) the entire flight time at pressure altitudes above 10 000 ft.
- c) the entire flight time at pressure altitudes above 13 000 ft.
- d) the entire flight time at pressure altitudes above 13 000 ft and for any period exceeding 30 minutes at pressure altitudes above 10 000 ft but not exceeding 13 000 ft.

Answer ;

- d) the entire flight time at pressure altitudes above 13 000 ft and for any period exceeding 30 minutes at pressure altitudes above 10 000 ft but not exceeding 13 000 ft.
-

0229. For a non pressurised aircraft , the supplemental oxygen is ;

- a) used for protection against smoke and carbon dioxide.
- b) available for supply to passengers for physiological reasons.
- c) therapeutical oxygen specially carried for certain passengers.
- d) required to operate at pressure altitudes above 10 000 ft.

Answer ;

- d) required to operate at pressure altitudes above 10 000 ft.
-

0230. For a pressurised aeroplane , all required cabin crew members shall be supplied with supplemental oxygen during ;

- 1. the entire flight time when cabin pressure altitude exceeds 13 000 ft but not less than 30 minutes.
- 2. the entire flight time at pressure altitudes above 13 000 ft and for any period exceeding 30 minutes at pressure altitudes above 10 000 ft but not exceeding 13 000 ft.
- 3. the flight time minus 30 minutes when cabin pressure altitude is greater than 10 000 ft but not exceeding 13 000 ft.
- 4. the flight time when cabin pressure altitude is greater than 10 000 ft but not exceeding 13 000 ft after the first 30 minutes at these altitudes.

The combination regrouping all correct statements is ;

- a) 1 , 3.
- b) 1 , 4.
- c) 2 , 4.
- d) 2 , 3.

Answer ;

- a) 1 , 3.
-

0231. For a pressurised aeroplane , certificated to fly above 25 000 ft , all occupants of flight deck seats on flight deck duty shall be supplied with supplemental oxygen during a period in any case no less than ;

- a) 10 minutes.
- b) 1 hour.
- c) 30 minutes.
- d) 2 hours.

Answer ;

- d) 2 hours.
-

- 0232.** For a pressurized aircraft , flying at FL240 with 150 passengers on board , the regulatory oxygen requirements are ;
1. each flight crew member shall be supplied with a quick donning oxygen mask.
 2. the aircraft will be equipped with a warning system indicating that the cabin altitude is higher than 3 000 m.
 3. the quantity of oxygen on board shall be sufficient for the supply of 100% of the occupants during the whole flight time at cabin pressure altitude above 15 000 ft (not less than 10 minutes).
 4. the first aid quantity of oxygen shall be sufficient for the supply of three passengers during the whole flight time when the cabin altitude is greater than 8 000 feet.

The combination regrouping all the correct statements is ;

- a) 1 , 2 , 3 , 4
- b) 3 , 4
- c) 2
- d) 2 , 3

Answer ;

- d) 2 , 3**
-

- 0233.** For a pressurised aircraft , the first-aid oxygen is designed to ;

- a) provide oxygen to 10% of passengers at a cabin altitude exceeding 13000 ft after 30 minutes.
- b) provide undiluted oxygen for passengers who , for physiological reasons , might require oxygen following a cabin depressurisation.
- c) protect the flight crew and cabin attendants against fumes and noxious gases.
- d) protect all the occupants against the effects of accidental depressurisation.

Answer ;

- b) provide undiluted oxygen for passengers who , for physiological reasons , might require oxygen following a cabin depressurisation.**
-

- 0234.** For a pressurised aircraft , the supplemental oxygen is ;

- a) the oxygen used for protection against smoke and carbon dioxide.
- b) the oxygen supplied to a passenger who needs oxygen for physiological reasons.
- c) a therapeutic oxygen specifically carried for certain passengers.
- d) the oxygen supplied to the aeroplane occupants in case of cabin pressurisation failure.

Answer ;

- d) the oxygen supplied to the aeroplane occupants in case of cabin pressurisation failure.**
-

- 0235.** For a twin-engine aeroplane , non ETOPS , the take-off alternate , if required , shall be located (in still air conditions) within ;

- a) one hour of flight time at cruising speed all engines operating.
- b) two hours of flight time , at cruising speed with only one engine operative.
- c) two hours of flight time at cruising speed all engines operating.
- d) one hour of flight time , at cruising speed with only one engine operative.

Answer ;

- d) one hour of flight time , at cruising speed with only one engine operative.**
-

- 0236.** For a twin engine aeroplane , non ETOPS , when the weather conditions require a takeoff alternate to be selected , it shall be located , in still air conditions , within ;

- a) 1 hour of flight time at single engine cruising speed.
- b) 2 hours of flight time at single engine cruising speed.
- c) 2 hours of flight time at cruising speed.
- d) 1 hour of flight time at cruising speed.

Answer ;

- a) 1 hour of flight time at single engine cruising speed.**
-

- 0237.** For a twin-engine aeroplane , the standard operational take-off minimums may be used provided an alternate aerodrome is accessible at less than ;

- a) 60 minutes at cruising speed with one engine unserviceable.
- b) 60 minutes at cruising speed all engines running.
- c) 30 minutes at cruising speed with one engine unserviceable.
- d) 30 minutes at cruising speed all engines running.

Answer ;

- a) 60 minutes at cruising speed with one engine unserviceable.**
-

0238. For aeroplane certified before the 1 April 1998 , cockpit voice recorder (CVR) , when required , must keep the conversations and sound alarms recorded during the last ;

- a) flight.
- b) 25 hours of operation.
- c) 48 hours of operation.
- d) 30 minutes of operation.

Answer ;

d) 30 minutes of operation.

0239. For an aeroplane with a tyre pressure of 8 bars , there is a risk of dynamic hydroplaning as soon as the ;

- a) Speed is greater than 127 kt.
- b) Speed is greater than 98 kt.
- c) Cross wind is greater than 20 kt.
- d) Water depth is equal to the half of the depth of tyre grooves.

Answer ;

b) Speed is greater than 98 kt.

Açıklama ;

Yağışlı havalarda ve yağıştan hemen sonra (yağış durumuna bağlı olarak) pist üzerinde oluşan , gerek kalkış rulesinde gerekse iniş rulesinde karşılaşılan tehlikelerden önemli bir tanesi de su yastığı (hydroplaning) olayıdır. Su yastığının oluşması için pist üzerinde 5 mm'lik su tabakası yeterlidir. Lastiğin dönüşü ile lastik yüzeyinden ayrılan ve sıçrayan sular lastik için ilave sürtünme gücü meydana getirecektir.

Sürat arttıkça , lastiğin yüzeyle temas noktasına basınç yaparak ve kalıplaşan suyun ince sivri ucu , lastiğin yüzeyle temas noktasına basınç yaparak hidrodinamik kaldırma kuvveti meydana getirmeye başlar. Buna kısmi su yastığı denir. Sürat daha da arttıkça ve belli bir yüksek sürate erişince , hidrodinamik kaldırma kuvveti lastiğin taşıdığı dikey kuvvete eşit olur ki , bu noktada lastik yüzey teması tam olarak kesilmiş olur. Buna dinamik su yastığı "Dynamic Hydroplaning" denir. Minimum Tam Su Yastığı (total hydroplaning) hızı (kt) lastik hava basıncının (psi) kare kökünün 9 katına eşittir.

Özet olarak , inişlerde de pist yüzeyi ile tekerler arasındaki sürtünme azalacağından frenlemede çok büyük tehlikeler meydana getirir. Tekerler altındaki su kayağı , tekerlerin dönüşünü azaltacak , tatbik edilen frenleme yeteri kadar sürtünme meydana getirmeyecek ve bu da moment enerjisinin dağılmasına ve ısınmasına sebep olacaktır. Isının artması tekerlerin yanmasına ve frenlemeye , uçağın kayması ile neticelenecektir. Sonuç olarak , frenleme kaybı ve istikamet kontrolsuzluğu aşağıda formüle ifade edilen "aquaplaning" hızı ile ifade edilir.

$$V = 9\sqrt{P}$$

V = Minimum Hydroplaning sürati (kt)
P = Lastik hava basıncı (psi)

Bu durumda :

- Sürtünme sıfıra düşer ,
- Tekerlek dönüşü olur ,
- Frenler kullanılamaz ,
- İstikamet kontrol edilemez.

Yağışlı havada iniş /kalkışlarda dikkat edilmesi gerekenler ; kalkışlarda hızlandırmayı yavaş yavaş artırmalı frenle istikamet kontrolü yapılmalı , inişlerde düşük sürat ile piste yaklaşarak palye yapılmalı fren ve reverse kesinlikle kullanılmamalıdır.

Sürat iyice azaldıktan sonra frenleme yapılmalıdır.

Çözüm ;

$$V = 9\sqrt{P}$$

1 bar = 14.5 psi olduğuna göre ; 8 bar = 8 x 14.5 = 116 psi

$$V = 9 \times \sqrt{116} = 9 \times 10.77 = 96.93 \approx 97 \text{ kt}$$

Görüldüğü gibi yaklaşık olarak 98 kt üzerinde dinamik Hydroplaning başlamaktadır. Cevap ; Speed is greater than 98 kt.

0240. For an aeroplane with a tyre pressure of 10 bars , there is a risk of dynamic hydroplaning as soon as the ;

- a) Runway temperature is greater than 40°C.
- b) Water depth is equal to the half of the depth of the tyre grooves.
- c) Speed is greater than 96 kt.
- d) Speed is greater than 108 kt.

Answer ;

d) Speed is greater than 108 kt.

Çözüm ;

$$V = 9\sqrt{P}$$

1 bar = 14.5 psi olduğuna göre ; 10 bar = 10 x 14.5 = 145 psi

$$V = 9 \times \sqrt{145} = 9 \times 12.04 = 108.36 \approx 108 \text{ kt}$$

Görüldüğü gibi yaklaşık olarak 108 kt üzerinde dinamik Hydroplaning başlamaktadır. Cevap ; Speed is greater than 108 kt.

NOT : Bu soru ile ilgili detaylı açıklama soru 0239'da yer almaktadır.

0241. For an aeroplane with a tyre pressure of 12 bars , there is a risk of dynamic hydroplaning as soon as the ;

- a) Speed is greater than 83 kt.
- b) Cross wind is greater than 10 kt.
- c) Water depth is equal to the half of the depth of the tyre grooves.
- d) Speed is greater than 119 kt.

Answer ;

d) Speed is greater than 119 kt.

Çözüm ;

$$V = 9\sqrt{P}$$

1 bar = 14.5 psi olduğuna göre ; 12 bar = 12 x 14.5 = 174 psi

$$V = 9 \times \sqrt{174} = 9 \times 13.19 = 118.71 \approx 119 \text{ kt}$$

Görüldüğü gibi yaklaşık olarak 119 kt üzerinde dinamik Hydroplaning başlamaktadır. Cevap ; Speed is greater than 119 kt.

NOT : Bu soru ile ilgili detaylı açıklama soru 0239'da yer almaktadır.

0242. For an aeroplane with a tyre pressure of 14 bars , there is a risk of dynamic hydroplaning as soon as the ;

- a) Speed is greater than 95 kt.
- b) Water depth is equal to the half of the depth of the tyre grooves.
- c) Tail wind is greater than 10 kt.
- d) Speed is greater than 129 kt.

Answer ;

d) Speed is greater than 129 kt.

Çözüm ;

$$V = 9\sqrt{P}$$

1 bar = 14.5 psi olduğuna göre ; 14 bar = 14 x 14.5 = 203 psi

$$V = 9 \times \sqrt{203} = 9 \times 14.24 = 128.16 \approx 129 \text{ kt}$$

Görüldüğü gibi yaklaşık olarak 129 kt üzerinde dinamik Hydroplaning başlamaktadır. Cevap ; Speed is greater than 129 kt.

NOT : Bu soru ile ilgili detaylı açıklama soru 0239'da yer almaktadır.

0243. For an aeroplane with a tyre pressure of 16 bars , assuming a rotating tyre , there is a risk of dynamic hydroplaning as soon as ;

- 1. water height is equal to the depth of the tyre grooves.
- 2. speed is greater than 137 kt.
- 3. water height is equal to the half of the depth of the tyre grooves.
- 4. speed is greater than 117 kt.

The combination regrouping all the correct statements is ;

- a) 2 and 3.
- b) 1 and 2.
- c) 3 and 4.
- d) 1 and 4.

Answer ;

b) 1 and 2.

Çözüm ;

$$V = 9\sqrt{P}$$

1 bar = 14.5 psi olduğuna göre ; 16 bar = 16 x 14.5 = 232 psi

$$V = 9 \times \sqrt{232} = 9 \times 15.23 = 137.07 \approx 137 \text{ kt}$$

Görüldüğü gibi yaklaşık olarak 137 kt üzerinde dinamik Hydroplaning başlamaktadır. Ayrıca bu sırada suyun yüksekliği lastik üzerindeki tahliye oluklarının yüksekliği kadardır. Cevap ; 1 and 2.

NOT : Bu soru ile ilgili detaylı açıklama soru 0239'da yer almaktadır.

0244. For an aeroplane with a tyre pressure of 16 bars , there is a risk of dynamic hydroplaning as soon as ;

- a) Water depth is equal to the depth of the tyre grooves.
- b) Speed is greater than 138 kt.
- c) Speed is greater than 117 kt.
- d) Cross wind is greater than 15 kt.

Answer ;

b) Speed is greater than 138 kt.

Çözüm ;

$$V = 9\sqrt{P}$$

1 bar = 14.5 psi olduğuna göre ; 16 bar = 16 x 14.5 = 232 psi

$$V = 9 \times \sqrt{232} = 9 \times 15.23 = 137.07 \approx 137 \text{ kt}$$

Görüldüğü gibi yaklaşık olarak 138 kt üzerinde dinamik Hydroplaning başlamaktadır. Cevap ; Speed is greater than 138 kt.

NOT : Bu soru ile ilgili detaylı açıklama soru 0239'da yer almaktadır.

0245. For flight preparation , each flight is subject to a preliminary file collecting a certain amount of information. Some of these information must be retained on the ground , at least for the duration of the flight. Which of the following must be retained ?

1. the weather conditions for the day including the weather forecast at destination.
2. one copy of the operational flight plan and , if required , the weight and balance sheet.
3. copies of the relevant parts of the aircraft's materiel report.
4. the en-route NOTAM documentation when specifically issued by the operator.
5. notification for special loadings.
6. for each flight , details of the day's performances and limitations with completed charts.

The combination regrouping all the correct statements is ;

- a) 1 , 3 , 5.
- b) 2 , 3 , 4 , 5.
- c) 1 , 2 , 3 , 4 , 5 , 6.
- d) 2 , 4.

Answer ;

b) 2 , 3 , 4 , 5.

0246. For purpose of wake turbulence separation , what is the ICAO minimum radar separation distance and minimum time if a medium aeroplane (less than 136000 kg and more than 7000 kg) is following directly behind a heavy aeroplane on the approach to the same runway ?

- a) 11.1 km (6 NM) and 3 minutes
- b) 9.3 km (5 NM) and 2 minutes
- c) 9.3 km (5 NM) and 3 minutes
- d) 7.4 km (4 NM) and 2 minutes

Answer ;

b) 9.3 km (5 NM) and 2 minutes

Açıklama ;

Soru 0250'nin açıklamasına bakınız.

0247. For purpose of wake turbulence separation , what is the ICAO minimum separation time if a light aeroplane (7000 kg or less) is following a medium aeroplane (less than 136000 kg but more than 7000 kg) on the approach to landing ?

- a) 3 minutes
- b) 4 minutes
- c) 5 minutes
- d) 2 minutes

Answer ;

a) 3 minutes

Açıklama ;

Soru 0250'nin açıklamasına bakınız.

0248. For the flight crew members , quick donning type of oxygen masks are compulsory on board any pressurized aeroplane operating at a pressure altitude above ;

- a) 13 000 ft.
- b) 10 000 ft.
- c) 25 000 ft.
- d) 29 000 ft.

Answer ;

c) 25 000 ft.

0249. For the purpose of wake turbulence separation , what is the ICAO minimum radar separation distance if a heavy aeroplane is following directly behind another heavy aeroplane on the approach to the same runway ?

- a) 11.1 km (6 NM)
- b) 9.3 km (5 NM)
- c) 7.4 km (4 NM)
- d) 3.7 km (2 NM)

Answer ;

c) 7.4 km (4 NM)

Açıklama ;

Soru 0250'nin açıklamasına bakınız.

0250. For the purpose of wake turbulence separation , what is the minimum separation time that is permitted when a light aircraft is taking off behind a heavy aircraft from an intermediate part of the same runway ?

- a) 3 minutes
- b) 2 minutes
- c) 4 minutes
- d) 5 minutes

Answer ;

a) 3 minutes

Açıklama ;

Wake Turbulence ayırmaları – İniş			
Öndeki uçak	Arkadaki uçak	Ayırma (mesafe)	Ayırma (zaman)
HEAVY	HEAVY	4 NM	2 dakika
HEAVY	MEDIUM	5 NM	2 dakika
HEAVY	LIGHT	6 NM	3 dakika
MEDIUM	HEAVY	3 NM	2 dakika
MEDIUM	MEDIUM	3 NM	2 dakika
MEDIUM	LIGHT	5 NM	3 dakika
LIGHT	HEAVY	3 NM	2 dakika
LIGHT	MEDIUM	3 NM	2 dakika
LIGHT	LIGHT	3 NM	2 dakika
Ters piste inildiği durumlarda 2 dakika			
Not : Bu ayırma minimumları ; – Aynı piste yaklaşan uçaklar arasında , – Aralarındaki mesafe 760 metreden az olan paralel pistlere yaklaşan uçaklar arasında , ve – Havada , öndeki uçak ile bu uçağın uçuş hattını 1000 feet’den az bir seviye farkı ile kat eden arkadaki uçak arasında uygulanır.			

Wake Turbulence ayırmaları – Kalkış		
Öndeki uçak	Arkadaki uçak	Ayırma (zaman)
HEAVY	HEAVY	2 dakika
HEAVY	MEDIUM	2 dakika
HEAVY	LIGHT	2 dakika
MEDIUM	HEAVY	2 dakika
MEDIUM	MEDIUM	2 dakika
MEDIUM	LIGHT	2 dakika
LIGHT	HEAVY	2 dakika
LIGHT	MEDIUM	2 dakika
LIGHT	LIGHT	2 dakika
Kavşak kalkışlarında (Intersection Take-off) 3 dakika		
Ters pistten kalkıldığı durumlarda 2 dakika		
Not : Bu ayırma minimumları ; – Aynı pistten kakan uçaklar arasında , – Aralarındaki mesafe 760 metreden az olan paralel pistlerden kakan uçaklar arasında uygulanır.		

0251. For three- and four-engined aeroplanes , the take-off alternate , if required , shall be located (in still air conditions) within ;

- a) 1 hour flight time at one-engine-inoperative cruising speed.
- b) 2 hours flight time at cruising speed with all engines operating.
- c) 2 hours flight time at one-engine-inoperative cruising speed.
- d) 1 hour flight time at cruising speed with all engines operating.

Answer ;

c) 2 hours flight time at one-engine-inoperative cruising speed.

0252. For two-engined aeroplanes not approved for ETOPS , the take-off alternate , if required , shall be located (in still air conditions) within ;

- a) two hours flight time at one engine inoperative cruising speed.
- b) two hours flight time at cruising speed with all engines operating.
- c) one hour flight time at one engine inoperative cruising speed.
- d) one hour flight time at cruising speed with all engines operating.

Answer ;

- c) one hour flight time at one engine inoperative cruising speed.**
-

0253. From the following list ;

- 1. Fire extinguishers.
- 2. Portable oxygen supplies.
- 3. First-aid kits.
- 4. Passenger meals.
- 5. Alcoholic beverages.

Which are classed as Dangerous Goods that are required to be on the aircraft in accordance with relevant JAR's for operating reasons ;

- a) 1 , 2 and 3 only.
- b) 3 , 4 and 5 only.
- c) 1 , 2 and 5 only.
- d) 2 , 3 and 4 only.

Answer ;

- a) 1 , 2 and 3 only.**
-

0254. From the following list ;


- 1. Fuel jettisoning system and its operation are free from fire hazard.
- 2. The fuel discharges clear of any part of the aeroplane.
- 3. Fuel fumes do not enter any part of the aeroplane.
- 4. The jettisoning operation does not adversely affect the controllability of the aeroplane.

Which of the above are requirements that must be shown to exist during fuel jettisoning tests ;

- a) 1 , 2 , 3 and 4.
- b) 1 , 3 and 4.
- c) 1 and 4.
- d) 2 and 3.

Answer ;

- a) 1 , 2 , 3 and 4.**
-

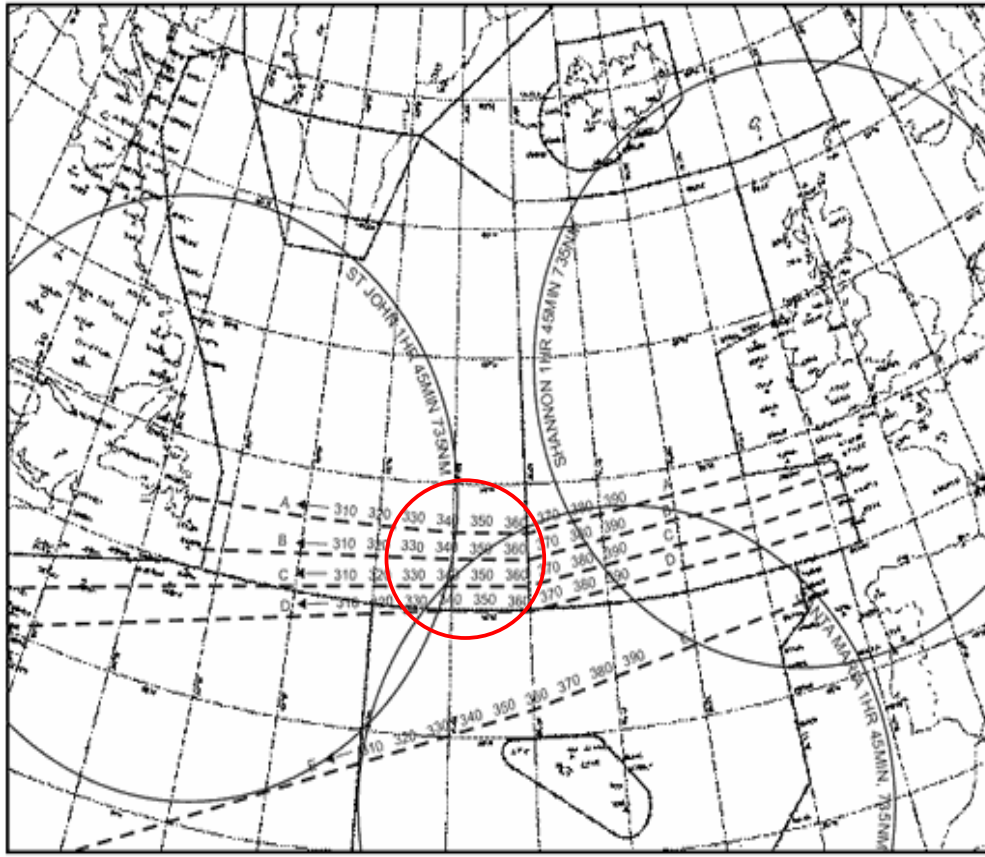

PARIS TO WASHINGTON VIA NAT A 8 HRS 3 MIN
NAT B 8 HRS 10 MIN
NAT C 8 HRS 15 MIN
NAT D 8 HRS 20 MIN

Annex 071-2083A

Given ;

Flight in a twin-engine aircraft from PARIS to WASHINGTON , ETOPS authorisation : 105 minutes at 420 kt

TRACK A : Flight time 08 h 03

TRACK B : Flight time 08 h 10

TRACK C : Flight time 08 h 15

TRACK D : Flight time 08 h 20

- a) Track C
- b) Track D
- c) Track B
- d) Track A

Answer ;

a) Track C

Açıklama ;

MNPS hava sahasında uçuş düzenleyecek çift motorlu bir uçağın uçuş standartlarına göre ; ETOPS müsaadesi , sizin hava koşullarında tek motoru çalışır haldeyken 420 kt süratle yedek meydana 105 dakikadır. Paris – Washington arasında MNPS havasahasında uçuş yapacak olan bu uçak belirlenmiş ATC rotalarından birini seçecektir. Haritaya göre olası üç adet yedek meydan vardır , bunlar ; Shannon , Santa Maria ve St John Torbay'dir ve ekte yer alan haritada bu meydanlara olan 1 saat 45 dakikalık (105 dakika) uçuş mesafeleri dairesel kavaraj şeklinde gösterilmiştir. Soruda Paris – Washington uçuşu için belirlenmiş olan A , B , C ve D rotalarından hangisinin en uygun rota olduğu sorulmaktadır.

Ekte verilen haritaya bakıldığında en kısa sürecek olan rota A olarak görülmektedir. Ancak uçak bu rota üzerinde Santa Maria için belirlenmiş 1 saat 45 dakikalık daireyi terk ettikten sonra St John Torbay ve Santa Maria yedek meydanlarına 1 saat 45 dakikalık uçuş süresinden daha fazla bir mesafede olacaktır ve aynı durum B rotası için de geçerlidir. Diğer rotalara bakıldığında ise uçak tek motora düşmesi durumunda rota boyunca bu 3 yedek meydandan herhangi birine ulaşabilecek durumda olacaktır. Bu iki rotadan 8 saat 15 dakikalık süre ile daha kısa olan C rotasının seçilmesi uygun olacaktır.

0256. H₂O extinguishers are fit to fight ;
- a) Class A fires
 - b) electrical source fires
 - c) Class B fires
 - d) special fires ; metals , gas , chemical products

Answer ;

a) Class A fires

0257. H₂O extinguishers are fit to fight ;
- a) electrical equipment.
 - b) flammable liquids.
 - c) seating fabric , wood.
 - d) metals , flammable gases , chemical products.

Answer ;

c) seating fabric , wood.

0258. How is the uncleared part of a contaminated runway reported in a SNOWTAM ?
- a) As a percentage of the total length of the runway available as the final item of a SNOWTAM.
 - b) In plain language at item T (the final paragraph) of a SNOWTAM.
 - c) It is not reported.
 - d) By a four figure group added to item D , which gives the length in metres.

Answer ;

b) In plain language at item T (the final paragraph) of a SNOWTAM.

0259. ICAO Annex 18 is a document dealing with ;
- a) the air transport of live animals.
 - b) the technical operational use of aircraft.
 - c) the safety of the air transport of dangerous goods.
 - d) the noise pollution of aircraft.

Answer ;

c) the safety of the air transport of dangerous goods.

0260. ICAO (International Civil Aviation Organization) Appendix 18 is a document dealing with ;
- a) the safety of the air transport of dangerous goods.
 - b) the air transport of live animals.
 - c) the technical operational use of aircraft.
 - d) the noise pollution of aircraft.

Answer ;

a) the safety of the air transport of dangerous goods.

0261. If a flight is planned to operate along the whole length of one of the organised tracks in the MNPS airspace , the intended organised track should be defined in items of the flight plan by ;
- a) inserting coordinates as detailed in the NAT track message.
 - b) using the abbreviation “OTS” followed by the code letter assigned to the track.
 - c) inserting coordinates defining significant points with intervals of 10° of longitude.
 - d) the abbreviation “NAT” followed by the code letter assigned to the track.

Answer ;

d) the abbreviation “NAT” followed by the code letter assigned to the track.

0262. (For this question use annex 071-12057A)



Annex 071-12057A

If a packet is marked with the label shown in the appendix it is ;

- a) a toxic material or gas.
- b) a corpse.
- c) an infectious substance.
- d) an explosive substance.

Answer ;

a) a toxic material or gas.

0263. If a pilot has connected the automatic pilot to the gyro compass (which is assumed to be operating correctly) and the latter is fitted with a rate correction device which is properly corrected by astronomical precession , the course followed by the aircraft (in still air conditions) is a ;

- a) great circle.
- b) curve of some type or other.
- c) spherical flight segment.
- d) rhumb line.

Answer ;

a) great circle.

0264. If a pilot has coupled the automatic pilot to the directional gyro equipped with a rate correction device set for astronomical precession , the course followed by the aircraft (in still air conditions) is ;

- a) an undetermined track.
- b) a spherical flight segment.
- c) a great circle.
- d) a rhumb line.

Answer ;

c) a great circle.

0265. If all long range navigation systems of an aircraft become unserviceable during a flight in MNPS airspace , and if no instructions are received from the air traffic control , you must consider ;

- a) climbing or descending 500 feet.
- b) land at the nearest airport.
- c) descend below the MNPS space.
- d) return to departure airport.

Answer ;

a) climbing or descending 500 feet.

0266. If cabin altitude increases during level flight , the differential pressure ;

- a) attains its maximum permitted operating limit
- b) increases
- c) remains constant
- d) decreases

Answer ;

d) decreases

0267. If installed , the flight crew compartment door of all aeroplanes operated for the purpose of carrying passengers shall be capable of being ;

- a) locked from within the compartment.
- b) remotely locked by cabin crew operation from outside the compartment.
- c) directly locked from outside the compartment.
- d) remotely locked from either inside or outside the compartment.

Answer ;

- a) locked from within the compartment.
-

0268. If it exists , the MMEL (Master Minimum Equipment List) is drawn up by ;

- a) the aircraft manufacturer's list.
- b) the operator.
- c) the aircraft state of registry.
- d) the manufacturer / the type certificate holder.

Answer ;

- d) the manufacturer / the type certificate holder.
-

0269. If no meteorological information is available for the destination , the operator must ;

- a) take extra fuel to fly two hours at holding speed.
- b) select two destination alternates.
- c) take extra fuel to fly one hour at holding speed , 1500 ft above the alternate aerodrome.
- d) not take-off until obtaining destination meteorological forecast.

Answer ;

- b) select two destination alternates.
-

0270. If obliged to jettison part of the fuel in flight , it would be better to do so ;

- a) under flight level 50 (FL50).
- b) during final phase of approach.
- c) in a straight line and at a relatively high flight level.
- d) in a holding stack , after control clearance.

Answer ;

- c) in a straight line and at a relatively high flight level.
-

0271. If smoke appears in the air conditioning , the first action to take is to ;

- a) Begin an emergency descent.
- b) Determine which system is causing the smoke.
- c) Cut off all air conditioning units.
- d) Put on the mask and goggles.

Answer ;

- d) Put on the mask and goggles.
-

0272. If the EPR probe becomes covered with ice , EPR indications will be ;

- a) Not available.
- b) Equal to the actual.
- c) Greater than the actual.
- d) Less than the actual.

Answer ;

- c) Greater than the actual.
-

0273. In a 5 kt right crosswind component behind a taking off aircraft ;

- a) The right wake turbulence stays approximately on the runway.
- b) The runway will be clear of any hazard turbulence.
- c) The left wake turbulence stays approximately on the runway.
- d) The right and left wake turbulence stays approximately on the runway.

Answer ;

- a) The right wake turbulence stays approximately on the runway.
-

0274. In a ditching situation , except for infants , the passengers shall be instructed to inflate their life jackets ;

- a) immediately on ditching.
- b) when exiting the aircraft.
- c) immediately on the opening of the exits.
- d) as soon as ditching is prepared.

Answer ;

- b) when exiting the aircraft.
-

0275. In a light crosswind (approximately 5 kt) from the right behind an aeroplane taking off ;

- a) the right wake vortex remains approximately on the runway.
- b) the right and left wake vortices remain approximately on the runway.
- c) the left wake vortex remains approximately on the runway.
- d) the runway will be clear of any wake turbulence.

Answer ;

- a) the right wake vortex remains approximately on the runway.
-

0276. In a microburst combined with a violent storm the winds at ;

- a) low altitude converge on the centre of the phenomenon and the atmospheric pressure decreases by a few hectopascals.
- b) low altitude diverge from the centre of the phenomenon and the atmospheric pressure increases by a few hectopascals.
- c) low altitude diverge from the centre of the phenomenon and the atmospheric pressure decreases by a few hectopascals.
- d) high altitude converge on the centre of the phenomenon and the atmospheric pressure increases by a few hectopascals.

Answer ;


- b) low altitude diverge from the centre of the phenomenon and the atmospheric pressure increases by a few hectopascals.
-

- a) 340° .
b) 240° .
c) 110° .
d) 060° .

Answer ;

b) 240° .

Çözüm ;

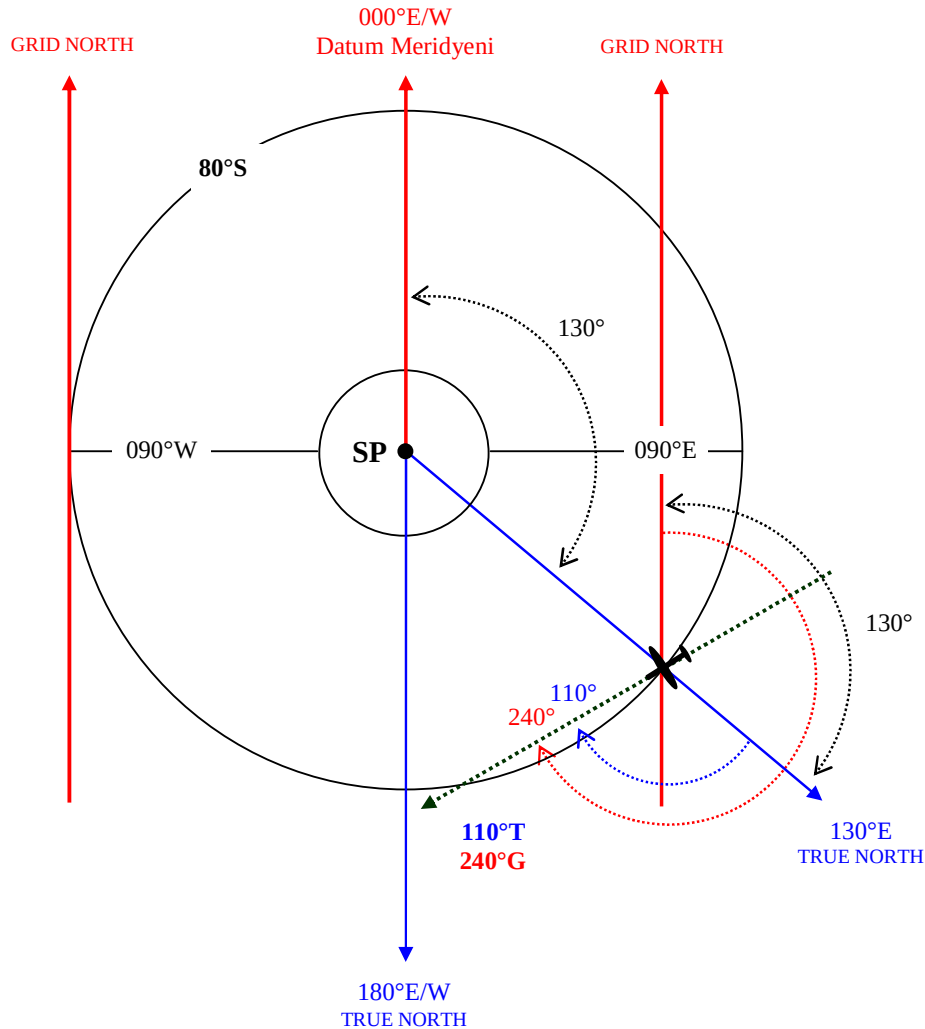

Bu tür problemlerin çözümünde kullanılabilecek en kolay yöntem eldeki verilerle yukarıdaki gibi bir diagram oluşturmaktır. Bu diagram Plotter kullanılarak kağıt üzerinde oluşturulabilir ve aynı zamanda rota ölçümleri de bu diagramdan yapılabilir. Burada Grid North Greenwich meridyeni ile oryantasyonludur. Öncelikle 80°S enlemini temsil eden bir dairesel hat çizilerek Datum meridyeni (000°E/W meridyeni) konumlandırılır. Daha sonra uçağın bulunduğu meridyen (130°E) diagram üzerinde belirtilir bu aynı zamanda Gerçek Kuzey'i de (True North) göstermektedir , yani True North'ü tanımlarken bu hattı Güney Kutbu'ndan Kuzey Kutbu'na doğru uzanan direkt hat olarak düşünmeliyiz. Bundan sonra uçağın rotası olan 110°T'yi belirtmek için verilen koordinatı kesen bir hat daha çizilir. Burada Convergency'nin yönü Lokal meridyen (130°E) üzerinde Grid North'dan True North'a doğru ölçülür ki bunun doğruyu yönde olduğu görülmektedir ve 130°dir.

Convergency West = True Track Best
Convergency East = True Track Least

Sonuç olarak ;

$$\text{Grid track} = \text{True track} + \text{Convergency}$$
$$\text{Grid track} = 110^\circ + 130^\circ$$

Grid track = 240°G olarak bulunur.

0278. In accordance with DOC 4444 (ICAO) when a MEDIUM and a LIGHT aircraft are using the same runway , or parallel runways separated by less than 760 m , (in approach or departure phases of flight) , shall be applied a wake turbulence radar separation minima of ;

- a) 2 NM
- b) 3 NM
- c) 5 NM
- d) 4 NM

Answer ;

c) 5 NM

Açıklama ;

Wake Turbulence ayırmaları – İniş			
Öndeki uçak	Arkadaki uçak	Ayırma (mesafe)	Ayırma (zaman)
HEAVY	HEAVY	4 NM	2 dakika
HEAVY	MEDIUM	5 NM	2 dakika
HEAVY	LIGHT	6 NM	3 dakika
MEDIUM	HEAVY	3 NM	2 dakika
MEDIUM	MEDIUM	3 NM	2 dakika
MEDIUM	LIGHT	5 NM	3 dakika
LIGHT	HEAVY	3 NM	2 dakika
LIGHT	MEDIUM	3 NM	2 dakika
LIGHT	LIGHT	3 NM	2 dakika
Ters piste inildiği durumlarda 2 dakika			
Not : Bu ayırma minimumları ; – Aynı piste yaklaşan uçaklar arasında , – Aralarındaki mesafe 760 metreden az olan paralel pistlere yaklaşan uçaklar arasında , ve – Havada , öndeki uçak ile bu uçağın uçuş hattını 1000 feet’ den az bir seviye farkı ile kat eden arkadaki uçak arasında uygulanır.			

Wake Turbulence ayırmaları – Kalkış		
Öndeki uçak	Arkadaki uçak	Ayırma (zaman)
HEAVY	HEAVY	2 dakika
HEAVY	MEDIUM	2 dakika
HEAVY	LIGHT	2 dakika
MEDIUM	HEAVY	2 dakika
MEDIUM	MEDIUM	2 dakika
MEDIUM	LIGHT	2 dakika
LIGHT	HEAVY	2 dakika
LIGHT	MEDIUM	2 dakika
LIGHT	LIGHT	2 dakika
Kavşak kalkışlarında (Intersection Take-off) 3 dakika		
Ters pistten kalkıldığı durumlarda 2 dakika		
Not : Bu ayırma minimumları ; – Aynı pistten kakan uçaklar arasında , – Aralarındaki mesafe 760 metreden az olan paralel pistlerden kalkan uçaklar arasında uygulanır.		

0279. In accordance with ICAO and PANS RAC procedures , which letter should be entered into a flight plan to denote an aeroplane which has a weight of less than 136000 kg but greater than 7000 kg ;

- a) H
- b) S
- c) L
- d) M

Answer ;

d) M

Açıklama ;

Soru 0184’ün açıklamasına bakınız.

0280. In accordance with ICAO Doc 4444 , when a MEDIUM aircraft preceeds a LIGHT aircraft using the same runway , or parallel runways separated by less than 760 m , the wake turbulence radar separation minima on the approach or departure phases of flight shall be ;

- a) 4 NM
- b) 5 NM
- c) 2 NM
- d) 3 NM

Answer ;

b) 5 NM

Açıklama ;

Soru 0278'in açıklamasına bakınız.

0281. In accordance with ICAO PANS OPS 8168 , noise preferential routes are established to ensure that departing and arriving aeroplanes avoid overflying noise-sensitive areas in the vicinity of the aerodrome as far as practicable. In establishing noise preferential routes ;

- a) turns during take-off and climb should not be required unless the bank angle for turns is limited to 28° (climbing at $V_2 + 10$ to 20 Kt)
- b) turns during take-off and climb should not be required unless the aeroplane has reached and can maintain throughout the turn a height of no less than 100 m above terrain and the highest obstacle.
- c) no turns should be required coincident with a reduction of power associated with a noise abatement procedure.
- d) turns during take-off and climb should not be required unless the bank angle for turns is limited to 20° (climbing at $V_2 + 10$ to 20 Kt)

Answer ;

c) no turns should be required coincident with a reduction of power associated with a noise abatement procedure.

0282. In accordance with JAR-OPS , 10% of the passengers in a non-pressurised aircraft shall be supplied with supplemental oxygen for the entire flight time after 30 minutes at pressure altitudes greater than ;

- a) 10000 ft but not exceeding 13000 ft.
- b) 10000 ft but not exceeding 14000 ft.
- c) 10000 ft but not exceeding 15000 ft.
- d) 14000 ft but not exceeding 15000 ft.

Answer ;

a) 10000 ft but not exceeding 13000 ft.

Açıklama ;

Soru 0285'in açıklamasına bakınız.

0283. In accordance with JAR-OPS , 100% of the passengers in a non-pressurised aircraft shall be supplied with supplemental oxygen for the entire flight time at pressure altitudes above ;

- a) 10000 ft.
- b) 14000 ft.
- c) 13000 ft.
- d) 15000 ft.

Answer ;

c) 13000 ft.

Açıklama ;

Soru 0285'in açıklamasına bakınız.

0284. In accordance with JAR-OPS , a commander shall ensure that the amount of usable fuel remaining in flight is not less than the fuel required to proceed to an aerodrome where a safe landing can be made with ;

- a) final reserve fuel remaining.
- b) fuel to fly 20 minutes at best range speed.
- c) 15 minutes of remaining fuel.
- d) fuel to hold 30 minutes at 1500 ft above the aerodrome.

Answer ;

a) final reserve fuel remaining.

0285. In accordance with JAR-OPS , all occupants of flight deck seats on flight deck duty in a non-pressurized aircraft shall be supplied with supplemental oxygen for the entire flight time at pressure altitudes above ;

- a) 10000 ft.
- b) 13000 ft.
- c) 15000 ft.
- d) 14000 ft.

Answer ;

a) 10000 ft.

Açıklama ;

JAR-OPS OKSİJEN GEREKLİLİKLERİ	
Kimler İçin	Süre ve Kabin Basınç İrtifası
Görevdeki tüm kişiler	Tüm uçuş boyunca kabin basıncı 13.000 ft ve 10.000 ft'i aştığında ancak , bu irtifalarda ilk 30 dakikadan sonra 13.000 ft'i aşmayan uçuş zamanı , hiçbir durumda aşağıdakilerden az olamaz , bunlar ; – 25.000 ft altındaki irtifalarda , uçuşa sertifikeli uçaklar için 30 dakika (not 2) , – 25.000 ft üstündeki irtifalarda , uçuşa sertifikeli uçaklar için 2 saat (not 3).
Gerekli kabin ekip üyeleri	Kabin basınç irtifası 13.000 ft üstünde ancak , 30 dakikadan fazla (not 2) uçuş zamanı ve kabin basınç irtifası 10.000 ft üstünde ancak , bu irtifalarda ilk 30 dakikadan sonra 10.000 ft'i geçmediğinde kalan uçuş zamanı.
Yolcuların % 100'ü (not 5)	Kabin basınç irtifası 15.000 ft üstünde ancak , 10 dakikadan az olmayan uçuş zamanı (not 4).
Yolcuların % 30'u (not 5)	Kabin basınç irtifası 14.000 ft'i aştığında ancak , 15.000 ft'i aşmadığında kalan uçuş zamanı.
Yolcuların % 10'u (not 5)	Kabin basınç irtifası 10.000 ft'i aştığında fakat bu irtifalarda ilk 30 dakikadan sonra 14.000 ft'i aşmadığında kalan uçuş zamanı.
Notlar : 1. Sağlanan ikmal , düşünülen rotalar için kabin basınç irtifası iniş profiline göre dikkate alınmalıdır. 2. Gerekli olan minimum ikmal , uçağın maksimum sertifikeli çalışmasında 10.000 ft'e kadar 10 dakikayı takip eden 10.000 ft'teki 20 dakika içindeki sabit oranlı iniş zorunlu olan oksijen miktarıdır. 3. Gerekli minimum ikmal , oksijen miktarı özellikle uçağın maksimum sertifikeli edilmiş çalışma irtifası 10.000 ft'e 10 dakikayı takiben 110 dakika uçabilecek devamlı alçalmayı yapmalıdır. Oksijen gerekliliği JAR-OPS 1.780 (a) (1) uygun olmalıdır. 4. Gerekli minimum ikmal , oksijen miktarı özellikle uçağın maksimum sertifikeli edilmiş çalışma irtifası 14.000 ft'e 10 dakikada devamlı alçalmayı yapmalıdır. 5. Bu tablodaki "yolcu" kelimesi , gerçekten biletlili yolcudur.	

0286. In accordance with JAR-OPS , an operator must ensure that the lowest MDH for a NDB approach is ;

- a) 200 ft.
- b) 250 ft.
- c) 350 ft.
- d) 300 ft.

Answer ;

d) 300 ft.

Açıklama ;

Hassas Olmayan Yaklaşımlarda Sistem Minimaları	
Kolaylık	En Düşük MDH
ILS (Süzülüş hattı yok - LLZ)	250 ft
SRA (½ NM'da sona eren)	250 ft
SRA (1 NM'da sona eren)	300 ft
VOR	300 ft
VOR / DME	250 ft
NDB	300 ft
VDF (QDM & QGH)	300 ft

0287. In accordance with JAR-OPS , an operator must ensure that the MDH for a VOR approach is not lower than ;

- a) 250 ft.
- b) 200 ft.
- c) 300 ft.
- d) 350 ft.

Answer ;

c) 300 ft.

Açıklama ;

Soru 0286'nın açıklamasına bakınız.

0288. In accordance with JAR-OPS , an operator must ensure that the MDH for a VOR/DME approach is not lower than ;

- a) 200 ft.
- b) 250 ft.
- c) 350 ft.
- d) 300 ft.

Answer ;

b) 250 ft.

Açıklama ;

Soru 0286'nın açıklamasına bakınız.

0289. In accordance with JAR-OPS , an operator must ensure that the MDH for an ILS approach without the glidepath (LLZ only) is not lower than ;

- a) 300 ft.
- b) 250 ft.
- c) 200 ft.
- d) 350 ft.

Answer ;

b) 250 ft.

Açıklama ;

Soru 0286'nın açıklamasına bakınız.

0290. In accordance with JAR-OPS , an operator shall ensure that a copy of the operational flight plan is stored in an acceptable form for at least ;

- a) 3 months.
- b) 15 months.
- c) 24 months.
- d) 12 months.

Answer ;

a) 3 months.

0291. In accordance with JAR-OPS , during a VOR procedure , if the reported RVR/visibility is less than the applicable minima , the approach shall not be continued beyond ;

- a) the FAF , or 1500 ft above the aerodrome / heliport if there is no FAF.
- b) the final path intersection.
- c) the middle marker , or 500 ft above the aerodrome / heliport if there is no middle marker.
- d) 1000 ft above the aerodrome / heliport on the final approach segment.

Answer ;

d) 1000 ft above the aerodrome / heliport on the final approach segment.

0292. In accordance with JAR-OPS , for a non pressurised aircraft , all occupants of flight deck seats on flight deck duty shall be supplied with supplemental oxygen during ;

- a) the entire flight time at pressure altitudes above 13.000 ft.
- b) the entire flight time after 30 minutes at pressure altitudes greater than 10.000 ft but not exceeding 13.000 ft.
- c) the entire flight time at pressure altitudes above 10.000 ft.
- d) the entire flight time at pressure altitudes above 13.000 ft and for any period exceeding 30 minutes at pressure altitudes above 10.000 ft but not exceeding 13.000 ft.

Answer ;

c) the entire flight time at pressure altitudes above 10.000 ft.

Açıklama ;

Soru 0285'in açıklamasına bakınız.

0293. In accordance with JAR-OPS , for a pressurised aeroplane , during and following an emergency descent , all occupants of flight deck seats on flight deck duty shall be supplied with a minimum supplemental oxygen quantity ;

1. In order to maintain a supply throughout the entire flight time where the cabin altitude pressure is greater than 13000 ft.
2. In order to maintain a supply throughout the entire flight time where the cabin altitude pressure is greater than 10000 ft and smaller than 13000 ft minus 30 minutes.
3. In no case less than 30 minutes for aeroplanes certificated to fly up to 25000 ft.
4. In no case less than 2 hours for aeroplanes certificated to fly over 25000 ft.

The combination regrouping all the correct statements is ;

- a) 1 , 2 , 3 , 4.
- b) 1 , 2.
- c) 1 , 3 , 4.
- d) 1 , 4.

Answer ;

a) 1 , 2 , 3 , 4.

Açıklama ;

Soru 0285'in açıklamasına bakınız.

0294. In accordance with JAR-OPS , for a pressurised aeroplane , the minimum requirement for supplemental oxygen needed to supply 100 % of the passengers following a cabin pressurisation failure , is ;

- a) the entire flight time when the cabin pressure altitude exceeds 13000 ft.
- b) 30 minutes.
- c) the entire flight time after 30 minutes at pressure altitude greater than 10000 ft but not exceeding 13000 ft.
- d) the entire flight time where the cabin pressure altitude exceeds 15000 ft , but in no case less than 10 minutes.

Answer ;

d) the entire flight time where the cabin pressure altitude exceeds 15000 ft , but in no case less than 10 minutes.

Açıklama ;

Soru 0285'in açıklamasına bakınız.

0295. In accordance with JAR-OPS , on board a non-pressurised aircraft , 10% of the passengers shall be supplied with oxygen throughout the entire flight time , after 30 minutes at pressure altitude greater than ;

- a) 10.000 ft and 12.000 ft.
- b) 10.000 ft and 13.000 ft.
- c) 11.000 ft and 13.000 ft.
- d) 11.000 ft and 12.000 ft.

Answer ;

b) 10.000 ft and 13.000 ft.

Açıklama ;

Soru 0285'in açıklamasına bakınız.

0296. In accordance with JAR-OPS , on board a non-pressurised aircraft , the crew and all the passengers must be fed with oxygen throughout the flight period during which the pressure altitude is greater than ;

- a) 13.000 ft.
- b) 11.000 ft.
- c) 10.000 ft.
- d) 12.000 ft.

Answer ;

a) 13.000 ft.

Açıklama ;

Soru 0285'in açıklamasına bakınız.

0297. In accordance with JAR-OPS , refuelling performed while passengers are embarking or disembarking the aircraft ;

- a) is acceptable provided that all the aircraft doors must be completely opened.
- b) is acceptable provided that all flight crew shall remain at their station.
- c) is prohibited.
- d) is acceptable provided that the ground area beneath the exits intended for emergency evacuation and slide deployment areas must be kept clear.

Answer ;

d) is acceptable provided that the ground area beneath the exits intended for emergency evacuation and slide deployment areas must be kept clear.

0298. In accordance with JAR OPS , the noise abatement procedures specified by the operator should be ;

- a) for all aeroplane types , the same for all aerodromes.
- b) different according to aerodromes and aeroplane types.
- c) for an aeroplane type , the same for all aerodromes.
- d) for all aeroplane types , the same for a specific aerodrome.

Answer ;

- c) for an aeroplane type , the same for all aerodromes.

0299. In accordance with JAR-OPS , the take-off climb procedures for noise abatement to be specified by the operator should be ;

- a) for all aeroplane types , the same for a specific aerodrome.
- b) for all aeroplane types , the same for all aerodromes.
- c) different according to aerodromes and aeroplane types.
- d) for any one aeroplane type , the same for all aerodromes.

Answer ;

- d) for any one aeroplane type , the same for all aerodromes.

0300. In accordance with JAR-OPS , when the flight data recorder is required , it must stop automatically to record the data ;

- a) when the aircraft clears the runway.
- b) after the aircraft is unable to move by its own power.
- c) when the landing gear is extended and locked.
- d) when the main gear shock strut compresses when touching the runway.

Answer ;

- b) after the aircraft is unable to move by its own power.

0301. In accordance with JAR OPS , where no outer marker or equivalent position exists , if the reported RVR/Visibility is less than the applicable minima , the approach shall not be continued beyond ;

- a) the glide slope intersection.
- b) 1000 ft above the aerodrome / heliport.
- c) the middle marker.
- d) the FAF.

Answer ;

- b) 1000 ft above the aerodrome / heliport.

0302. In accordance with JAR-OPS , which of the following are included in the Aerodrome Operating Minima for a non-precision approach ?

- 1. the required RVR.
 - 2. the ceiling.
 - 3. the minimum descent height (MDH).
 - 4. the decision height (DH).
- a) 1 , 2 , 3.
 - b) 1 , 3.
 - c) 1 , 4.
 - d) 1 , 2 , 4.

Answer ;

- a) 1 , 2 , 3.

0303. In accordance with JAR OPS 1 (Aerodrome Operating Minima) , for a Category IIIA approach , the RVR shall not be less than ;

- a) 250 m.
- b) 200 m.
- c) 230 m.
- d) 300 m.

Answer ;

- b) 200 m.

Açıklama ;

Soru 0305'in açıklamasına bakınız.

0304. In accordance with JAR-OPS 1 (Aerodrome Operating Minima) , for a Category IIIB approach and landing , the RVR shall not be less than ;

- a) 75 m.
- b) 150 m.
- c) 100 m.
- d) 50 m.

Answer ;

a) 75 m.

Açıklama ;

Soru 0305'in açıklamasına bakınız.

0305. In accordance with JAR OPS 1 (Aerodrome Operating Minima) , the Category IIIA approach and landing , the RVR shall not be less than ;

- a) 230 m.
- b) 250 m.
- c) 200 m.
- d) 300 m.

Answer ;

c) 200 m.

Açıklama ;

CAT III minimaları					
		Uçuş Kontrol Sistemi / RVR (metre)			
		Fail passive	Fail operasyonel		
			Roll-out kontrol sistemi olmadan	Roll-out guidance veya kontrol sistemiyle beraber	
Yaklaşma kategorisi	Karar yüksekliği (ft)			Fail passive	Fail operasyonel
IIIA	100 ft'ten az	200 m (not 1)	200 m	200 m	200 m
IIIB	50 ft'ten az	yetkili değil	yetkili değil	125 m	75 m
IIIC	karar yüksekliği yok	yetkili değil	yetkili değil	yetkili değil	75 m

Not 1 : 300 metreden az gerçek RVR değerli operasyonlar için DH veya altındaki irtifalarda oto pilot arızası pas geçmeyi gerektirir.

0306. In accordance with JAR-OPS 1 , an aeroplane whose maximum approved passenger seating configuration is 401 to 500 seats must be equipped with at least ;

- a) 7 hand fire-extinguishers conveniently located in the passenger compartment.
- b) 5 hand fire-extinguishers conveniently located in the passenger compartment.
- c) 6 hand fire-extinguishers conveniently located in the passenger compartment.
- d) 8 hand fire-extinguishers conveniently located in the passenger compartment.

Answer ;

c) 6 hand fire-extinguishers conveniently located in the passenger compartment.

Açıklama ;

Onaylı maksimum yolcu oturma düzenlemesi	Söndürücü sayısı
7 – 30 arası	1
31 – 60 arası	2
61 – 200 arası	3
201 – 300 arası	4
301 – 400 arası	5
401 – 500 arası	6
501 – 600 arası	7
601 ve daha fazla	8

0307. In accordance with JAR-OPS 1 , an aeroplane whose maximum approved passenger seating configuration is 501 to 600 seats must be equipped with at least ;

- a) 8 hand fire-extinguishers conveniently located in the passenger compartment.
- b) 6 hand fire-extinguishers conveniently located in the passenger compartment.
- c) 5 hand fire-extinguishers conveniently located in the passenger compartment.
- d) 7 hand fire-extinguishers conveniently located in the passenger compartment.

Answer ;

- d) 7 hand fire-extinguishers conveniently located in the passenger compartment.**

Açıklama ;

Soru 0306'nın açıklamasına bakınız.

0308. In accordance with JAR-OPS 1 , an aeroplane whose maximum approved passenger seating configuration is greater than 60 seats must be equipped (including flight deck) with at least ;

- a) 2 HALON 1211 fire-extinguishers or equivalent.
- b) 4 HALON 1211 fire-extinguishers or equivalent.
- c) 1 HALON 1211 fire-extinguishers or equivalent.
- d) 3 HALON 1211 fire-extinguishers or equivalent.

Answer ;

- d) 3 HALON 1211 fire-extinguishers or equivalent.**

Açıklama ;

Soru 0306'nın açıklamasına bakınız.

0309. In accordance with JAR-OPS 1 , an aeroplane whose maximum approved passenger seating configuration is greater than 600 seats must be equipped with at least ;

- a) 8 hand fire-extinguishers conveniently located in the passenger compartment.
- b) 7 hand fire-extinguishers conveniently located in the passenger compartment.
- c) 6 hand fire-extinguishers conveniently located in the passenger compartment.
- d) 9 hand fire-extinguishers conveniently located in the passenger compartment.

Answer ;

- a) 8 hand fire-extinguishers conveniently located in the passenger compartment.**

Açıklama ;

Soru 0306'nın açıklamasına bakınız.

0310. In accordance with JAR-OPS 1 , an aeroplane whose maximum take-off mass exceeds 5 700 kg or whose maximum approved passenger seating configuration is greater than 9 seats and less than 200 seats must be equipped with a ;

- a) crash axe in the flight deck and a crow-bar in the passenger compartment.
- b) crash axe or a crow-bar in the flight deck.
- c) crash axe and a crow-bar in the passenger compartment.
- d) crow-bar in the flight deck and a crash axe in the passenger compartment.

Answer ;

- b) crash axe or a crow-bar in the flight deck.**

0311. In accordance with JAR-OPS 1 , an operator shall ensure that a pilot does not operate an aeroplane as commander unless ;

- a) he has carried out at least 3 take-offs and 3 landings as pilot flying in an aeroplane of the same type/class or in a flight simulator of the aeroplane type to be used , in the preceding 90 days.
- b) he has carried out at least 3 flights as commander in an aeroplane or an approved flight simulator of the type to be used , in the preceding 90 days.
- c) he has carried out at least 3 take-offs and 3 landings as pilot flying in an aeroplane or an approved flight simulator of the type to be used , in the preceding 30 days.
- d) he has carried out at least 3 take-offs and 3 landings as pilot flying in any type of aeroplane or an approved simulator , under the supervision of an examiner , in the preceding 60 days.

Answer ;

- a) he has carried out at least 3 take-offs and 3 landings as pilot flying in an aeroplane of the same type/class or in a flight simulator of the aeroplane type to be used , in the preceding 90 days.**

0312. In accordance with JAR-OPS 1 , an operator shall ensure that all relevant operational and technical information for a individual flight is preserved on ground for a predetermined period of time. Consequently , if practicable , a copy of the operational flight plan shall be retained , during at least ;

- a) 15 months.
- b) 24 months.
- c) 3 months.
- d) 12 months.

Answer ;

- c) 3 months.**

0313. In accordance with JAR-OPS 1 and if required , the number of life rafts to be carried on board an aeroplane must allow the transportation of the entire aeroplane occupants ;

- a) plus 30 %.
- b) in the case of a loss of one raft of the largest rated capacity.
- c) plus 30 %.
- d) plus 10 %.

Answer ;

- b)** in the case of a loss of one raft of the largest rated capacity.

0314. In accordance with JAR-OPS 1 , for a pressurised aeroplane , certificated to fly at altitudes more than 25000 ft , all occupants of flight deck seats on flight deck duty shall be supplied with supplemental oxygen during a period in no case less than ;

- a) 1 hour
- b) 30 minutes
- c) 10 minutes
- d) 2 hours

Answer ;

- d)** 2 hours

Açıklama ;

Soru 0285'in açıklamasına bakınız.

0315. In accordance with JAR-OPS 1 , for a pressurised aircraft , the definition of supplemental oxygen is ;

- a) oxygen used for protection against smoke and carbon dioxide.
- b) oxygen supplied to a passenger who needs oxygen for physiological reasons.
- c) oxygen supplied to the aeroplane occupants in the case of cabin pressurisation failure.
- d) oxygen specifically carried for therapeutic purposes.

Answer ;

- c)** oxygen supplied to the aeroplane occupants in the case of cabin pressurisation failure.

0316. In accordance with JAR-OPS 1 , for aeroplanes certified before the 1 April 1998 , cockpit voice recorder (CVR) , when required , must keep the conversations and sound alarms recorded during the last ;

- a) flight.
- b) 25 hours of operation.
- c) 30 minutes of operation.
- d) 48 hours of operation.

Answer ;

- c)** 30 minutes of operation.

0317. In accordance with JAR-OPS 1 , for aeroplanes intended to be operated at pressure altitude of 39.000 ft , the total number of oxygen dispensing units and outlets shall exceed ;

- a) the number of passengers.
- b) the number of seats.
- c) the number of seats by at least 10%.
- d) the number of passengers by at least 10%.

Answer ;

- c)** the number of seats by at least 10%.

0318. In accordance with JAR-OPS 1 , for the flight crew members , quick donning type of oxygen masks are compulsory on board any pressurised aeroplane operating at a pressure altitude above ;

- a) 10.000 ft.
- b) 25.000 ft.
- c) 29.000 ft.
- d) 13.000 ft.

Answer ;

- b)** 25.000 ft.

0319. In accordance with JAR-OPS 1 , if the flight is to be carried out at FL 290 , demonstration about oxygen equipment must be completed before ;

- a) the aircraft reaches FL250.
- b) the aircraft reaches FL140.
- c) take-off.
- d) the aircraft reaches FL100.

Answer ;

- c)** take-off.

0320. In accordance with JAR-OPS 1 , in an aeroplane in which fuses are used , the number of spare fuses available for use in flight must be at least ;

- a) 20% of the number of fuses of each rating or 2 of each rating , whichever is the greater.
- b) 10% of the number of fuses of each rating or 3 of each rating , whichever is the greater.
- c) 10% of the number of fuses of each rating or 1 of each rating , whichever is the greater.
- d) 5% of the number of fuses of each rating or 1 of each rating , whichever is the greater.

Answer ;

- b)** 10% of the number of fuses of each rating or 3 of each rating , whichever is the greater.
-

0321. In accordance with JAR-OPS 1 , on aeroplanes intended to be operated at pressure altitude above 25000 ft , the total number of oxygen dispensing units shall exceed the number of ;

- a) seats by 2%.
- b) passengers by 10%.
- c) passengers by 2%.
- d) seats by 10%.

Answer ;

- d)** seats by 10%.
-

0322. In accordance with JAR-OPS 1 , regarding the first aid oxygen , the supply of undiluted oxygen carried on board a pressurised aeroplane with 8 passengers operated at pressure altitude 27.000 ft , shall be sufficient for at least ;

- a) 1 passenger for the remainder of the flight after cabin depressurisation when the cabin altitude only exceeds 14.000 ft.
- b) 2 passenger for the remainder of the flight after cabin depressurisation when the cabin altitude only exceeds 14.000 ft.
- c) 1 passenger for the remainder of the flight after cabin depressurisation when the cabin altitude exceeds 8.000 ft but does not exceed 15.000 ft.
- d) 2 passenger for the remainder of the flight after cabin depressurisation when the cabin altitude exceeds 8.000 ft but does not exceed 15.000 ft.

Answer ;

- c)** 1 passenger for the remainder of the flight after cabin depressurisation when the cabin altitude exceeds 8.000 ft but does not exceed 15.000 ft.
-

0323. In accordance with JAR-OPS 1 , the cockpit voice recorder , when required , must start to record automatically ;

- a) when full thrust is applied until the termination of the flight when the aeroplane is no longer capable of moving under its own power.
- b) prior to the aeroplane moving under its own power until the termination of flight when the parking brake is set.
- c) prior to the aeroplane moving under its own power until the termination of the flight when the aeroplane is no longer capable of moving under its own power.
- d) when the parking brake is released until the termination of flight when the parking brake is set.

Answer ;

- c)** prior to the aeroplane moving under its own power until the termination of the flight when the aeroplane is no longer capable of moving under its own power.
-

0324. In accordance with JAR-OPS 1 , the commander of a turbojet engine aeroplane should have a final reserve fuel for ;

- a) 45 minutes of flight at cruising speed at FL140.
- b) 30 minutes of flight at cruising speed at FL140.
- c) 45 minutes of flight at holding speed at 1500 ft above aerodrome elevation in standard conditions.
- d) 30 minutes of flight at holding speed at 1500 ft above aerodrome elevation in standard conditions.

Answer ;

- d)** 30 minutes of flight at holding speed at 1500 ft above aerodrome elevation in standard conditions.
-

0325. In accordance with JAR-OPS 1 , the minimum required recent experience for a pilot engaged in a single-pilot operation under IFR or at night shall be ;

- a) 5 IFR flights , including 3 take-off and 3 landings carried out during the preceding 30 days on the type or class of aeroplane in the single-pilot role.
- b) 3 IFR flights , including 3 instrument approaches , carried out during the preceding 90 days on the type/class of aeroplane in the single-pilot role.
- c) 5 IFR flights , including 3 instrument approaches , carried out during the preceding 90 days on the type/class of aeroplane in the single-pilot role.
- d) 5 IFR flights , including 3 take-off and 3 landings carried out during the preceding 90 days on the type or class of aeroplane in the single-pilot role.

Answer ;

- c)** 5 IFR flights , including 3 instrument approaches , carried out during the preceding 90 days on the type/class of aeroplane in the single-pilot role.
-

0326. In accordance with JAR OPS 1 , the operator shall ensure that ;
- a) for VFR flights conducted in class F airspace , vertical distance from clouds is t least 250 m.
 - b) for VFR flights conducted in class E airspace , flight visibility at and above 3050 m (10.000 ft) is at least 5 km (clear of cloud).
 - c) for VFR flights conducted in class B airspace , horizontal distance from clouds is at least 1000 m.
 - d) special VFR flights are not commenced when visibility is less than 3 km.

Answer ;

- d) special VFR flights are not commenced when visibility is less than 3 km.

0327. In accordance with JAR-OPS 1 , the purpose of the first aid oxygen is to ;

- a) supply all the passengers in case of depressurisation.
- b) provide undiluted oxygen to passengers for physiological reasons following a cabin depressurisation.
- c) provide the cabin attendants with respiratory protection.
- d) provide the flight crew with respiratory assistance after depressurisation.

Answer ;

- b) provide undiluted oxygen to passengers for physiological reasons following a cabin depressurisation.

0328. In accordance with JAR-OPS 1.430 (Aerodrome Operational Minima) , an operator must ensure that system minima for “non-precision approach procedures” , which are based upon the use of ILS without glidepath (LLZ only) , VOR NDB , SRA , and VDF are no lower than MDH following value with ;

- a) NDB facility , lowest MDH = 300 ft
- b) VOR/DME facility , lowest MDH = 300 ft
- c) VOR facility , lowest MDH = 250 ft
- d) ILS facility without glidepath (localizer) lowest MDH = 200 ft

Answer ;

- a) NDB facility , lowest MDH = 300 ft

Açıklama ;

Hassas Olmayan Yaklaşımlarda Sistem Minimaları	
Kolaylık	En Düşük MDH
ILS (Süzülüş hattı yok - LLZ)	250 ft
SRA (½ NM’da sona eren)	250 ft
SRA (1NM’da sona eren)	300 ft
VOR	300 ft
VOR / DME	250 ft
NDB	300 ft
VDF (QDM & QGH)	300 ft

0329. In accordance with JAR-OPS 1.430 (Aerodrome Operating Minima) , the lowest minima to be used by an operator in a category B aeroplane for circling are ;

- a) MDH = 400 ft and visibility = 1500 m.
- b) MDH = 500 ft and visibility = 1600 m.
- c) MDH = 700 ft and visibility = 2600 m.
- d) MDH = 600 ft and visibility = 2400 m.

Answer ;

- b) MDH = 500 ft and visibility = 1600 m.

Açıklama ;

Turlu yaklaşımda , işletici tarafından kullanılan en düşük minimalar şu şekildedir ;

Uçak Kategorisi	A	B	C	D
MDH	400 ft	500 ft	600 ft	700 ft
Minimum meteorolojik görüş	1500 m	1600 m	2400 m	3600 m

0330. In accordance with OPS 1 430 (Aerodrome Operating Minima - General) , it is established , among other considerations , that an Operator must take full account of Aeroplane Categories. The criteria taken into consideration for classification of Aeroplanes by Categories is the indicated airspeed at threshold (V_{at}) , which is equal to the stalling speed at the maximum landing mass (V_{SO}) multiplied by 1.3. Corresponding Aeroplane Category when V_{at} is from 141 kt to 165 kt is ;

- a) D
- b) C
- c) E
- d) B

Answer ;

- a) D

Açıklama ;

Havaaracı Yaklaşma Kategorileri	
Kategori	V_{AT}
A	91 kt'dan az
B	91 kt – 120 kt
C	121 kt – 140 kt
D	141 kt – 165 kt
E	166 kt – 210 kt

0331. In accordance with the fuel policy for isolated aerodromes (JAR-OPS 1) , for aeroplanes with turbine engines , the amount of Additional Fuel should not be less than the fuel to fly after arriving overhead the destination aerodrome for ;

- a) 30 minutes at holding consumption at 1500 ft (450 m) above aerodrome elevation in standard conditions.
- b) 2 hours at holding consumption at 1500 ft (450 m) above aerodrome elevation in standard conditions.
- c) 30 minutes at normal cruise consumption , including final reserve fuel.
- d) 2 hours at normal cruise consumption , including final reserve fuel.

Answer ;

- d) 2 hours at normal cruise consumption , including final reserve fuel.

0332. In accordance with the JAR-OPS , a single deck aeroplane , equipped with an approved seating capacity of 61 seats and carrying passengers , must be equipped with at least ;

- a) 2 megaphones.
- b) 3 megaphones.
- c) 2 megaphones if there are more than 31 passengers on board.
- d) 1 megaphone.

Answer ;

- d) 1 megaphone.

0333. In accordance with the JAR-OPS and with the exception of amphibians and seaplanes , the carriage of a life jacket for each person on board is compulsory when the aeroplane is ;

1. cruising at such a distance from the shore that it would not be able to return in the case of an engine failure.
2. is flying over a water surface at more than 50 NM off shore.
3. is using departure and arrival paths above the water and when a ditching probability exists in the case of a problem.
4. is flying over a stretch of water at more than 40 NM off shore.

The combination regrouping all the correct statements is ;

- a) 3 , 4.
- b) 2 , 3.
- c) 1 , 2.
- d) 1 , 2 , 3 , 4.

Answer ;

- b) 2 , 3.

0334. In addition to informing each State , whose citizens are known to be on board an aircraft , the State of the country in which an aircraft has landed after an act of unlawful interference must immediately notify the ;

- a) State of Registry of the aircraft , the State of the operator and ICAO.
- b) State of Registry of the aircraft and the State of the operator only.
- c) State of Registry of the aircraft and the J.A.A.
- d) State of the operator , the J.A.A. and ICAO.

Answer ;

- a) State of Registry of the aircraft , the State of the operator and ICAO.

0335. In airspace where MNPS is applicable , the minimum vertical separation between FL 290 and FL 410 is ;
- 500 ft.
 - 1000 ft.
 - 2000 ft.
 - 1500 ft.

Answer ;

b) 1000 ft.

0336. In an aeroplane , each crew member shall be properly secured by all safety belts and harnesses provided ;
- during taxiing.
 - during take-off.
 - during landing.
 - whenever deemed necessary by the commander in the interest of safety.
 - during other phases of the flight while at his station.

The combination regrouping all the correct statements is ;

- 1 , 2 , 3 , 4.
- 2 , 3 , 4 , 5.
- 1 , 2 , 3 , 4 , 5.
- 2 , 3 , 4.

Answer ;

d) 2 , 3 , 4.

0337. In calm wind conditions , an aircraft at take-off creates tip vortices that ;

- stagnate on the runway.
- separate outwards on each side of the runway.
- separate outwards to the right side only.
- separate outwards to the left side only.

Answer ;

b) separate outwards on each side of the runway.

0338. In case of a cargo compartment fire , the system which should be switched off , is generally the ;

- total air-conditioning.
- pressurisation.
- ventilation of the cargo compartment.
- trim air.

Answer ;

c) ventilation of the cargo compartment.

0339. In case of a ditching , the cabin attendants should ;

- evacuate women and children first.
- have the passengers embark directly in the life rafts.
- prevent passenger movements which may impede the airplane's flotation ability.
- ensure the complete evacuation of the airplane.

The combination regrouping all the correct statements is ;

- 1 , 2 , 3 , 4.
- 2 , 3 , 4.
- 2 , 3.
- 1 , 4.

Answer ;

b) 2 , 3 , 4.

0340. In case of a fire due to the heating of the brakes , you fight the fire using ;

- a dry powder fire extinguisher.
- a water spray atomizer.
- a water fire-extinguisher.
- a CO₂ fire-extinguisher to the maximum.

The combination regrouping all the correct statements is ;

- 2 , 3 , 4.
- 3 , 4.
- 1 , 2.
- 1 , 4.

Answer ;

c) 1 , 2.

0341. In case of a hi-jack , the squawk code is ;

- a) A 7500.
- b) A 7600.
- c) A 7700.
- d) A 2000.

Answer ;

- a) A 7500.

0342. In case of a serious threat based on the presence of a bomb on board a pressurized aircraft and disregarding any fuel considerations ;

- a) you descend to the flight level corresponding to the indicated cabin altitude or the safety altitude if higher and take preventive steps by putting yourself in a landing approach configuration.
- b) you climb to the maximum flight level which does not need the use of pressurization.
- c) you carry out an emergency descent to reach the safety altitude.
- d) you go down to the level corresponding to the indicated cabin altitude and keep the aircraft in a clean configuration until the final approach.

Answer ;

- a) you descend to the flight level corresponding to the indicated cabin altitude or the safety altitude if higher and take preventive steps by putting yourself in a landing approach configuration.

0343. In case of an engine nozzle fire while on ground you ;

- a) pull the fire shut off handle and trigger the engines fire-extinguishers.
- b) carry out a dry cranking.
- c) fight the nozzle fire with a water fire-extinguisher.
- d) carry out a damp cranking.

Answer ;

- b) carry out a dry cranking.

0344. In case of an engine tail pipe fire during start while on the ground you should abort the starting procedure and ;

- a) carry out a dry motoring cycle.
- b) pull the fire shut off handle and trigger the engines fire-extinguishers.
- c) carry out a damp cranking.
- d) fight the fire with a water fire-extinguisher.

Answer ;

- a) carry out a dry motoring cycle.

0345. In case of an unexpected encounter with windshear , you will ;

- 1. set the maximum take-off thrust.
- 2. increase the pitch-up attitude up to the limit actuating the stick shaker.
- 3. retract gear and flaps , if they are extended.
- 4. keep gear , flaps and slats in current configuration and retract the speed brakes.
- 5. try to reach the maximum lift-to-drag ratio.

The combination regrouping all the correct statements is ;

- a) 1 , 3 , 5.
- b) 3 , 5.
- c) 2 , 3.
- d) 1 , 2 , 4.

Answer ;

- d) 1 , 2 , 4.

0346. In case of landing on a flooded runway and in heavy rain ;

- 1. you increase your approach speed.
- 2. you land firmly in order to obtain a firm contact of the wheels with the runway and immediately land your nose gear.
- 3. you decrease your approach speed.
- 4. you use systematically all the lift dumper devices.
- 5. you land as smoothly as possible.
- 6. you brake energetically.

The combination regrouping all the correct statements is ;

- a) 3 , 5.
- b) 1 , 2 , 4.
- c) 2 , 3 , 4.
- d) 1 , 4 , 5 , 6.

Answer ;

- b) 1 , 2 , 4.

0347. In case of total loss of communications , if an aircraft operating in MNPS airspace is unable to continue its flight in accordance with its ATC clearance , it must offset from the assigned route by 15 NM and climb by 1000 ft or descend by 500 ft to a level which differs from those normally used if flying ;

- a) below FL410.
- b) above FL410.
- c) at FL410.
- d) at FL430.

Answer ;

c) at FL410.

0348. In compliance with JAR OPS and ICAO annex 18 , in order to carry dangerous goods on board a public transport aircraft , they must be accompanied with a ;

- a) system to warn the crew in case of a leak or of an abnormal increase in temperature.
- b) transport document for dangerous materials.
- c) specialized handling employee.
- d) representative of the company owning the goods.

Answer ;

b) transport document for dangerous materials.

0349. In final approach , you encounter a strong rear wind gust or strong down wind which forces you to go around. You ;

- 1. maintain the same aircraft configuration (gear and flaps).
- 2. reduce the drags (gear and flaps).
- 3. gradually increase the attitude up to triggering of stick shaker.
- 4. avoid excessive attitude change.

The combination of correct statements is ;

- a) 1 , 4.
- b) 2 , 3.
- c) 1 , 3.
- d) 2 , 4.

Answer ;

c) 1 , 3.

0350. In icing conditions and after the application of an anti-icing fluid on an aeroplane , the commander should ;

- 1. avoid positioning the aeroplane in the engine jet blast of the preceding aeroplane.
- 2. avoid positioning the aeroplane in the turbo-prop wash of the preceding aeroplane.
- 3. position the aeroplane in the engine jet blast of the preceding aeroplane.
- 4. position the aeroplane in the turbo-prop wash of the preceding aeroplane.

The combination regrouping all the correct statements is ;

- a) 1 , 2.
- b) 1 , 4.
- c) 2 , 3.
- d) 3 , 4.

Answer ;

a) 1 , 2.

0351. In icing conditions , if you have exceeded the holdover time , the correct procedure is to ;

- a) operate the aircraft de-icing/anti-icing systems.
- b) apply directly anti-icing fluid without conducting previous de-icing procedures.
- c) de-ice the aircraft.
- d) de-ice again the aircraft , then apply anti-icing fluid.

Answer ;

d) de-ice again the aircraft , then apply anti-icing fluid.

0352. In MNPS airspace , the speed reference for turbo-jet aircraft is the ;

- a) ground speed.
- b) Mach number.
- c) indicated airspeed.
- d) true airspeed.

Answer ;

b) Mach number.

0353. In NAT region , a revised estimate should be transmitted to the ATS when the estimated time for the next position has changed by ;

- a) 5 minutes or more.
- b) 3 minutes or more.
- c) 10 minutes or more.
- d) 2 minutes or more.

Answer ;

b) 3 minutes or more.

0354. In order to be operated at night in areas with potentially hazardous weather conditions , an aeroplane must be equipped with an airborne weather radar when the aeroplane is ;

- 1. pressurised.
- 2. non-pressurised with a maximum take-off mass of more than 5.700 kg.
- 3. non-pressurised with a maximum approved seating configuration of more than 9 seats.
- 4. non-pressurised , operating for public transportation.


The combination regrouping all the correct statements is ;

- a) 1 and 4.
- b) 1 , 2 and 3.
- c) 4.
- d) 1 and 2.

Answer ;

b) 1 , 2 and 3.

0355. (Refer to Image 1)

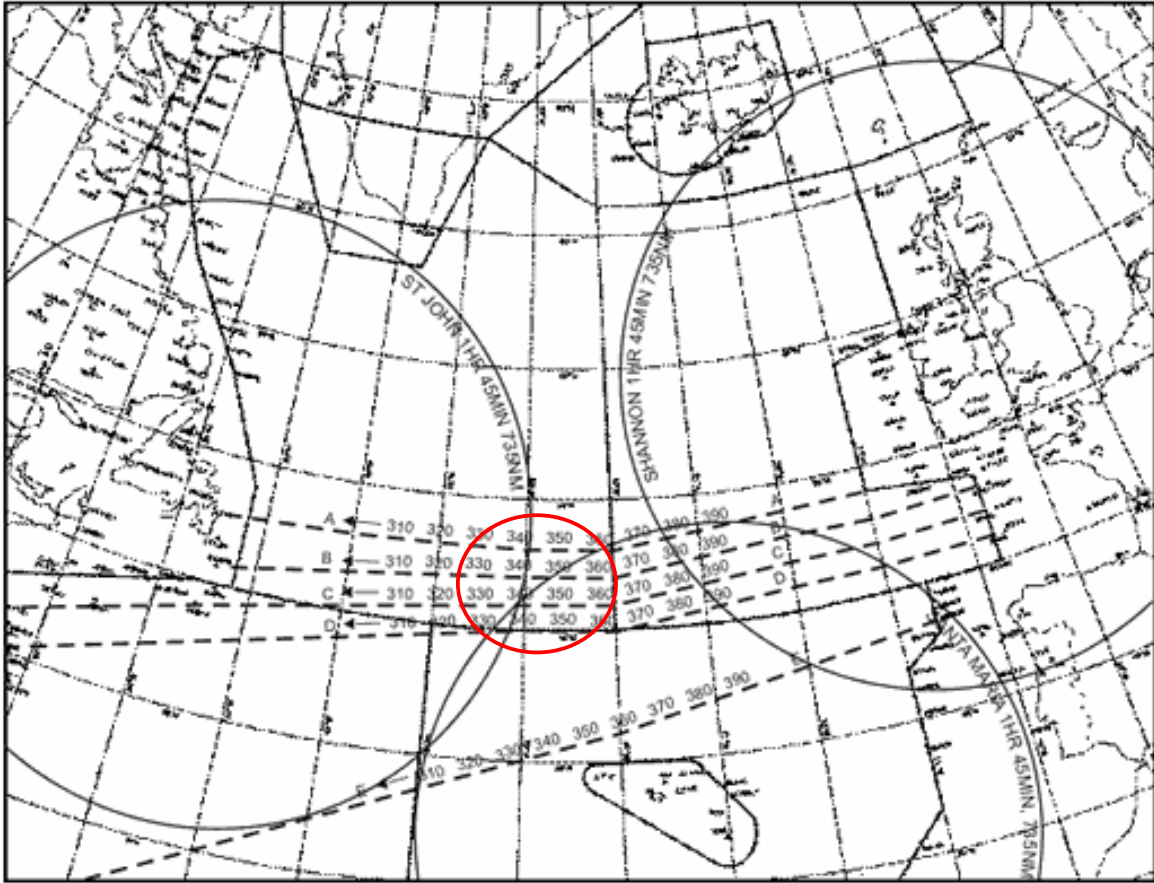

PARIS TO WASHINGTON VIA NAT A 8 HRS 3 MIN
NAT B 8 HRS 10 MIN
NAT C 8 HRS 15 MIN
NAT D 8 HRS 20 MIN

Image 1

In order to meet the “twin-engine” flight standards authorised by the official departments of his company (1 hour 45 minutes flight on 1 engine at an air speed of 420 kt to reach the alternate aerodromes in still air conditions) , a pilot has to choose an ATC route , in Minimum Navigation Performance Specification area , while at the same time taking the shortest possible time. Given that the three alternate aerodromes taken into account are SHANNON , SANTA MARIA , ST JOHN TORBAY , the track to be chosen between PARIS and WASHINGTON will be ;

- a) Track C , time 8 hours 15 minutes.
- b) Track D , time 8 hours 20 minutes.
- c) Track B , time 8 hours 10 minutes.
- d) Track A , time 8 hours 3 minutes.

Answer ;

- a) Track C , time 8 hours 15 minutes.

Açıklama ;

MNPS hava sahasında uçuş düzenleyecek çift motorlu bir uçağın uçuş standartlarına göre ; sakin hava koşullarında tek motoru çalışır haldeyken 420 kt süratle yedek meydana 1 saat 45 dakikada ulaşmaktadır. Paris – Washington arasında MNPS havasahasında uçuş yapacak olan bu uçak belirlenmiş ATC rotalarından birini seçecektir. Üç adet yedek meydan vardır , bunlar ; Shannon , Santa Maria ve St John Torbay’dir ve ekte yer alan haritada bu meydanlara olan 1 saat 45 dakikalık uçuş mesafeleri dairesel kavaraj şeklinde gösterilmiştir. Soruda Paris – Washington uçuşu için belirlenmiş olan A , B , C ve D rotalarından hangisinin en uygun rota olduğu sorulmaktadır.

Ekte verilen haritaya bakıldığında en kısa sürecek olan rota A olarak gözükmektedir. Ancak uçak bu rota üzerinde Santa Maria için belirlenmiş 1 saat 45 dakikalık daireyi terk ettikten sonra St John Torbay ve Santa Maria yedek meydanlarına 1 saat 45 dakikalık uçuş süresinden daha fazla bir mesafede olacaktır ve aynı durum B rotası için de geçerlidir. Diğer rotalara bakıldığında ise uçak tek motora düşmesi durumunda rota boyunca bu 3 yedek meydana herhangi birine ulaşabilecek durumda olacaktır. Bu iki rotadan 8 saat 15 dakikalık süre ile daha kısa olan C rotasının seçilmesi uygun olacaktır.

- 0356.** In order to operate an airplane at night , the airplane must be equipped with an airborne weather radar when the airplane is ;
1. pressurised.
 2. non-pressurised , and maximum take-off mass is more than 5.700 kg
 3. non-pressurised , and maximum approved seating configuration is more than 9 seats
 4. non-pressurised , operating for public transportation.

The combination regrouping all the correct statements is ;

- a) 4.
- b) 1 , 2.
- c) 1 , 4.
- d) 1 , 2 , 3.

Answer ;

- d)** 1 , 2 , 3.
-

- 0357.** In public transport , prior to take-off in icing conditions , the captain must check that ;
- a) external surfaces are free from any ice accretion greater than 5 mm.
 - b) possible ice accretions do not cause to exceed weight and balance limits.
 - c) external surfaces are free from any ice accretion which may impede the airplane performance and manoeuvrability , except within the limits specified by the flight manual.
 - d) external surfaces are still covered with anti-icing fluid.

Answer ;

- c)** external surfaces are free from any ice accretion which may impede the airplane performance and manoeuvrability , except within the limits specified by the flight manual.
-

- 0358.** In regard to passengers briefing in public transport aeroplane , information about oxygen must be given to passengers through a demonstration. If a flight is to be carried out at FL 290 , this demonstration must be completed before ;

- a) take-off.
- b) the aircraft reaches FL 250.
- c) the aircraft reaches FL 140.
- d) the aircraft reaches FL 100.

Answer ;

- a)** take-off.
-

- 0359.** In regards to ICAO Annex 18 , when offering dangerous goods for transportation by air , who initially is responsible for compliance with the regulations ?

- a) The shipper.
- b) The aerodrome manager.
- c) The station manager.
- d) The pilot in command.

Answer ;

- a)** The shipper.
-

- 0360.** In the absence of wind and without the astronomic precession effect , an aircraft would , at a constant gyro heading , follow a ;

- a) rhumb line.
- b) great circle line.
- c) spherical flight segment.
- d) straight map line.

Answer ;

- b)** great circle line.
-

- 0361.** In the Airspace where the MNPS is applicable , the vertical separation that can be applied between FL 290 and FL410 inclusive is ;

- a) 1000 ft.
- b) 1500 ft.
- c) 500 ft.
- d) 2000 ft.

Answer ;

- a)** 1000 ft.
-

- 0362.** In the case of overheating of the brakes following the landing , the appropriate action at the parking position is ;
1. set parking brake on.
 2. set parking brake off , with chocks in position.
 3. spray water on the brakes.
 4. ventilate the brakes.

The combination regrouping of all the correct statements is ;

- a) 1 , 3.
- b) 2 , 4.
- c) 1 , 4.
- d) 2 , 3.

Answer ;

b) 2 , 4.

- 0363.** In the event of a contingency which requires an en-route diversion to an alternate aerodrome across the direction of the prevailing “NAT” traffic flow and prior ATC clearance cannot be obtained an aeroplane capable of maintaining its assigned flight level 410 should ;

- a) climb or descend 500 ft , while turning towards the alternate aerodrome.
- b) descend 1000 ft , while turning towards the alternate aerodrome.
- c) climb 500 ft , while turning towards the alternate aerodrome.
- d) climb 1000 ft or descend 500 ft , while turning towards the alternate aerodrome.

Answer ;

d) climb 1000 ft or descend 500 ft , while turning towards the alternate aerodrome.

- 0364.** In the event of a contingency which requires an en-route diversion to an alternate aerodrome across the direction of the prevailing “NAT” traffic flow and if prior ATC clearance cannot be obtained an aircraft able to maintain its assigned flight level should ;

- a) If below FL410 , climb 500 ft or descend 1000 ft , while turning towards the alternate aerodrome.
- b) If below FL410 , climb or descend 1000 ft , while turning towards the alternate aerodrome.
- c) If above FL410 , climb 1000 ft or descend 500 ft , while turning towards the alternate aerodrome.
- d) If above FL410 , climb or descend 1000 ft , while turning towards the alternate aerodrome.

Answer ;

d) If above FL410 , climb or descend 1000 ft , while turning towards the alternate aerodrome.

- 0365.** In the event of a contingency which required an en-route diversion to an alternate aerodrome across the direction of the prevailing “NAT” traffic flow and if prior ATC clearance cannot be obtained an aircraft not able to maintain its assigned flight level should ;

- a) Start its climb or descent while turning to acquire an offset by 60 NM from its assigned route or track.
- b) Start its climb or descent while turning to acquire an offset by 30 NM from its assigned route or track.
- c) Descend below FL275.
- d) Start its climb or descent while turning to acquire an offset by 90 NM from its assigned route or track.

Answer ;

b) Start its climb or descent while turning to acquire an offset by 30 NM from its assigned route or track.

- 0366.** In the event of a contingency which required an en-route diversion to an alternate aerodrome across the direction of the prevailing “NAT” traffic flow and if prior ATC clearance cannot be obtained an aircraft not able to maintain its assigned flight level should ;

- a) minimise its rate of descent while acquiring a 60 NM offset track.
- b) minimise its rate of descent while acquiring a 15 NM offset track.
- c) immediately descend below FL280 nd then acquire a 15 NM offset track.
- d) immediately descend below FL280 nd then acquire a 60 NM offset track.

Answer ;

b) minimise its rate of descent while acquiring a 15 NM offset track.

- 0367.** In the event of an en-route HF communication failure in an MNPS (Minimum Navigation Performance Specification) airspace , the appropriate VHF frequency for air to air communications is ;

- a) 118.800 MHz.
- b) 128.800 MHz.
- c) 123.45 MHz.
- d) 121.800 MHz.

Answer ;

c) 123.45 MHz.

0368. In the event of communication failure in an MNPS (Minimum Navigation Performance Specification) airspace , the pilot must ;

- a) return to the flight plan route if it is different from the last oceanic clearance received and acknowledged.
- b) continue the flight in compliance with the last oceanic clearance received and acknowledged.
- c) change the flight level in accordance with predetermined instructions.
- d) join one of the so-called “special” routes.

Answer ;

- b)** continue the flight in compliance with the last oceanic clearance received and acknowledged.
-

0369. In the JAR OPS , a runway is considered damp when ;

- a) it is covered with a film of water of less than 3 mm.
- b) it is covered with a film of water of less than 1 mm.
- c) surface moisture gives it a shiny appearance.
- d) its surface is not dry , and when surface moisture does not give it a shiny appearance.

Answer ;

- d)** its surface is not dry , and when surface moisture does not give it a shiny appearance.
-

0370. In the JAR OPS , a runway is considered wet when ;

- 1. it is covered with a quantity of water or loose or slushy snow less than or equal to the equivalent of 3 mm of water.
- 2. the amount of surface moisture is sufficient to modify its colour but does not give it a shiny appearance.
- 3. the amount of surface moisture is sufficient to make it reflective , but does not create large stagnant sheets of water.
- 4. it bears stagnant sheets of water.

The combination regrouping all the correct statements is ;

- a) 1 , 3.
- b) 1 , 2.
- c) 4.
- d) 1 , 2 , 3.

Answer ;

- a)** 1 , 3.
-

0371. In the JAR OPS , a runway is referred to as contaminated when more than 25% of the required runway surface is covered with the one of the following elements ;

- 1. a water film sufficiently thick to give a shiny appearance to the runway.
- 2. a water film or loose or slushy snow equivalent to more than 3 mm of water.
- 3. compacted snow (a solid mass which may not be compacted further).
- 4. ice , including wet ice.
- 5. moist grass.

The combination regrouping all the correct statements is ;

- a) 2 , 3 , 4
- b) 1 , 3 , 4
- c) 1 , 3 , 4 , 5
- d) 1 , 2 , 3 , 4

Answer ;

- a)** 2 , 3 , 4
-

0372. In the MNPS airspace , a pilot should first of all take the following action in the event of a failure of the last inertial navigation system ;

- a) immediately climb or descend 1000 ft.
- b) notify Air Traffic Control and wait for instructions within a reasonable period.
- c) request authorisation from Control to track another aircraft.
- d) set a different heading approximately 45° from the previous one.

Answer ;

- b)** notify Air Traffic Control and wait for instructions within a reasonable period.
-

0373. In the MNPS (Minimum Navigation Performance Specification) area , a pilot should first of all take the following action in the event of a failure of the last inertial navigation system ;

- a) immediately climb or descend 1 000 ft.
- b) notify Air Traffic Control and wait for a reply within a reasonable time.
- c) request authorisation from Control to track another aircraft.
- d) set a different heading approximately 45° from the previous one.

Answer ;

- b)** notify Air Traffic Control and wait for a reply within a reasonable time.
-

0374. In the “worst case” scenario of recovery from the effects of a microburst , having increased to full go-around power , in co-ordinating power and pitch it may be necessary to ;

- a) increase the pitch angle until the stick shaker is felt and hold at slightly below this angle.
- b) climb away at $V_{at} + 20$ kt.
- c) reduce speed to V_2 and hold.
- d) slowly increase speed whilst maintaining a positive rate of climb.

Answer ;

- a) increase the pitch angle until the stick shaker is felt and hold at slightly below this angle.
-

0375. In VFR public transport on an aircraft for which the flight manual indicates a minimum crew of one pilot , when do the regulations require the presence of a second pilot ?

- a) never.
- b) if the aircraft is a twin-engine.
- c) if the flight lasts more than 3 hours.
- d) if part or all the flight is done at night.

Answer ;

- a) never.
-

0376. In VMC , a runway should not be chosen as preferential for noise abatement procedures when ;

- a) Tail wind component , including gusts , is less than 4 kt.
- b) It has a tail wind regardless its magnitude.
- c) It has no ILS or visual approach slope guidance.
- d) Cross-wind component , including gusts , is 10 kt or less.

Answer ;

- c) It has no ILS or visual approach slope guidance.
-

0377. In what period of time must a fuel jettisoning system be capable of jettisoning sufficient fuel to meet the specified approach and landing climb performance requirements ?

- a) 30 minutes
- b) 90 minutes
- c) 15 minutes
- d) 60 minutes

Answer ;

- c) 15 minutes
-

0378. Information concerning emergency evacuation procedures shall be found in the ;

- a) operations manual.
- b) journey logbook.
- c) flight manual.
- d) operational flight plan.

Answer ;

- a) operations manual.
-

0379. Initially , who is responsible for ensuring that cargo for air transportation as dangerous goods is not prohibited ?

- a) The shipper when completing the shipper’s declaration for dangerous goods.
- b) It is not specified.
- c) The operator.
- d) The commander , always using the list of prohibited items.

Answer ;

- a) The shipper when completing the shipper’s declaration for dangerous goods.
-

0380. Item D of a SNOWTAM gives the cleared length of a runway in metres. If this is less than the published length , how is this reported ;

- a) as a percentage of the total length of the runway available as the final item of a SNOWTAM.
- b) in plain language at item T (the final paragraph) of a SNOWTAM.
- c) it is not reported.
- d) by a four figure group added to item D , which gives the length in metres.

Answer ;

- d) by a four figure group added to item D , which gives the length in metres.
-

0381. JAR-OPS 1 applies to ;
- a) aircraft used by police , customs and defence departments.
 - b) the operation by a JAA state member of any civil aircraft.
 - c) the operation by a JAA state member of any civil commercial transport aeroplane.
 - d) aircraft proceeding from European states or flying over them.

Answer ;

- c) the operation by a JAA state member of any civil commercial transport aeroplane.
-

0382. JAR-OPS 1 establishes that , a co-pilot is not assigned to operate at the flight controls during take-off and landing unless ;
- a) he has carried out as-pilot-in-command or as co-pilot at least three take-off and three landings in an aeroplane or an approved flight simulator of the type used , in the preceding 30 days.
 - b) he has carried out as pilot-in-command or as co-pilot at least three take-off and three landings in an aeroplane or an approved flight simulator of the type used , in the preceding 90 days.
 - c) he has carried out at least three flights as pilot-in-command or as a co-pilot at the controls of the type to be used , in the preceding 90 days.
 - d) he has operated as pilot-in-command or as co-pilot at the controls during take-off and landing of the type to be used in the preceding 90 days.

Answer ;

- d) he has operated as pilot-in-command or as co-pilot at the controls during take-off and landing of the type to be used in the preceding 90 days.
-

0383. JAR-OPS 1 requires that a co-pilot does not serve at the flight controls (as pilot flying or pilot non-flying) as part of the minimum certificated crew unless ;
- a) he has operated the controls as a pilot for three take-offs and landings in an aeroplane in the preceding 60 days.
 - b) he has operated the controls as a pilot for three take-offs and landings in an aeroplane of the same type/class or in a flight simulator of the aeroplane type to be used in the preceding 60 days.
 - c) he has operated the controls as a pilot for three take-offs and landings in an aeroplane of the same type/class or in a flight simulator of the aeroplane type to be used in the preceding 90 days.
 - d) he has operated the controls as a pilot for three take-offs and landings in an aeroplane in the preceding 90 days.

Answer ;

- c) he has operated the controls as a pilot for three take-offs and landings in an aeroplane of the same type/class or in a flight simulator of the aeroplane type to be used in the preceding 90 days.
-

0384. JAR-OPS 1 requires that a co-pilot does not serve at the flight controls during take-off and landing unless ;
- a) he has operated the controls as a pilot for three take-offs and landings in an aeroplane of the same type/class or in a flight simulator of the aeroplane type to be used in the preceding 60 days.
 - b) he has operated the controls as a pilot for three take-offs and landings in an aeroplane in the preceding 90 days.
 - c) he has operated the controls as a pilot for three take-offs and landings in an aeroplane in the preceding 60 days.
 - d) he has operated the controls as a pilot for three take-offs and landings in an aeroplane of the same type/class or in a flight simulator of the aeroplane type to be used in the preceding 90 days.

Answer ;

- d) he has operated the controls as a pilot for three take-offs and landings in an aeroplane of the same type/class or in a flight simulator of the aeroplane type to be used in the preceding 90 days.
-

0385. JAR OPS 1.465 (VFR Operating minima) , establishes that , the operator shall ensure about VFR flights , that ;
- a) special VFR flights are not commenced when visibility is less than 3 km.
 - b) for conducted VFR flights in airspace F , vertical distance from clouds is 250 m at least.
 - c) for conducted VFR flights in airspace B , horizontal distance from clouds is 1 000 m at least.
 - d) for conducted VFR flights in airspace E , flight visibility at and above 3 050 m. (10 000 ft) is 5 km at least (clear of cloud).

Answer ;

- a) special VFR flights are not commenced when visibility is less than 3 km.
-

- 0386.** Just after take-off an aircraft encounters a “microburst” situated directly ahead. The initial indications will be ;
1. an increase in head wind.
 2. an increase in tail wind.
 3. better climb performance.
 4. a decrease in climb gradient.

The combination regrouping all the correct statements is ;

- a) 1 , 3.
- b) 2 , 4.
- c) 1 , 4.
- d) 2 , 3.

Answer ;

- a) 1 , 3.
-

- 0387.** Malfunctioning of the automatic pressurization system is indicated by ;

1. a change in environmental sounds.
2. the cabin altitude gauge indicates an abnormal rate of climb.
3. the differential pressure between the exterior and the interior of the aircraft decreases.

The combination regrouping all the correct statements is ;

- a) 1 , 2.
- b) 2 , 3.
- c) 1 , 2 , 3.
- d) 1 , 3.

Answer ;

- c) 1 , 2 , 3.
-

- 0388.** Minimum Navigation Performance Specification (MNPS) airspace in the applicable areas of the North Atlantic is defined between the following flight levels ;

- a) sea level and FL660.
- b) FL 280 and FL 475.
- c) FL 270 and FL 400.
- d) FL 285 and FL 420.

Answer ;

- d) FL 285 and FL 420.
-

- 0389.** Minimum time route is a route calculated for ;

- a) a period of 12 hours.
- b) a period of 24 hours.
- c) a given flight from departure to destination.
- d) aircraft flying in MNPS airspace.

Answer ;

- c) a given flight from departure to destination.
-

- 0390.** Mist in the cabin , pressure and temperature drop characterise ;

- a) a rapid depressurization.
- b) a slow depressurization.
- c) a plastic fire.
- d) an electrical fire.

Answer ;

- a) a rapid depressurization.
-

- 0391.** MNPS is the abbreviation for ;

- a) Minimum Navigation Performance Specification.
- b) Minimum Navigation Positioning System.
- c) Maximum North-Atlantic Precision System.
- d) Military Network Performance Structure.

Answer ;

- a) Minimum Navigation Performance Specification.
-

0392. Noise attenuation shall not be the determining factor in the designation of a runway , under the following circumstances ;
1. when cross wind component , including gust , exceeds 15 knots.
 2. when the tail wind component , including gust , exceeds 5 knots.
 3. when the runway is not clear or dry.

The combination regrouping all the correct statements is ;

- a) 2 , 3.
- b) 1 , 2 , 3.
- c) 1 , 2.
- d) 1 , 3.

Answer ;

- b) 1 , 2 , 3.


0393. On a polar stereographic chart where the earth convergence between 2 points located on the parallel 60°N is 20°, the great circle maximum cross-track difference with the straight line joining the 2 points is ;

- a) 4.0 NM.
- b) 30 NM.
- c) 4.0 NM.
- d) 9.2 NM.

Answer ;

- b) 30 NM.

Çözüm ;

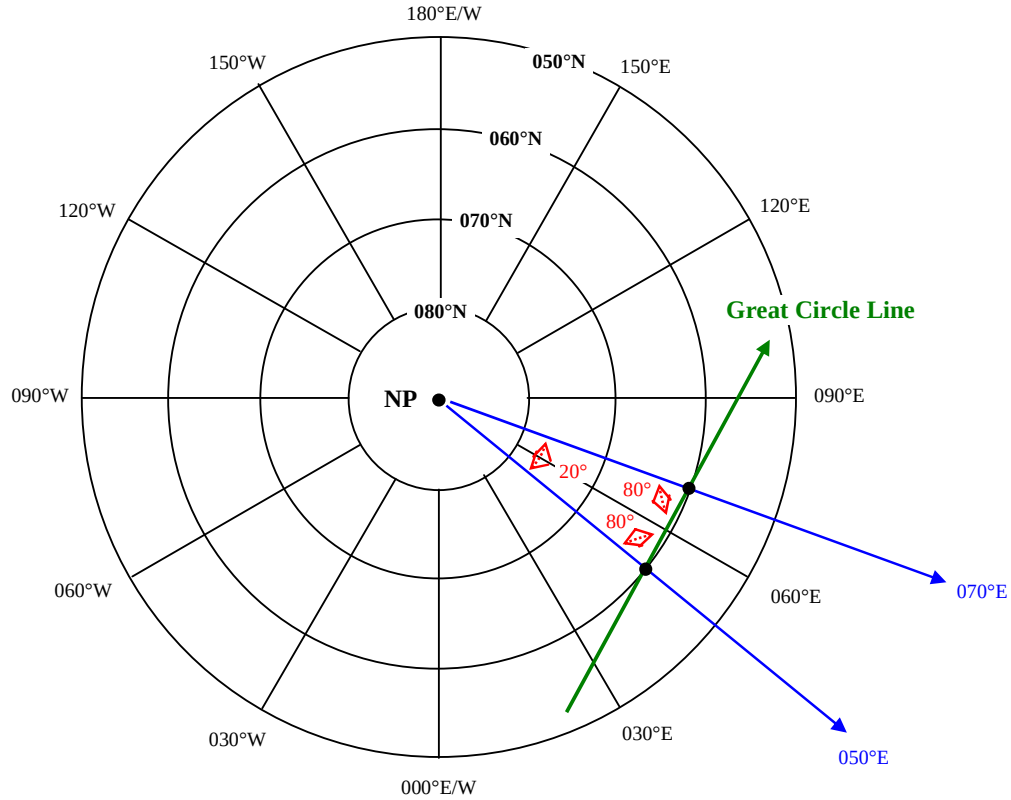

Bir polar stereografik haritada , 60°N enlemi üzerinde yer alan iki noktanın birleşme açısı 20 derecedir. Soruda bu iki nokta arasında uzanan büyük daire hattına göre maksimum olabilecek cross-track farklılığı sorulmuştur. Çizdiğimiz diagramda 20 derecelik ayrılmaya örnek olarak 050°E ve 070°E meridyenlerini gösterebiliriz.


0394. On a polar stereographic chart whose grid is parallel with the Greenwich meridian in the direction of the true North pole , the “true” orientation of the great circle linking point 62°N 010°E to point 66°N 050°W is 305°. The grid route at the starting point of this great circle is ;

- a) 298°.
- b) 295°.
- c) 301°.
- d) 292°.

Answer ;

b) 295°.

Çözüm ;

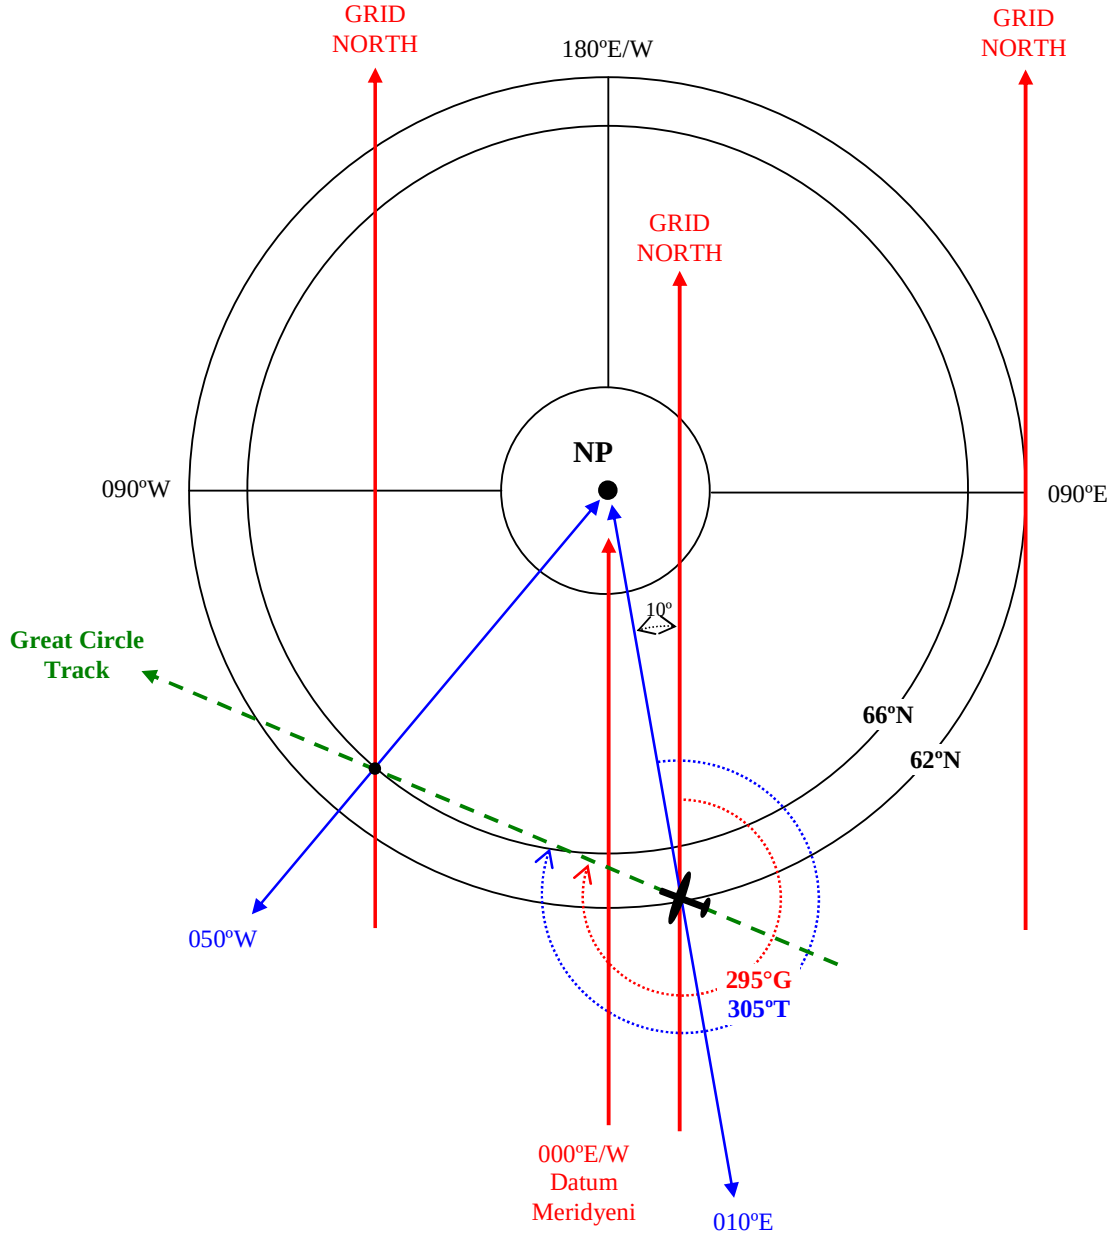

Bu tür problemlerin çözümünde kullanılabilecek en kolay yöntem eldeki verilerle yukarıdaki gibi bir diagram oluşturmaktır. Bu Kuzey Kutbu (NP) Polar Stereografik haritasında Grid North Greenwich meridyeni ile oryantasyonludur. Öncelikle 62°N ve 66°N enlemlerini temsil eden dairesel hatlar çizilerek 305°T rotalı büyük daire hattının geçtiği ilk nokta (62°N 010°E) ve diğer geçtiği nokta (66°N 050°W) diagram üzerinde belirtilir. Burada 010°E meridyeni aynı zamanda Gerçek Kuzey'i de (True North) göstermektedir. Soruda ilk noktadaki Grid rota değeri sorulduğuna göre öncelikle Convergency tespit edilmelidir. Convergency'nin yönü Lokal meridyen (010°E) üzerinde Grid North'dan True North'a doğru ölçülür ki bunun batılı yönde olduğu görülmektedir ve 10°dir. Sonuç olarak ;
Grid track = True track – Convergency (W)
Grid track = 305° – 10°
Grid track = 295°G olarak bulunur.

0395. On a pressurised aeroplane , supplemental oxygen is used to ;
- a) provide selected passengers with oxygen.
 - b) assist a passenger with breathing disorders.
 - c) provide passengers on board with oxygen following a cabin depressurisation.
 - d) protect the aircrew fighting fires.

Answer ;

c) provide passengers on board with oxygen following a cabin depressurisation.

0396. On a pressurised aeroplane , supplemental oxygen is used to ;
- a) provide people on board with oxygen during a cabin depressurisation
 - b) provide with oxygen passengers who might require it , following a cabin depressurisation
 - c) protect an aircrew who fights a fire
 - d) assist a passenger with breathing disorders

Answer ;

a) provide people on board with oxygen during a cabin depressurisation

0397. On arriving overhead an isolated aerodrome , the commander of a turbojet engine aircraft should have a minimum quantity of fuel (additional reserve including the final reserve) sufficient for flying during ;

- a) 30 minutes with normal cruising consumption.
- b) 2 hours at holding flight speed and 1500 ft.
- c) 30 minutes at holding flight speed and 1500 ft.
- d) 2 hours with normal cruise consumption.

Answer ;

d) 2 hours with normal cruise consumption.

Açıklama ;

Yedek bir meydan seçilemediği durumlarda , örneğin gidilecek meydan izole bir durumda ise yani yakın çevresinde uygun bir meydan yok ise ilave olarak alınacak yakıt ; planlı gidiş meydanına uçuş ve normal seyir tüketimi ile 2 saat havada kalmaya yetecek yakıt miktarıdır.

0398. On board a non-pressurised aircraft , 10% of the passengers shall be supplied with oxygen throughout the entire flight time , after 30 minutes at pressure altitude greater than ;

- a) 11 000 ft but not exceeding 13 000 ft.
- b) 10 000 ft but not exceeding 13 000 ft.
- c) 11 000 ft but not exceeding 12 000 ft.
- d) 10 000 ft but not exceeding 12 000 ft.

Answer ;

b) 10 000 ft but not exceeding 13 000 ft.

Açıklama ;

Soru 0400'ün açıklamasına bakınız.

0399. On board a non-pressurized aircraft , the crew and all the passengers must be fed with oxygen throughout the flight period during which the pressure altitude is greater than ;

- a) 13 000 ft.
- b) 11 000 ft.
- c) 10 000 ft.
- d) 12 000 ft.

Answer ;

a) 13 000 ft.

Açıklama ;

Soru 0400'ün açıklamasına bakınız.

0400. On board a pressurised aircraft , a flight shall be undertaken only if the aircraft is provided with an oxygen reserve enabling all the crew members and part of the passengers to be supplied with oxygen in the event of a cabin depressurisation , throughout the flight period , during which the pressure altitude is greater than ;

- a) 13 000 ft.
- b) 11 000 ft.
- c) 12 000 ft.
- d) 10 000 ft.

Answer ;

a) 13 000 ft.

Açıklama ;

JAR-OPS OKSİJEN GEREKLİLİKLERİ	
Kimler İçin	Süre ve Kabin Basınç İrtifası
Görevdeki tüm kişiler	Tüm uçuş boyunca kabin basıncı 13.000 ft ve 10.000 ft'i aştığında ancak , bu irtifalarda ilk 30 dakikadan sonra 13.000 ft'i aşmayan uçuş zamanı , hiçbir durumda aşağıdakilerden az olamaz , bunlar ; – 25.000 ft altındaki irtifalarda , uçuşa sertifikeli uçaklar için 30 dakika (not 2) , – 25.000 ft üstündeki irtifalarda , uçuşa sertifikeli uçaklar için 2 saat (not 3).
Gerekli kabin ekip üyeleri	Kabin basınç irtifası 13.000 ft üstünde ancak , 30 dakikadan fazla (not 2) uçuş zamanı ve kabin basınç irtifası 10.000 ft üstünde ancak , bu irtifalarda ilk 30 dakikadan sonra 10.000 ft'i geçmediğinde kalan uçuş zamanı.
Yolcuların % 100'ü (not 5)	Kabin basınç irtifası 15.000 ft üstünde ancak , 10 dakikadan az olmayan uçuş zamanı (not 4).
Yolcuların % 30'u (not 5)	Kabin basınç irtifası 14.000 ft'i aştığında ancak , 15.000 ft'i aşmadığında kalan uçuş zamanı.
Yolcuların % 10'u (not 5)	Kabin basınç irtifası 10.000 ft'i aştığında fakat bu irtifalarda ilk 30 dakikadan sonra 14.000 ft'i aşmadığında kalan uçuş zamanı.
Notlar : 1. Sağlanan ikmal , düşünülen rotalar için kabin basınç irtifası iniş profiline göre dikkate alınmalıdır. 2. Gerekli olan minimum ikmal , uçağın maksimum sertifikeli çalışmasında 10.000 ft'e kadar 10 dakikayı takip eden 10.000 ft'teki 20 dakika içindeki sabit oranlı iniş zorunlu olan oksijen miktarıdır. 3. Gerekli minimum ikmal , oksijen miktarı özellikle uçağın maksimum sertifikeli çalıştırma irtifası 10.000 ft'e 10 dakikayı takiben 110 dakika uçabilecek devamlı alçalmayı yapmalıdır. Oksijen gerekliliği JAR-OPS 1.780 (a) (1) uygun olmalıdır. 4. Gerekli minimum ikmal , oksijen miktarı özellikle uçağın maksimum sertifikeli çalıştırma irtifası 14.000 ft'e 10 dakikada devamlı alçalmayı yapmalıdır. 5. Bu tablodaki "yolcu" kelimesi , gerçekten bileli yolcudur.	

0401. On most of the large modern aeroplanes , an engine fire warning system will switch on the relevant fire shut off-handle. The fire shut-off handle will be switched off when ;

- a) the fire shut-off handle has been pulled.
- b) the fire-extinguisher has been triggered.
- c) fire is no longer detected.
- d) all the fire-extinguishers connected to this engine have been triggered.

Answer ;

c) fire is no longer detected.

0402. On overwater flights , an operator shall not operate an aeroplane at a distance away from land , which is suitable for making an emergency landing greater than that corresponding to ;

- a) 300 NM or 90 minutes at cruising speed.
- b) 100 NM or 30 minutes at cruising speed.
- c) 200 NM or 45 minutes at cruising speed.
- d) 400 NM or 120 minutes at cruising speed.


Answer ;

d) 400 NM or 120 minutes at cruising speed.

Açıklama ;

Eğer bir uçak (30'dan fazla yolcu taşıma konfigürasyonuna sahip) suya mecburi iniş yapabilecek kabiliyette değilse , karadaki bir meydana ulaşmak için normal seyir sürati ile 120 dakikadan ya da 400 NM'dan (hangisi daha az ise) daha fazla süre su üzerinde uçmamalıdır.

0403. (For this question use annex 071-2070A)

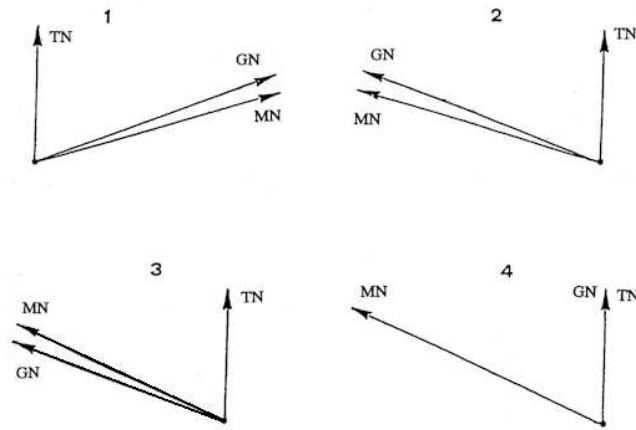

Annex 071-2070A

On the diagram where ;

TN = True North
MN = Magnetic North
GN = Grid North

If the magnetic variation is equal to 65°W and if the grid variation is equal to 4°E , the correct arrangement of the different north is ;


- a) 4.
- b) 2.
- c) 1.
- d) 3.

Answer ;

d) 3.

Çözüm ;

Burada Manyetik varyasyon değeri 65°W olarak verildiğine göre ; Manyetik Kuzey , Gerçek Kuzey'in (True North) 65° batısında yer almaktadır. Grid varyasyonu ise 4°E olarak verilmiştir , yani Manyetik Kuzey Grid Kuzeyi'nin 4° doğusunda yer almaktadır.

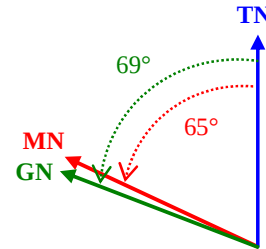

0404. One of the main characteristics of windshear is that it ;

- a) occurs only at a low altitude (2000 ft) and never in the vertical plane.
- b) can occur at any altitude and only in the horizontal plane.
- c) occurs only at a low altitude (2000 ft) and never in the horizontal plane.
- d) can occur at any altitude in both the vertical and horizontal planes.

Answer ;

d) can occur at any altitude in both the vertical and horizontal planes.

0405. One of the primary factors causing dynamic hydroplaning is ;

- a) the strength of the crosswind.
- b) the strength of the headwind.
- c) the aircraft's weight.
- d) the depth of the standing water on the runway.

Answer ;

d) the depth of the standing water on the runway.

0406. Penetration into the NAT MNPS airspace is ;

- a) not subject to a clearance , since the flight is already controlled.
- b) subject to a mandatory clearance.
- c) subject to a clearance only if the flight route is changed.
- d) subject to an optional clearance depending on the type of flight (scheduled or not).

Answer ;

b) subject to a mandatory clearance.

0407. Posit ;

g , the longitude difference
Lm , the average latitude
Lo , the latitude of the tangent

The correct formula expressing the travel precession applied during a transoceanic and polar navigation , is equal to ;

- a) $g / 2.\sin Lm$
- b) $15^\circ / h.\sin Lm$
- c) $g.(\sin Lm - \sin Lo)$
- d) $g.\sin Lm$

Answer ;

d) $g.\sin Lm$

0408. Posit ;

g , the longitude difference
Lm , the average latitude
Lo , the latitude of the tangent

The transport precession is equal to ;

- a) $g.(\sin Lm - \sin Lo)$
- b) $15^\circ / h.\sin Lm$
- c) $g / 2.\sin Lm$
- d) $g.\sin Lm$

Answer ;

d) $g.\sin Lm$

0409. Products or materials are considered to be dangerous goods if the products or materials in question are defined as such by ;

- a) The IATA document entitled "Regulations governing the transportation of dangerous goods by air".
- b) The directives of the Community Union.
- c) The UNO document entitled "Dangerous Goods Regulations".
- d) The ICAO document entitled "Technical Instructions for the safe transport of dangerous goods by air".

Answer ;

d) The ICAO document entitled "Technical Instructions for the safe transport of dangerous goods by air".

0410. Reference shall be made to the Minimum Equipment List (MEL) for equipment found unserviceable at any time ;

- a) prior to the flight time stage.
- b) prior to the aircraft take-off.
- c) during the flight
- d) from engine start-up until the aircraft has come to a complete stop at the end of the flight.

Answer ;

a) prior to the flight time stage.

0411. Regarding all weather operations , if V_{AT} is from 91 kt to 120 kt , the aeroplane is in ;

- a) Category B.
- b) Category E.
- c) Category C.
- d) Category D.

Answer ;

a) Category B.

Açıklama ;

Havaaracı Yaklaşma Kategorileri	
Kategori	V_{AT}
A	91 kt'dan az
B	91 kt – 120 kt
C	121 kt – 140 kt
D	141 kt – 165 kt
E	166 kt – 210 kt

- 0412.** Regarding all weather operations , if V_{AT} is from 121 kt to 140 kt , the aeroplane is in ;
- a) Category C.
 - b) Category D.
 - c) Category E.
 - d) Category B.

Answer ;

a) Category C.

Açıklama ;

Soru 0411'in açıklamasına bakınız.

- 0413.** Regarding all weather operations , if V_{AT} is from 141 kt to 165 kt , the aeroplane is in ;
- a) Category C.
 - b) Category D.
 - c) Category E.
 - d) Category B.

Answer ;

b) Category D.

Açıklama ;

Soru 0411'in açıklamasına bakınız.

- 0414.** Regarding wake turbulence , what are the ICAO minimum radar separation distance and the minimum non-radar separation time for a MEDIUM aircraft behind a HEAVY aeroplane on approach to the same runway ?
- a) 11.1 km (6 NM) and 3 minutes.
 - b) 9.3 km (5 NM) and 2 minutes.
 - c) 9.3 km (5 NM) and 3 minutes.
 - d) 7.4 km (4 NM) and 2 minutes.

Answer ;

b) 9.3 km (5 NM) and 2 minutes.

Açıklama ;

Soru 0278'in açıklamasına bakınız.

- 0415.** Regarding wake turbulence , what is the ICAO minimum non-radar separation time for a LIGHT aircraft behind a MEDIUM or HEAVY aeroplane on approach to the same runway ?
- a) 2 minutes.
 - b) 3 minutes.
 - c) 4 minutes.
 - d) 5 minutes.

Answer ;

b) 3 minutes.

Açıklama ;

Soru 0278'in açıklamasına bakınız.

- 0416.** The abbreviation MNPS means ;
- a) Minimum Navigation Performance Specification.
 - b) Main Navigation Performance Specification.
 - c) Magnetic Navigation Performance Specification.
 - d) Maximum Navigation Performance Specification.

Answer ;

a) Minimum Navigation Performance Specification.

- 0417.** The accumulation of frost , snow or ice on an aeroplane in flight induces , amongst other serious consequences , an increase in the ;
- a) roll rate.
 - b) stalling speed.
 - c) tuck under.
 - d) value of the stall angle of attack.

Answer ;

b) stalling speed.

0418. The aerodrome operating minima for a VOR/DME approach are ; MDH = 360 ft , Required RVR = 1500 metres. Reported RVR is 1800 metres. According to JAR-OPS , the pilot may continue the final approach ;

- a) regardless of the ceiling reported.
- b) if the ceiling reported is higher than 240 ft during the day and 360 ft at night.
- c) if the ceiling reported is higher than 240 ft.
- d) if the ceiling reported is higher than 360 ft.

Answer ;

- a) regardless of the ceiling reported.
-

0419. The aircraft is a single engine , IFR , category A with a cruising speed of 150 knots. The aircraft is flown by a single pilot. The usable runway has edge lights , high intensity runway centre lights and RVR readings for threshold mid and end of runway. The approach minimums for runway 06 are ;

DH = 300 feet

Horizontal visibility (HV) = 800 metres

The weather conditions are : horizontal visibility (HV) 900 metres and ceiling 200 feet.

Is take-off possible ?

- a) Yes , if there is an accessible airport within 75 NM.
- b) No , the ceiling being below the DH for the runway's approach procedure.
- c) Yes , visibility being higher than the horizontal visibility for the approach procedure.
- d) No , visibility being below 1 200 metres.

Answer ;

- a) Yes , if there is an accessible airport within 75 NM.
-

0420. The aircraft is of Category A. The runway has edge lights and high intensity centre line lights. There is an accessible alternate aerodrome and the two pilot crew is IFR qualified on type. The minimum RVR / Visibility required for take-off is ;

- a) 150 m.
- b) 200 m.
- c) 150 m if a threshold RVR is available.
- d) 300 m.

Answer ;

- a) 150 m.
-

0421. The anti-icing fluid protecting film can wear off and reduce the holdover time considerably ;

- a) when the outside temperature is close to 0 °C.
- b) when the temperature of the aeroplane skin is close to 0 °C.
- c) when the aeroplane is parked facing into wind.
- d) during strong winds or as a result of other aircraft engines jet blast.

Answer ;

- d) during strong winds or as a result of other aircraft engines jet blast.
-

0422. The application of a type II anti-icing fluid on an aircraft on the ground will provide a ;

- a) limited holdover time.
- b) protection against icing for the duration of the flight.
- c) limited time of protection independent of the outside temperature.
- d) protection time up to 24 hours.

Answer ;

- a) limited holdover time.
-

0423. The authorization for the transport of dangerous goods is specified on the ;

- a) air operator certificate.
- b) registration certificate.
- c) insurance certificate.
- d) airworthiness certificate.

Answer ;

- a) air operator certificate.
-


0424. The chart is a South polar stereographic projection of the Antarctic regions. A grid , printed over it , is aligned with meridian 180° , the grid North is pointing in the direction of the geographic North (non standard grid). The grid course followed by the aircraft is $R_g = 280^\circ$, the position is $80^\circ\text{S } 100^\circ\text{E}$.; The true course followed at this moment is ;

- a) 080° .
- b) 360° .
- c) 260° .
- d) 100° .

Answer ;

b) 360° .

Çözüm ;

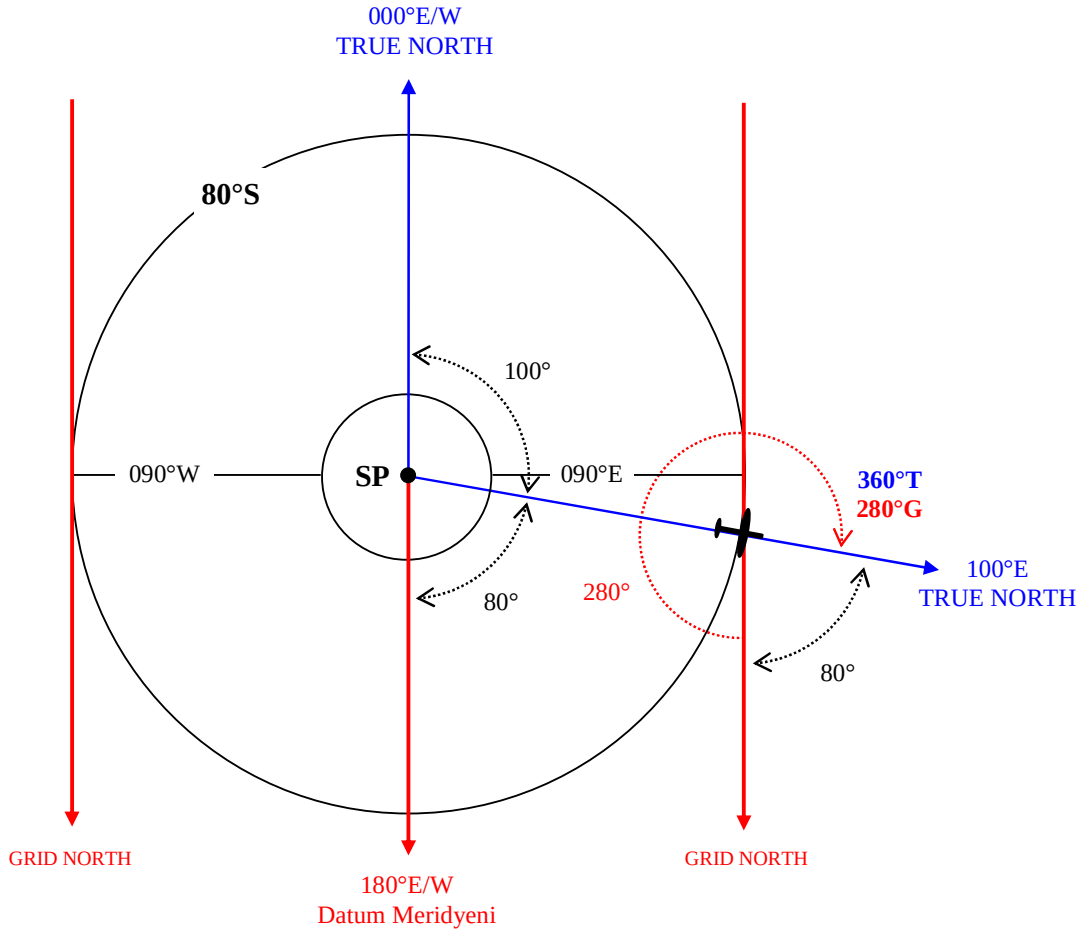

Bu tür problemlerin çözümünde kullanılabilecek en kolay yöntem eldeki verilerle yukarıdaki gibi bir diagram oluşturmaktır. Bu diagram Plotter kullanılarak kağıt üzerinde oluşturulabilir ve aynı zamanda rota ölçümleri de bu diagramdan yapılabilir. Burada Grid North 180°E/W meridyeni ile oryantasyonludur. Öncelikle 80°S enlemini temsil eden bir dairesel hat çizilerek Datum meridyeni (180°E/W meridyeni) konumlandırılır. Daha sonra uçağın bulunduğu meridyen (100°E) diagram üzerinde belirtilir bu aynı zamanda Gerçek Kuzey'i de (True North) göstermektedir , yani True North'u tanımlarken bu hattı Güney Kutbu'ndan Kuzey Kutbu'na doğru uzanan direkt hat olarak düşünmeliyiz. Ayrıca burada çizimde de görüleceği gibi uçağın 280°G olan rotası 100°E meridyeni ile tamamen çakışmaktadır ve direkt olarak Gerçek Kuzey'e göre olan rotasını 360°T olarak söyleyebiliriz. Diğer taraftan bunu convergency değeri ile de hesaplayabiliriz. Burada Convergency'nin yönü Lokal meridyen (100°E) üzerinde Grid North'dan True North'a doğru ölçülür ki bunun doğru yönde olduğu görülmektedir ve 80° dir.

Convergency West = True Track Best
Convergency East = True Track Least

Sonuç olarak ;

Grid track = True track + Convergency

Grid track = $280^\circ + 80^\circ$

Grid track = 360°G olarak bulunur.

0425. The chart type is polar stereographic with the grid parallel to the zero meridian , and Grid North in the direction of the North geographic pole. The gyro is not fitted with a rate correction device. The gyro-magnetic compass of an aircraft standing at an aerodrome located at 59°57'N 010°30'E is switched to free gyro mode at 14.00 UTC , with gyro North being aligned with Grid North and the gyro heading reading 120°. A technical problem delays take off until 16.30 UTC. The gyro , whose mechanical precession is zero , was not reset prior to take off. The error (E) at the time of alignment on this runway will be ;

- a) +73.5°.
- b) +32.5°.
- c) +13°.
- d) -32.5°.

Answer ;

d) -32.5°.


Çözüm ;

The only Error calculation we need is EARTH RATE:

Earth Rate Error = $15 \times \sin Lm \times \text{time} = 15 \times 0.87 \times 2.5 = 32.5^\circ$

Earth rate in northern hemisphere is -ve hence -32.5°

This is the correct answer ...

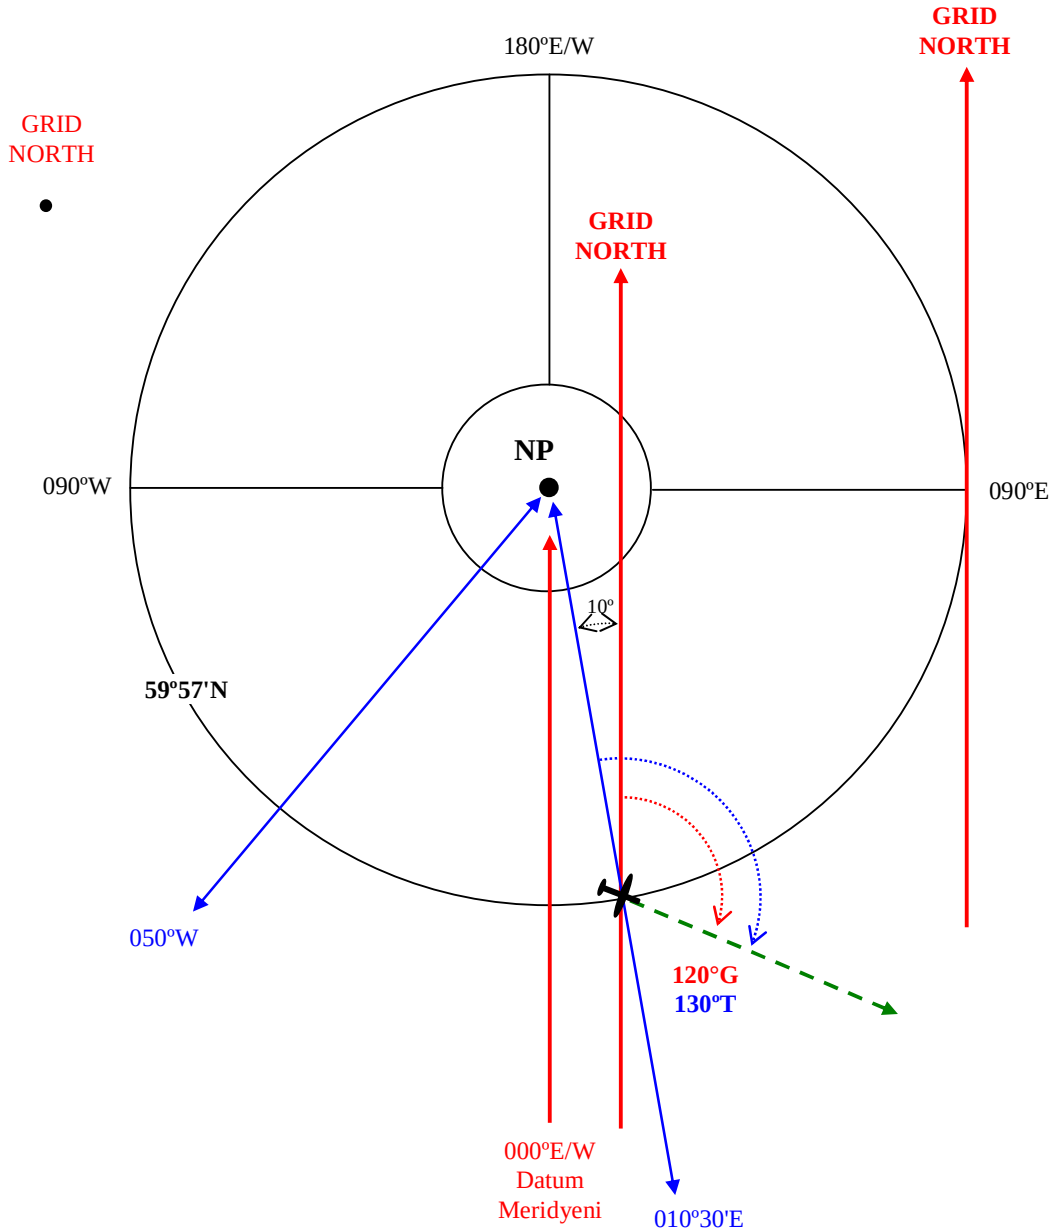

0426. The climb or descent through MNPS (Minimum Navigation Performance Specification) airspace of a non MNPS certified aircraft ;

- a) is forbidden in all circumstances.
- b) can be authorised only if the pilot is in communication with the conflicting aircraft pilot.
- c) can be authorised under radar control if the pilot is in VHF contact with the controller.
- d) can be authorised when the aircraft has two long range navigation systems.

Answer ;

- c)** can be authorised under radar control if the pilot is in VHF contact with the controller.
-

0427. The commander is required by the authority to present the aircraft documents. He ;

- a) shall do so if authorised by the operator.
- b) can refuse to present them.
- c) can request a delay of 48 hours.
- d) shall do so , within a reasonable period of time.

Answer ;

- d)** shall do so , within a reasonable period of time.
-

0428. The commander shall not commence take-off in icing conditions ;

- a) even if the ice contamination does not lead to an exceedence of mass and balance limits.
- b) unless the external surfaces are still covered with anti-icing fluid and the aircraft is not to be operated in forecasted icing conditions greater than moderate icing.
- c) unless the external surfaces are clear of any contamination , except as permitted by Aircraft Flight Manual.
- d) unless the external surfaces are free from any ice contamination greater than 5 mm.

Answer ;

- c)** unless the external surfaces are clear of any contamination , except as permitted by Aircraft Flight Manual.
-

0429. The complete information regarding the types of goods which the passengers are forbidden from transporting aboard an aircraft is listed in the ;

- a) JAR-OPS documentation.
- b) ICAO Annex 18.
- c) ICAO document “Technical Instructions for the Safe Transport of Dangerous Goods by Air”.
- d) aircraft’s flight manual.

Answer ;

- c)** ICAO document “Technical Instructions for the Safe Transport of Dangerous Goods by Air”.
-

0430. The content of the dangerous goods transport document is specified in the ;

- a) Air Transport Permit.
- b) JAR-OPS documentation.
- c) Technical Instructions.
- d) Flight Manual.

Answer ;

- c)** Technical Instructions.
-

0431. The correct definition of a safe forced landing is ;

- a) a landing on land or sea from which it is guaranteed no injuries will result to the occupants.
- b) an inevitable landing on land or sea from which one may reasonably expect no injuries on board.
- c) an unavoidable landing or ditching with a reasonable expectancy of no injuries to persons in the aircraft or on the surface.
- d) a voluntary landing on land or sea carried out by the crew in order to protect the aircraft and its occupants.

Answer ;

- c)** an unavoidable landing or ditching with a reasonable expectancy of no injuries to persons in the aircraft or on the surface.
-

0432. The correct statement about extinguishing agents on board aeroplanes is ;

- a) Water may only be used for minor fires.
- b) Halon is an effective extinguishing agent for use in aeroplanes.
- c) Burning cargo in a cargo-aeroplane is usually extinguished by using carbon dioxide.
- d) A powder extinguisher is suitable for extinguishing a cockpit fire.

Answer ;

- b)** Halon is an effective extinguishing agent for use in aeroplanes.
-


0433. The coverage angle of the red navigation / position light is ;

- a) 140°
- b) 220°
- c) 70°
- d) 110°

Answer ;

d) 110°

Açıklama ;

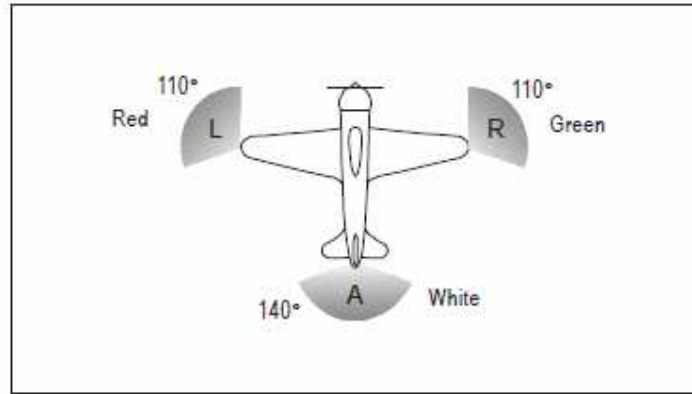

0434. The coverage angle of the regulatory white navigation / position lights , located to the rear of the aircraft , is ;

- a) 220°
- b) 140°
- c) 70°
- d) 110°

Answer ;

b) 140°

Açıklama ;

Soru 0433'teki şekle bakınız.

0435. The dangerous goods regulations ICAO annex 18 and JAR OPS require that , when delivering cargo for transport , the responsibility for compliance with the regulations are to ;

- a) commander.
- b) station manager.
- c) aerodrome manager.
- d) sender.

Answer ;

d) sender.

0436. The dangerous goods transport document , if required , shall be drawn up by ;

- a) the operator.
- b) the shipper.
- c) the captain.
- d) the handling agent.

Answer ;

b) the shipper.

0437. The dangerous goods transport document regarding the safe transport of dangerous goods by air is specified in the ;

- a) flight manual.
- b) air transport permit.
- c) technical instructions.
- d) operations manual.

Answer ;

c) technical instructions.

0438. The field of application of the Minimum Equipment List (MEL) is defined by a phase of flight. In the event of an aircraft serviceability problem , the commander must use the limitations provided by the MEL ;

- a) at the parking area prior to the aircraft taxiing.
- b) until the aircraft has come to a complete stop at the end of the flight.
- c) prior to take-off.
- d) at any time during the flight.

Answer ;

- a)** at the parking area prior to the aircraft taxiing.
-

0439. The field of application of the Minimum Equipment List (MEL) is defined by a phase of flight operation. The commander must use the limitations provided by the MEL ;

- a) at any time during the flight.
- b) until the aircraft has come to a complete stop at the end of the flight.
- c) at the parking area prior to the aircraft taxiing.
- d) prior to the aircraft take-off.

Answer ;

- c)** at the parking area prior to the aircraft taxiing.
-

0440. The file kept by an employer on its flight crews records ;

- 1. the training.
- 2. the test results.
- 3. a log of flying hours.
- 4. a summary of the training by reference period.

Which of the following combinations contains all of the correct answers ?

- a) 1 , 2 , 3 , 4.
- b) 2 , 3.
- c) 1 , 2 , 3.
- d) 3 , 4.

Answer ;

- a)** 1 , 2 , 3 , 4.
-

0441. The fire extinguisher types which may be used on class A fires are ;

- 1. H₂O.
- 2. CO₂.
- 3. dry-chemical.
- 4. halon.

Which of the following combinations contains all of the correct statements ?

- a) 1.
- b) 1 , 2 , 3 , 4.
- c) 2 , 3 , 4.
- d) 3 , 4.

Answer ;

- b)** 1 , 2 , 3 , 4.
-

0442. The fire extinguisher types which may be used on class B fires are ;

- 1. H₂O.
- 2. CO₂.
- 3. dry-chemical.
- 4. halon.

Which of the following combinations contains all of the correct statements ?

- a) 3 , 4.
- b) 1 , 2 , 3 , 4.
- c) 2.
- d) 2 , 3 , 4.

Answer ;

- d)** 2 , 3 , 4.
-

0443. The flight data recorder must start automatically to record the data ;

- a) when taking-off.
- b) prior to the aircraft being capable of moving under its own power.
- c) when the landing gear is retracted.
- d) when lining up.

Answer ;

- b)** prior to the aircraft being capable of moving under its own power.
-

0444. The flight data recorder must stop automatically to record the data ;
- a) when the main gear shock strut compresses when touching the runway.
 - b) when the aeroplane clears the runway.
 - c) after the aeroplane is unable to move by its own power.
 - d) when the landing gear is extended and locked.

Answer ;

- c) after the aeroplane is unable to move by its own power.
-

0445. The frequency designated for VHF air to air communications when out of range of VHF ground stations in NAT region is ;
- a) 243 MHz.
 - b) 121.5 MHz.
 - c) 118.5 MHz.
 - d) 123.45 MHz.

Answer ;

- d) 123.45 MHz.
-

0446. The general information , instructions and recommendations on the transport of dangerous goods are specified in the ;
- a) AIP (Aeronautical Information Publication).
 - b) air operator certificate.
 - c) flight manual.
 - d) operations manual.

Answer ;

- d) operations manual.
-

0447. The general information , instructions and recommendations on the transport of hazardous materials are specified in the ;
- a) air carrier certificate.
 - b) AIP (Aeronautical Information Publication).
 - c) operations manual.
 - d) flight manual.

Answer ;

- c) operations manual.
-

0448. The greatest wake turbulence occurs when the generating aircraft is ;
- a) Large , heavy , at low speed in clean configuration.
 - b) Small , light , at maximum speed in full flaps configuration.
 - c) Large , heavy , at maximum speed in full flaps configuration.
 - d) Small , light , at low speed in clean configuration.

Answer ;

- a) Large , heavy , at low speed in clean configuration.
-

0449. The highest risk of bird strikes occurs ;
- a) between 500 and 1000 m.
 - b) between 500 and 1500 m.
 - c) above 1000 m.
 - d) under 500 m.

Answer ;

- d) under 500 m.
-

0450. The holdover time of an anti-icing procedure , for a given ambient temperature , will be longest in weather conditions of ;
- a) frost.
 - b) steady snow.
 - c) freezing fog.
 - d) rain on a cold soaked wing.

Answer ;


- a) frost.
-

0451. The ICAO Annex dealing with the safe transport of dangerous goods by air is ;
- a) Annex 8.
 - b) Annex 1.
 - c) Annex 17.
 - d) Annex 18.

Answer ;

- d) Annex 18.
-

0452. (For this question use annex 071-2084A)

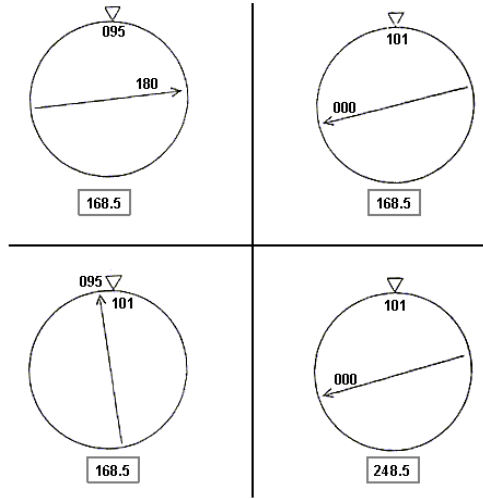

Annex 071-2084A

The inertial navigation system (INS) indicates ; Position : 71° 55.1'N 094°55.3'W , Drift : 6°L (left).

The route followed in order to return to the VOR station used ; RESOLUTE BAY (74°43.6'N 094°55.3'W), this VOR has North set on the local geographic meridian. The gyro compass has just been reset to Grid North (chart used : polar stereographic chart , grid parallel to zero meridian , Grid North in the direction of geographic North Pole). The correct representation of the RMI VOR/DME is at this moment ; (the distance DME is in the box)

- a) 3
- b) 2
- c) 1
- d) 4


Answer ;

b) 2

Uçak RESOLUTE BAY VOR'ına doğru uçmaktadır. Bu VOR'ın Kuzey'i lokal meridyene göre oryante edilmiştir , ki bu 094°55.3'W meridyeni yani hemen hemen 095°W meridyenidir. Halihazırda uçak ile VOR Kuzey Kutbu ile aynı hizadadır. Kullanılan harita Greenwich meridyeni datum alınmış Polar Stereografik haritadır ve uçağın cayro pusulası Grid heading'i göstermek üzere resetlenmiştir. Şeklin altında yer alan kutucuk DME mesafesini gösterdiğine göre öncelikle mesafe hesaplanmalıdır.
 $74^{\circ}43.6' - 71^{\circ}55.1' = 02^{\circ}48.5' \rightarrow (2 \times 60) + 48.5 = 168.5 \text{ NM}$

Uçağın halihazırdaki rotası diagramdan da görüleceği üzere 360°T ve Grid rota olarak 095°G'dir. Uçağın INS'i 6°L Drift gösterdiğine göre rüzgar sağdan gelmektedir ve uçak VOR'a doğru olan rotasını muhafaza etmek için 6° sağa baş değişikliği yapmış olmalıdır. Buna göre ;

Grid Heading = Grid track + Drift L
 Grid Heading = 095° + 6° = 101°G olarak bulunur.

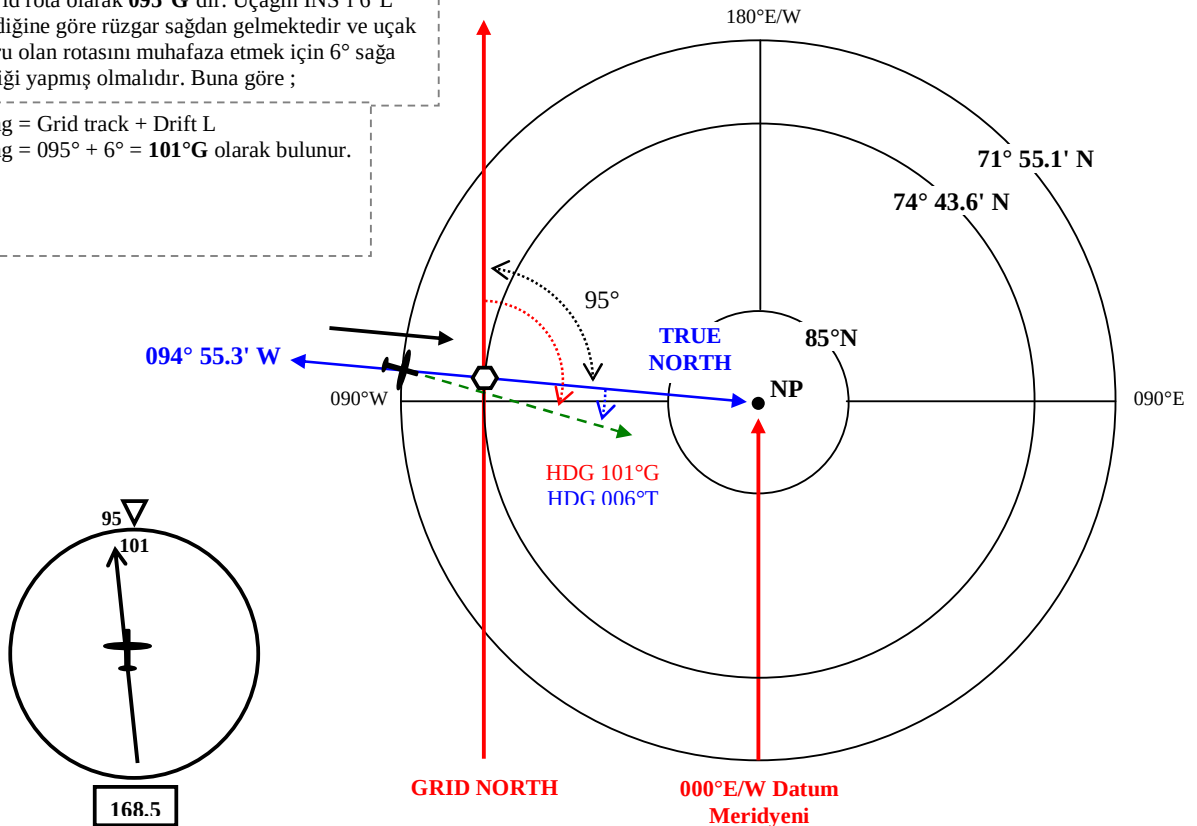

0453. The ICAO procedure designed to collect and disseminate information on bird strikes to aircraft is called ;
- IBSR (ICAO Bird Strike Report).
 - IBHA (ICAO Bird Hazard Annex).
 - IBIS (ICAO Bird Strike Information System).
 - IBSA (ICAO Bird Safet Alert).

Answer ;

c) IBIS (ICAO Bird Strike Information System).

0454. The information concerning dangerous goods that passengers may carry , are listed in the ;

- aircraft's flight manual.
- JAR-OPS documentation.
- IATA document "Dangerous products transportation".
- ICAO document titled "Technical safety instructions for the air transportation of dangerous products".

Answer ;

d) ICAO document titled "Technical safety instructions for the air transportation of dangerous products".

0455. The information to consider for a non precision straight in approach is ;

- RVR/Visibility.
- the ceiling.
- the minimum descent altitude/height (MDA/H).
- the decision altitude/height (DA/H).

Which of the following combinations contains all of the correct statements ?

- 1 , 3.
- 1 , 2 , 3.
- 1 , 4.
- 1 , 2 , 4.

Answer ;

a) 1 , 3.

0456. The main cause of wake turbulence is the result of ;

- An aerodynamic effect (wing tip vortices).
- The engines power setting.
- The position of the high lift devices (of the flaps , etc.).

The combination regrouping all the correct statements is ;

- 1 , 2 and 3.
- 2 and 3.
- 3.
- 1.

Answer ;

d) 1.

0457. The Master Minimum Equipment List (MMEL) defines the equipment which can be inoperative when undertaking a flight and the conditions under which this allowance can be accepted. This MMEL is drawn up by ;

- the manufacturer and approved by the certification authority.
- the operator and approved by the certification authority.
- the operator from a main list drawn up by the manufacturer.
- the operations manual.

Answer ;

a) the manufacturer and approved by the certification authority.

0458. The master minimum equipment list (MMEL) if this exists is established by ;

- the manufacturer of the aircraft , but need not to be accepted by the authority.
- the operator of the aircraft , and accepted by the manufacturer.
- the operator of the aircraft , and accepted by the authority.
- the manufacturer of the aircraft , and accepted by the authority.

Answer ;

d) the manufacturer of the aircraft , and accepted by the authority.

0459. The maximum validity of a SNOWTAM is ;

- 24 hours.
- 6 hours.
- 12 hours.
- 3 hours.

Answer ;

a) 24 hours.

0460. The MEL (Minimum Equipment List) is produced by ;

- a) the state of the operator.
- b) the operator.
- c) the manufacturer.
- d) the aircraft state of registry.

Answer ;

b) the operator.

0461. The Minimum Equipment List (MEL) defines the equipment which can be inoperative when undertaking a flight and the additional procedures under which this allowance can be accepted . The Mel is drawn up by ;

- a) the operator and may be more restrictive than the Master Minimum Equipment List (MMEL).
- b) the operator and may be less restrictive than the Master Minimum equipment List (MMEL).
- c) the manufacturer and may be less restrictive than the Master Minimum equipment List (MMEL).
- d) the manufacturer and may be more restrictive than the Master Minimum Equipment List (MMEL).

Answer ;

a) the operator and may be more restrictive than the Master Minimum Equipment List (MMEL).

0462. The minimum equipment list (MEL) gives the equipment which can be inoperative when undertaking a flight and the additional procedures to be observed accordingly. This list is prepared by ;

- a) the operator , and it is inserted in the operations manual
- b) the operator , and it is appended to the flight manual
- c) the manufacturer , and it is inserted in the operations manual
- d) the manufacturer , and it is appended to the flight manual

Answer ;

a) the operator , and it is inserted in the operations manual

0463. The Minimum Equipment List (MEL) is established by ;

- a) the manufacturer and approved by the authority.
- b) the airline operator and approved by the authority.
- c) the aeronautical authority the airline operator depends on.
- d) the Civil Aviation Authority of the European states.

Answer ;

b) the airline operator and approved by the authority.

0464. The minimum equipment list of a public transport aircraft is to be found in the ;

- a) flight manual.
- b) operations manual.
- c) flight record.
- d) JAR OPS.

Answer ;

b) operations manual.

0465. The minimum lateral separation in the NAT region is ;

- a) 60 NM between all aircraft operating below MNPS airspace.
- b) 90 NM between all aircraft flying in the NAT region.
- c) 60 NM between aircraft meeting minimum navigation performance specifications.
- d) 90 NM between aircraft flying above FL285.

Answer ;

c) 60 NM between aircraft meeting minimum navigation performance specifications.

0466. The minimum lateral separation to be maintained between aircraft flying in MNPS airspace is ;

- a) 30 NM.
- b) 120 NM.
- c) 60 NM.
- d) 90 NM.

Answer ;

c) 60 NM.

0467. The minimum longitudinal separation of two aircraft flying in MNPS airspace at the same Flight Level , on the same track and with the same Mach number is ;

- a) 15 minutes.
- b) 20 minutes.
- c) 5 minutes.
- d) 10 minutes.

Answer ;

d) 10 minutes.

0468. The minimum navigation equipment required for an aircraft flying without restriction in MNPS airspace can be at the very least ;

- a) three inertial navigation systems.
- b) one Global Navigation Satellite System.
- c) one inertial navigation system.
- d) two inertial navigation systems.

Answer ;

d) two inertial navigation systems.

0469. The minimum number of hand fire-extinguishers to be located in the passenger compartment of an aircraft with a maximum approved passenger seating configuration of 31 is ;

- a) 3.
- b) 1.
- c) 2.
- d) 0.

Answer ;

c) 2.

0470. The minimum requirements for Supplemental Oxygen to be supplied in pressurised aeroplanes during and following an emergency descent are that for pilots it shall be available for the entire flight time that the cabin pressure altitude exceeds a minimum of ;

- a) 15000 ft.
- b) 25000 ft.
- c) 13000 ft.
- d) 14000 ft.

Answer ;

c) 13000 ft.

0471. The minimum requirements for Supplemental Oxygen to be supplied in pressurised aeroplanes during and following an emergency descent are that for pilots it shall be available for the entire flight time that the cabin pressure altitude exceeds a minimum of X feet. That minimum of X feet is ;

- a) 13000 ft.
- b) 15000 ft.
- c) 25000 ft.
- d) 14000 ft.

Answer ;

a) 13000 ft

0472. The minimum visibility required by JAR OPS 1 and 3 to commence a special VFR flight is ;

- a) 5 km.
- b) 2.5 km.
- c) 3 km.
- d) 1.5 km.

Answer ;

c) 3 km.


0473. The MNPS (Minimum Navigation Performance Specification) airspace extends from ;

- a) 27° North to 70° North.
- b) 27° North to 90° North.
- c) 30° North to 70° North.
- d) 30° North to 90° North.

Answer ;

b) 27° North to 90° North.

Açıklama ;

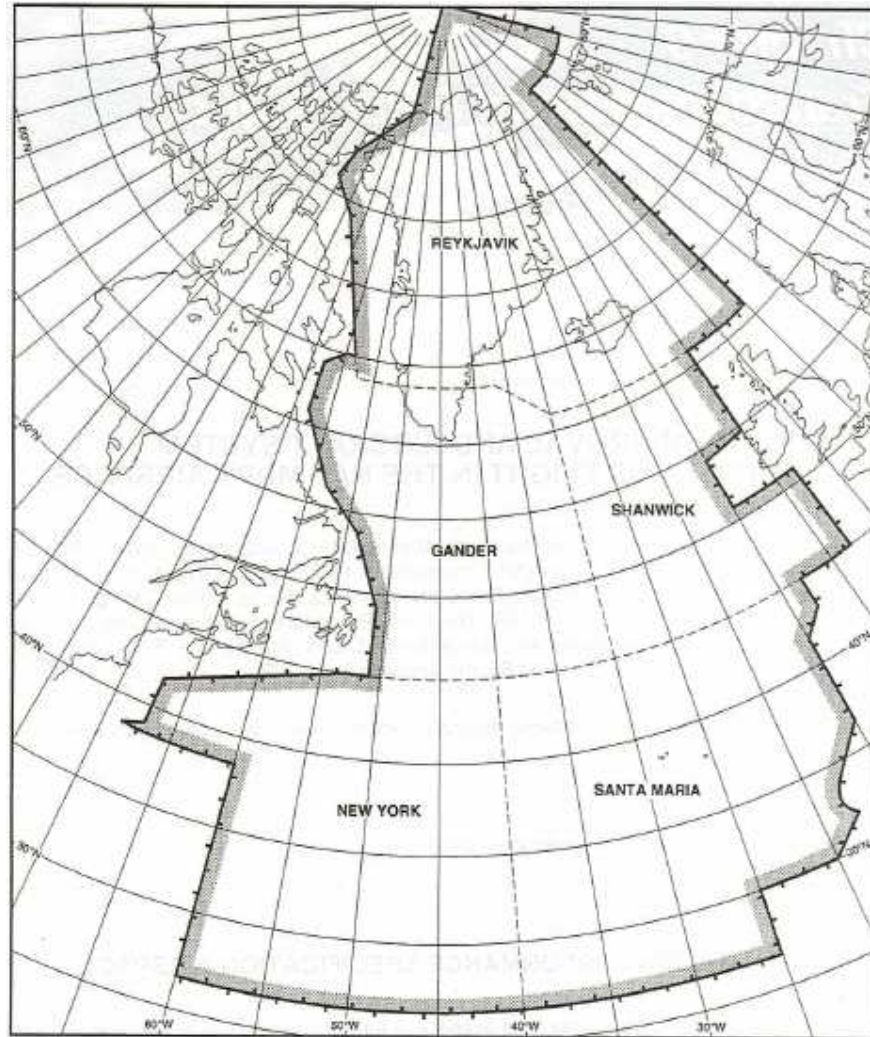

MNPS AIRSPACE

0474. The MNPS (Minimum Navigation Performance Specification) airspace extends vertically between flight levels ;

- a) 285 and 420.
- b) 275 and 400.
- c) 280 and 400.
- d) 280 and 390.

Answer ;

a) 285 and 420.

0475. The North Atlantic airspace is regulated , among other , according to ;

- a) rules common to the bordering States , grouped in document 7050 (North Atlantic Ocean Airspace).
- b) Canadian rules , because this country has the greatest surface area of territorial waters in this airspace.
- c) the ICAO document 7030 (additional regional procedures).
- d) rules issued by the bordering States (Document 6530).

Answer ;

c) the ICAO document 7030 (additional regional procedures).

0476. The number of crash axes or crowbars on board an aeroplane , whose maximum approved configuration of passenger seats is 201 , is ;

- a) 4.
- b) 2.
- c) 3.
- d) 1.

Answer ;

b) 2.

0477. The number of hand fire extinguishers which have to be installed in the passenger cabin according to JAR-OPS depends on the approved number of ;

- a) seat rows in the cabin.
- b) seats in the cabin.
- c) emergency exits in the cabin.
- d) passengers in the cabin.

Answer ;

b) seats in the cabin.

0478. The number of spare fuses available for use in flight must be ;

- a) 20% of the number of fuses of each rating with a minimum of 2.
- b) 10% of the number of fuses of each rating with a minimum of 1.
- c) 5% of the number fuses of each rating with a minimum of 1.
- d) 10% of the number of fuses of each rating with a minimum of 3.

Answer ;

d) 10% of the number of fuses of each rating with a minimum of 3.

0479. The operations requirements in regard to the supply of oxygen , for a pressurized aeroplane intended to be operated at FL 260 , 150 passengers on board are . As concerns the regulatory requirements about oxygen ;

- 1. each crew member will have available a quick donning type of mask.
- 2. the aircraft will be equipped with a warning system indicating that the cabin altitude is higher than 13 000 ft.
- 3. the quantity of oxygen on board shall be sufficient for the supply of 100% of the occupants during the whole flight time at cabin pressure altitude above 15 000 ft (not less than 10 minutes).
- 4. the first aid quantity of oxygen shall be sufficient for the supply of two passengers during the whole flight time when the cabin altitude is greater than 8 000 feet.

The combination regrouping all the correct statements is ;

- a) 1 , 3.
- b) 1 , 2 , 3 , 4.
- c) 3 , 4.
- d) 2 , 3.

Answer ;

a) 1 , 3.

0480. The operator must ensure that the information contained in the aircraft technical log is stored for a minimum period of ;

- a) 3 months.
- b) 24 months.
- c) 15 months.
- d) 12 months.

Answer ;

b) 24 months

0481. The operator must ensure that the mass and balance documentation of a flight is stored for a minimum period of ;

- a) 6 months.
- b) 1 year.
- c) 1 month.
- d) 3 months.

Answer ;

d) 3 months.

- 0482.** The operator shall include in the operations manual a minimum equipment list which shall be approved by the authority of ;
- a) The country where the aircraft was manufactured.
 - b) None , no approval is required.
 - c) The country where the aircraft is operated.
 - d) The country of the operator.

Answer ;

d) The country of the operator.

- 0483.** The permanent approval for the transport of dangerous goods is specified in the ;
- a) certificate of aircraft registration.
 - b) insurance certificate.
 - c) air operator certificate.
 - d) airworthiness certificate.

Answer ;

c) air operator certificate.

a) 240°
b) 060°
c) 340°
d) 110°

a) 240°

[illegible]

Convergency West = True Track Best
Convergency East = True Track Least

Sonuç olarak ;
Grid track = True track + Convergency
Grid track = $110^{\circ} + 130^{\circ}$
Grid track = 240°G olarak bulunur.

- 0485.** The protection time of an anti-icing fluid depends on ;
1. the type and intensity of the showers.
 2. the ambient temperature.
 3. the relative humidity.
 4. the direction and speed of the wind.
 5. the temperature of the aircraft skin.
 6. the type of fluid , its concentration and temperature.

The combination regrouping all the correct statements is ;

- a) 2 , 3 , 4 , 5.
- b) 1 , 2 , 4 , 6.
- c) 1 , 2 , 3 , 4 , 5 , 6.
- d) 1 , 3 , 5 , 6

Answer ;

- c)** 1 , 2 , 3 , 4 , 5 , 6.
-

- 0486.** The public address system must be audible and intelligible at ;

1. all passenger seats.
2. toilets.
3. cabin crew seats.
4. work stations.

The combination regrouping all the correct statements is ;

- a) 1.
- b) 1 , 2 , 3.
- c) 1 , 2.
- d) 1 , 2 , 3 , 4.

Answer ;

- d)** 1 , 2 , 3 , 4.
-

- 0487.** The purpose of the first aid oxygen is to ;

- a) provide the cabin attendants with respiratory protection.
- b) supply all the passengers in case of depressurization.
- c) provide undiluted oxygen to passengers for physiological reasons following a cabin depressurisation.
- d) provide the flight crew with respiratory assistance after depressurization.

Answer ;

- c)** provide undiluted oxygen to passengers for physiological reasons following a cabin depressurisation.
-

- 0488.** The recent experience conditions of a commander assigned to a flight on an aircraft by an operator must not be less than ;

- a) 6 take-offs and 6 landings as pilot flying on the same type of aircraft or approved simulator.
- b) 3 take-offs and 3 landings on this type of aircraft during the last 6 months.
- c) 6 take-offs and 6 landings during the last 6 months.
- d) 3 take-offs and 3 landings as pilot flying on the same type of aircraft or approved simulator in the preceding 90 days.

Answer ;

- d)** 3 take-offs and 3 landings as pilot flying on the same type of aircraft or approved simulator in the preceding 90 days.
-

- 0489.** The reference document you shall use when a piece of equipment on your aeroplane fails during taxi is ;

- a) the Operations Manual under the heading "MEL".
- b) the JAR OPS 1.
- c) the MMEL.
- d) the Operations Manual under the heading "Abnormal and Emergency Procedures".

Answer ;

- d)** the Operations Manual under the heading "Abnormal and Emergency Procedures".
-

- 0490.** The regulations for transportation of dangerous goods are contained in ;

- a) ICAO Appendix 8.
- b) ICAO Annex 18.
- c) ICAO Annex 17.
- d) the Washington Convention.

Answer ;


- b)** ICAO Annex 18.
-

0491. The regulatory green navigation light is located on the starboard side with a coverage angle of ;
- a) 110°.
 - b) 220°.
 - c) 70°.
 - d) 140°.

Answer ;

a) 110°.

Açıklama ;

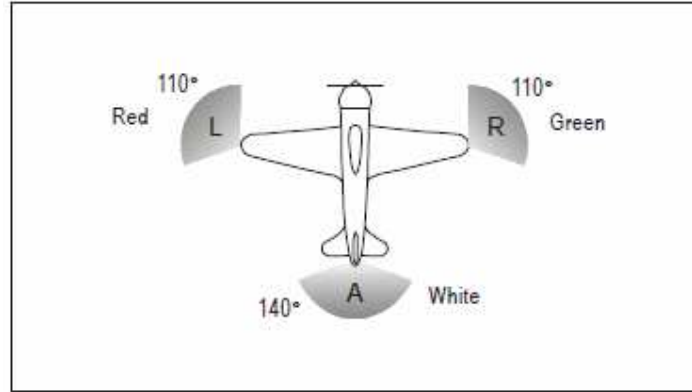

0492. The responsibility to provide flight operations personnel with the relevant parts of the operations manual and to ensure the issue of the amendments rests with ;

- a) Aircraft producer.
- b) Owner of the aircraft.
- c) The national authority.
- d) Aircraft operator.

Answer ;

d) Aircraft operator.

0493. The risk of dynamic hydroplaning depends primarily on the ;

- a) depth of the standing water on the runway.
- b) aircraft's weight.
- c) strength of the headwind.
- d) amount of the lift off speed.

Answer ;

a) depth of the standing water on the runway.

0494. The safety precautions to be taken when using 100% medical oxygen are ;

1. refrain from smoking.
2. avoid sparks.
3. avoid operation of radio communication equipment.
4. operate oxygen system shut off valves slowly.

The combination regrouping all the correct statements is ;

- a) 1 , 2 , 3.
- b) 1 , 2 , 4.
- c) 2 , 3 , 4.
- d) 1 , 3 , 4.

Answer ;

b) 1 , 2 , 4.

0495. The system which must be switched off in case of a belly compartment fire is generally the ;

- a) pressurization.
- b) trim air.
- c) ventilation of the cargo compartment.
- d) total air-conditioning.

Answer ;

c) ventilation of the cargo compartment.

0496. The term decision height (DH) is used for ;

- a) a circling approach only.
- b) a non precision approach.
- c) a precision approach.
- d) an indirect approach.

Answer ;

c) a precision approach.

0497. The time needed for the dissipation of a turbulent wake created by a wide-body aircraft during take-off is about ;

- a) 30 seconds.
- b) 3 minutes.
- c) 10 minutes.
- d) 1 minute.

Answer ;

b) 3 minutes.

0498. The time of useful consciousness in case of an explosive decompression at an altitude of 40 000 ft is ;

- a) 1 minute.
- b) 12 seconds.
- c) 5 minutes.
- d) 30 seconds.

Answer ;

b) 12 seconds.

0499. The tip vortices circulate about each wing tip ;

- a) counter clockwise.
- b) from the underwing toward the upper side of the wing.
- c) clockwise.
- d) from the upper side of the wing toward the underwing.

Answer ;

b) from the underwing toward the upper side of the wing.

0500. The touch down areas located at both ends of the runways are typical for the appearance of ;

- a) rubber reversion hydroplaning.
- b) viscous hydroplaning.
- c) rubber steaming hydroplaning.
- d) dynamic hydroplaning.

Answer ;

b) viscous hydroplaning.

0501. The type of hydroplaning that is most likely to occur at the touch down area located at both ends of the runway is called ;

- a) rubber reversion.
- b) viscous.
- c) dynamic.
- d) rubber steaming.

Answer ;

b) viscous.

0502. The tyre pressure of an aeroplane main landing gear is 10.8 bars. There is a risk of hydroplaning as soon as the speed reaches ;

- a) 87 kt
- b) 56 kt
- c) 145 kt
- d) 113 kt

Answer ;

d) 113 kt

Çözüm ;

$$V = 9\sqrt{P}$$

1 bar = 14.5 psi olduğuna göre ; 10.8 bar = 10.8 x 14.5 = 156.6 psi

$$V = 9 \times \sqrt{156.6} = 9 \times 12.51 = 112.59 \approx 113 \text{ kt}$$

NOT : Bu soru ile ilgili detaylı açıklama soru 0239'da yer almaktadır.

0503. The validity period of a day-time organised track system in MNPS (Minimum Navigation Performance Specification) airspace is normally , at 30°W , between ;

- a) 00H00 UTC to 08H00 UTC.
- b) 01H00 UTC to 08H00 UTC.
- c) 10H30 UTC to 19H00 UTC.
- d) 11H30 UTC to 19H00 UTC.

Answer ;

d) 11H30 UTC to 19H00 UTC.

Açıklama ;

NAT DÜZENLENMİŞ YOL SİSTEMİ (NAT OTS)

Düzenlenmiş yollar, subsonic trafik için formüle edilerek basılmıştır. Gündüz operasyonları (30°W'de 11:30 Z'dan 19:00 Z'ya kadar) için basımı Shanwick , gece operasyonları (30°W'de 01:00 Z'dan 08:00 Z'ya kadar) için basımı Gender tarafından yapılır. İşleticiler , buralardan teferruatlı bilgileri (Preferred Route Message-PRM) alabilirler. Gündüz düzenlenmiş yol sisteminin (OTS) en kuzeydeki yolu NAT Alfa yolu , bitişiği NAT Bravo yolu vs. olarak dizayn edilmiştir. Gece için en güneyden itibaren NAT Zulu Yolu , ondan sonra gelen NAT Yankee Yolu vs. olarak dizayn edilmiştir. Uçuş seviyeleri optimum kullanım için tahsis edilmiştir. MPNS düzenlenmiş yol sistem tarifi;

1. Doğu / Batı uçuşu ;

a) 70°N enleminin güneyi ;

Greenwich meridyenden 70°W enlemine kadar 10°lik aralıklarda belirli noktalarla boylamlara paralel planlı yollar tarif edilmiştir.


b) 70°N enleminin kuzeyi ;

Greenwich meridyenden 60°W enlemine kadar 20°lik aralıklarda belirli noktalarla boylamlara paralel planlı yollar tarif edilmiştir.

2. Kuzey / Güney uçuşu ;

Kuzey/güney uçuşları için planlı yollar , belirli noktalarla enlemlere paralel her 5°de formlandırılmıştır. Birbirini takip eden pozisyon raporları arasındaki maksimum zaman 60 dakikadan fazla değildir. Şayet iki pozisyon raporu arasındaki mesafe 30 dakikadan az ise rapor verilmeyebilir.

Aşağıda gündüz saatlerinde , batı yönlü uçuşlar için kullanılan OTS rotaları için bir örnek yer almaktadır.

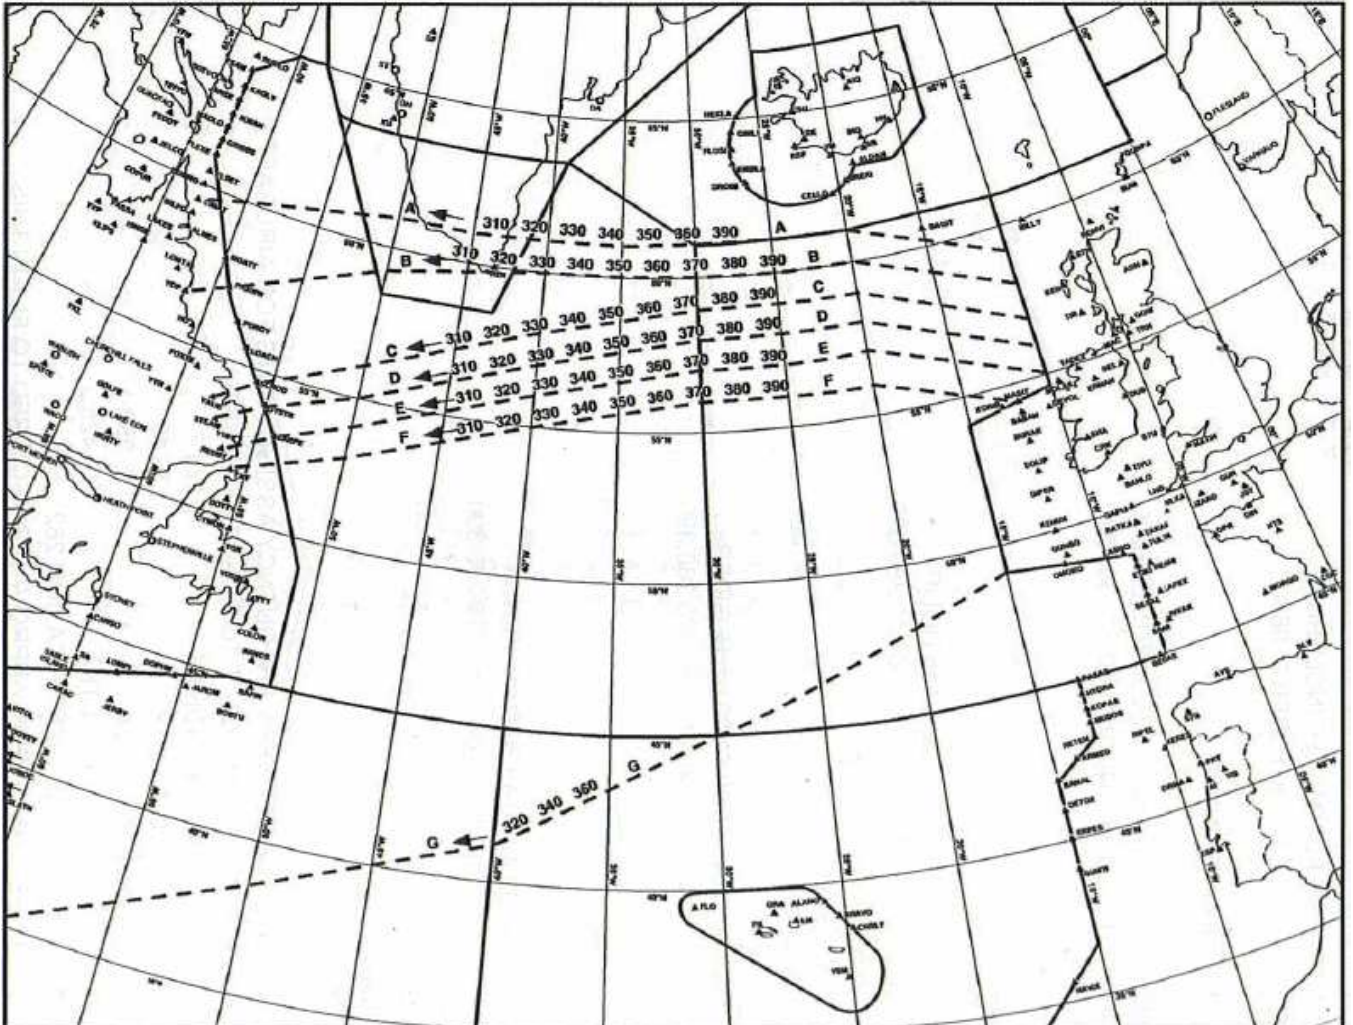

0504. The validity period of a night-time organised track system in MNPS (Minimum Navigation Performance Specification) airspace is normally at 30°W , between ;

- a) 01H00 UTC to 08H00 UTC.
- b) 10H30 UTC to 19H00 UTC.
- c) 00H00 UTC to 08H00 UTC.
- d) 11H30 UTC to 18H00 UTC.

Answer ;

- a) 01H00 UTC to 08H00 UTC.

Açıklama ;

NAT DÜZENLENMİŞ YOL SİSTEMİ (NAT OTS)

Düzenlenmiş yollar, subsonic trafik için formüle edilerek basılmıştır. Gündüz operasyonları (30°W'de 11:30 Z'dan 19:00 Z'ya kadar) için basımı Shanwick , gece operasyonları (30°W'de 01:00 Z'dan 08:00 Z'ya kadar) için basımı Gender tarafından yapılır. İşleticiler , buralardan teferruatlı bilgileri (Preferred Route Message-PRM) alabilirler. Gündüz düzenlenmiş yol sisteminin (OTS) en kuzeydeki yolu NAT Alfa yolu , bitişiği NAT Bravo yolu vs. olarak dizayn edilmiştir. Gece için en güneyden itibaren NAT Zulu Yolu , ondan sonra gelen NAT Yankee Yolu vs. olarak dizayn edilmiştir. Uçuş seviyeleri optimum kullanım için tahsis edilmiştir. MPNS düzenlenmiş yol sistem tarifi;

1. Doğu / Batı uçuşu ;

a) 70°N enleminin güneyi ;

Greenwich meridyenden 70°W enlemine kadar 10°lik aralıklarda belirli noktalarla boylamlara paralel planlı yollar tarif edilmiştir.


b) 70°N enleminin kuzeyi ;

Greenwich meridyenden 60°W enlemine kadar 20°lik aralıklarda belirli noktalarla boylamlara paralel planlı yollar tarif edilmiştir.

2. Kuzey / Güney uçuşu ;

Kuzey/güney uçuşları için planlı yollar , belirli noktalarla enlemlere paralel her 5°de formlandırılmıştır. Birbirini takip eden pozisyon raporları arasındaki maksimum zaman 60 dakikadan fazla değildir. Şayet iki pozisyon raporu arasındaki mesafe 30 dakikadan az ise rapor verilmeyebilir.

Aşağıda gece saatlerinde , doğu yönlü uçuşlar için kullanılan OTS rotaları için bir örnek yer almaktadır.

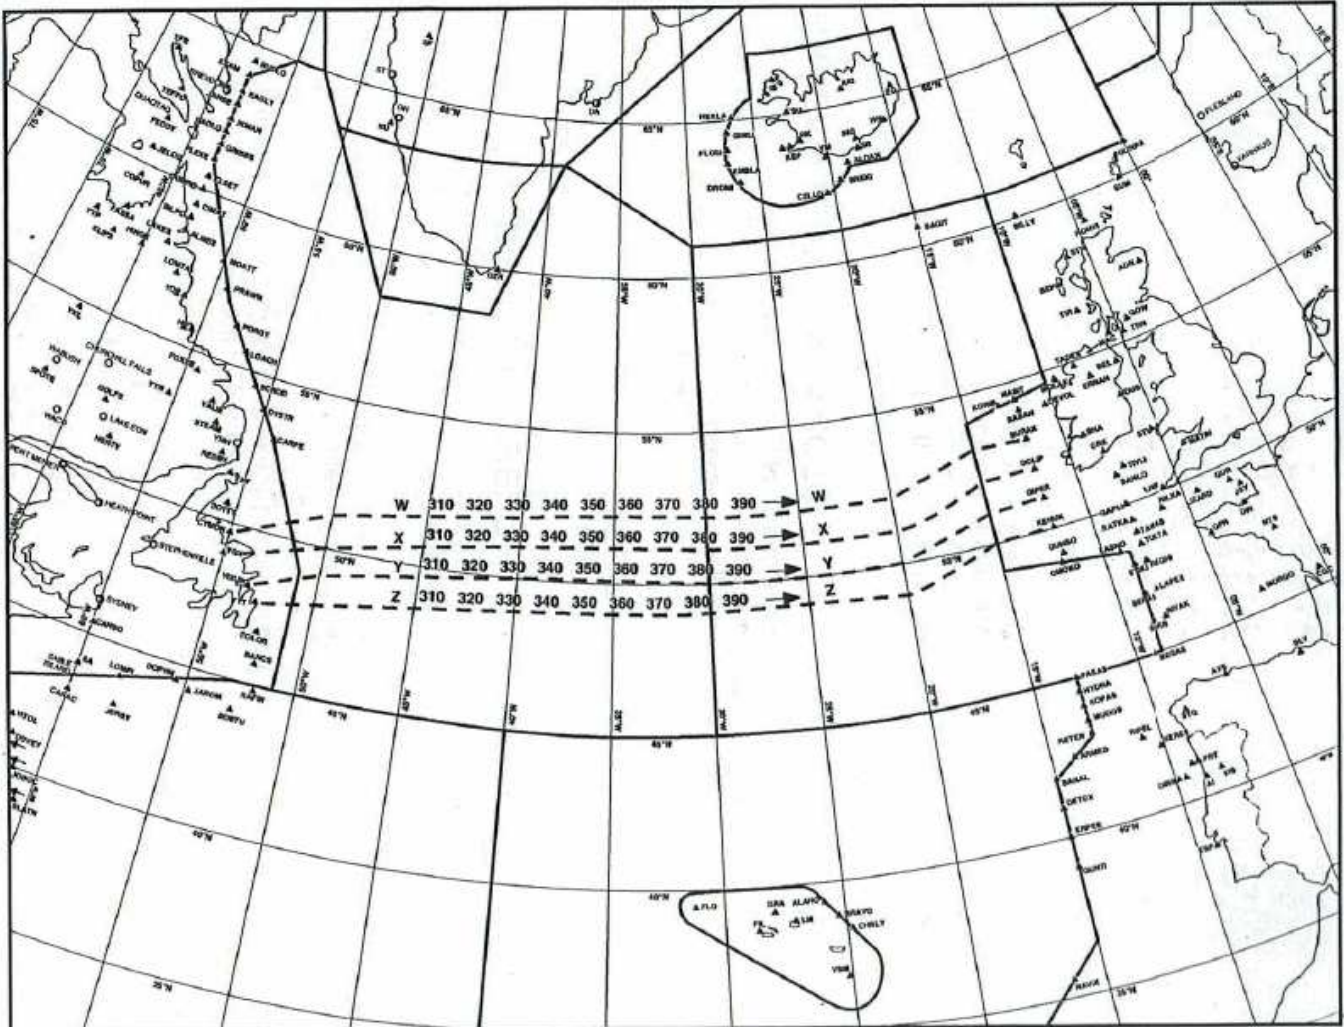

0505. The wake turbulence ;
- starts when pulling out the drag devices and stops when retracting the drag devices.
 - starts during rotation and stops as soon as the aeroplane's wheel touch the ground.
 - starts as soon as the aeroplane is running for take-off and stops as soon as it has come to a stop at landing.
 - starts when the aeroplane reaches a height of 300 ft above the ground and stops when it crosses this height before landing.

Answer ;

- b)** starts during rotation and stops as soon as the aeroplane's wheel touch the ground.
-

0506. The wake turbulence ;
- starts at rotation and stops as soon as the aeroplane's wheels touch the ground.
 - starts when pulling out the drag devices and stops when retracting the drag devices.
 - starts when the aeroplane reaches a height of 35 ft above the ground and stops when it crosses this height before landing.
 - starts as soon as the aeroplane commences rolling and stops as soon as it has come to a stop at landing.

Answer ;

- a)** starts at rotation and stops as soon as the aeroplane's wheels touch the ground.
-

0507. The wake turbulence caused by an aircraft is mainly the result of ;
- An aerodynamic effect (wing tip vortices).
 - The engines action (propellers rotation or engine gas exhausts).
 - The importance of the drag devices (size of the landing gear , of the flaps, etc.).

The combination regrouping all the correct statements is ;

- 1.
- 3.
- 1 , 2 and 3.
- 2 and 3.

Answer ;

- a)** 1.
-

0508. The wake turbulence is the most severe when the aircraft is ;

- slow.
- heavy.
- in a clean configuration.
- flying with a high thrust.

The combination of correct statement is ;

- 1 , 4.
- 2 , 3 , 4.
- 1 , 2 , 3.
- 1 , 2 , 3 , 4.

Answer ;

- c)** 1 , 2 , 3.
-

0509. The wake turbulence is the most severe when the generating aeroplane is ;

- flying slowly.
- heavy.
- in a clean configuration.
- flying with high thrust.

The combination regrouping all of the correct statements is ;

- 2 , 3 , 4.
- 1 , 4.
- 1 , 2 , 3.
- 1 , 2 , 3 , 4.

Answer ;

- c)** 1 , 2 , 3.
-


0510. Tip vortices which are responsible for wake turbulence appear as soon as the following is established ;

- lift.
- drag.
- lift destruction.
- spin up.

Answer ;

- a)** lift.
-

0511. (For this question use annex 071-2083A)

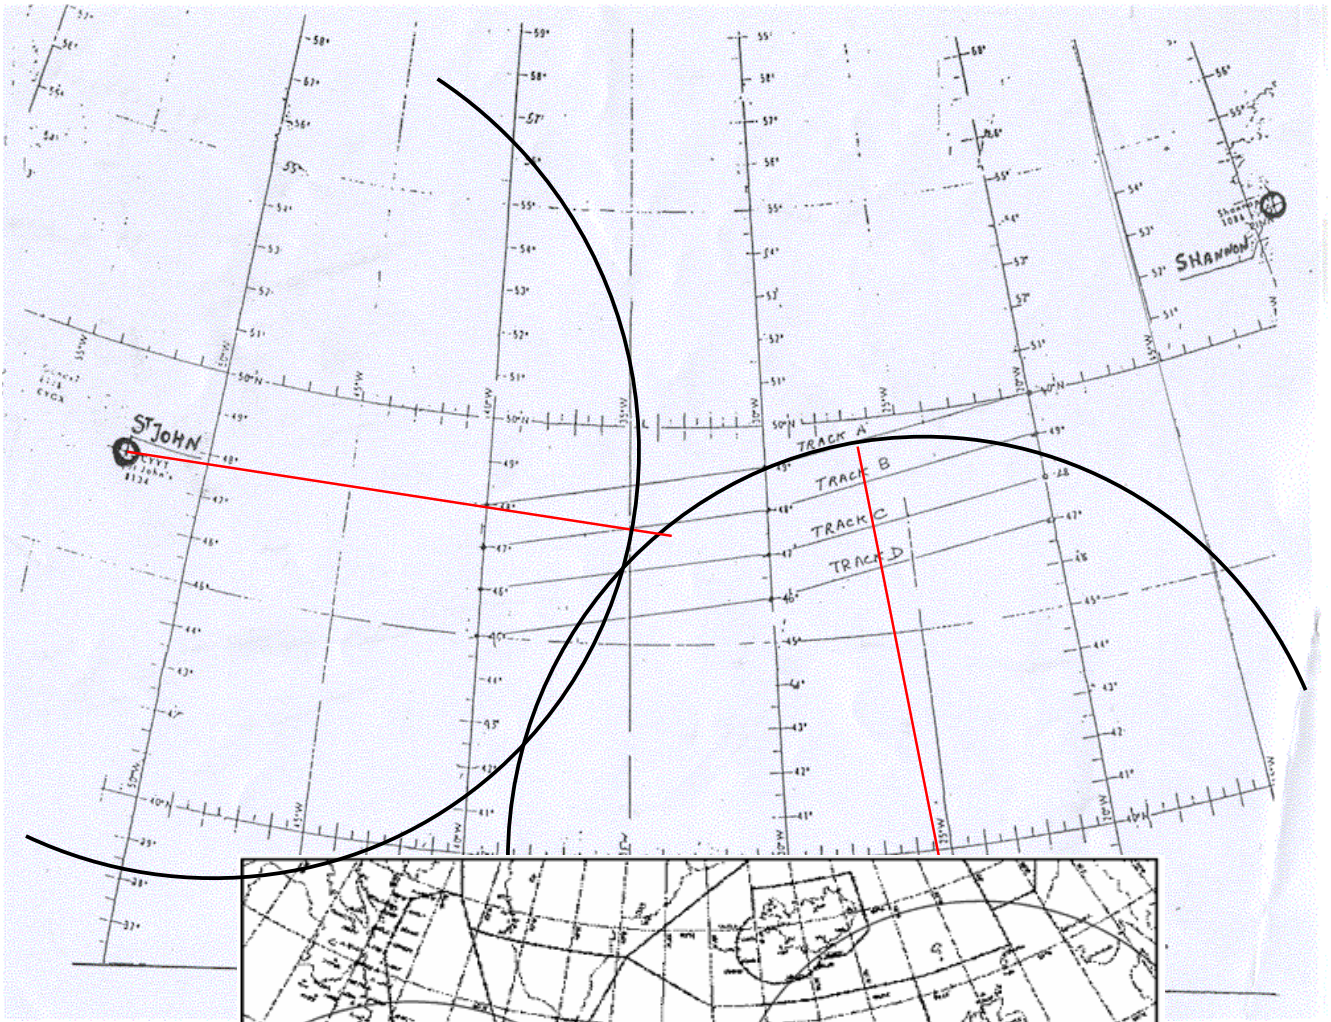

To comply with
air speed of 420 kt to rea
Navigation Performance
aerodromes taken into ac
WASHINGTON will be

- a)
- b)
- c)
- d)

Answer ;

a) Track C

Açıklama ;

MNPS hava sah
motoru çalışır h
havasahasında t
bunlar ; Shanno
rotalarından har
Ekte verilen har
Maria için belir

1 saat 45 dakikalık uçuş süresinden daha fazla bir mesafede olacaktır ve aynı durum B rotası için de geçerlidir. Diğer rotalara bakıldığında ise uçak tek motora düşmesi durumunda rota boyunca bu 3 yedek meydana herhangi birine ulaşabilecek durumda olacaktır. Bu iki rotadan 8 saat 15 dakikalık süre ile daha kısa olan C rotasının seçilmesi uygun olacaktır.

on 1 engine at an
/inimum
three alternate
ween PARIS and

larında tek
ı arasında MNPS
ydandır ,
n A , B , C ve D

erinde Santa
eydanlarına

PARIS TO WASHINGTON VIA NAT A 8 HRS 3 MIN
NAT B 8 HRS 10 MIN
NAT C 8 HRS 15 MIN
NAT D 8 HRS 20 MIN

Image 1

0512. To avoid wake turbulence , when departing behind a larger aircraft , the pilot should manoeuvre ;

- a) below and upwind from the larger aircraft.
- b) above and upwind from the larger aircraft.
- c) below and downwind from the larger aircraft.
- d) above and downwind from the larger aircraft.

Answer ;

- b)** above and upwind from the larger aircraft.
-

0513. To avoid wake turbulence , when flying behind and close to a large aeroplane , the pilot should manoeuvre whenever possible ;

- a) above and upwind from the large aeroplane.
- b) below and upwind from the large aeroplane.
- c) above and downwind from the large aeroplane.
- d) below and downwind from the large aeroplane.

Answer ;

- a)** above and upwind from the large aeroplane.
-

0514. To conduct a special VFR flight , the minimum visibility required by JAR-OPS 1 is ;

- a) 2500 meters.
- b) 1500 meters.
- c) 5000 meters.
- d) 3000 meters.

Answer ;

- d)** 3000 meters.
-

0515. To establish the aerodrome operating minima which will apply to any particular operation , an operator must take full account of ;

- 1. equipment available for navigation.
- 2. dimensions and characteristics of the runways.
- 3. composition of the flight crew.
- 4. obstacles in the approach and missed approach areas.
- 5. means to determine and report the meteorological conditions.

The combination regrouping all the correct statements is ;

- a) 1 , 2 , 4 , 5.
- b) 1 , 2 , 3 , 4 , 5.
- c) 2 , 4 , 5.
- d) 2 , 3 , 5.

Answer ;

- b)** 1 , 2 , 3 , 4 , 5.
-

0516. To extinguish a fire in the cockpit , you use ;

- 1. a water fire-extinguisher.
- 2. a powder or chemical fire-extinguisher.
- 3. a halon fire-extinguisher.
- 4. a CO₂ fire-extinguisher.

The combination regrouping all the correct statements is ;

- a) 3 , 4.
- b) 1 , 2.
- c) 2 , 3 , 4.
- d) 1 , 2 , 3 , 4.

Answer ;

- a)** 3 , 4.
-

0517. To fight a fire in an air-conditioned cargo hold ;

- a) you turn off the cargo hold ventilation and extinguish fire.
- b) Extinguish fire only.
- c) Extinguish fire and reduce air conditioning.
- d) Fire-fighting is not necessary, since the transport of combustible goods in an airconditioned cargo hold is forbidden.

Answer ;

- a)** you turn off the cargo hold ventilation and extinguish fire.
-

0518. To fight a fire in an air-conditioned class E cargo hold , the correct initial action is to ;
- a) discharge the fire extinguishers in the affected compartment.
 - b) evacuate the smoke.
 - c) shut off the ventilating airflow within the affected compartment.
 - d) confirm visually the fire.

Answer ;

- c) shut off the ventilating airflow within the affected compartment.
-

0519. To use passengers oxygen in case of severe cabin smoke is ;
- a) possible and recommended.
 - b) useless because breathing oxygen would explode under smoke conditions.
 - c) useless because the toxical cabin smoke is mixed with the breathing oxygen.
 - d) useless because the oxygen units do not operate under smoke conditions.

Answer ;

- c) useless because the toxical cabin smoke is mixed with the breathing oxygen.
-

0520. Under what circumstances may an operator introduce alternative procedures to those prescribed in JAR-OPS Subpart M (maintenance) ?

- a) When needed and when an equivalent safety case has been established. No prior approval is needed from the Authority.
- b) When needed and when an equivalent safety case has first been approved by the Authority and supported by JAA Member Authorities.
- c) When needed to expedite maintenance procedures.
- d) Never. Subpart M is mandatory and may not be modified.

Answer ;

- b) When needed and when an equivalent safety case has first been approved by the Authority and supported by JAA Member Authorities.
-

0521. Unless sufficient life-rafts to carry all persons on board are carried , on overwater flights , an operator shall not operate an aeroplane at a distance away from land , which is suitable for making an emergency landing , greater than that corresponding to(i)..... minutes at cruising speed or(ii)..... nautical miles , whichever is the lesser , for aeroplanes capable of continuing the flight to an aerodrome with the critical power unit(s) becoming inoperative at any point along the route or planned diversions.

- a) (i) 120 minutes , (ii) 400 nautical miles
- b) (i) 30 minutes , (ii) 100 nautical miles
- c) (i) 90 minutes , (ii) 300 nautical miles
- d) (i) 45 minutes , (ii) 200 nautical miles

Answer ;

- a) (i) 120 minutes , (ii) 400 nautical miles

Açıklama ;

Eğer bir uçak (30'dan fazla yolcu taşıma konfigürasyonuna sahip) suya mecburi iniş yapabilecek kabiliyette değilse , karadaki bir meydana ulaşmak için normal seyir sürati ile 120 dakikadan ya da 400 NM'dan (hangisi daha az ise) daha fazla süre su üzerinde uçmamalıdır.

0522. Viscous hydroplaning occurs primarily if the runway is covered with a thin film of water and ;
- a) the runway is very smooth and clean.
 - b) the tyre treads show minor cuts.
 - c) the runway is very smooth and dirty.
 - d) the runway has a rough surface.

Answer ;

- c) the runway is very smooth and dirty.
-

0523. Viscous hydroplaning occurs primary if the runway is covered with a thin film of water and ;
- a) the tyre treads are not in a good state.
 - b) is rough textured.
 - c) is very smooth and clean.
 - d) is very smooth and dirty.

Answer ;

- d) is very smooth and dirty.
-

0524. Wake turbulence category HEAVY refers to aircraft which have a maximum certificated take-off mass of ;

- a) 146.000 kg or more.
- b) between 136.000 kg and 186.000 kg.
- c) 186.000 kg or more.
- d) 136.000 kg or more.

Answer ;

d) 136.000 kg or more.

Açıklama ;

Wake Türbülans Kategorileri	
Kategori	Ağırlık
Light (L)	7.000 kg veya daha hafif
Medium (M)	7.000 – 136.000 kg
Heavy (H)	136.000 kg'dan fazla

0525. Wake turbulence risk is highest ;

- a) when a preceding aircraft has briefly applied take-off thrust just prior to take off.
- b) if , just before landing a much lighter aircraft has landed at the same runway with heavy crosswind.
- c) following a preceding aircraft at high speed.
- d) when a heavy aircraft has just performed a take-off at a closely situated parallel runway with a light crosswind.

Answer ;

d) when a heavy aircraft has just performed a take-off at a closely situated parallel runway with a light crosswind.

0526. Wake turbulence should be taken into account when ;

- a) during cruise the vertical separation is reduced to 1000 ft.
- b) when just before the landing a much lighter aeroplane has landed with a strong crosswind on a long runway.
- c) a preceding aeroplane has performed low altitude high roll rate rolling manoeuvres over the runway.
- d) a much heavier aeroplane has landed just previously on the same runway , a light crosswind condition exist and all high-lift devices are being used.

Answer ;

d) a much heavier aeroplane has landed just previously on the same runway , a light crosswind condition exist and all high-lift devices are being used.

0527. What is the transponder code to be used by the commander of an aircraft that is subject to unlawful interference (hijacked) ?

- a) A 7500
- b) A 7800
- c) A 7600
- d) A 7700

Answer ;

a) A 7500

0528. What transponder code should be used to provide recognition of an aircraft which is being subjected to unlawful interference ;

- a) code A 7500
- b) code A 7600
- c) code A 7700
- d) code A 2000

Answer ;

a) code A 7500

0529. When a commander of an aircraft notices , after take-off , a flock of birds presenting a bird strike hazard , he/she shall ;

- a) inform the appropriate ground station within a reasonable period of time.
- b) inform the other aircraft by radio.
- c) submit a written hazard bird strike report upon arrival and within at most 48 hours.
- d) immediately inform the local ground station/ATS unit.

Answer ;

d) immediately inform the local ground station/ATS unit.

0530. When a course is plotted at minimum time track , one passes from the air isochrone to the corresponding ground isochrone by applying to the air isochrone a vector which is equal to ;

- a) mean wind from the preceding ground isochrone.
- b) wind at K'.
- c) mean wind up to the next ground isochrone.
- d) wind at K.

Answer ;

- a) mean wind from the preceding ground isochrone.
-

0531. When a LIGHT aircraft is landing behind a MEDIUM aircraft , the wake turbulence non-radar minimum time approach separation , according with DOC 4444 (ICAO) , shall be ;

- a) 2 MIN
- b) 3 MIN
- c) 1 MIN
- d) 4 MIN

Answer ;

- b) 3 MIN
-

0532. When an aircraft flies into a horizontal tail wind gust the aircraft tends ;

- a) to descend.
- b) to climb.
- c) not to change its trajectory.
- d) to climb or descend , depending on the gust strength.

Answer ;

- a) to descend.
-

0533. When establishing an instrument approach procedure , five aircraft categories according to their speed at the threshold (V_{at}) are established. This speed is equal to the stalling speed in the landing configuration at the maximum certified landing mass multiplied by a factor of ;

- a) 1.5
- b) 1.15
- c) 1.3
- d) 1.45

Answer ;

- c) 1.3
-

0534. When flying in straight and level flight at FL 290 for some considerable time a small leak develops in the cabin which causes a slow depressurisation , this can be seen on the cabin rate of climb indicator which will indicate ;

- a) zero.
- b) a rate of descent of approximately 300 fpm.
- c) a rate of climb.
- d) a rate of descent dependent upon the cabin differential pressure.

Answer ;

- c) a rate of climb.
-

0535. When leaving the MNPS oceanic control area for a domestic controlled area , the pilot has to ;

- a) take the Mach number provided for this type of flight by his airline.
- b) take the Mach number specified in this initial flight plan.
- c) maintain the Mach number previously assigned up to the last position shown in the oceanic clearance.
- d) take any Mach number.

Answer ;

- c) maintain the Mach number previously assigned up to the last position shown in the oceanic clearance.
-

0536. When refuelling is being performed while passengers are boarding or disembarking the aircraft , one of the requirements is ;

- a) The aircraft's stairs be completely extended.
- b) Refuelling is prohibited while passengers are boarding and/or disembarking.
- c) All flight crew shall remain at their station.
- d) The ground area beneath the exits intended for emergency evacuation and slide deployment areas must be kept clear.

Answer ;

- d) The ground area beneath the exits intended for emergency evacuation and slide deployment areas must be kept clear.
-

0537. When requested by an Authority to produce the aircraft documentation required to be carried on board , the commander ;
- a) can request a delay of 48 hours.
 - b) shall only comply if authorised by the operator.
 - c) shall comply within a reasonable period of time.
 - d) can refuse o present them.

Answer ;

- c) shall comply within a reasonable period of time.
-

0538. When taking-off after a widebody aircraft which has just landed , you should take-off ;
- a) at the point where the aircraft's wheels have touched down and on the wind side of the runway .
 - b) at the point where the aircraft's wheels have touched the ground and on the underwind side of the runway .
 - c) in front of the point where the aircraft's wheels have touched down.
 - d) beyond the point where the aircraft's wheels have touched down.

Answer ;

- d) beyond the point where the aircraft's wheels have touched down.
-

0539. When taking-off behind a heavy aircraft , with the wind coming from the left side , you adopt , whenever possible ;
- a) a different flight path form the preceding aircraft , by remaining behind it and under its path.
 - b) a different flight path from the preceding aircraft , by remaining to the right of and under its path.
 - c) an identical flight path to the one of the preceding aircraft.
 - d) a different flight path from the preceding aircraft , by remaining to the left of and above its path.

Answer ;

- d) a different flight path from the preceding aircraft , by remaining to the left of and above its path.
-

0540. When taking-off behind a heavy aircraft , with the wind coming from the right side , you adopt , whenever possible ;
- a) a different flight path from the preceding aircraft , by remaining behind it and under its path.
 - b) an identical flight path to the one of the preceding aircraft.
 - c) a different flight path from the preceding aircraft , by remaining to the left of and under its path.
 - d) a different flight path from the preceding aircraft , by remaining to the right of and above its path.

Answer ;

- d) a different flight path from the preceding aircraft , by remaining to the right of and above its path.
-

0541. When taking-off , in winter conditions , the wing contamination by ice , snow or frost will cause the following effects ;
- 1. an increase in the take-off distance.
 - 2. a diminution of the take-off run.
 - 3. an increase in the stalling speed.
 - 4. a diminution of the stalling speed.
 - 5. a diminution of the climb gradient.

The combination regrouping all the correct statements is ;

- a) 2 , 3 , 5.
- b) 1 , 2 , 3.
- c) 2 , 4 , 5.
- d) 1 , 3 , 5.

Answer ;

- d) 1 , 3 , 5.
-

0542. When the weather conditions require an alternate aerodrome to be available on take-off , the latter shall be located , for aircraft with three or more engines , at an equivalent distance not exceeding ;
- a) 1 hour of flight time at single engine cruising speed.
 - b) 2 hours of flight time at one-engine-inoperative cruising speed.
 - c) 1 hour of flight time at cruising speed.
 - d) 2 hours of flight time at cruising speed.

Answer ;

- b) 2 hours of flight time at one-engine-inoperative cruising speed.
-

0543. When there is a risk of hydroplaning the pilot of an aeroplane ;
- a) should use normal landing , braking and reverse technique.
 - b) should make a positive landing and apply maximum reverse thrust and brakes as quickly as possible.
 - c) should use maximum reverse thrust , however should start braking below the hydroplaning speed.
 - d) must wait for landing until the risk for hydroplaning is no longer existing.

Answer ;

- b) should make a positive landing and apply maximum reverse thrust and brakes as quickly as possible.
-

0544. Whenever a potential bird hazard is observed , the commander shall ;
- a) inform immediately the bird control unit (BCU) directly by radio.
 - b) submit a written hazard bird strike report upon arrival and within 48 hours.
 - c) immediately inform the local ATS unit.
 - d) inform other aircraft in the vicinity by radio.

Answer ;

- c) immediately inform the local ATS unit.
-

0545. Whenever practicable , what transponder code should be used to provide recognition of an aircraft which is being subjected to unlawful interference ;

- a) A 2000.
- b) A 7700.
- c) A 7600.
- d) A 7500.

Answer ;

- d) A 7500.
-

0546. Where dangerous goods are carried on a flight which takes place wholly or partly outside the territory of a State , which language must be used on the transport document in addition to any other language ?

- a) English.
- b) French.
- c) Spanish.
- d) English , French , Spanish , Russian , Chinese.

Answer ;

- a) English.
-

0547. Which errors in “estimates” of minutes shall be reported by aircraft overflying the North Atlantic ?

- a) 3 or more.
- b) 10 or more
- c) 2 or more
- d) 5 or more.

Answer ;

- a) 3 or more.
-

0548. Which JAR prescribes requirements for approved maintenance organisations ?

- a) JAR-25
- b) JAR-66
- c) JAR-AMO
- d) JAR-145

Answer ;

- d) JAR-145
-

0549. Which of the following items , required to be on board an aircraft for operating reasons in accordance with the relevant JARs , are classified as dangerous goods ?

1. Fire extinguishers.
2. Self-inflating life jackets.
3. Portable oxygen supplies.
4. First-aid kits.

The combination regrouping all the correct statements is ;

- a) 2 , 4.
- b) 1 , 3 , 4.
- c) 1 , 3.
- d) 1 , 2 , 3 , 4.

Answer ;

- d) 1 , 2 , 3 , 4.
-

0550. Which of the following requirements should be met when planning a flight with icing conditions ;

- a) A meteorologist shall decide whether the flight may be performed without ice-protection systems.
- b) The aircraft shall be equipped with approved ice-protection systems.
- c) The aircraft shall before flight be sprayed with anti-icing fluid.
- d) The flight should be planned so that a change of cruising level can be initiated rapidly.

Answer ;

- b) The aircraft shall be equipped with approved ice-protection systems.
-

0551. Which of the following statements is correct concerning a take off from a contaminated runway ?

- a) In general the performance data for take off has been determined by means of calculation and has not been verified by flight tests.
- b) The take off from a contaminated runway is forbidden.
- c) As the amount of contamination increases at constant take off weight , V_1 should decrease to compensate for decreasing friction.
- d) The performance corrections for contamination should be applied with any kind of measurable contamination.

Answer ;

- a) In general the performance data for take off has been determined by means of calculation and has not been verified by flight tests.
-

0552. Which of the following weather conditions will give the shortest holdover time for a given ambient temperature and type of anti-icing fluid ?

- a) Light freezing rain.
- b) Frost.
- c) Steady snow.
- d) Freezing fog.

Answer ;

- a) Light freezing rain.
-

0553. Which one of the following sets of conditions is most likely to attract birds to an aerodrome ?

- a) maintaining the grass on the airfield.
- b) the extraction of minerals such as sand and gravel.
- c) a opened refuse tip in close vicinity.
- d) modern and close sewage treatment centre in close proximity.

Answer ;

- c) a opened refuse tip in close vicinity.
-

0554. Which one of the following sets of conditions is the least likely to attract flocks of birds ?

- a) edible rubbish.
- b) short gang-mown grass.
- c) an area liable to flooding.
- d) long grass.

Answer ;

- d) long grass.
-

0555. Which parameter will change first , when penetrating an horizontal windshear ?

- a) Groundspeed.
- b) Pitch angle.
- c) Vertical speed.
- d) Indicated airspeed.

Answer ;

- d) Indicated airspeed.
-

0556. Which separation will be provided if Reduced Vertical Separation Minimum (RVSM) is used when operating in MNPS airspace ?

- a) 90 NM lateral and 500 ft vertical.
- b) 90 NM lateral and 1000 ft vertical.
- c) 60 NM lateral and 1000 ft vertical.
- d) 60 NM lateral and 500 ft vertical.

Answer ;

- c) 60 NM lateral and 1000 ft vertical.
-

0557. Which statement is correct about noise abatement procedures during landing ?

- a) These procedures prohibit the use of reverse thrust .
- b) These procedures shall not prohibit the use of reverse thrust.
- c) These procedures are applied in case of instrument approach only.
- d) There are no noise abatement procedures for landing.

Answer ;

- b) These procedures shall not prohibit the use of reverse thrust.
-

0558. While approaching a mountainous airfield , the captain of a transport aircraft notices a fast and high increase in the indicated airspeed without any change in the preselected engine and attitude parameters. The preceding crews had reported the occurrence of windshears in final phase. You must ;

- a) reduce rapidly the selected thrust , maintain on the glide path.
- b) reduce rapidly the selected thrust in order to reach 1.2 V_S and try a precision landing.
- c) take a level flight attitude to reduce speed , then come back to glide path from above.
- d) maintain the aircraft on the glide path , accept a positive speed deviation , monitor the speed evolution.

Answer ;

- d)** maintain the aircraft on the glide path , accept a positive speed deviation , monitor the speed evolution.
-

0559. While approaching the outer-marker , the tower informs you about the presence of a “microburst”. You will expect to encounter ;

- a) wake turbulence .
- b) supercooled water.
- c) convection motion of air mass.
- d) windshears (vertical and horizontal).

Answer ;

- d)** windshears (vertical and horizontal).
-

0560. Who has the responsibility for establishing operating procedures for noise abatement purposes during instrument flight in compliance with ICAO PANS OPS 8168 the ;

- a) operator.
- b) state of the operator.
- c) commander.
- d) state in which the aeroplane is operating.

Answer ;

- a)** operator.
-

0561. Who initially is responsible for ensuring that cargo for air transportation as dangerous goods is not prohibited ?

- a) The shipper when completing the shipper’s declaration for dangerous goods.
- b) The operator.
- c) It is not specified.
- d) The commander , always using the list of prohibited items.

Answer ;

- a)** The shipper when completing the shipper’s declaration for dangerous goods.
-

0562. Who is responsible for providing an Operation Manual in accordance with JAR-OPS Subpart P for the use and guidance of the operations personnel ?

- a) The aircraft operator.
- b) The aircraft producer.
- c) The national authority.
- d) The owner of the aircraft.

Answer ;

- a)** The aircraft operator.
-

0563. Who must finally determine that the load and its distribution is such that the mass and balance limits of the aircraft are not exceeded and confirm their acceptance by countersigning the mass and balance documentation ?

- a) The commander.
- b) The operator.
- c) The airline’s dispatcher.
- d) The flight engineer.

Answer ;

- a)** The commander.
-

0564. Who shall be satisfied , before flight , that the aircraft’s weight is such that flight can be safely made , and that any transported cargo is properly distributed and secured ?

- a) The airline’s dispatcher.
- b) The operator.
- c) The commander.
- d) The flight engineer.

Answer ;

- c)** The commander.
-

0565. Wind shear is ;

- a) a variation only in horizontal wind velocity over a short distance.
- b) a large variation in vertical or horizontal wind velocity and / or wind direction over a short distance.
- c) a variation in vertical or horizontal wind velocity and / or wind direction over a large distance.
- d) a variation only in vertical wind velocity over a short distance.

Answer ;

- b)** a large variation in vertical or horizontal wind velocity and / or wind direction over a short distance.
-

0566. Windshear is ;

- a) a variation in vertical or horizontal wind velocity and / or wind direction over a short distance.
- b) a vertical or horizontal wind velocity and / or wind direction over a large distance.
- c) a horizontal wind velocity variation over a short distance.
- d) a variation in vertical wind velocity variation over a short distance.

Answer ;

- a)** a variation in vertical or horizontal wind velocity and / or wind direction over a short distance.
-

0567. Windshear may be described as a change in wind direction and/or speed in space , including updraughts and downdraughts. To counter the effects of windshear the amount of control action that is required is ;

- a) small.
- b) substantial.
- c) null.
- d) medium.

Answer ;

- b)** substantial.
-

0568. With the Control Display Unit (CDU) of an Inertial Navigation System (INS) , you can read the following information ;

Desired track (DTK) = 100°

Track (TK) = 120°

You can conclude that the ;

- a) Aircraft is converging towards its ideal course.
- b) Aircraft is diverging from its ideal course.
- c) Track Error Angle (TKE) is left (L).
- d) Track Error Angle (TKE) is right (R).

Answer ;

- d)** Track Error Angle (TKE) is right (R).
-

0569. Without ETOPS Approval , an operator shall not operate a two-engined Class A aeroplane with a maximum approved passenger seating configuration of 20 or more over a route which contains a point further from an adequate aerodrome , at a distance flown ;

- a) in 60 minutes at the one-engine-inoperative cruise speed.
- b) in 90 minutes at the one-engine-inoperative cruise speed.
- c) in 30 minutes at the one-engine-inoperative cruise speed.
- d) in 120 minutes at the one-engine-inoperative cruise speed.

Answer ;

- a)** in 60 minutes at the one-engine-inoperative cruise speed.
-

0570. You intend to operate a multi-engine public transport aeroplane (land aeroplane) with 60 persons on board. The cruising speed is 180 kt. The aeroplane is capable of continuing the flight one engine inoperative. The track will overfly water at 380 NM from an emergency landing place. The minimum equipment configuration complying with JAR OPS is ;

- a) none , distance being less than 400 NM.
- b) two 30-seat life rafts.
- c) one 30-seat life raft and two 20-seat life raft.
- d) three 30-seat life rafts.

Answer ;

- d)** three 30-seat life rafts.
-

0571. You intend to operate a public transport aeroplane (land aeroplane) with 60 persons on board. The track will overfly water at 80 nautical miles from the shore. The minimum number of approved life jackets to be on board is ;

- a) 66.
- b) 0.
- c) 60.
- d) None if equipped with life rafts.

Answer ;

- c)** 60.
-


0572. You plan to fly from point A (60°N 010°E) to point B (60°N 020°E). The gyro North of the gyro compass , assumed to be operating perfectly , with no rate correction device , is aligned with the true North of point A. The constant gyro heading to be followed when starting from A given that the flight time scheduled is 1 h 30 min with a zero wind , is equal to ;

- a) 076°.
- b) 066°.
- c) 080°.
- d) 085°.

Answer ;

a) 076°.

Çözüm ;

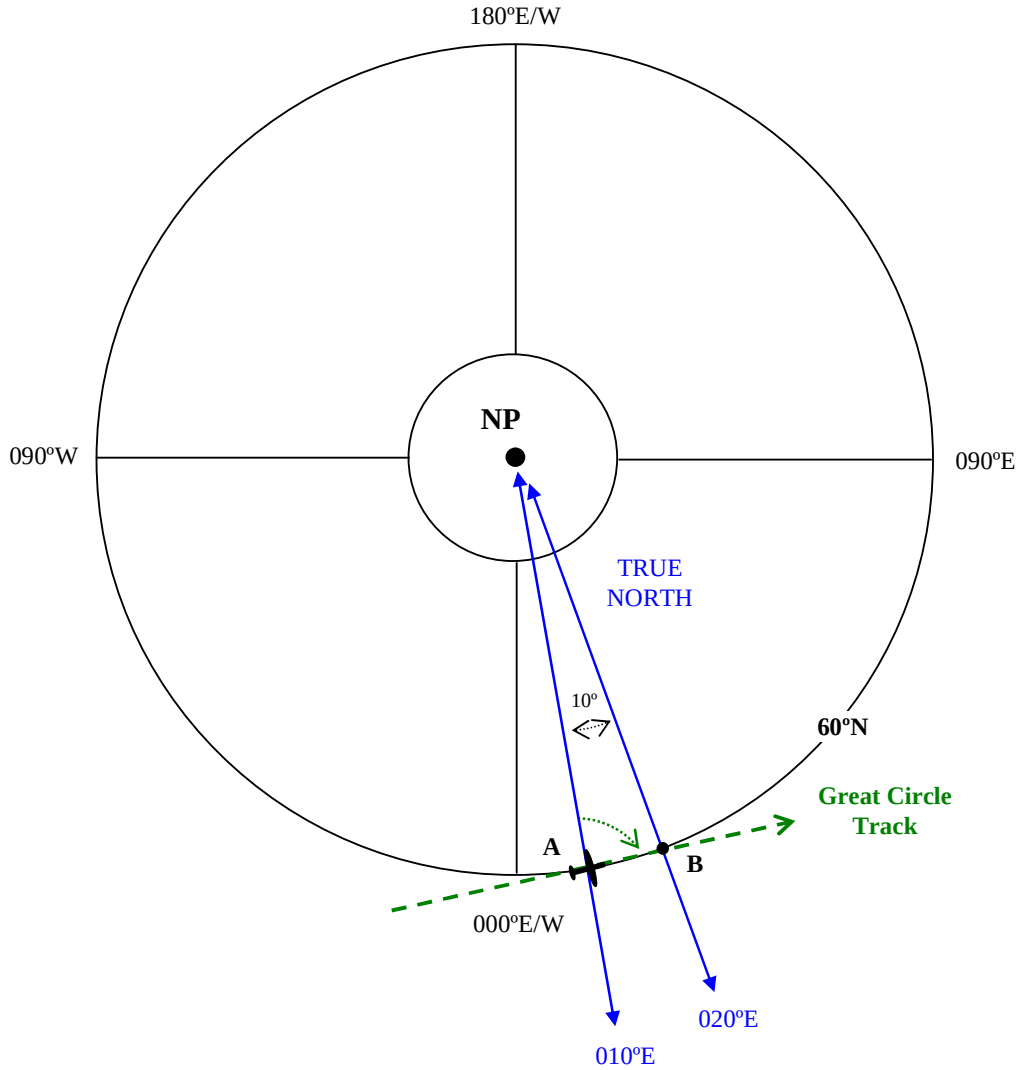

WITH the LAT NUT correctly set, we compensate for ER...with no LN,

ER = $15 \times \sin \text{Lat} \times 1.5 = 20$,

TW = $10 \times \sin \text{Lat} = 8$

Total ERROR -28 (both negative)

So at the start (N60 E010).....090G, at the end (N60 E020) 062G.....so the mean (which we need) 076G.

0573. You will use a CO₂ fire-extinguisher for ;

1. a paper fire.
2. a plastic fire.
3. a hydrocarbon fire.
4. an electrical fire.

The combination regrouping all the correct statements is ;

- a) 1, 2, 3.
- b) 3, 4.
- c) 2, 3.
- d) 1, 2, 3, 4.

Answer ;

d) 1, 2, 3, 4.

0574. You will use a halon extinguisher for a fire of ;

1. solids (fabric , plastic , ...).
2. liquids (alcohol , gasoline , ...).
3. gas.
4. metals (aluminium , magnesium , ...).

The combination regrouping all the correct statements is ;

- a) 1, 2, 3, 4.
- b) 1, 2, 3.
- c) 2, 3, 4.
- d) 1, 2, 4.

Answer ;

b) 1, 2, 3.

0575. You will use a powder fire-extinguisher for ;

1. a paper fire.
2. a plastic fire.
3. a hydrocarbon fire.
4. an electrical fire.

The combination regrouping all the correct statements is ;

- a) 1, 2, 3.
- b) 2, 3.
- c) 1, 2, 3, 4.
- d) 1, 4.

Answer ;

c) 1, 2, 3, 4.

0576. You will use a water fire-extinguisher (straight jet) on a fire of ;

1. solids (fabric , carpet , ...).
2. liquids (ether , gasoline , ...).
3. gas.
4. metals (sodium , ...).

The combination regrouping all the correct statements is ;

- a) 1.
- b) 3 and 4.
- c) 3.
- d) 2.

Answer ;

a) 1.

0577. Your flight manual does not include specific supplementary information on landing distances on wet runways and the service bulletins or weather reports indicate that the runway may be wet at the estimated time of arrival. The required landing distance on a dry runway must be increased by ;

- a) 15%.
- b) 20%.
- c) 18%.
- d) 17.6%.

Answer ;

a) 15%.

Açıklama ;

JAR-OPS 1.595'e uygun olarak ; eğer uçuş manuel'i veya servis bültenlerinde ıslak pistlere iniş ile ilgili spesifik bir madde yoksa ve ilgili hava durumu raporları veya tahminleri tahmini varış zamanında pistin nemli olabileceğini gösteriyorsa , hesap edilecek iniş mesafesi mevcut iniş mesafesinin en az 1.15 katı fazlası (15%) olacaktır..
