

Customer: Haemonetics Penang		Date: 28-Nov-23	Time: 9:00
Participant From Maruwa		Participant From Organizer	
1. Mr Sasaki	CEO	1. Mr Allan	Plant Director
2. Mr Siva	Tool Manager	2. Mr Saw	Engineering Mgr
3.		3. Mr Chun Seng	Engineering
4.		4. Ms Wen Chee	Purchaser
5.		5. Ms Sim	Material Planner
		Report To	
		1. Datuk Anthony & Mr Sasaki	
		2. Mr Justin & Mr Prasan	
		3. Mr Naga & Mr Saupi	
		4. Mr Sathia & Ms Pang	
		5. Mr Mori & Mr Lai	


Agenda

Meeting started of with quality Discussion

Quality Discussion

1. Unground / Uneven Surface

Maruwa

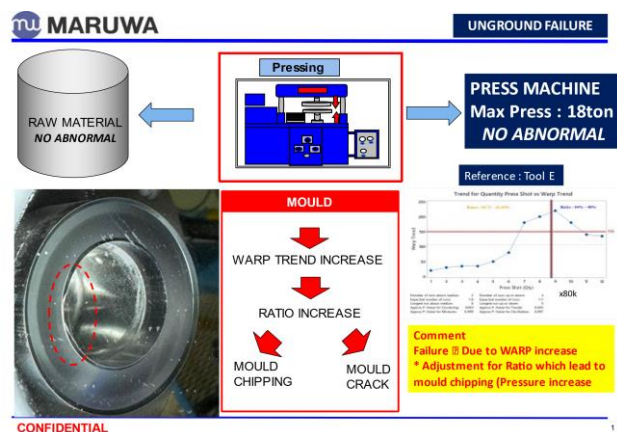


MARUWA

SRONG ROUNG FAILURE

SEAL ROTATING CERAMIC - UNGROUND CAUSE & ACTION

Tool	Ratio	Warp	Ingrind	Problem	Effect	Action Taken	Current condition
D	40.57%	>150μ	11.87	Adjustment of Press Ratio from 40.57% ~ 42% to 50.3% ~ 52%	Mold started to chip especially at the upper punch & 2nd Lower Punch (Chamfer area)	Evaluate to get the optimal ratio condition 44% ~ 48%	Under monitoring - warp <150μ
E	40.57%	>150μ	12.79				
H	40.57%	>150μ	7.35				
F	40.57%	<150μ	3.01	No issue	NO ACTION		
G	40.57%	<150μ	2.46	No issue			

Maruwarequesting change the KPIV of Ratio spec from 40% ~ 42% ➔ 40% ~ 48%

CONFIDENTIAL

Detail report as attached

Maruwa requested to widen the Ratio spec from 40% ~ 42% => 40% ~ 48%

HAE : Agreed to submit the sample for Tool J (Will perform the OQ & PQ qualification)

Maruwa : Requested to revise the mould life from 1,000,000pcs ==> 800,000pcs

HAE : Agreed to accept the qty for a base line reference and HAE will support additional 2 sets of mould (Tool N & P)

Process Flow (HAE IQC - Quality check) for Maruwa's Burr product (Uneven surface)

Effected Tool : D, E & H

- IQC - 100% Visual (100% Acceptance)
- After assembly - 30pcs bowl will be cut for cinform on
 - Crack
 - Carbon Inprint



All the cut bowl will be scrap

=> Maruwa: New spare tool expected incoming on 30th Nov => Effective 03rd Dec : Eliminate burr cutting process in Maruwa

Product comparison with CT Scan between Pink Ceramic & Maruwa Ceramic

=> Maruwa's product generally showing on bigger side compare to the pink product. Will review the mould design which believe to create more stability at the chamfer area

Maruwa : Will discuss further with tool maker

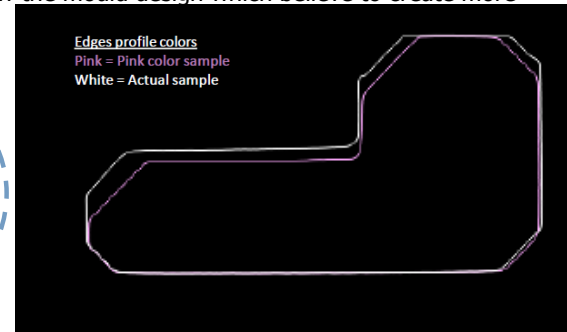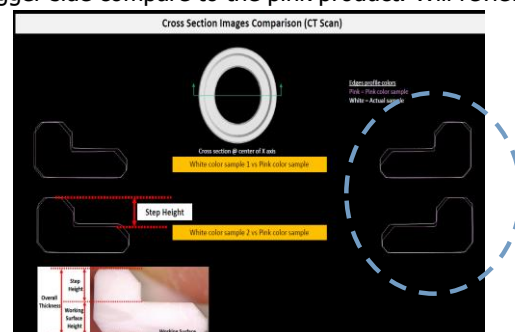

Maruwa ceramic showing larger trend compare to pink ceramic. Adjustment of product angle will improve further the product strenght

Delivery Status

Updated the Dec'23 shipment plan

Dec'23 Plan qty : 880kpcs

1st Dec	32K
4th ~ 8th	208K
11th ~ 15th	216K
18th ~ 22nd	216K
25th ~ 29th	216K
	880K

Jan'24 : 940kpcs

1st ~ 5th	216K
8th ~ 12th	220k
15th ~ 19	220k
22th ~ 26th	220k
29th ~ 31st	64k
	940K

Process tour to understand process failure occurrence position. The current yield showing some spikes which was due to the OD2 dimension

Meeting adjourned at 11: 30

Conclusion & Opinion

Mr Allan's main consent is on the delivery issues where the Maruwa need to be consistent on the shipment plan. Haemonetics generally understand the quality iossues especially on the unground and surface uneven and the corrective action explained to solve this issue permanently