Project: Worked examples
Title: Motor and actuator sizing
Status: DRAFT · Author: TempestOS (2026-10-23) · Checker: — (—) · Issued: —

1. Scope and method

Torque, speed and power a motor needs to move a load through a mechanism on a point-to-point cycle: the load reflected to the motor shaft, the acceleration from the motion profile, peak torque during acceleration, RMS torque over the cycle (thermal duty), peak speed, inertia ratio, and a check of a candidate motor's rated and peak torque and speed with a safety margin. A rotary load that runs continuously (a pump, a fan) is sized instead from its steady torque and speed and a run-up time.

WHAT IT CALCULATES	RELATION
Motor-to-load ratio of a linear mechanism, in metres per motor radian	$k = p/(2\pi\, i)$ (screw); $D/(2\, i)$ (belt); $D_p/(2\, i)$ (rack)
Load inertia reflected to the motor through a linear mechanism	$J_{refl} = m\, k^2/\eta$
Load torque at the motor through a linear mechanism	$T_{load} = F\, k/\eta$, with $F = m\, g\, (\sin\theta + \mu \cos\theta) + F_p$
Reflected inertia and torque of a rotary load through a gearbox	$J_{refl} = J_L/(i^2\, \eta)$; $T_{load} = T_L/(i\, \eta)$
Move profile, trapezoidal 1/3–1/3–1/3 (adjustable)	$v_{pk} = s/(t_{move} - t_{acc})$; $a = v_{pk}/t_{acc}$
Move profile, S-curve (sine acceleration, same peak speed)	$a_{pk} = (\pi/2)\, a_{trap}$
Torque to accelerate the total inertia, and the peak torque	$T_{acc} = J_{total}\, \alpha$; $T_{pk} = T_{acc} + T_{load}$
RMS (thermal) torque over the whole cycle, dwell included	$T_{rms} = \sqrt{(\Sigma\, T_i^2\, t_i / t_{cycle})}$
RMS mechanical power over the cycle, the thermal-equivalent continuous power a supply sees (regeneration counts as power; the instantaneous peak P_{pk} is not a continuous demand), trapezoidal profile	$P_{rms} = \omega_{pk}\, \sqrt{\{[t_{acc}\cdot(2/3)(T_{load}^2 + T_{acc}^2) + T_{load}^2\, t_{const}]/t_{cycle}\}}$; for the S-curve the acceleration term becomes $t_{acc}\cdot[(3/4)\, T_{load}^2 + (5/16)\, T_{acc}^2]$
Continuous rotary duty (a pump or fan), speed at the motor	$\omega = 2\pi\, n_L\, i/60$; $n_{pk} = n_L\, i$
Continuous rotary duty, load torque and RMS torque	$T_{load} = T_L/(i\, \eta)$; $T_{rms} = T_{load}$
Peak torque during the run-up, with full load throughout (conservative)	$T_{pk} = J_{total}\, \omega/t_{start} + T_{load}$
Continuous power	$P_{cont} = T_{load}\, \omega$; $P_{rms} = P_{cont}$

WHAT IT CALCULATES	RELATION
Rated shaft power of the candidate motor, from its rated torque and its rated speed n_{rated} (not the running speed), the shaft power its supply must be sized for; without n_{rated} there is no P_{rated} and the sheet warns	$P_{rated} = T_{rated} \cdot 2\pi\, n_{rated}/60$

Basis: Load torque, inertia referred to the motor, duty cycles[1](Ch. on motor and drive selection); Reflected inertia, RMS torque, inertia ratio practice[2].

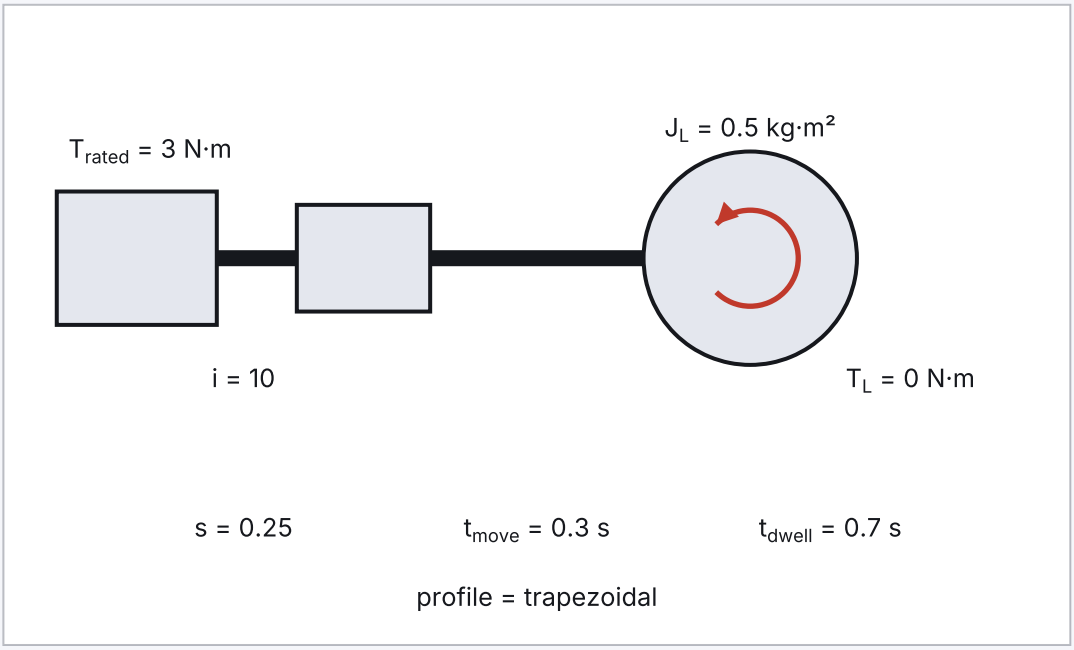


Figure 1 — A motor through a gearbox to a rotary load of inertia J_L and torque T_L. Not to scale; the labels are the inputs as entered.

2. Inputs

SYMBOL	DESCRIPTION	VALUE	UNIT	SOURCE	VALID RANGE
mechanism	Mechanism	`gearbox rotary`		assumption: Sizing convention.	any
i	Gear ratio i (motor : output, 1 = none)	`10`		spec: Gearbox datasheet PG-10: 10:1, 85 %	1 … 1000
η	Mechanism efficiency (overall)	`0.85`		spec: Gearbox datasheet PG-10: 10:1, 85 %	0.3 … 1
J_{mech}	Transmission inertia referred to the motor shaft (screw, pulleys, gearbox, coupling)	`0`	kg·m²	assumption: Sizing convention.	0 … 10 kg·m²
μ	Friction coefficient (guide / bearing)	`0.1`		default	0 … 1
θ	Incline from horizontal (+ moving uphill)	`0`	°	default	-90 … 90 °

SYMBOL	DESCRIPTION	VALUE	UNIT	SOURCE	VALID RANGE
F_p	Process force opposing the move (linear)	0	N	default	0 … 1000000 N
J_L	Load inertia at the output (rotary mechanisms)	0.5	kg·m²	spec: S1-style inertia calc of the 600 mm table with fixtures: 0.5 kg·m²	0 … 10000 kg·m²
T_L	Constant load torque at the output (rotary)	0	N·m	assumption: Sizing convention.	0 … 100000 N·m
$duty_{mode}$	Duty (point-to-point move cycle, or continuous rotary running with a run-up)	point-to-point		default	any
profile	Motion profile	trapezoidal		assumption: Sizing convention.	any
s	Move distance (linear: m; rotary: output revolutions)	0.25		spec: Cycle specification CS-7: 90° index in 0.3 s, 0.7 s dwell	0.0001 … 10000
t_{move}	Move time	0.3	s	spec: Cycle specification CS-7: 90° index in 0.3 s, 0.7 s dwell	0.01 … 3600 s
f_{acc}	Acceleration (and deceleration) fraction of the move time	0.333333		spec: Cycle specification CS-7: 90° index in 0.3 s, 0.7 s dwell	0.05 … 0.5
t_{dwell}	Dwell between moves	0.7	s	spec: Cycle specification CS-7: 90° index in 0.3 s, 0.7 s dwell	0 … 3600 s
J_{motor}	Candidate motor rotor inertia	0.0005	kg·m²	spec: Motor datasheet SM-060: 5.0e-4 kg·m², 3.0 / 9.0 N·m, 3000 rpm	1e-7 … 10 kg·m²
T_{rated}	Candidate motor continuous (rated) torque	3	N·m	spec: Motor datasheet SM-060: 5.0e-4 kg·m², 3.0 / 9.0 N·m, 3000 rpm	0.01 … 100000 N·m
T_{peak}	Candidate motor peak torque	9	N·m	spec: Motor datasheet SM-060: 5.0e-4 kg·m², 3.0 / 9.0 N·m, 3000 rpm	0.01 … 100000 N·m

SYMBOL	DESCRIPTION	VALUE	UNIT	SOURCE	VALID RANGE
n_{max}	Candidate motor maximum speed	3000	rpm	spec: Motor datasheet SM-060: 5.0e-4 kg·m², 3.0 / 9.0 N·m, 3000 rpm	10 … 100000 rpm
SF	Safety margin on torque	1.25		assumption: Sizing convention.	1 … 3
$J_{ratio,max}$	Inertia ratio limit (load : motor), warning	10		assumption: Sizing convention.	1 … 100

3. Assumptions

A1. Rigid transmission; the mechanism efficiency applies to the driving direction and is also used in the deceleration phase (conservative for peak, slightly pessimistic for RMS). (Servo-sizing practice.)
A2. The friction force is Coulomb friction on the moved mass; viscous and breakaway friction are not modelled unless included in F_p. (Load model.)
A3. Continuous duty: the load torque is constant at the stated speed and the motor accelerates the whole inertia linearly to speed in t_{start} while carrying the full load torque (conservative); the move distance, move time, acceleration fraction, dwell and profile are ignored. (Run-up idealisation for pumps and fans.)
A4. The S-curve profile has sine-shaped acceleration over the same acceleration time, so its peak acceleration is π/2 times the trapezoidal value. (Jerk-limited profile idealisation.)
A5. mechanism (Mechanism) is taken as gearbox rotary. (Sizing convention.)
A6. J_{mech} (Transmission inertia referred to the motor shaft (screw, pulleys, gearbox, coupling)) is taken as 0 kg*m^2. (Sizing convention.)
A7. T_L (Constant load torque at the output (rotary)) is taken as 0 N*m. (Sizing convention.)
A8. profile (Motion profile) is taken as trapezoidal. (Sizing convention.)
A9. SF (Safety margin on torque) is taken as 1.25. (Sizing convention.)
A10. $J_{ratio,max}$ (Inertia ratio limit (load : motor), warning) is taken as 10. (Sizing convention.)

4. Working

[21] $k = 1 / i$
$= 1 / 10$
$= 0.1$
Output radians per motor radian
[22] $T_{load} = T_L / (i * \eta)$
$= 0\ N·m / (10 \times 0.85)$
$= 0\ N·m$
Load torque at the motor shaft
[23] $J_{refl} = J_L / (i^2 * \eta)$
$= 0.5\ kg·m^2 / (10^2 \times 0.85)$
$= 0.0058824\ kg·m^2$
Load inertia reflected to the motor shaft
[24] $\theta_m = s * 2 * pi * i$
$= 0.25 \times 2 \times \pi \times 10$
$= 15.708\ rad$
Motor angle for the move
[25] $\omega_{pk} = \theta_m / (t_{move} * (1 - f_{acc}))$
$= 15.708\ rad / (0.3\ s \times (1 - 0.33333))$
$= 78.54\ rad/s$
Peak motor speed (trapezoid)
[26] $\alpha_{trap} = \omega_{pk} / (f_{acc} * t_{move})$
$= 78.54\ rad/s / (0.33333 \times 0.3\ s)$
$= 785.4\ rad/s^2$

Trapezoidal angular acceleration at the motor

[28] $\alpha_{pk} = \alpha_{trap}$

$= 785.4\ rad/s^2$

$= 785.4\ rad/s^2$

Peak acceleration

[29] $\alpha_{pk} = \alpha_{pk}$

$= 785.4\ rad/s^2$

$= 785.4\ rad/s^2$

Peak motor angular acceleration

[30] $J_{total} = J_{motor} + J_{mech} + J_{refl}$

$= 0.0005\ kg \cdot m^2 + 0\ kg \cdot m^2 + 0.0058824\ kg \cdot m^2$

$= 0.0063824\ kg \cdot m^2$

Total inertia at the motor shaft

[31] $T_{acc} = J_{total} * \alpha_{pk}$

$= 0.0063824\ kg \cdot m^2 \times 785.4\ rad/s^2$

$= 5.0127\ N \cdot m$

Acceleration torque

[32] $T_{pk} = T_{acc} + T_{load}$

$= 5.0127\ N \cdot m + 0\ N \cdot m$

$= 5.0127\ N \cdot m$

Peak torque (accelerating against the load)

[33] $T_{dec} = -T_{acc} + T_{load}$

$= -5.0127\ N \cdot m + 0\ N \cdot m$

$= -5.0127\ N \cdot m$

Torque during deceleration

[34] $n_{pk} = \omega_{pk}$

$= 78.54\ rad/s$

$= 750\ rpm$

Peak motor speed

[35] $P_{pk} = T_{pk} * \omega_{pk}$

$= 5.0127\ N \cdot m \times 78.54\ rad/s$

$= 0.3937\ kW$

Peak mechanical power

[36] $t_{acc} = f_{acc} * t_{move}$

$= 0.33333 \times 0.3\ s$

$= 0.1\ s$

Acceleration time

[37] $t_{const} = t_{move} - 2 * t_{acc}$

$= 0.3\ s - 2 \times 0.1\ s$

$= 0.1\ s$

Constant-velocity time

[38] $t_{cycle} = t_{move} + t_{dwell}$

$= 0.3\ s + 0.7\ s$

$= 1\ s$

Cycle time

[39] $P_{rms} = \omega_{pk} * sqrt((t_{acc} * (2 / 3) * (T_{load}\text{^}2 + T_{acc}\text{^}2) + T_{load}\text{^}2 * t_{const}) / t_{cycle})$

$= 78.54\ rad/s \times sqrt((0.1\ s \times 2 / 3 \times ((0\ N \cdot m)\text{^}2 + (5.0127\ N \cdot m)\text{^}2) + (0\ N \cdot m)\text{^}2 \times 0.1\ s) / 1\ s$

$= 0.10165\ kW$

RMS mechanical power over the cycle (thermal-equivalent continuous power)

[40] $T_{rms} = sqrt((T_{pk}\text{^}2 * t_{acc} + T_{load}\text{^}2 * t_{const} + T_{dec}\text{^}2 * t_{acc}) / t_{cycle})$

$= sqrt(((5.0127\ N \cdot m)\text{^}2 \times 0.1\ s + (0\ N \cdot m)\text{^}2 \times 0.1\ s + (-5.0127\ N \cdot m)\text{^}2 \times 0.1\ s) / 1\ s)$

$= 2.2417\ N \cdot m$

RMS torque over the cycle (thermal)

[41] $J_{ratio} = (J_{refl} + J_{mech}) / J_{motor}$
$= (0.0058824\ kg \cdot m^2 + 0\ kg \cdot m^2) / 0.0005\ kg \cdot m^2$
$= 11.765$
Inertia ratio (load : motor)
[42] $u_{peak} = SF * T_{pk} / T_{peak}$
$= 1.25 \times 5.0127\ N \cdot m / 9\ N \cdot m$
$= 0.69621$
Peak torque utilisation with safety margin
[43] $u_{rms} = SF * T_{rms} / T_{rated}$
$= 1.25 \times 2.2417\ N \cdot m / 3\ N \cdot m$
$= 0.93406$
Continuous torque utilisation with safety margin
[44] $u_{speed} = n_{pk} / n_{max}$
$= 750\ rpm / 3000\ rpm$
$= 0.25$
Speed utilisation
[45] $duty = T_{rms} / T_{rated}$
$= 2.2417\ N \cdot m / 3\ N \cdot m$
$= 0.74725$
Thermal duty (without margin)

5. Results

SYMBOL	VALUE	DESCRIPTION
k	0.1	Transmission constant
T_{load}	0 N·m	Load torque at motor
J_{refl}	0.0058824 kg·m²	Reflected load inertia
J_{total}	0.0063824 kg·m²	Total inertia
θ_m	15.708 rad	Motor angle
a_{pk}	785.4 rad/s²	Peak acceleration
α_{pk}	785.4 rad/s²	Motor angular acceleration
T_{acc}	5.0127 N·m	Acceleration torque
T_{pk}	5.0127 N·m	Peak torque
T_{dec}	-5.0127 N·m	Deceleration torque
T_{rms}	2.2417 N·m	RMS torque
n_{pk}	750 rpm	Peak speed
P_{pk}	0.3937 kW	Peak power
P_{rms}	0.10165 kW	RMS power (continuous equivalent)
J_{ratio}	11.765	Inertia ratio
duty	0.74725	Thermal duty
u_{peak}	0.69621	Peak utilisation
u_{rms}	0.93406	Continuous utilisation
u_{speed}	0.25	Speed utilisation

6. Checks (governing first)

RESULT	CHECK	DEMAND	CAPACITY	UTILISATION	REF
PASS	RMS torque $SF \cdot T_{rms} \le T_{rated}$	$u_{rms} = 0.93406$	$u_{rms} \le 1$	0.934	
PASS	Peak torque $SF \cdot T_{pk} \le T_{peak}$	$u_{peak} = 0.69621$	$u_{peak} \le 1$	0.696	
PASS	Speed $n_{pk} \le n_{max}$	$u_{speed} = 0.25$	$u_{speed} \le 1$	0.25	

7. Applicability

WARNING — record: Tabulated values not taken from a reference record: J_{motor}, T_{rated}, T_{peak}, n_{max} (Candidate motor rating). Enter each as one so its source, edition and licence travel with it.
WARNING — input.mu: μ (Friction coefficient (guide / bearing)) was not entered; the template default 0.1 is used.
WARNING — input.theta: θ (Incline from horizontal (+ moving uphill)) was not entered; the template default 0 deg is used.
WARNING — input.F_p: F_p (Process force opposing the move (linear)) was not entered; the template default 0 N is used.
WARNING — input.duty_mode: $duty_{mode}$ (Duty (point-to-point move cycle, or continuous rotary running with a run-up)) was not entered; the template default 'point-to-point' is used.
WARNING — inertia-ratio: J_{motor}: the inertia ratio 11.8 exceeds 10.
WARNING — overhauling: T_{dec}: the motor brakes during deceleration (negative torque); the drive must absorb the regenerated energy.

8. Verification

```
Template elec.motor-sizing@1.5.0 Content hash e27e82fd084979ba Engine calc-engine/1.0.0
Known-answer cases passed 3/3 Test run 2026-10-23 12:00 UTC TempestOS 0.26.0
```

9. References

1. Hughes A, Drury B. Electric Motors and Drives: Fundamentals, Types and Applications. 5th ed. Newnes; 2019.
2. Kollmorgen; Parker Hannifin. Servo motor sizing guides [manufacturer technical literature].