Project: Worked examples
Title: Bolted joint (simplified VDI 2230)
Status: DRAFT · Author: TempestOS (2026-10-23) · Checker: — (—) · Issued: —

1. Scope and method

One bolt clamping members under an axial working load: the preload from the tightening torque with its scatter (or as measured), the stiffness of bolt and members, how much of the working load the bolt sees, the residual clamp after embedding, separation, yield under preload plus working load, the thread engagement needed against stripping, and the fatigue amplitude.

WHAT IT CALCULATES	RELATION
Tensile stress area of the thread	$A_s = (\pi/4)\cdot((d_2 + d_3)/2)^2$, with $d_2 = d - 0.6495\ P$ and $d_3 = d - 1.2269\ P$
Assembly preload from the tightening torque, nut-factor method	$F_M = M_A/(K\ d)$
Assembly preload from the tightening torque, thread and head friction method	$F_M = M_A/(0.16\ P + 0.58\ d_2\ \mu_G + 0.5\ D_{Km}\ \mu_K)$
Assembly preload stated directly (measured) instead of derived	$F_M = F_V$
Bolt and member stiffness and the stress area may also be given (measured, FE or a fastener record) instead of derived.	
Minimum preload after the tightening scatter	$F_{M,min} = F_M/\alpha_A$
Bolt resilience, the head, free shank and engaged thread as springs in series	$\delta_S = (0.4\ d + 0.4\ d)/(E_S\ A_N) + l_k/(E_S\ A_s) + 0.5\ d/(E_S\ A_{d3})$
Member stiffness, the clamped parts as two pressure frusta	$k = 0.5774\ \pi\ E\ d\ /\ \ln[((1.155\ t + d_w - d_h)(d_w + d_h))/((1.155\ t + d_w + d_h)(d_w - d_h))]$
Load factor, the share of the working load the bolt sees	$\Phi = n\ k_S/(k_S + k_P)$
Preload lost to embedding (settling of the interfaces)	$F_Z = f_Z\ (k_S\ k_P)/(k_S + k_P)$
Residual clamp at the interface under the working load	$F_{KR} = \max(F_{M,min} - (1 - \Phi)\ F_A - F_Z, 0)$
Maximum bolt load, the whole working load once the joint opens	$F_{S,max} = \max(F_M + \Phi\ F_A, F_A)$
Working equivalent stress in the bolt, tension with half the tightening torsion	$\sigma_{red} = \sqrt{(\sigma_z^2 + 3\ (0.5\ \tau)^2)}$
Fatigue stress amplitude in the thread	$\sigma_a = (F_{S,max} - F_M)/(2\ A_s)$
Thread engagement length needed against stripping	$m_{min} = S\ F_{S,max}/(0.5\ \pi\ d\ \tau_B)$

Basis: Systematic calculation of highly stressed bolted joints — calculation steps R0–R13[1](§5.1–§5.5); Tensile stress area of the thread[2](§9.1.6); Joint stiffness (frusta); preload and torque[3](§8-5, §8-7).

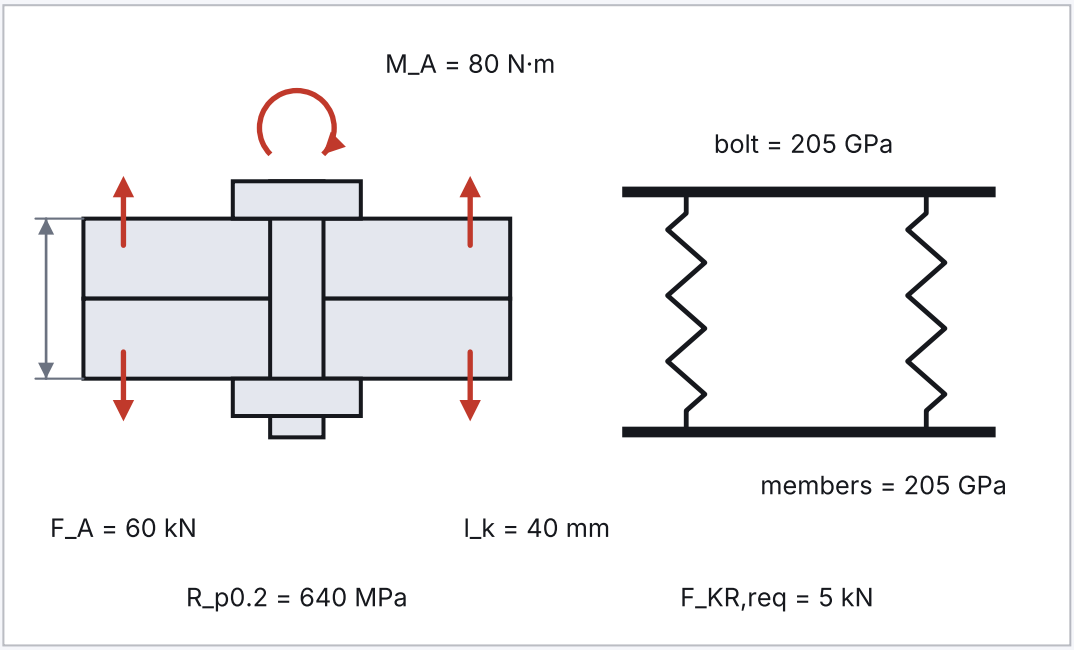


Figure 1 — A preloaded bolt clamping two members, the working load pulling them apart; beside it, bolt and members as two springs in parallel. Not to scale; the labels are the inputs as entered.

2. Inputs

SYMBOL	DESCRIPTION	VALUE	UNIT	SOURCE	VALID RANGE
d	Nominal thread diameter	12	mm	drawing: DRG-FLG-02 rev A	3 … 64 mm
P	Thread pitch	1.75	mm	spec: ISO 261 coarse pitch	0.35 … 6 mm
R_p02	Bolt 0.2 % proof (yield) strength	640	MPa	spec: ISO 898-1 class 8.8	200 … 1200 MPa
E_S	Bolt Young's modulus	205	GPa	spec: steel	60 … 250 GPa
sigma_A	Bolt endurance limit (stress amplitude)	50	MPa	assumption: Rolled-before-heat-treatment M12, VDI 2230 order of magnitude.	10 … 200 MPa
l_k	Clamp length	40	mm	drawing: DRG-FLG-02 rev A	1 … 2000 mm
d_h	Hole diameter	13	mm	drawing: DRG-FLG-02 rev A	1 … 100 mm
d_w	Head / washer bearing diameter	18	mm	spec: ISO 4762 head bearing	2 … 200 mm
E_P	Clamped members' Young's modulus	205	GPa	spec: steel	5 … 250 GPa
n	Load introduction factor (0 = at the clamped faces, 1 = under the head)	0.5		assumption: Load introduced at mid-thickness.	0 … 1
f_Z	Embedding (settling) loss	11	µm	assumption: Three interfaces, machined.	0 … 100 µm

SYMBOL	DESCRIPTION	VALUE	UNIT	SOURCE	VALID RANGE
method	Preload method	friction		spec: Assembly procedure AP-7	any
M_A	Tightening torque	80	N·m	spec: Assembly procedure AP-7	0.1 … 10000 N·m
K	Nut factor (nut-factor method)	0.2		assumption: Not used by the friction method.	0.1 … 0.35
mu_G	Thread friction coefficient	0.12		assumption: Lightly oiled zinc-plated thread.	0.06 … 0.25
mu_K	Head / nut bearing friction coefficient	0.12		assumption: Lightly oiled head bearing.	0.06 … 0.25
alpha_A	Tightening scatter factor (F_M,max / F_M,min)	1.6		assumption: Torque wrench, VDI 2230 Table A8 order.	1 … 4
F_A	Axial working load (per bolt)	60	kN	spec: LOAD-CASE-3	0 … 5000 kN
F_KR_req	Required residual clamp force	5	kN	spec: SPEC-FLG §6 sealing	0 … 5000 kN
tau_B	Nut / internal-thread material shear strength	400	MPa	assumption: Nut material shear strength.	50 … 1200 MPa
m_eff	Thread engagement length provided	12	mm	drawing: DRG-FLG-02 rev A	1 … 200 mm
S_strip	Safety factor on stripping	1.25		assumption: Stripping safety factor.	1 … 3

3. Assumptions

A1. The joint is concentrically clamped and concentrically loaded; the members behave as two 30° frusta in series. (Eccentric clamping and loading (VDI 2230 full procedure) are outside this sheet.)
A2. Thread torsion is taken at 50 % in the equivalent stress for the working state. (Common VDI 2230 practice (k_τ = 0.5).)
A3. The working load is a pulsating 0…F_A load; the fatigue amplitude is Φ F_A / (2 A_s). (Compare with the bolt's endurance limit as entered.)
A4. Thread stripping uses a shear area of half the pitch per unit length on the nominal diameter. (A conservative simplification of ISO 898-2 / VDI 2230 §5.5.5.)
A5. sigma_A (Bolt endurance limit (stress amplitude)) is taken as 50 MPa. (Rolled-before-heat-treatment M12, VDI 2230 order of magnitude.)
A6. n (Load introduction factor (0 = at the clamped faces, 1 = under the head)) is taken as 0.5. (Load introduced at mid-thickness.)
A7. f_Z (Embedding (settling) loss) is taken as 11 µm. (Three interfaces, machined.)
A8. K (Nut factor (nut-factor method)) is taken as 0.2. (Not used by the friction method.)
A9. mu_G (Thread friction coefficient) is taken as 0.12. (Lightly oiled zinc-plated thread.)
A10. mu_K (Head / nut bearing friction coefficient) is taken as 0.12. (Lightly oiled head bearing.)
A11. alpha_A (Tightening scatter factor (F_M,max / F_M,min)) is taken as 1.6. (Torque wrench, VDI 2230 Table A8 order.)
A12. tau_B (Nut / internal-thread material shear strength) is taken as 400 MPa. (Nut material shear

strength.)
A13. S_strip (Safety factor on stripping) is taken as 1.25. (Stripping safety factor.)

4. Working

[23] d_2 = d - 0.6495 * P [2](§9.1.6)
= 12 mm − 0.6495 × 1.75 mm
= 10.863 mm
Pitch diameter

[24] d_3 = d - 1.2269 * P [2](§9.1.6)
= 12 mm − 1.2269 × 1.75 mm
= 9.8529 mm
Minor diameter

[25] A_s = pi / 4 * ((d_2 + d_3) / 2)^2 [2](§9.1.6)
= π / 4 × ((10.863 mm + 9.8529 mm) / 2)^2
= 84.266 mm²
Tensile stress area

[26] A_N = pi / 4 * d^2
= π / 4 × (12 mm)^2
= 113.1 mm²
Nominal shank area

[27] A_d3 = pi / 4 * d_3^2
= π / 4 × (9.8529 mm)^2
= 76.247 mm²
Minor-diameter area

[28] D_Km = (d_w + d_h) / 2
= (18 mm + 13 mm) / 2
= 15.5 mm
Mean bearing diameter under the head

[29] F_M = M_A / (0.16 * P + 0.58 * d_2 * mu_G + 0.5 * D_Km * mu_K) [1](§5.4.3)
= 80 N·m / (0.16 × 1.75 mm + 0.58 × 10.863 mm × 0.12 + 0.5 × 15.5 mm × 0.12)
= 40.69 kN
Assembly preload (friction)

[30] F_M_min = F_M / alpha_A [1](R2)
= 40.69 kN / 1.6
= 25.431 kN
Minimum preload after scatter

[31] sigma_M = F_M / A_s
= 40.69 kN / 84.266 mm²
= 482.87 MPa
Preload stress

[32] M_G = F_M * (0.16 * P + 0.58 * d_2 * mu_G) [1](§5.4.3)
= 40.69 kN × (0.16 × 1.75 mm + 0.58 × 10.863 mm × 0.12)
= 42.158 N·m
Thread torque under preload

[33] W_p = pi / 16 * d_3^3
= π / 16 × (9.8529 mm)^3
= 187.81 mm³
Polar section modulus at the minor diameter

[34] tau_M = M_G / W_p
= 42.158 N·m / 187.81 mm³
= 224.47 MPa
Thread torsional stress under preload

[35] sigma_red_M = sqrt(sigma_M^2 + 3 * tau_M^2) [1](R8)
= sqrt((482.87 MPa)^2 + 3 × (224.47 MPa)^2)
= 619.94 MPa
Equivalent stress at assembly (full torsion)
[36] nu_M = sigma_red_M / R_p02
= 619.94 MPa / 640 MPa
= 0.96866
Utilisation of proof strength at assembly
[37] delta_S = 0.4 * d / (E_S * A_N) + l_k / (E_S * A_s) + 0.5 * d / (E_S * A_d3) + 0.4 * d / [1](B5.1.1)
= 0.4 × 12 mm / (205 GPa × 113.1 mm²) + 40 mm / (205 GPa × 84.266 mm²) + 0.5 × 12 mm / (205 G
76.247 mm²) + 0.4 × 12 mm / (205 GPa × 113.1 mm²)
= 0.0000031135 m/kN
Bolt resilience (head, shank, engaged thread, nut)
[38] k_S = 1 / delta_S
= 1 / 0.0000031135 m/kN
= 321190 kN/m
Bolt stiffness
[39] t_f = l_k / 2
= 40 mm / 2
= 20 mm
Frustum height (two equal frusta)
[40] k_f = 0.5774 * pi * E_P * d / ln(((1.155 * t_f + d_w - d_h) * (d_w + d_h)) / ((1.155 * t
(d_w - d_h))) [3](eq. 8-20)
= 0.5774 × π × 205 GPa × 12 mm / ln((1.155 × 20 mm + 18 mm − 13 mm) × (18 mm + 13 mm) / ((1.1
mm + 18 mm + 13 mm) × (18 mm − 13 mm)))
= 3815600 kN/m
Stiffness of one frustum
[41] k_P = k_f / 2 [3](eq. 8-21)
= 3815600 kN/m / 2
= 1907800 kN/m
Clamped members' stiffness (two frusta in series)
[42] Phi = n * k_S / (k_S + k_P) [1](R3)
= 0.5 × 321190 kN/m / (321190 kN/m + 1907800 kN/m)
= 0.072047
Load factor
[43] F_Z = f_Z * (k_S * k_P) / (k_S + k_P) [1](R4)
= 11 µm × 321190 kN/m × 1907800 kN/m / (321190 kN/m + 1907800 kN/m)
= 3.024 kN
Preload loss from embedding
[44] F_SA = Phi * F_A
= 0.072047 × 60 kN
= 4.3228 kN
Additional bolt load from the working load
[45] F_PA = (1 - Phi) * F_A
= (1 − 0.072047) × 60 kN
= 55.677 kN
Load relieved from the members
[46] F_KR = max(F_M_min - F_PA - F_Z, 0 kN) [1](R7)
= max(25.431 kN − 55.677 kN − 3.024 kN, 0 kN)
= 0 kN
Residual clamp force (minimum; zero once the joint opens)
[47] F_S_max = max(F_M + F_SA, F_A)
= max(40.69 kN + 4.3228 kN, 60 kN)
= 60 kN

Maximum bolt load (maximum preload + additional load; the whole working load once the joint opens)

```
[48] sigma_z_max = F_S_max / A_s
= 60 kN / 84.266 mm²
= 712.03 MPa
```

Maximum bolt tensile stress

```
[49] sigma_red_B = sqrt(sigma_z_max^2 + 3 * (0.5 * tau_M)^2)
= sqrt((712.03 MPa)^2 + 3 × (0.5 × 224.47 MPa)^2)
= 738.09 MPa
```

[1](R8)

Equivalent stress in the working state (50 % torsion)

```
[50] u_yield = sigma_red_B / R_p02
= 738.09 MPa / 640 MPa
= 1.1533
```

Yield utilisation in the working state

```
[51] sigma_a = (F_S_max - F_M) / (2 * A_s)
= (60 kN - 40.69 kN) / (2 × 84.266 mm²)
= 114.58 MPa
```

[1](R9)

Fatigue stress amplitude (pulsating 0...F_A load)

```
[52] u_fatigue = sigma_a / sigma_A
= 114.58 MPa / 50 MPa
= 2.2916
```

Fatigue utilisation

```
[53] m_min = S_strip * F_S_max / (0.5 * pi * d * tau_B)
= 1.25 × 60 kN / (0.5 × π × 12 mm × 400 MPa)
= 9.9472 mm
```

[1](§5.5.5)

Thread engagement needed against stripping

```
[54] u_strip = m_min / m_eff
= 9.9472 mm / 12 mm
= 0.82893
```

Engagement utilisation

```
[55] F_A_sep = (F_M_min - F_Z) / (1 - Phi)
= (25.431 kN - 3.024 kN) / (1 - 0.072047)
= 24.147 kN
```

[1](R7)

Working load at which the members separate (minimum preload, after embedding)

```
[56] F_proof = R_p02 * A_s
= 640 MPa × 84.266 mm²
= 53.93 kN
```

Bolt load at the proof (yield) strength

```
[57] n_0 = F_A_sep / F_A
= 24.147 kN / 60 kN
= 0.40245
```

Load factor against separation (F_A,sep / F_A)

```
[58] F_A_yield = min((F_proof - F_M) / Phi, F_proof)
= min((53.93 kN - 40.69 kN) / 0.072047, 53.93 kN)
= 53.93 kN
```

Working load at which the bolt reaches its proof load (separation included)

```
[59] n_L = F_A_yield / F_A
= 53.93 kN / 60 kN
= 0.89884
```

Load factor against axial yield of the bolt, torsion excluded

5. Results

SYMBOL	VALUE	DESCRIPTION
n_0	0.40245	Load factor against separation

SYMBOL	VALUE	DESCRIPTION
n_L	0.89884	Load factor against axial yield
A_s	84.266 mm²	Tensile stress area
F_M	40.69 kN	Assembly preload (maximum)
F_M_min	25.431 kN	Minimum preload
sigma_M	482.87 MPa	Preload stress
nu_M	0.96866	Assembly utilisation of proof strength
k_S	321190 kN/m	Bolt stiffness
k_P	1907800 kN/m	Members' stiffness
Phi	0.072047	Load factor
F_Z	3.024 kN	Embedding loss
F_SA	4.3228 kN	Additional bolt load
F_KR	0 kN	Residual clamp
F_A_sep	24.147 kN	Separation load
F_S_max	60 kN	Maximum bolt load
sigma_z_max	712.03 MPa	Maximum bolt tensile stress
sigma_red_B	738.09 MPa	Working equivalent stress
sigma_a	114.58 MPa	Fatigue amplitude
m_min	9.9472 mm	Engagement needed

6. Checks (governing first)

RESULT	CHECK	DEMAND	CAPACITY	UTILISATION	REF
FAIL	No separation	0 kN	> 0 kN	—	[1](R7)
FAIL	Residual clamp against requirement	0 kN	≥ 5 kN	—	[1](R7)
FAIL	Fatigue amplitude	u_fatigue = 2.2916	u_fatigue ≤ 1	2.29	[1](R9)
FAIL	Yield in the working state	u_yield = 1.1533	u_yield ≤ 1	1.15	[1](R8)
PASS	Thread stripping	u_strip = 0.82893	u_strip ≤ 1	0.829	[1](§5.5.5)

7. Applicability

WARNING — preload-yield: M_A: the preload alone takes the bolt above 90 % of its proof strength.
WARNING — separation: F_KR: the residual clamp force is not positive; the joint separates under the working load and the bolt carries all of it.

8. Verification

Template mech.bolted-joint@1.1.1 Content hash b62d38a48d8639fd Engine calc-engine/1.0.0
Known-answer cases passed 5/5 Test run 2026-10-23 12:00 UTC TempestOS 0.26.0

9. References

1. Verein Deutscher Ingenieure. Systematic Calculation of Highly Stressed Bolted Joints: Joints With One Cylindrical Bolt. VDI 2230 Part 1:2015. Beuth Verlag; 2015.
2. International Organization for Standardization. Mechanical Properties of Fasteners Made of Carbon Steel and Alloy Steel—Part 1: Bolts, Screws and Studs With Specified Property Classes—Coarse Thread and Fine Pitch Thread. ISO 898-1:2013. ISO; 2013.
3. Budynas RG, Nisbett JK. Shigley's Mechanical Engineering Design. 11th ed. McGraw-Hill Education; 2020.