
Solar ESS Co., Ltd.
53 Moo 2, Nang Lae, Mueang, Chiang Rai 57100, Thailand
Tel. 063 151 6694, 089 632 5829 · LINE: solaress1
www.solaress.org · www.โซลาร์เอสส์.com

MONTHLY REPORT · OCTOBER 2026 · HUAWEI FUSIONSOLAR

Plant report: 5.12 kWp community health center

Rooftop grid-tied solar with panel optimizers · Chiang Mai province · full production review since March 2025

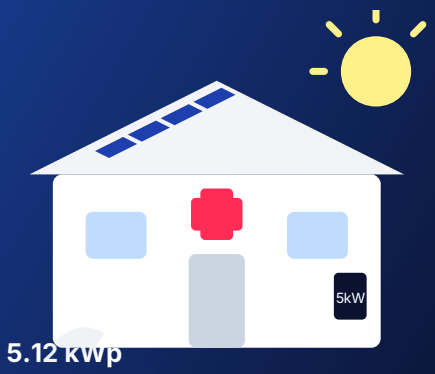

VERDICT

Healthy plant, no outages in 589 days

Zero alarms and not a single day without production since 18 March 2025. Yield of 1,403 kWh per kWp in the last 12 months is good for northern Thailand.

ACTION

Clean the panels before the dry season

Clear-day output in April–August 2026 was 5–10% below the same days in 2025, the pattern of dust building up on the panels.

At a glance

LIFETIME YIELD
11,757 kWh
18 Mar 2025 – 29 Oct 2026

LAST 12 MONTHS
7,183 kWh
1,403 kWh/kWp · 3.84 per day


USED ON SITE
97%
only 334 kWh sent to grid

OUTAGE DAYS
0
lowest day 5.2 kWh (rain)

BEST DAY
29.6 kWh
22 May 2025

CO_2 AVOIDED
5.6 t
since commissioning

Monthly yield: 2025 and 2026

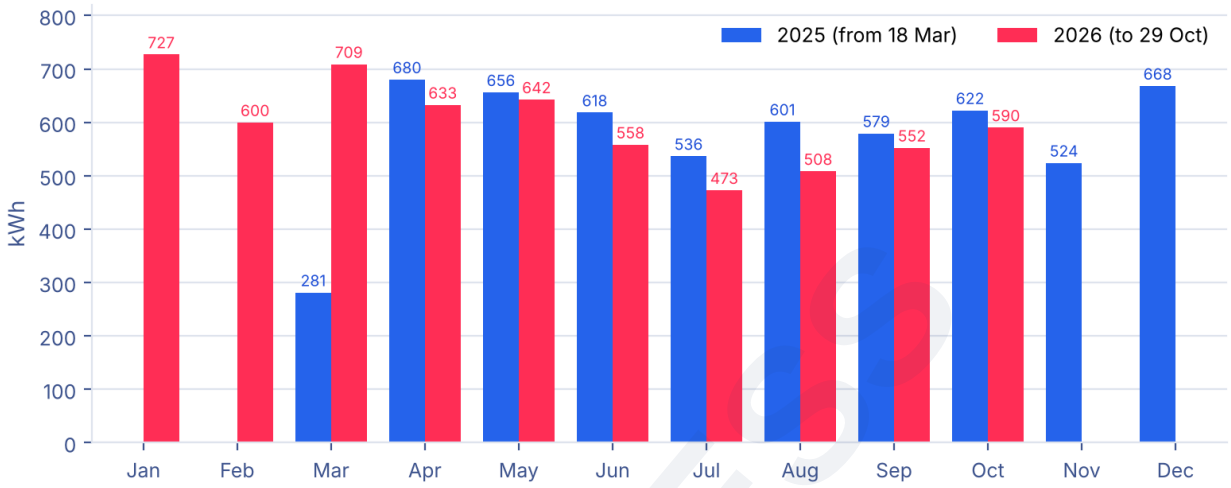


Month	2025	2026	Change
April	680	633	−7%
May	656	642	−2%
June	618	558	−10%
July	536	473	−12%
August	601	508	**−15%**
September	579	552	−5%
October (per day)	20.1	21.1	+5%

SOLAR ESS
www.solaress.org


Every day since commissioning

Each square is one day. Pink and amber are strong solar days; navy and blue are cloudy or rainy days. The dry season (December–March) is the most even; the monsoon months scatter between 6 and 25 kWh.

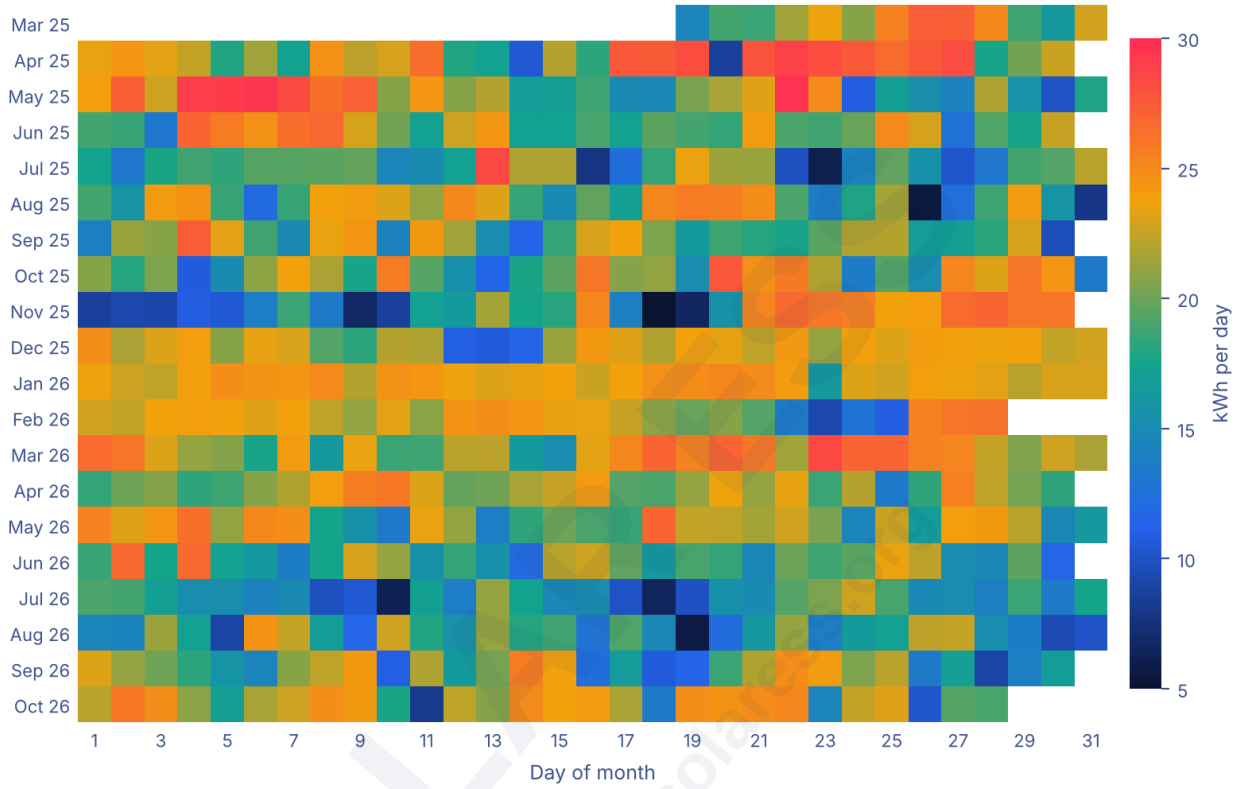


Clear-day output: the dust check

Cloud lowers the average, but not the best days. Taking the three best days of each month removes most of the weather effect. In April–August 2026 the best days came in 5–10% below 2025, and recovered in September–October after the rain washed the panels.

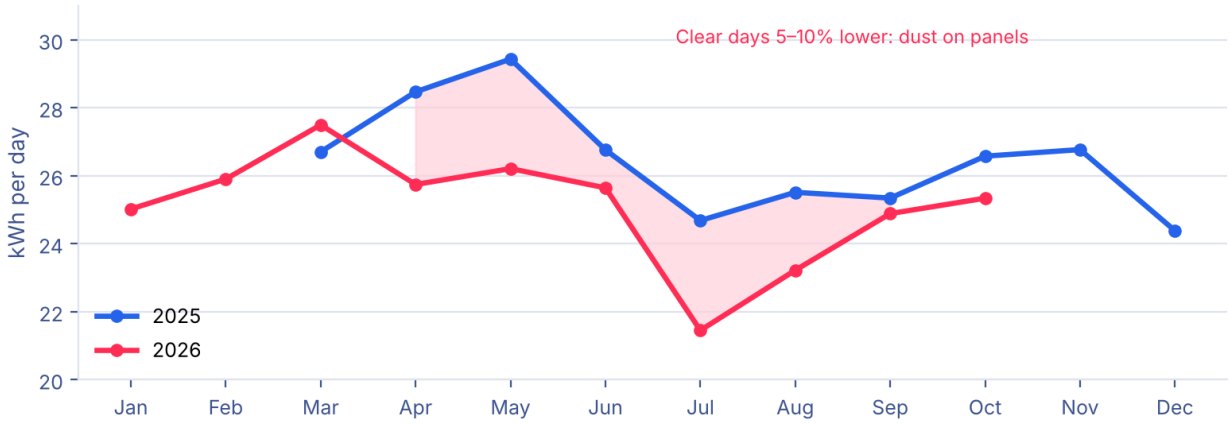

Where the building's electricity comes from

The building uses 1,300–1,700 kWh a month. Solar covers about 45% of it; the rest is bought from PEA. Almost nothing is exported, so every extra kWh of solar would replace grid power.

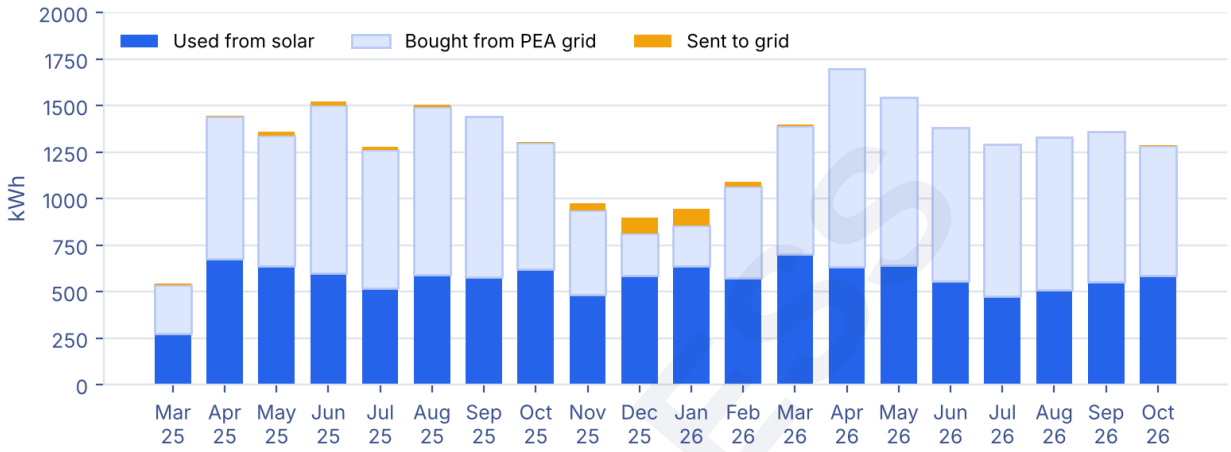

Recommendations

1 · NOW
Clean the panels
Before the dry season, to bring best days back to 28+ kWh

2 · SAME VISIT
Check each panel
Optimizer view at midday: one panel lagging means a fault, not dust

3 · NEXT STEP
Add capacity
About 10 kWp could roughly halve the power bought from PEA

Data from Huawei FusionSolar monitoring, read on 29 October 2026. Site name and location removed. For a system check, panel cleaning or an expansion, book a consultation at www.solaress.org or LINE: solaress1.

Sources: Huawei FusionSolar