Solar ESS Co. Ltd.
53 Moo 2 Tambon Nanglae, Amphoe Muang
Chiang Rai 57100, Thailand
Tel 063 151 6694, 089 429 6832
www.solaress.org · LINE: solaress1

Results after the settings change

October 2026 Monthly Report · part 3 of 3 · 28 October 2026

This report is part of a series

1 · Fleet review
25 Oct 2026
15 plants reviewed; settings found that waste solar every day

2 · Settings applied
25 Oct 2026
Changes made remotely at three of those plants

3 · Results
28 Oct 2026
This report: three days before and three days after the change

On 25 October 2026 Solar ESS changed inverter settings at three plants (part 2). This report compares the three days before the change (22–24 October) with the three days after (25–27 October), using the daily totals and the battery charge level from the monitoring system. Three days is a short test: the weather and how many people were in each building changed too, so we say where a result is clear and where it is not yet. Site names, exact locations and serial numbers are removed.

Summary

Plant	What we changed	Before (22–24 Oct)	After (25–27 Oct)	Result
Office (5 kWp)	Solar Sell off	15.8 kWh/day exported	0 kWh/day exported	**Worked**
Villa A, Koh Samui	Battery floors 50 → 20 %, 150 A, load first	Battery stopped at 50 % in the evening; 17.6 kWh bought on 24 Oct	28 kWh from the battery and 4.7 kWh bought on 25 Oct (similar use); villa nearly empty 26–27 Oct	**Worked – battery stops at 35 %**
Residence, Chiang Mai	Evening/night Time-of-Use slots 40/100 → 20 %	Battery idle after 22:00; grid ≈0.7 kW	Battery covers 22:00–24:00; 1.4 kWh bought on 25 Oct; cloudy 26 Oct	**Partly clear – check battery**

What happens next


- Office: working as intended. A small battery would let the solar that is now held back cover evening use; we will offer a sizing.
- Villa A: the battery stops at about 35 % instead of 20 %. We will read the inverter's battery settings again (read only) and check the battery management system.
- Residence: the battery charge level dropped suddenly from 35 % to 7 % during the night of 25–26 October. We will check the battery management system and its charge-level calibration.
- The November fleet review will repeat this comparison over a full month.

Figures are daily totals and charge levels read from the monitoring system on 28 October 2026. Three days before and after are a short test; weather and occupancy differ from day to day.

Solar ESS Co. Ltd.
53 Moo 2 Tambon Nanglae, Amphoe Muang
Chiang Rai 57100, Thailand
Tel 063 151 6694, 089 429 6832
www.solaress.org · LINE: solaress1

Office (5 kWp)

5 kW single-phase hybrid inverter · no battery · office, export not paid

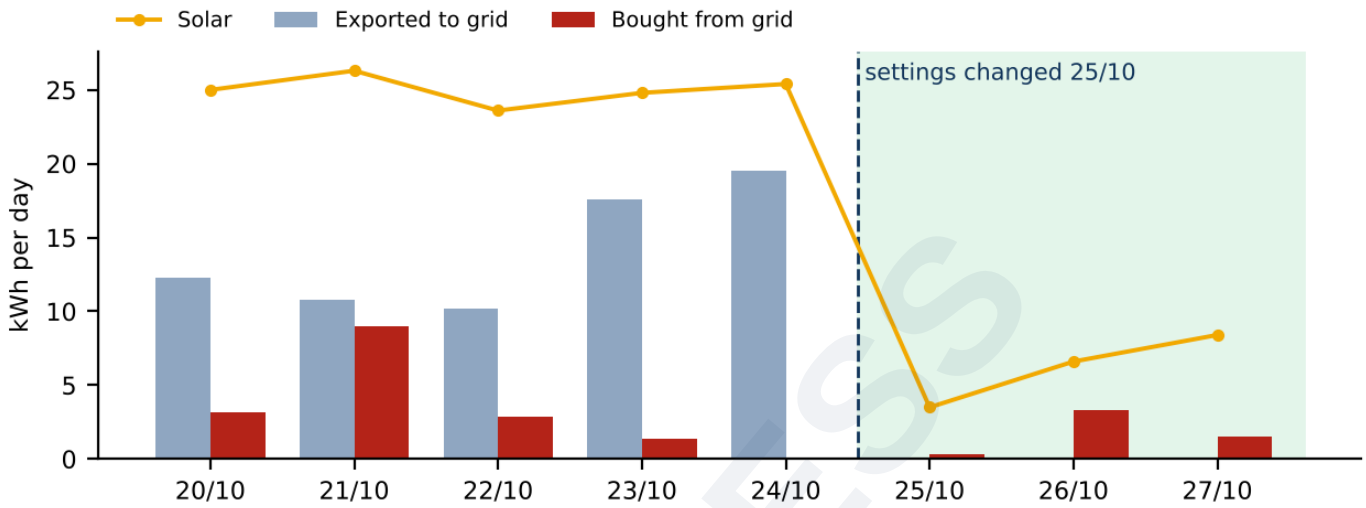

What the data shows

- Export stopped completely: 10.2, 17.6 and 19.5 kWh on 22–24 October, then 0, 0 and 0 kWh on 25–27 October.
- Solar production now follows the office load: 3.5 kWh on Sunday 25 October and 6.6–8.4 kWh on the working days after, against about 25 kWh before.
- Grid purchase stayed small (0.3–3.3 kWh a day), so the change cost the office nothing.


Verdict: Worked as intended. About 15–20 kWh a day of solar is now held back instead of being given away; a small battery could store it for the evening.

SOLAR ESS
www.solaress.org

Solar ESS Co. Ltd.
53 Moo 2 Tambon Nanglae, Amphoe Muang
Chiang Rai 57100, Thailand
Tel 063 151 6694, 089 429 6832
www.solaress.org · LINE: solaress1

Villa A, Koh Samui

20 kW three-phase hybrid inverter · 41 kWh lithium battery · holiday villa

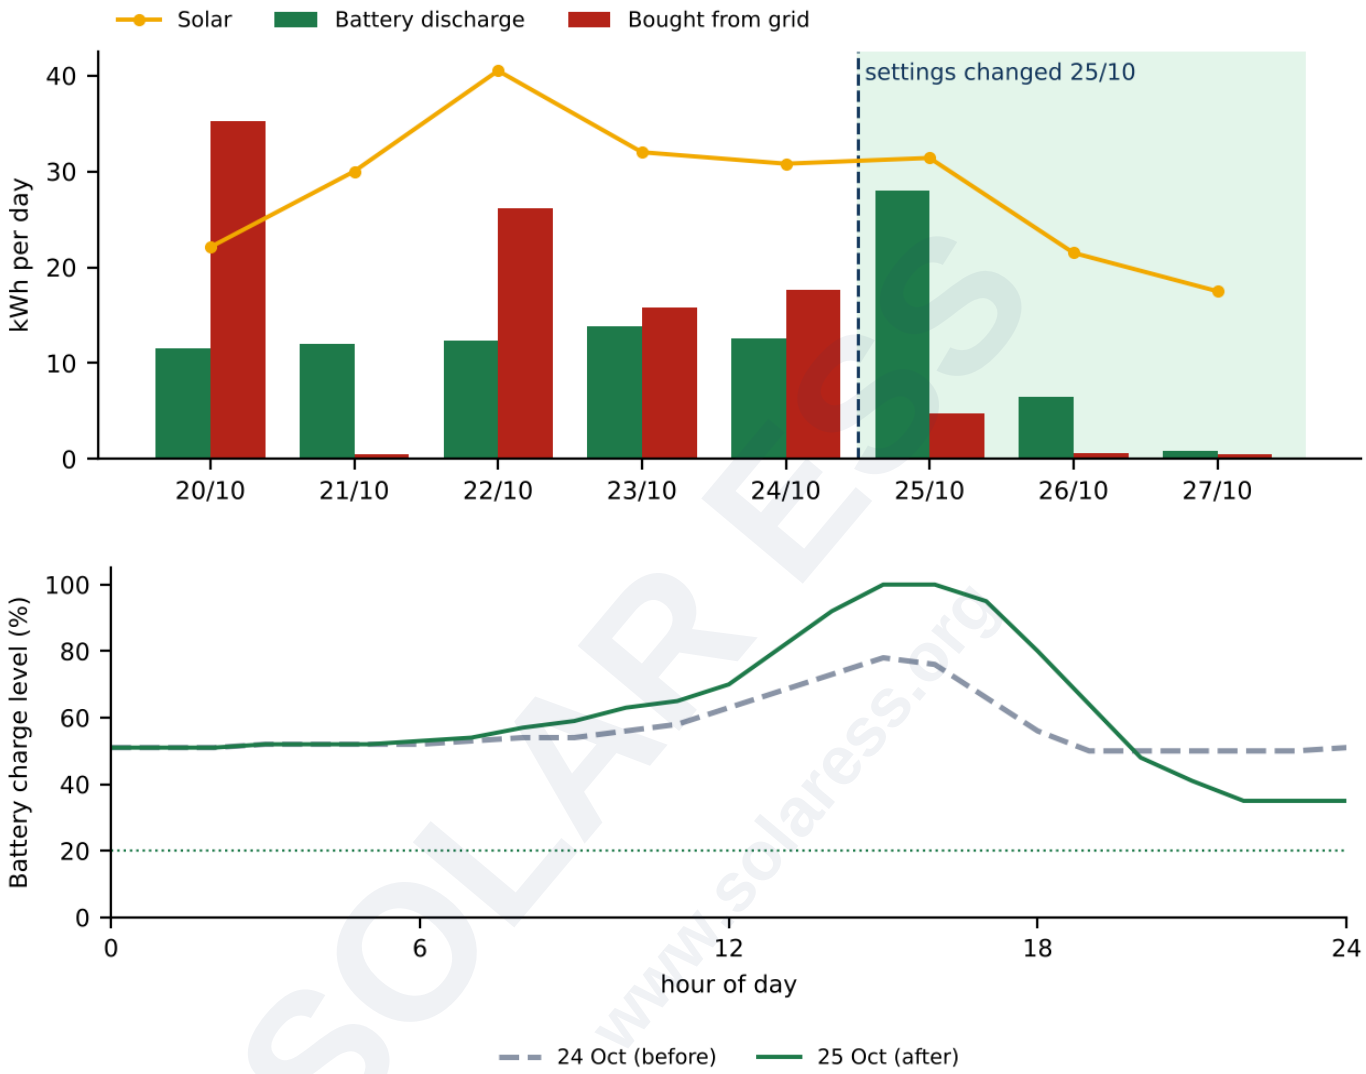

What the data shows


- Before: on 24 October the battery stopped at 50 % at about 19:00 and the villa drew 2.3–3.9 kW from the grid until about 22:00. It bought 17.6 kWh that day.
- After: on 25 October, with similar use (41.8 kWh against 47.7 kWh), the battery charged to 100 % by 15:00, then supplied about 6.5 kW from 17:00 to 21:00. Battery discharge rose from 12.6 to 28 kWh, and grid purchase fell to 4.7 kWh.
- On 26–27 October the villa was nearly empty (11.7 and 4.5 kWh used), so those days say little.
- The battery stopped at about 35 % instead of the new 20 % floor, so about 6 kWh of the battery is still unused each night.

Verdict: Worked: about 13 kWh a day less grid on an occupied day. Still to check: why the battery stops at 35 %.

Solar ESS Co. Ltd.
53 Moo 2 Tambon Nanglae, Amphoe Muang
Chiang Rai 57100, Thailand
Tel 063 151 6694, 089 429 6832
www.solaress.org · LINE: solaress1

Residence, Chiang Mai

5 kW single-phase hybrid inverter · 32 kWh lithium battery · family home

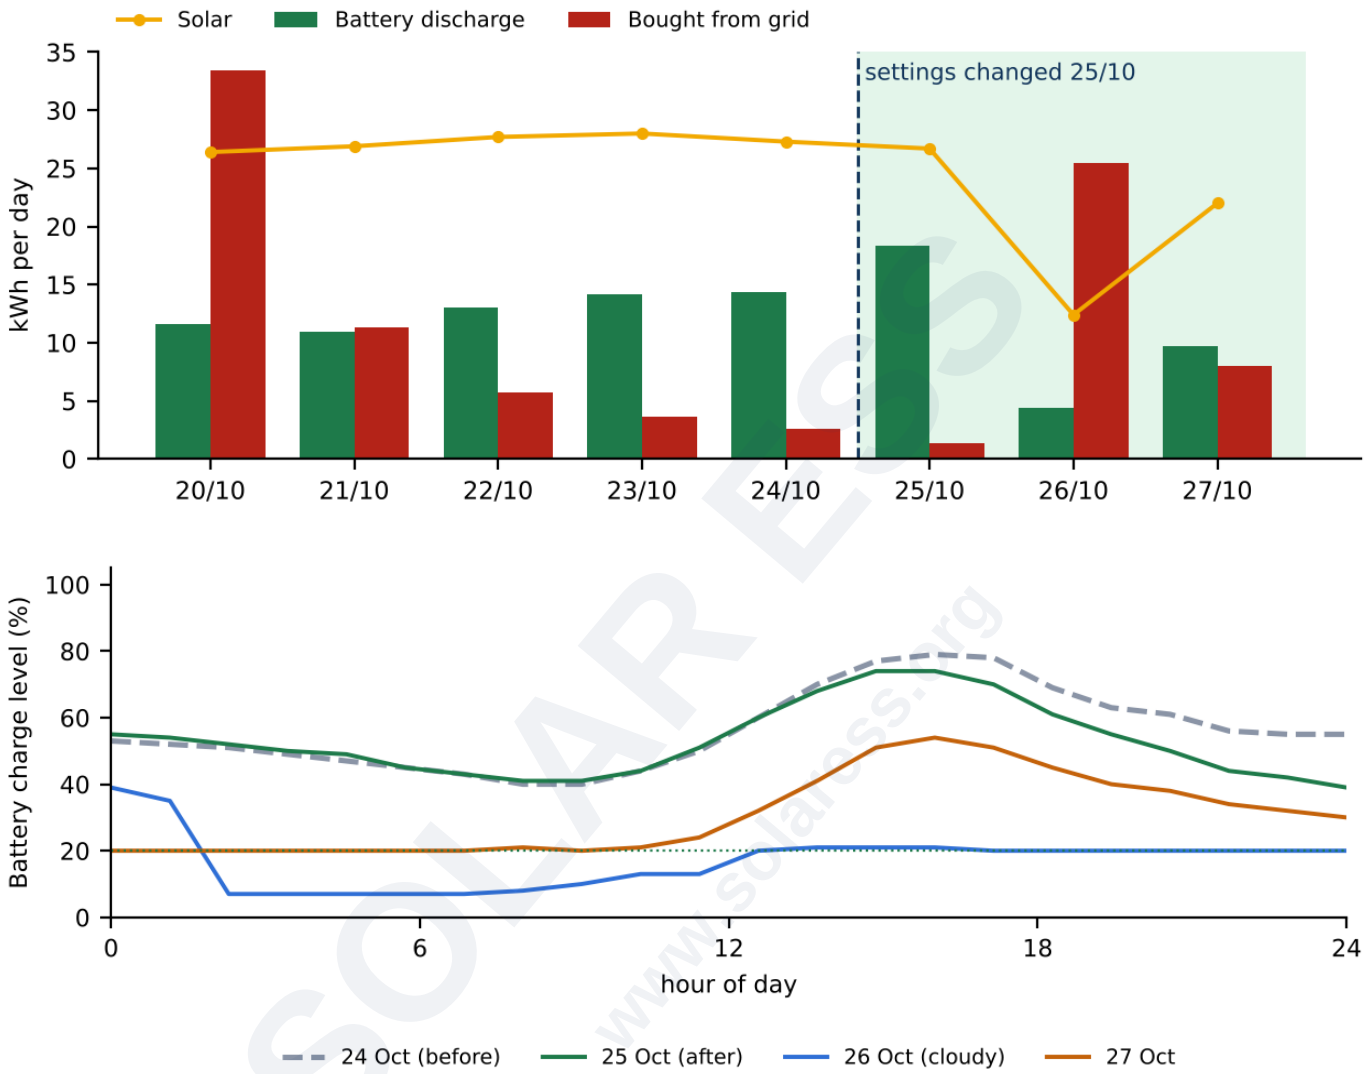

What the data shows

- Before: on 24 October the battery stopped discharging at about 22:00 at 55 %, and the house drew about 0.7 kW from the grid until midnight.
- After: on 25 October the battery kept supplying about 0.7 kW after 22:00, and the grid fell to almost zero. Grid purchase that day was 1.4 kWh, against 2.6–5.7 kWh on 22–24 October.
- 26 October was cloudy (12.4 kWh of solar against about 27 kWh), so the battery could not recharge and the house bought 25.5 kWh. 27 October was partly cloudy (22 kWh solar; 8 kWh bought).
- In the early hours of 26 October the battery charge level dropped from 35 % to 7 % within an hour, below the 15 % shutdown level. This looks like the battery management system resetting its charge reading, not real use.

Verdict: The evening change works: the battery now covers 22:00–24:00. The weather made 26–27 October inconclusive, and the sudden drop to 7 % needs a battery check.