Solar ESS Co. Ltd.
53 Moo 2 Tambon Nanglae, Amphoe Muang
Chiang Rai 57100, Thailand
Tel 063 151 6694, 089 632 5829
www.solaress.org · LINE: solaress1

SOLAR ESS MONTHLY REPORT · OCTOBER 2026 · SOLISCLOUD · PLANT REPORT


Fix now

Café, Chiang Rai


Battery model error for 101 days

23.22 kWp · 15 kW 3-phase hybrid inverter · battery

1876	3.37	75%	26.9	0	19.8
kWh solar	kWh/kWp/day	solar share of use	kWh/day bought	kWh exported	kWh/day from battery

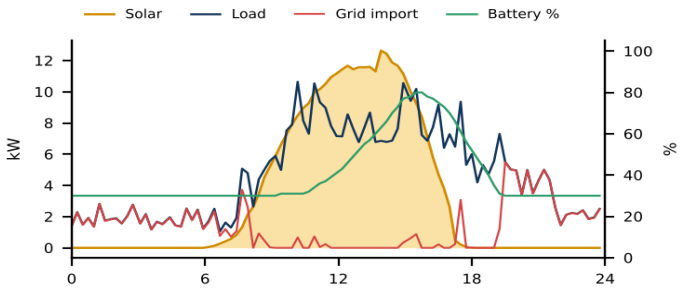

24 October, 5-minute data

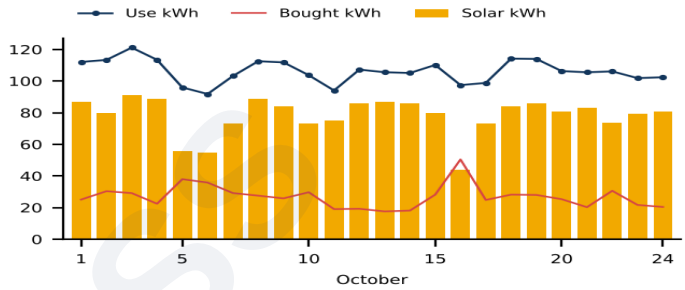

Daily totals, 1–24 October


What we found

• Active alarm 'BattChoose-Err' since 15 Jul 2026: the battery model selected in the inverter does not match the battery.
• The battery only works between 30% and 80% and never reaches full, so evening power is bought from the grid (27 kWh/day).
• 23.2 kWp on a 15 kW inverter – peak 12.6 kW, so clipping is small.

What to do

• Select the correct battery model in the inverter and restart it (as the alarm advises).
• Then set the battery low/overdischarge SOC to 20% so the full battery is used.
• Expected: 5–8 kWh/day less grid.

How this plant compares with the other SolisCloud plants (kWh per kWp per day, 1–24 Oct)

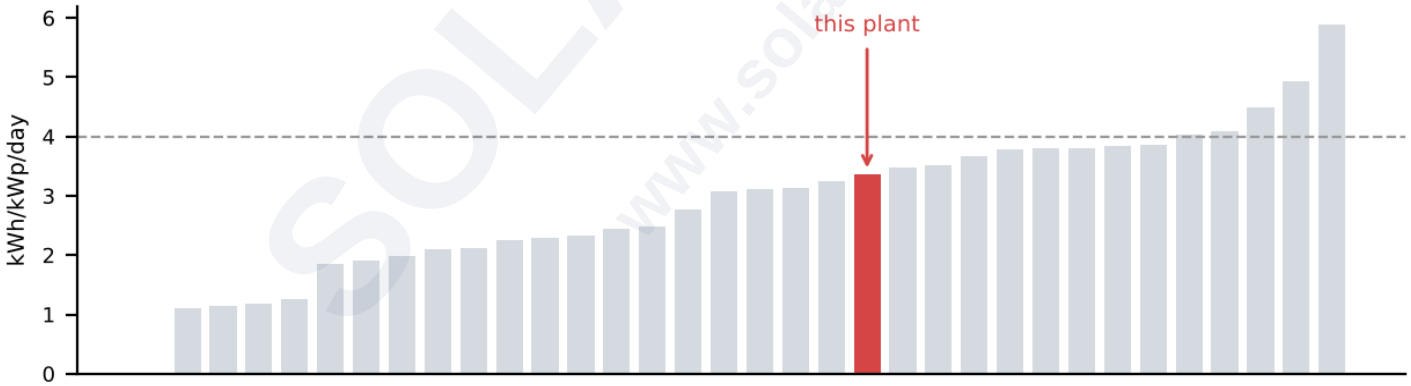

Rank 14 of 34 for yield per kWp. Dashed line ≈ 4.0, a typical clear month in the north and centre. A low yield is not always a fault – a full battery or little daytime load makes the inverter throttle the panels.

This plant report is part of the October 2026 SolisCloud fleet review on www.solaress.org (Technical → Monthly Report), which also lists the recommended standard settings. Figures are estimates from monitoring data; site name removed.