MILESTONE

INSPECTION STANDARD (HT LAB)

☐ Prototype ■ Pre-Launch ☐ Production		Date (Original)	19/01/2019
Part Name:- SPUR PINION 2ND	Part No.:- 93675580	Inspection Standard Number	SIP/4288/190
Customer :- TMTL	Change Level.:-00	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	**Surface Hardness**	∗	**58~62 HRC**	**Rockwell Hardness Tester**	1Pc/Lot	FMT-HT-39	A
2.	**ECD Measured To 550HV**	∗	**0.80~1.10 mm**	**Vicker Hardness Tester**	1Pc/Lot	FMT-HT-39	A
3.	**Core Hardness at PCD**	∗	**42 HRC Max.**	**Rockwell Hardness Tester**	1Pc/Lot	FMT-HT-39	A
4.	**Core Hardness at RCD**	∗	**30 HRC Min.**	**Rockwell Hardness Tester**	1Pc/Lot	FMT-HT-39	A
5.	**Micro Case**	∗	**Tempered Martensite + RA<12%, Carbide (Globular) Upto 2% Max.**	**Microscope**	1Pc/Lot	FMT-HT-39	A
6.	**Core Micro**	∗	**LCM+Baintic Structure, Ferrite Upto 5% Max.**	**Microscope**	1Pc/Lot	FMT-HT-39	A
7.	**IGO / NMTP**	∗	**20 Micron Max.**	**Microscope**	1Pc/Lot	FMT-HT-39	A

OPEN SKTCH

Material- 20MnCr5

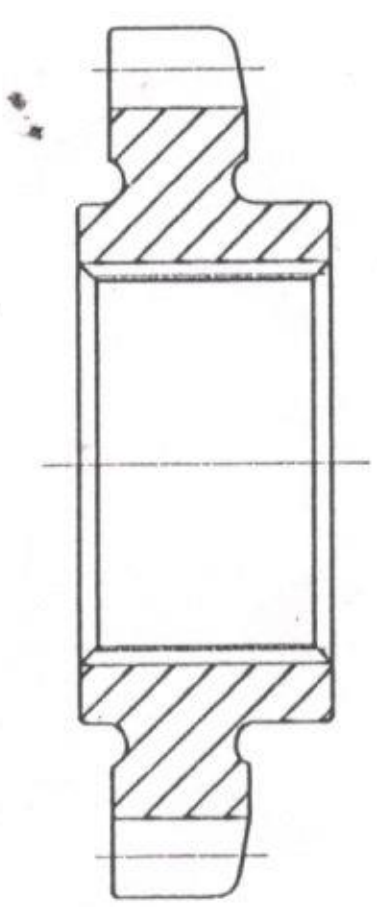

CONTROLLED COPY
SR NO 01
ISSUED TO Unit-7
DATE 25/7/22

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टेग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends:	➤ Special Characteristics as Per Drawing	∗ Special Characteristics For Process	⚠ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change