



INSPECTION STANDARD (HT LAB)

Page 01 of 01

☐ Prototype ☒ Pre-Launch ☐ Production Date (Original) 16/12/18



Part Name:- Spur Pinion H/L Part No.:- 1966121 Inspection Standard Number SIP/4282/190

Customer :- TMTL Change Level:-00 Part Stage HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	59~63 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD Measured To 550HV	*	0.60~0.90 mm	Micro VickerVicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	Core Hardness at PCD	*	42 HRC (Max.)	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	Core Hardness at RCD	*	30 HRC (Min.)	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
5.	Micro Case	*	Tempered Martensite + RA<12%, Carbide (Globular) Upto 2% Max.	Microscope	1Pc/Lot	FMT-HT-39	A
6.	Core Micro	*	LCM+Bainitic Structure, Ferrite Upto 5% Max.	Microscope	1Pc/Lot	FMT-HT-39	A
7.	IGO / NMTP	*	20 Micron Max.	Microscope	1Pc/Lot	FMT-HT-39	A

Space For Sketch:-

Material- 20MnCr5

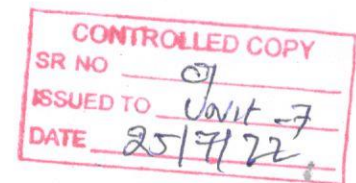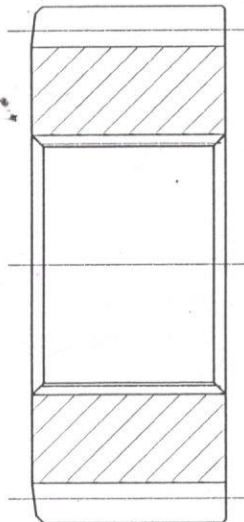

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends: ☒ Special Characteristics as Per Drawing ☒ * Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Prepared By: *M. D. J.*

Checked By: .

Approved By: *Sharma*