INSPECTION STANDARD (HT LAB)

(10Z)

☐ Prototype	☐ Pre-Launch	■ Production	Date (Original)	16/06/2022
Part Name:-Bull Pinion Shaft RH	Part No.:- 1810C20001		Inspection Standard Number	SIP/4508/190
Customer :- TAFE	Change Level.:-00		Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58~63 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD 526 HV 0.5 /516 HV 1	*	1.0~1.3 mm	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	Core Hardness	*	30~43 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	Micro Case	*	Tempered Martensite+ RA 15% Max.	Microscope	1Pc/Lot	FMT-HT-39	A
5.	Micro Core	*	LCTM+Bainitic	Microscope	1Pc/Lot	FMT-HT-39	A
6.	Surface Carbon Content	*	0.80~1.0%	Microscope	1Pc/Lot	FMT-HT-39	A

OPEN SKETCH

MATERIAL ;-EN353: BS970

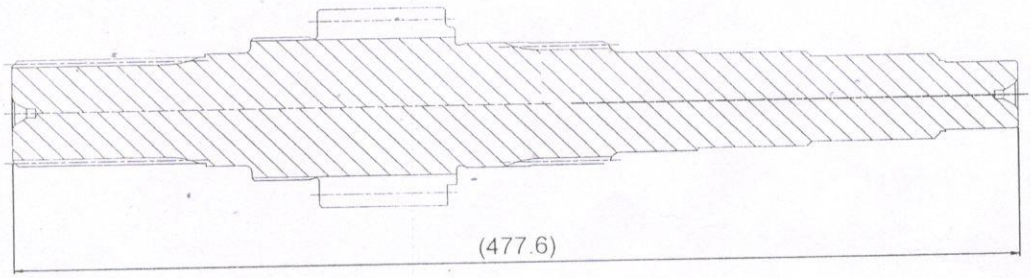

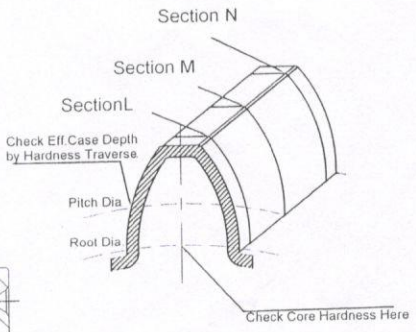

CONTROLLED COPY
SR NO. 01
ISSUED TO Unit-7
DATE 01/08/22

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टेग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends: Special Characteristics as Per Drawing | * Special Characteristics For Process | ⚠ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change