




INSPECTION STANDARD (HT LAB)

139

☐ Prototype		☐ Pre-Launch	☒ Production	Date (Original)		29-06-2022		
Part Name:- Through Shaft			Part No.:- 0.312.4207.00		Inspection Standard Number		SIP/4497/210	
Customer :- Comer Industries			Change Level.:-00		Part Stage		HT Lab.	
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan	
			Product Specification	Inspection Method	Inspection Frequency	Control Method		
1.	Surface Hardness	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report		A
2.	ECD Measured To HV1 550 Vickers On Root Dia Of Spline Located B/T Two Teeth Of a Cross Section Of The Spline Profile On Spline A	*	0.6mm~1.0 mm	Micro Vicker/Vicker Hardness Tester	1Pc/Lot	HT Lab Report		A
3.	ECD Measured To HV1 550 Vickers On Diameter Ø35 As Shown in Figure	*	0.6mm~1.0 mm	Micro Vicker/Vicker Hardness Tester	1Pc/Lot	HT Lab Report		A
4.	Core Hardness Checked On Perpendicular To The Carburized Layer At a Conventional Depth From The Outer Edge Of 5.0mm On Spline A	*	27~45 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report		A
5.	Core Hardness Checked On Perpendicular To The Carburized Layer At a Conventional Depth From The Outer Edge Of 5.0mm On Dia Ø35.0	*	27~45 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report		A
6.	Micro Case	*	Tempered Martensite + RA<20% Max	Microscope	1Pc/Lot	HT Lab Report		A
7.	Core Micro	*	LCM+Bainitic Structure	Microscope	1Pc/Lot	HT Lab Report		A

Space For Sketch:

Material- 20MnCr5

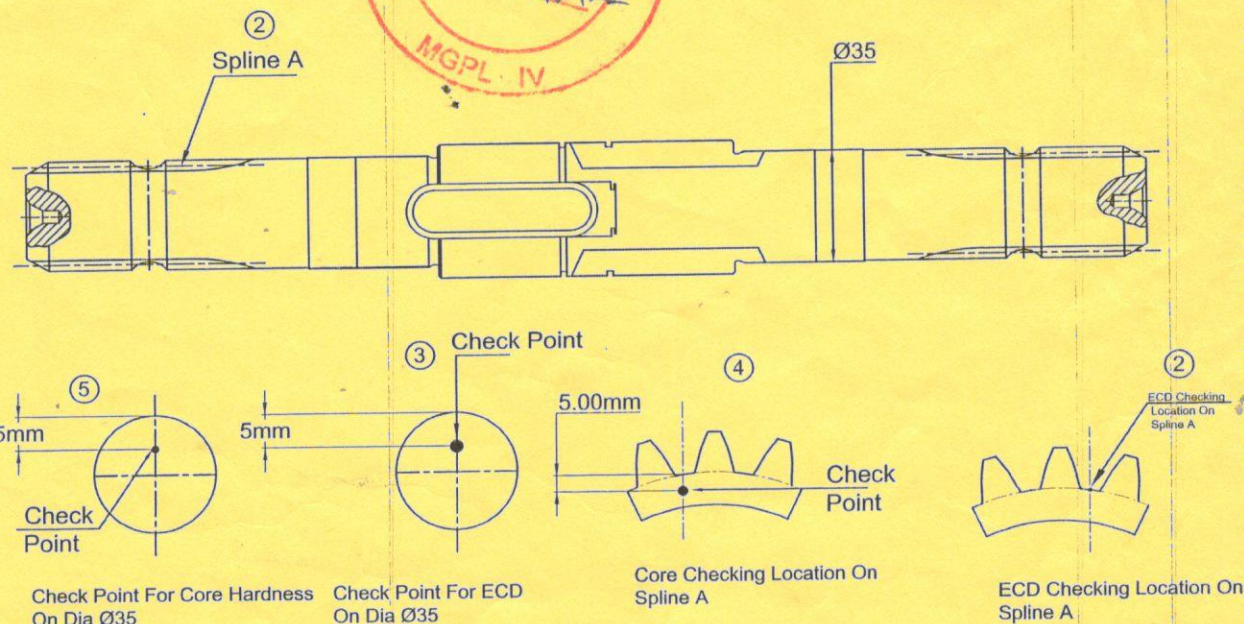

Reaction Plan: A-यदि Inspection करते समय कम्पौनेट खराब मिले तो खराब कम्पौनेट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में

Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change