
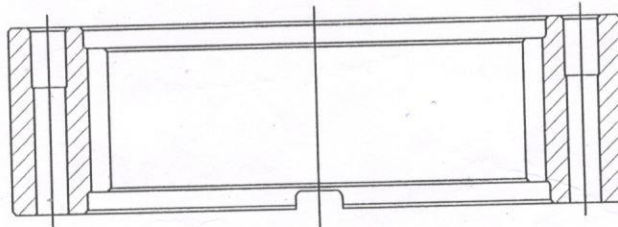


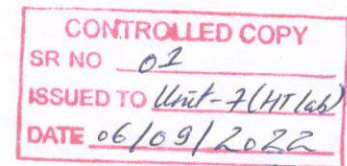

INSPECTION STANDARD (HT LAB)

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)		04/02/17		
Part Name:- Ring Gear-Epicyclic		Part No.:- 4252270M01 (A)		Inspection Standard Number		SIP/4194/180	
Customer :- TAFE		Change Level.:-A		Part Stage		HT Lab.	
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58~61 HRC	Rockwell Hardness Tester	1 Pc/Lot	FMT-HT-39	A
2.	ECD Measured To 550HV	*	0.50~0.75 mm	Vicker Hardness Tester	1 Pc/Lot	FMT-HT-39	A
3.	Surface Carbon Content	*	0.8/1.10%	Microscope	1 Pc/Lot	FMT-HT-39	A
4.	Core Hardness	*	30~43 HRC	Rockwell Hardness Tester	1 Pc/Lot	FMT-HT-39	A
5.	Micro Case	*	Tempered Martensite+ RA<15% Max.	Microscope	1 Pc/Lot	FMT-HT-39	A
6.	Core Micro	*	Bainitic Structure+LCTM	Microscope	1 Pc/Lot	FMT-HT-39	A

OPEN SKTCH

Material- 20MnCr5

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: Special Characteristics as Per Drawing Special Characteristics For Process Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change
17/05/19	A	Part No is 4252270M01 was 2512C32901. Part Manufacturer is Carburising Route was Induction Route ECN No-1341	New Customer Drawing Received.				