





INSPECTION STANDARD (HT LAB)

Page 01 of 01

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	05/10/17			
Part Name:- Drive Gear		Part No.:- 002210416.1		Inspection Standard Number		SIP/4153/140	
Customer :- CLAAS		Change Level.:-c,15,05,2019		Part Stage		Hard	
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness on Face	*	53~59 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	E.C.D At root of tooth space	*	1.5 mm Min	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	Micro Case	*	Tempered Martensite	Microscope	1Pc/Lot	FMT-HT-39	A
4.	Core Micro	*	LCMT+Bainite	Microscope	1Pc/Lot	FMT-HT-39	A
5.	Core Hardness	*	Not Given in Drawing	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A

OPEN SKETCH

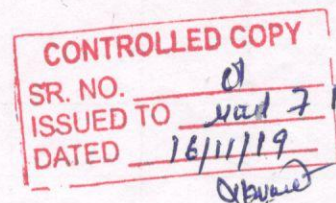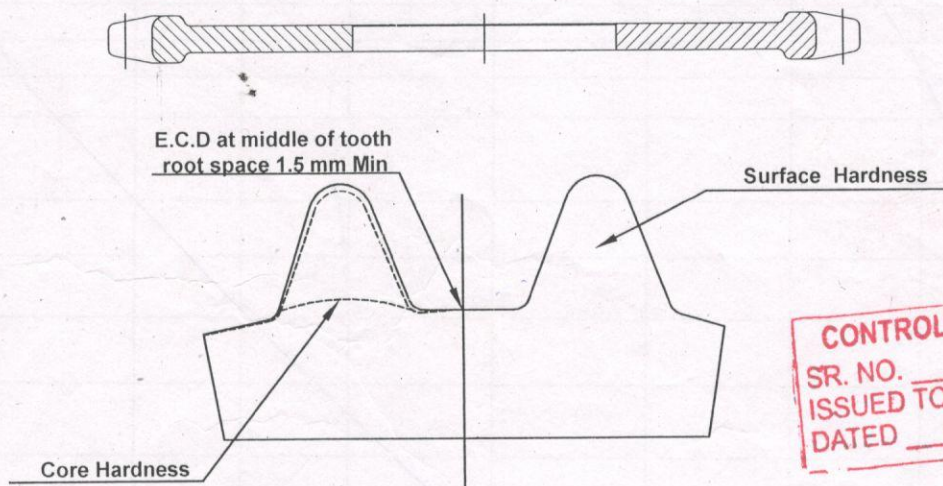

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends: ☒ Special Characteristics as Per Drawing ☒ * Special Characteristics For Process ☒ Δ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change
22/08/2019	A	New Customer drawing recieved Part no.002210416.1 was 2210416.1 Part Name Drive gear was Drive Sprocket	Customer drawing revision change				