



INSPECTION STANDARD (HT LAB)

Page 01 of 01




206

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	17/11/2023
Part Name:- Assy Coupler & Bush		Part No.:- 1510A10502	Inspection Standard Number	SIP/28020/230
Customer :- TAFE		Change Level.:-00	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58-62 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Measured To 550HV1 At PCD (Z-26)	*	0.76~1.10 mm	Micro Vicker / Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	Core Hardness At RCD (Z-26)	*	28~41 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	Surface Carbon Contents	*	0.8~1.10%	Microscope	1Pc/Lot	HT Lab Report	A
5.	Micro Case	*	Tempered Martensite+ RA<15%	Microscope	1Pc/Lot	HT Lab Report	A.
6.	Core Micro	*	LCM + Bainitic Structure	Microscope	1Pc/Lot	HT Lab Report	A

Material-20MnCr5

Space For Sketch:-

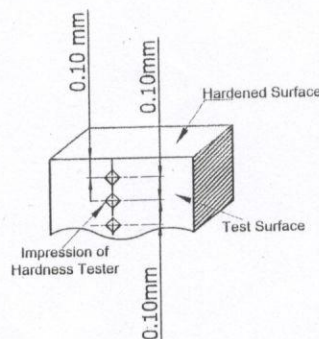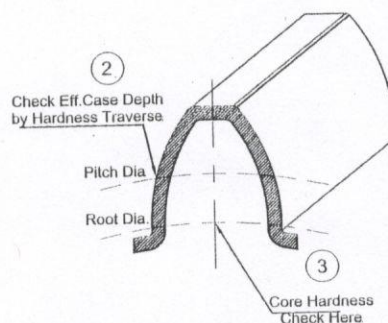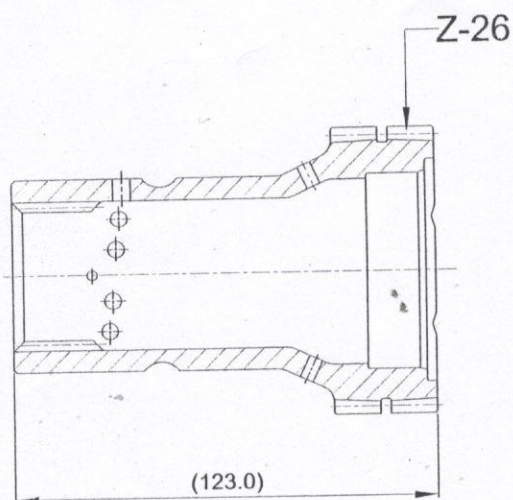

Transverse For Hardness Check
(Take Every Impression At a Distance Of 0.1mm)

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में

Department के Incharge को बतायें ।

Legends: ☒ Special Characteristics as Per Drawing * Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change