




INSPECTION STANDARD (HT LAB)



☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	01/05/18			
Part Name:- F D Pinion Shaft Left		Part No.:- 93655921		Inspection Standard Number		SIP/4270/160	
Customer :- TMTL		Change Level:-00		Part Stage		HT Lab.	
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58-62 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD at 544HV (52 HRC)	*	1.1~1.4 mm	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	ECD Below Undercuts	*	0.5 mm min.	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	Core Hardness At PCD	*	42 HRC Max.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
5.	Core Hardness At RCD	*	30 HRC Min.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
6.	Case Micro	*	Tempered Martensite+ RA<12%, Carbide (Globular) Upto 2%Max.	Microscope	1Pc/Lot	FMT-HT-39	A
7.	Core Micro	*	LCTM+Bainitic Structure Ferrite Upto 5% Max.	Microscope	1Pc/Lot	FMT-HT-39	A
8.	IGO/NMTP	*	20 Micron Max.	Microscope	1Pc/Lot	FMT-HT-39	A

Space For Sketch

Material:-SAE 8620H

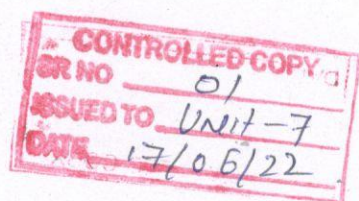

(ECD Below Undercut 0.5 mm min)

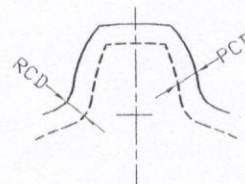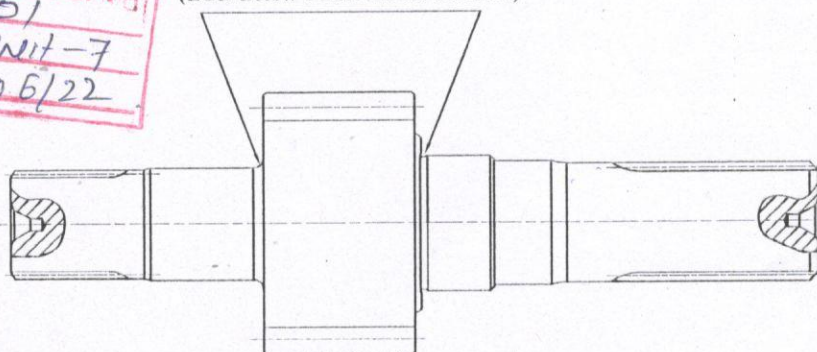

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing ☒ * Special Characteristics For Process ☒ Δ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change