





INSPECTION STANDARD (HT LAB)

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	31/05/19			
Part Name:- F D Pinion Shaft Left Z-14		Part No.:- 93658764		Inspection Standard Number		SIP/4314/210	
Customer :- TMTL		Change Level:-00		Part Stage		HT Lab.	
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD at 52 HRC (544HV)	*	1.1~1.4 mm	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	ECD Below Undercuts	*	0.5 mm min.	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	Core Hardness At PCD	*	42 HRC Max.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
5.	Core Hardness At RCD	*	30 HRC Min.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
6.	Micro Case	*	Tempered Martensite + RA<12%, Carbide (Globular) Upto 2% Max.	Microscope	1Pc/Lot	FMT-HT-39	A
7.	Core Micro	*	LCM+Bainitic Structure, Ferrite Upto 5% Max.	Microscope	1Pc/Lot	FMT-HT-39	A
8.	IGO / NMTP	*	20 Micron Max.	Microscope	1Pc/Lot	FMT-HT-39	A

Space For Sketch

Material:-En 353 ES 01

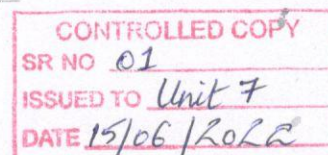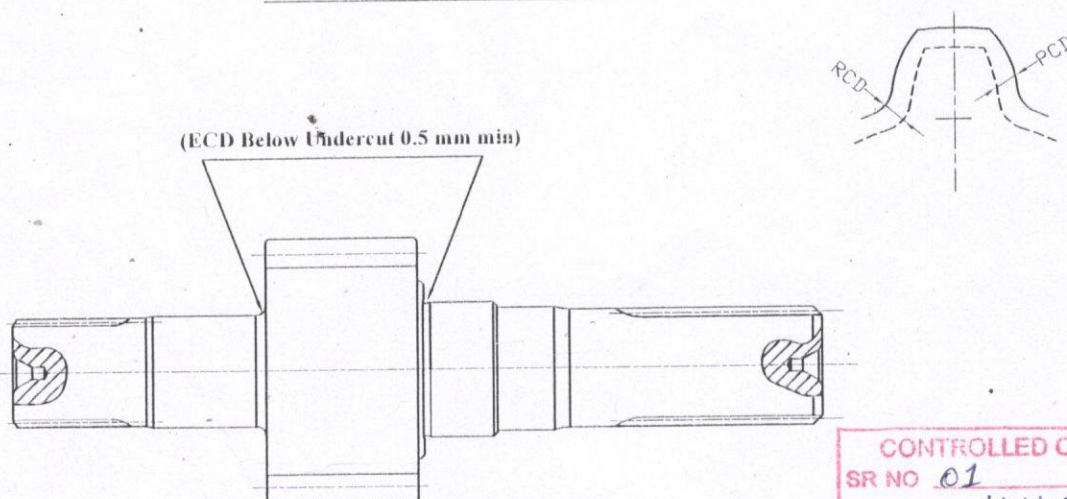

Reaction Plan: A-यदि Inspection करते समय कम्पोंनट खराब मिले तो खराब कम्पोंनट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends: ☒ Special Characteristics as Per Drawing ☒ * Special Characteristics For Process ☒ Δ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Prepared By:

Checked By:

Approved By: