



INSPECTION STANDARD (HT LAB)

Page 01 of 01

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	18/01/18
Part Name:- Shaft Pinion Z-12 Helical RH		Part No.:- D10687480A	Inspection Standard Number	SIP/4243/160
Customer :- Escorts		Change Level.:-00	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness On Spline Teeth	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	Surface Hardness On Ground Diameter	*	54 HRC min.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	ECD At Gear PCD & Spline Root Up To 513 HV	*	1.0~1.3 mm	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	ECD On Ground Diameter. Up To 513 HV	*	0.8 mm min	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
5.	Core Hardness	*	32~43 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
6.	Micro Case	*	Tempered Martensite+ RA<20%	Microscope	1Pc/Lot	FMT-HT-39	A
7.	Core Micro	*	Bainite+Free Ferrite	Microscope	1Pc/Lot	FMT-HT-39	A

OPET. SKTCH

Material:-20Mn5Cr5-S

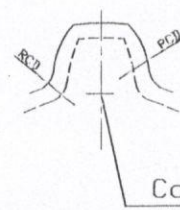
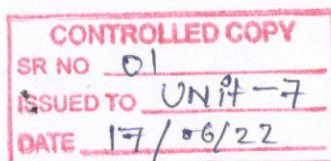


Figure :- 1 Core Hardness Measured at this Location

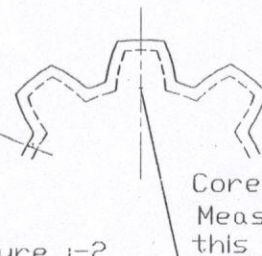
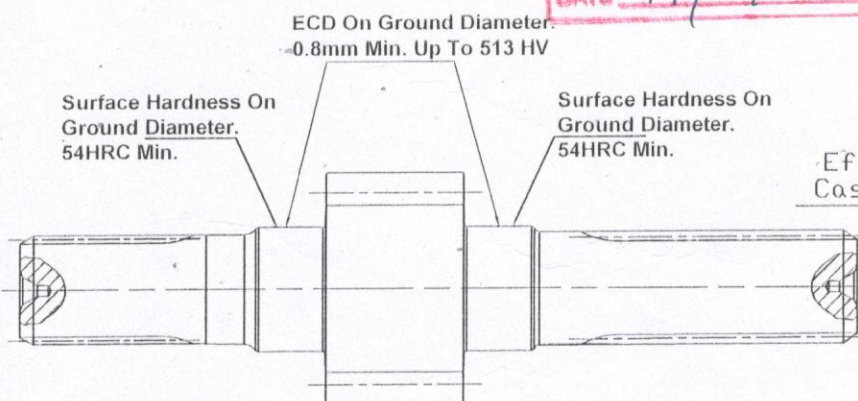


Figure :-2 Core Hardness Measured at this Location

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection को टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change