



INSPECTION STANDARD (HT LAB)




Page 01 of 01

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	14/10/2021
Part Name:-Bull Pinion Shaft RH		Part No.:- 1810C16601	Inspection Standard Number	SIP/4447/130
Customer :- Tafe		Change Level:-00	Part Stage	HT Lab.

Sr.No	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58~63 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD 526 HV 0.5 /516 HV 1	*	1.0~1.3 mm	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	Core Hardness	*	30~43 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	Micro Case	*	Tempered Martensite+ RA 15% Max.	Microscope	1Pc/Lot	FMT-HT-39	A
5.	Micro Core	*	LCTM+Bainitic	Microscope	1Pc/Lot	FMT-HT-39	A
6.	Surface Carbon Content	*	0.80~1.0%	Microscope	1Pc/Lot	FMT-HT-39	A

OPEN SKETCH

MATERIAL :-EN353: BS970

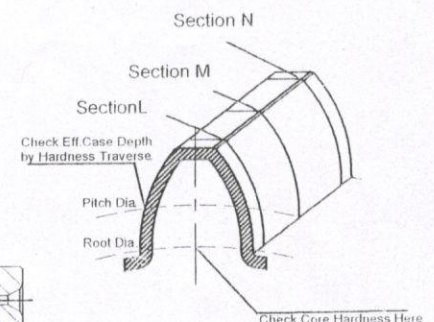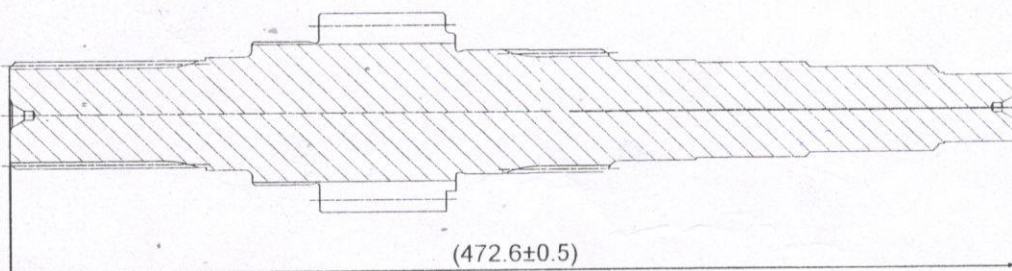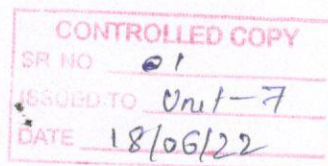

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Prepared By: *[Signature]* Checked By: *[Signature]* Approved By: *[Signature]*