



INSPECTION STANDARD (HT LAB)


Page 01 of 01

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	08/01/20
Part Name:- Shaft Pinion Rear Axle Z-13		Part No.:-D10684980AB (A)	Inspection Standard Number	SIP/4347/190
Customer :- ESCORTS		Change Level:- A , 28 / Feb/2022	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness (On Spline Teeth)	▶	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab	A
2.	Surface Hardness (On Ground Diameter)	▶	54 HRC Min.	Rockwell Hardness Tester	1Pc/Lot	HT Lab	A
3.	ECD At 513 HV at 1kg Load (At PCD Of Gear & Root of Spline)	▶	1.0~1.3 mm	Vicker Hardness Tester	1Pc/Lot	HT Lab	A
4.	ECD At 513 HV at 1 Kg Load (On Ground Dia)	▶	0.8 mm Min.	Vicker Hardness Tester	1Pc/Lot	HT Lab	A
5.	Core Hardness	▶	32~43 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab	A
6.	Case Micro	*	Tempered Martensitec RA<20%	Microscope	1Pc/Lot	HT Lab	A
7.	Core Micro	*	LCTM + Bannite	Microscope	1Pc/Lot	HT Lab	A

Material -20Mn5Cr5

OPEN SKETCH

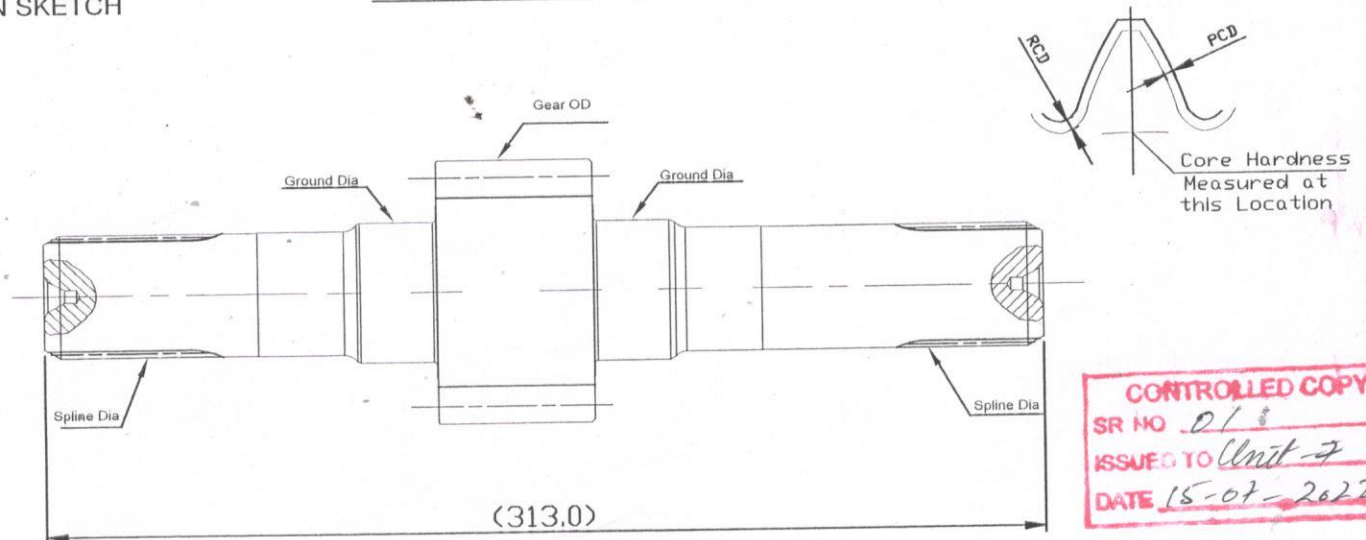

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends: ▶ Special Characteristics as Per Drawing * Special Characteristics For Process ▲ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change
28/02/22	A	New customer Drawing received with D10684980 rev AB was D10684980 rev. A and semi topping angle in Z-14,Z-18, Z-13 is (45~55°) was 45° as per ECN 22/22 dated 28/Feb/2022	Customer Requirements				