


☐	Prototype	☐	Pre-Launch	☒	Production	Date (Original)		03/10/2024	
Part Name:- Shaft Output			Part No.:- 388-8374			Inspection Standard Number		SIP/12001/260	
Customer :- Caterpillar			Change Level.:- A, 30/09/2024			Part Stage		HT Lab.	
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan		
			Product Specification	Inspection Method	Inspection Frequency	Control Method			
1.	Surface Hardness Check On Grinding (Ø40.0)	►	58-63 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A		
2.	Surface Hardness Check On Grinding (Ø50.2)	►	58-63 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A		
3.	Surface Hardness Check On Grinding (Ø45.0)	►	58-63 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A		
4.	Surface Hardness Check On Grinding (Ø40.0)	►	58-63 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A		
5.	Surface Hardness Check On Thrust Face	►	58-63 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A		
6.	Surface Hardness Check On Spline RCD (Z-23)	►	58-63 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A		
7.	Surface Hardness Check On Spline RCD (Z-30)	►	58-63 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A		

SPACE FOR SKETCH :-

Material- 20MnCr5 

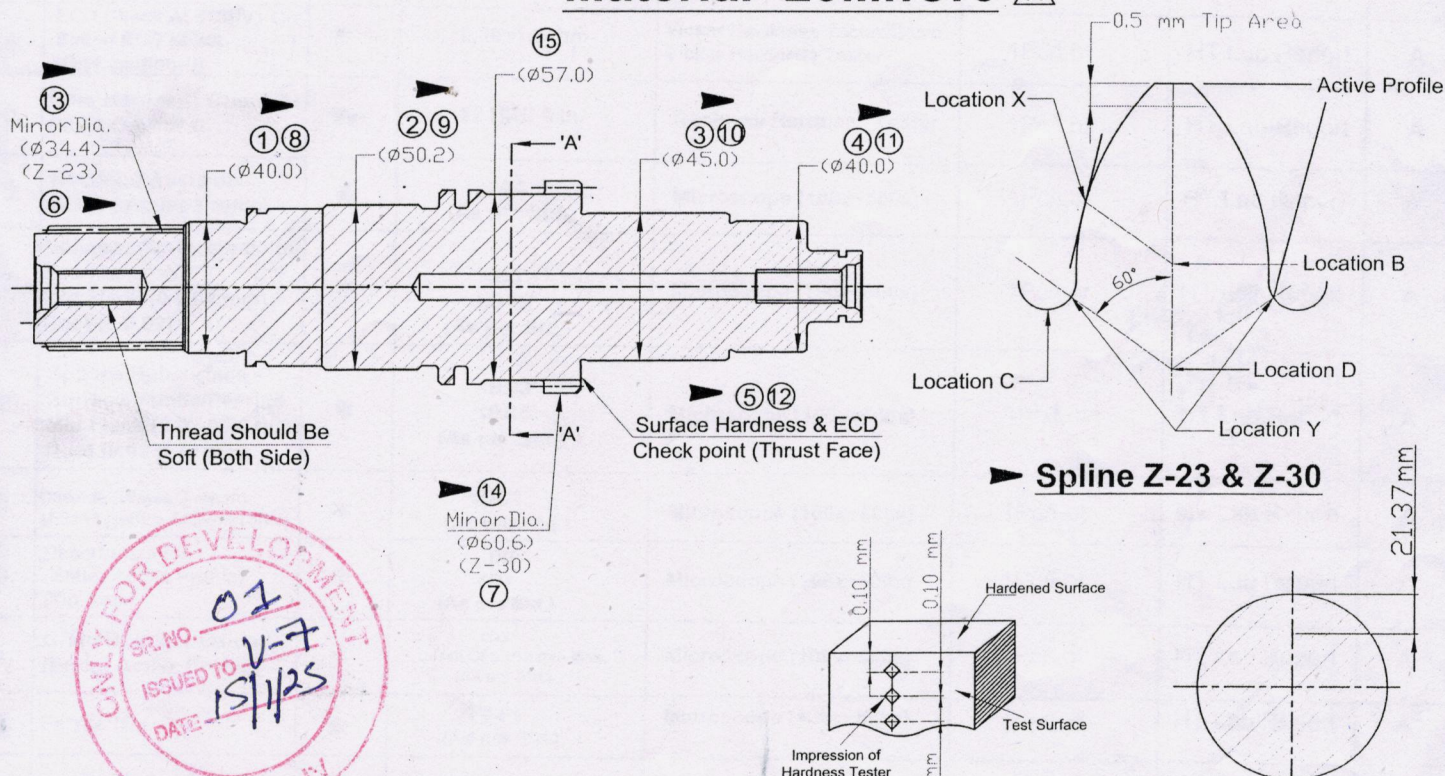

As Per Standard No. : 1E2318

Note :- Thread Should Be Free From Carburising

Transverse For Hardness Check

Check Point Of Core
Hardness Ø57.0
(Section A-A)

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection डेवल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends:	► Special Characteristics as Per Drawing	* Special Characteristics For Process	△ Special Characteristics For Safety
----------	--	---------------------------------------	--------------------------------------

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change
30/09/24	A	Material is 20MnCr5 Was SAE8620H As Per ECN 75/24 On Date :-30/09/2024	New Customer Drawing Recieved				

Prepared By:

Checked By: *[Signature]*

Approved By:



INSPECTION STANDARD (HT LAB)

Page 02 of 02

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	03/10/2024
Part Name:- Shaft Output		Part No.:- 388-8374	Inspection Standard Number	SIP/12001/260
Customer :- Caterpillar		Change Level.:- A, 30/09/2024	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
8.	ECD Check At 513HV1 On Grinding Dia. (Ø40.0)	▶	0.6~1.3 mm	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
9.	ECD Check At 513HV1 On Grinding Dia. (Ø50.2)	▶	0.6~1.3 mm	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
10.	ECD Check At 513HV1 On Grinding Dia. (Ø45.0)	▶	0.6~1.3 mm	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
11.	ECD Check At 513HV1 On Grinding Dia. (Ø40.0)	▶	0.6~1.3 mm	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
12.	ECD Check At 513HV1 On Trust Face	▶	0.6~1.3 mm	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
13.	ECD Check At 513HV1 On Spline RCD (Z-23) (On Location-C)	▶	0.36~1.3 mm	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
14.	ECD Check At 513HV1 On Spline RCD (Z-30) (On Location-C)	▶	0.36~1.3 mm	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
15.	Core Hardness Check At R0.75 On Ø57.0	▶	25 HRC Min.	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
16.	Retained Austenite (Entire Active Profile)	*	<A4 (As per Std.)	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A
17.	Splines - Surface bainite/Pearlite Mid Flank (0-0.02 mm) Root (0-0.02)	*	<B5 B0-B7 (As per Std.)	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A
18.	Splines Subsurface - Surface bainite/Pearlite Mid Flank (0.02-0.20 mm) Root (0.02-0.20 mm)	*	<BB3 <BB5 (As per Std.)	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A
19.	Carbide (Direct Quench) 1E2318 (Entire Active Profile)	*	<DC1 (As per Std.)	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A
20.	Decarburization (Entire Active Profile) (Tip Area)	*	D0 <D1 (As per Std.)	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A
21.	Grain Boundry Oxides (Entire Active Profile)	*	<O3 Depth Of 0.018 mm Max. (As per Std.)	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A
22.	Ferrite (B,D)	*	F0-F5 (As per Std.)	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A

Reaction Plan: A-यदि Inspection करते समय कम्पनेट खराब मिले तो खराब कम्पनेट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ▶ Special Characteristics as Per Drawing * Special Characteristics For Process ▲ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change
30/09/24	A	Material is 20MnCr5 Was SAE8620H As Per ECN 75/24 On Date :-30/09/2024	New Customer Drawing Recieved				

Prepared By: *[Signature]* Checked By: *[Signature]* Approved By: *[Signature]*