
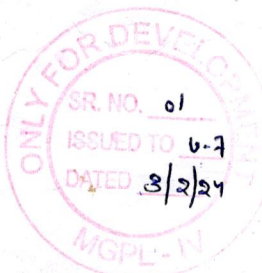
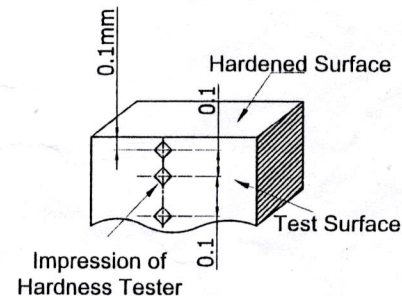
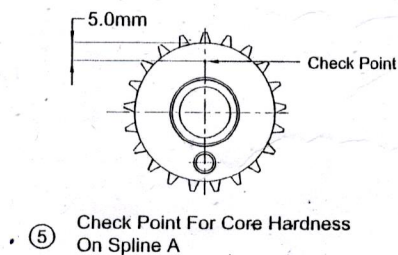
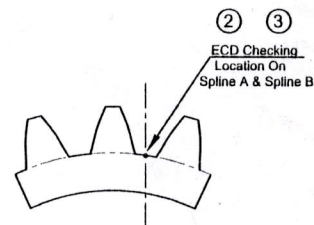


☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)		04-01-2024		
Part Name:- Intermediate Shaft		Part No.:- 0.867.3003.00		Inspection Standard Number		SIP/15000/220	
Customer :- Comer Industries		Change Level:-00		Part Stage		HT Lab.	
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness To Be Checked On ECD Check Points	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Measured To HV1 550 Vickers On Root Dia Of Spline Located B/T Two Teeth Of a Cross Section Of The Spline Profile On Spline A	*	0.6mm~0.9mm	Micro Vicker/Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	ECD Measured To HV1 550 Vickers On Root Dia Of Spline Located B/T Two Teeth Of a Cross Section Of The Spline Profile On Spline B	*	0.6mm~0.9mm	Micro Vicker/Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	ECD Measured To HV1 550 Vickers On Grinding Diameter Ø30 As Shown in Figure	*	0.36 min.	Micro Vicker/Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
5.	Core Hardness Checked at a distance of 5mm below Root Diameter	*	27~45 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
6.	Micro Case	*	Tempered Martensite+ RA<20% Max	Microscope (100X to 500X)	1Pc/Lot	HT Lab Report	A
7.	Core Micro	*	LCM+Bainitic Structure	Microscope (100X to 500X)	1Pc/Lot	HT Lab Report	A

Space For Sketch:

Material- 20MnCr5

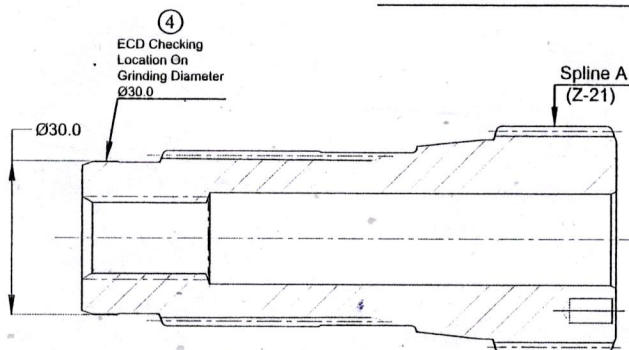

Reaction Plan: A-यदि Inspektion करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Prepared By:

Checked By:

Approved By: