



INSPECTION STANDARD (HT LAB)




Page 01 of 01

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)		18/09/15	
Part Name:- Gear Final Drive Reduction Z-62		Part No.:- D10383050		Inspection Standard Number		SIP/2069/140
Customer :- Escorts		Change Level.:-00		Part Stage		HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Check On 513 HV At Gear PCD Z-62	*	0.9~1.2 mm	Vicker Hardness Tester/ Micro Vicker hardness tester	1Pc/Lot	HT Lab Report	A
3.	ECD Check On 513 HV At Gear Root Z-62	*	0.8 mm Min.	Vicker Hardness Tester/ Micro Vicker hardness tester	1Pc/Lot	HT Lab Report	A
4.	Core Hardness Check On Tooth Center As Per Figure.	*	32~41 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
5.	Case Micro	*	Tempered Martensite And Must Be Free From Network Carbide. Fine, Uniform Dispersed Carbide Less Than 5% Are Acceptable + RA<15%	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A
6.	Core Micro	*	LCTM+Bainitic Network Or Undissolved Ferrite Is Not Desirable.	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A
	Surface Carbon Content	*	0.8~1.0 %	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A
	IGO	*	0.025 mm Max.	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A

OPEN. SKTCH

Material:- 20MnCr5-S

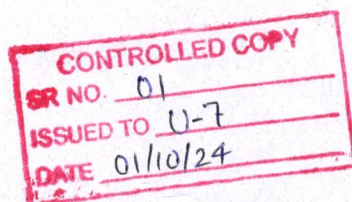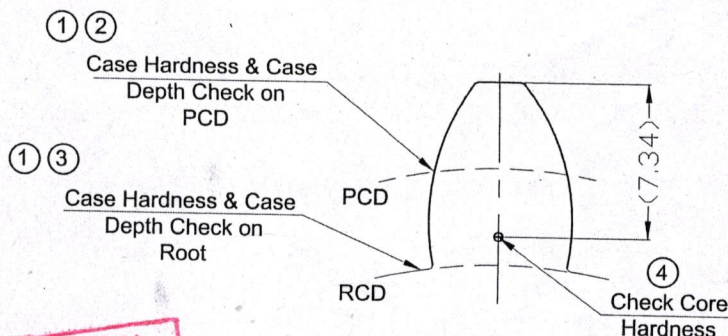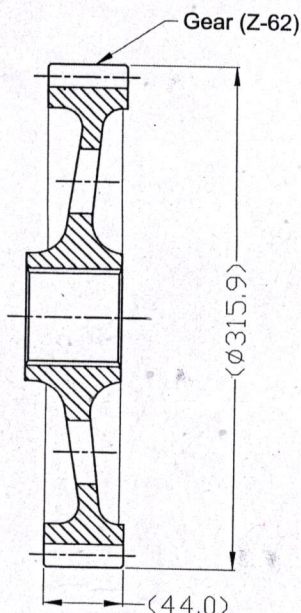

ECD & Core Hardness Checking Location

Note :- 1) The Case Depth At The Root Shall Not Be less than 0.8 mm.
2) Sample To Be Cut At Center Of Gear Width For Inspection.

Reaction Plan: A-यदि Inspektion करते समय कम्पोनेट खराब मिले तो खराब कम्पोनेट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing * Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Prepared By