



INSPECTION STANDARD (HT LAB)





Page 01 of 01

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	22/02/2024			
Part Name:- Third Gear-34T-SS670 XLR & L/R		Part No.:- 459-S6898	Inspection Standard Number	SIP/21010/170			
Customer :- JCB (UK)		Change Level:-A	Part Stage	HT Lab.			

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	59-63 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Check 540HV5 At Gear PCD (Z-34)	*	0.75~1.0 mm	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	ECD Check 540HV5 At Bore Dia. (Ø50.0)	*	0.5 mm min.	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	Core Hardness at Gear RCD (Z-34)	*	450vdh5 max. (45HRC)	Vicker Hardness Tester/ Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
5.	Micro Case	*	Tempered Martensite+ RA 10% Max.	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A
6.	Micro Core	*	LCM+Bainitic Structure,	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A

SPACE FOR SKETCH :-

Material- 20MnCr5 With Boron

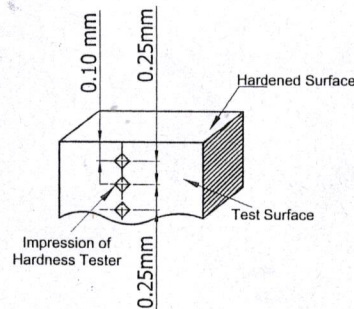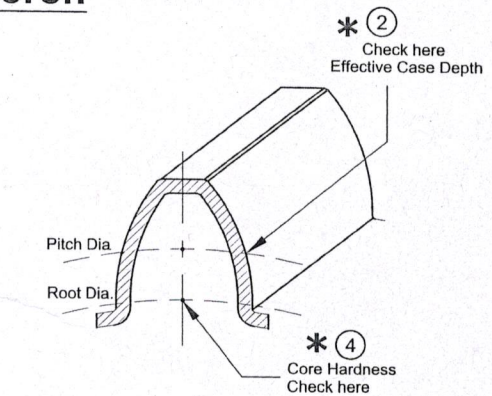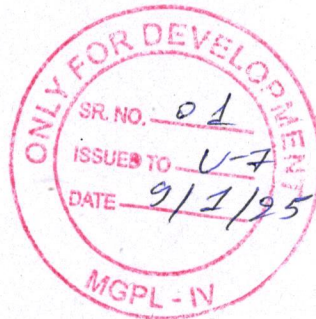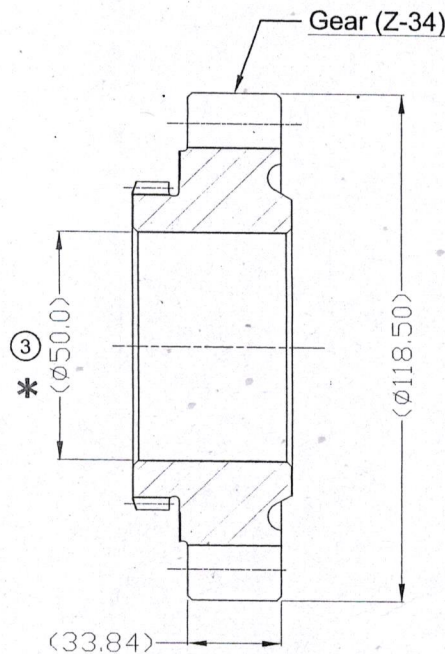

Transverse For Hardness Check

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Agends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

te	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change
09/24	A	Customer Drawing Part No. is 459/S6898 was 459/S6710 As Per ECN 76/24	New Customer Drawing Received				