





INSPECTION STANDARD (HT LAB)

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	17/12/2019
Part Name:- Main Shaft -PS760/PS900		Part No.:- 459/M5201	Inspection Standard Number SIP/3014/200	
Customer :- JCB-UK		Change Level.:-A	Part Stage	HT Lab.


Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58~63 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD Measured at 540HV	*	0.50~0.75 mm	Micro Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	Case Micro	*	Tempered Martensite+ RA<10%,	Microscope	1Pc/Lot	FMT-HT-39	A
4.	Core Micro	*	LCTM+Bainitic Structure	Microscope	1Pc/Lot	FMT-HT-39	A
5.	For more details refer JCB STD. 9995/0002						

OPEN SKETCH

Material- 20MnCr5

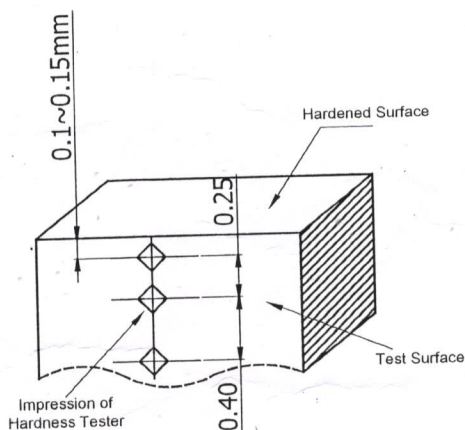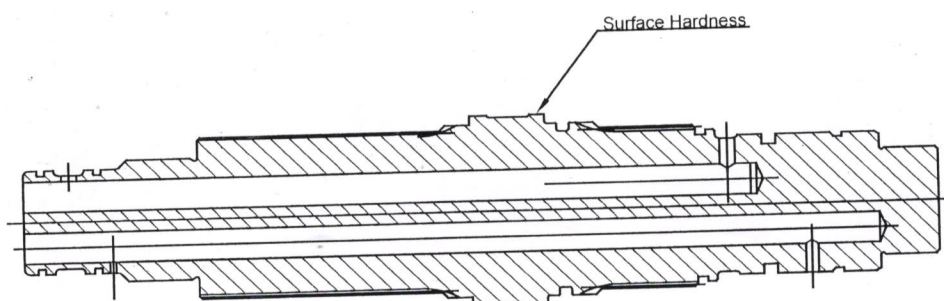

ECD Checking Pattern Details

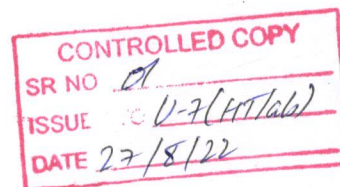

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends:	Special Characteristics as Per Drawing	* Special Characteristics For Process	△ Special Characteristics For Safety
----------	--	---------------------------------------	--------------------------------------

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change
14-7-20	A	New customer drg received with new rev. 6 & drg updated					

Checked By:

Approved By: