





INSPECTION STANDARD (HT LAB)

Page 01 of 01

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	18/12/17
Part Name:-Bull Pinion Shaft RH		Part No.:- 4252444M03	Inspection Standard Number	SIP/4051/130
Customer :- Tafe		Change Level.:-00	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab report	A
2.	ECD	*	1.15~1.45 mm @513 HV I	Vicker Hardness Tester	1Pc/Lot	HT Lab report	A
3.	Core Hardness	*	26/35 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab report	A
4.	Surface Carbon Content	*	0.8/1.10%	Microscope	1Pc/Lot	HT Lab report	A
5.	Micro Case	*	Tempered Martensite+ RA<15%	Microscope	1Pc/Lot	HT Lab report	A
6.	Core Micro	*	Bainite+Sorbide Free Ferrite	Microscope	1Pc/Lot	HT Lab report	A

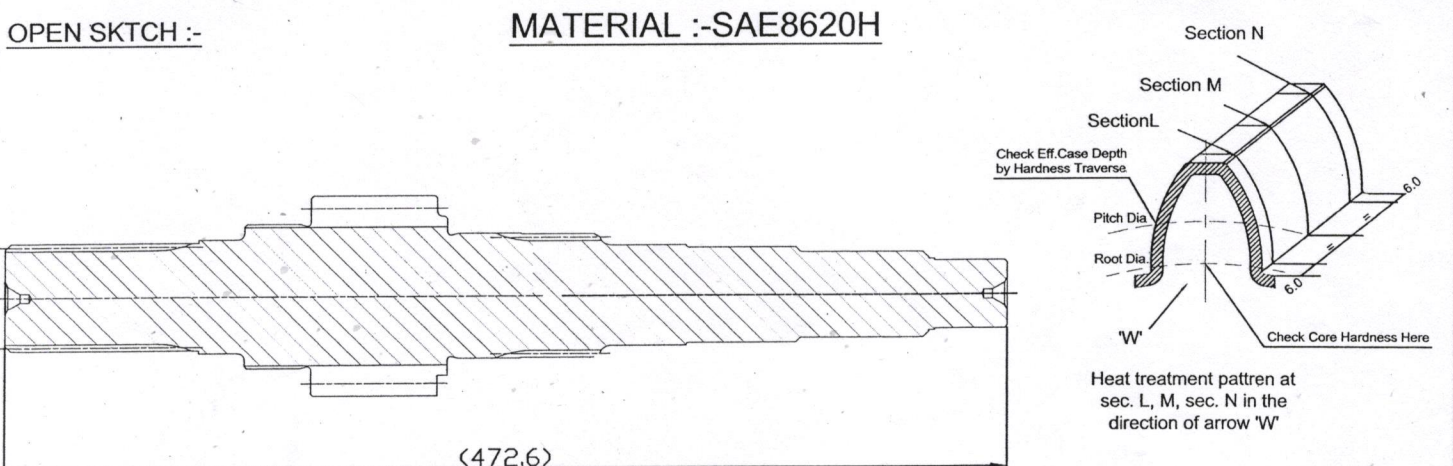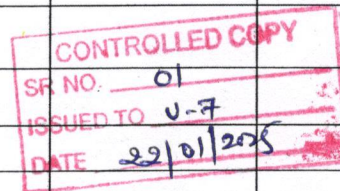

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends:	▶ Special Characteristics as Per Drawing	* Special Characteristics For Process	△ Special Characteristics For Safety
----------	--	---------------------------------------	--------------------------------------

Change Details							
Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change