




INSPECTION STANDARD (HT LAB)

Page 01 of 01


☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	08/05/2021			
Part Name:- IDLER GEAR-35T		Part No.:- 459/50440		Inspection Standard Number		SIP/4416/140	
Customer :- JCB India		Change Level.:-00		Part Stage		HT Lab	
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	59~63 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Measure at 540 HV	*	0.75~1.0 mm	Micro Vicker / Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	ECD at Bore	*	0.5 mm (Min.)	Micro Vicker / Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	Micro Case	*	Tempered Martensite+ RA<10%	Microscope	1Pc/Lot	HT Lab Report	A
5.	Core Micro	*	LCTM + Baintic Structure	Microscope	1Pc/Lot	HT Lab Report	A

SKETCH:-


Material Grade:- 20MnCr5+B

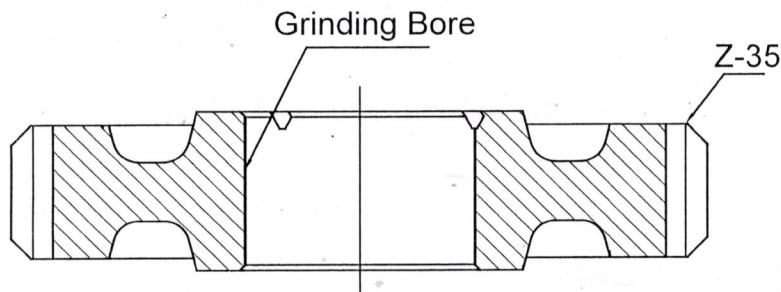

Component Sketch

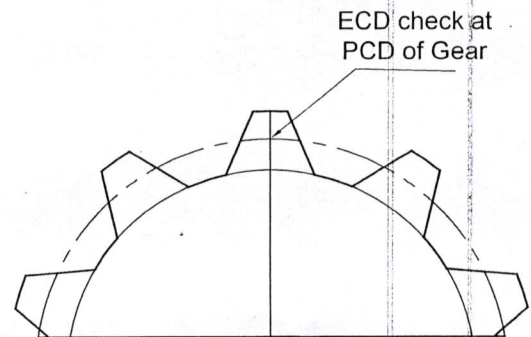

Gear Profile

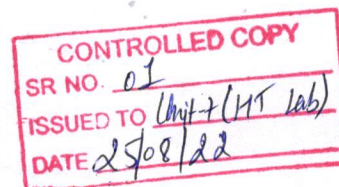

Note:- For Other Detail see Std No:- 9995/0001

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change