



INSPECTION STANDARD (HT LAB)


Page 01 of 01

☐ Prototype	☒ Pre-Launch	☐ Production	Date (Original)	11/03/2022
Part Name:- Transfer-Gear 38T (Increased Face Width)		Part No.:- 336/Y0237	Inspection Standard Number	SIP/4461/180
Customer :- JCB India		Change Level.:-00	Part Stage	HT Lab

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	59-63 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Measure at 540 HV	*	1.0~1.25 mm	Micro Vicker / Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	Micro Case	*	Tempered Martensite+ RA<10%	Microscope	1Pc/Lot	HT Lab Report	A
4.	Micro Core	*	LCTM+ Baintic Structure	Microscope	1Pc/Lot	HT Lab Report	A
5.	Core Hardness	*	-----	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
6.	Surface Hardness on Bore Diameter Ø51.94/51.97	*	No Greater Than 45 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
7.	Surface Hardness on Thread end to be softened Back so that the Max. Hardness over Length 33.0	*	40 HRC Max.	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A

SKETCH:-

Material Grade:- 20MnCr5

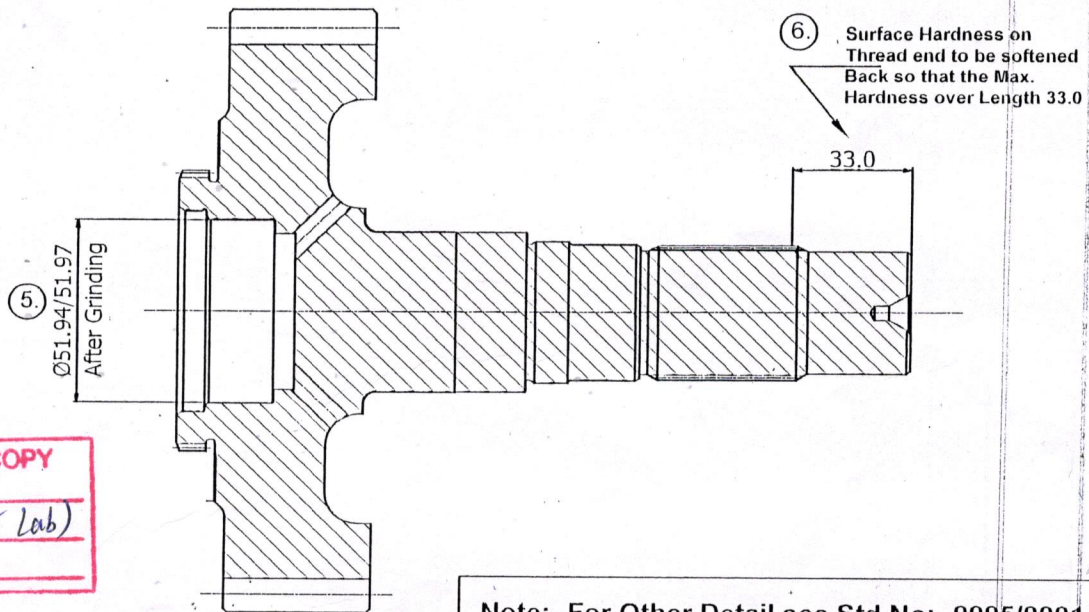

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Prepared By: *[Signature]*

Checked By: *[Signature]*