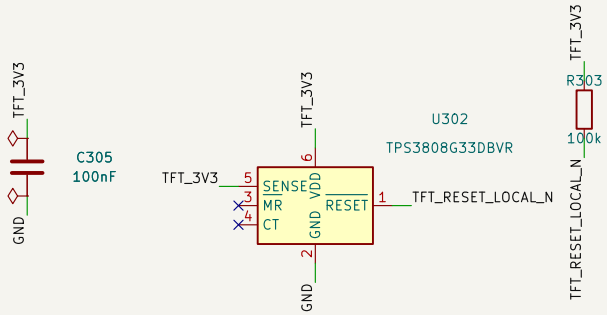


DRAFT / NOT FOR ORDER / NO FIRE
LOCAL TFT RESET REVIEW — NOT INTEGRATED
U302: TFT_3V3 supply + SENSE; RESET -> module RST only.
MR open: internal pull-up. CT open: 12...28 ms (20 ms typ).
R303 = RC0603FR-07100KL; C305 = GRM188R71E104KA01D.
PWR_FLAG declares EXTERNAL test supply / return, not board integration.
NO connection to ESP32 EN, safety RESET, or a GPIO.
Firmware reinitialization after TFT-only power loss remains OPEN.
TFT cable load / voltage thresholds / SPI backfeed remain unqualified.

Sheet: /		
File: sirokko_tft_reset_local_DRAFT.kicad_sch		
Title: TFT reset candidate — NOT INTEGRATED		
Size: A4	Date:	**Rev: DRAFT-01**
KiCad E.D.A. 10.0.7		Id: 1/1