
Your specialist in innovating humidity & temperature sensors

# Digital-output relative humidity & temperature sensor/module DHT22 (DHT22 also named as AM2302)

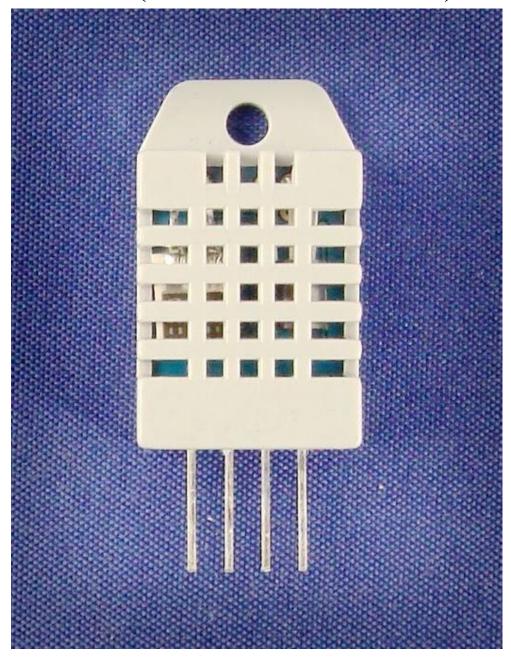

Capacitive-type humidity and temperature module/sensor

Thomas Liu (Business Manager)

\_\_\_\_\_\_

Your specialist in innovating humidity & temperature sensors

- 1. Feature & Application:
- \* Full range temperature compensated \* Relative humidity and temperature measurement
- \* Calibrated digital signal \*Outstanding long-term stability \*Extra components not needed
- \* Long transmission distance \* Low power consumption \*4 pins packaged and fully interchangeable

#### 2. Description:

DHT22 output calibrated digital signal. It utilizes exclusive digital-signal-collecting-technique and humidity sensing technology, assuring its reliability and stability. Its sensing elements is connected with 8-bit single-chip computer.

Every sensor of this model is temperature compensated and calibrated in accurate calibration chamber and the calibration-coefficient is saved in type of programme in OTP memory, when the sensor is detecting, it will cite coefficient from memory.

Small size & low consumption & long transmission distance(20m) enable DHT22 to be suited in all kinds of harsh application occasions.

Single-row packaged with four pins, making the connection very convenient.

#### 3. Technical Specification:


Model	DHT22				
Power supply	3.3-6V DC				
Output signal	digital signal via single-bus				
Sensing element	Polymer capacitor				
Operating range	humidity 0-100%RH; temperature -40~80Celsius				
Accuracy	humidity +-2%RH(Max +-5%RH); temperature <+-0.5Celsius				
Resolution or sensitivity	humidity 0.1%RH; temperature 0.1Celsius				
Repeatability	humidity +-1%RH; temperature +-0.2Celsius				
Humidity hysteresis	+-0.3%RH				
Long-term Stability	+-0.5%RH/year				
Sensing period	Average: 2s				
Interchangeability	fully interchangeable				
Dimensions	small size 14*18*5.5mm; big size 22*28*5mm				

#### 4. Dimensions: (unit----mm)

1) Small size dimensions: (unit----mm)

Your specialist in innovating humidity & temperature sensors

Your specialist in innovating humidity & temperature sensors

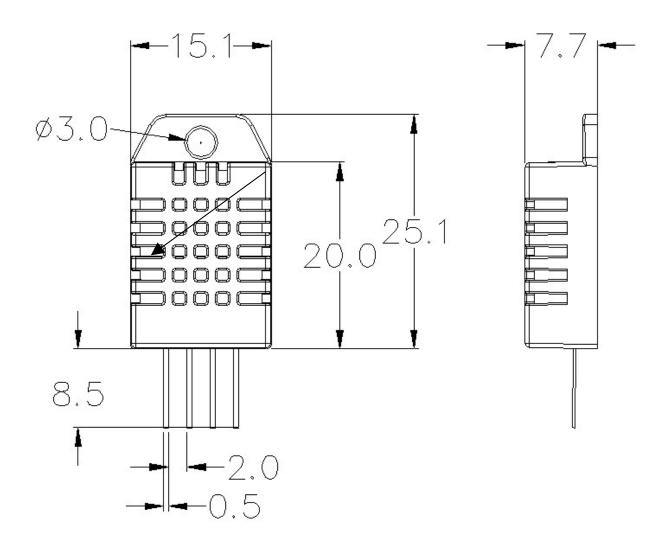


Pin sequence number: 1 2 3 4 (from left to right direction).

Pin	Function
1	VDDpower supply
2	DATAsignal
3	NULL
4	GND

\_\_\_\_\_\_

Your specialist in innovating humidity & temperature sensors

#### 5. Electrical connection diagram:

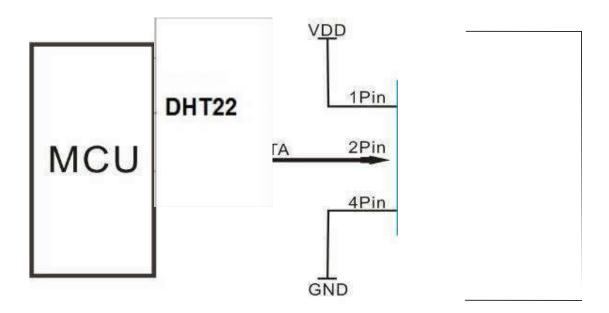

3Pin---NC, AM2302 is another name for DHT22

#### 6. Operating specifications:

#### (1) Power and Pins

Power's voltage should be 3.3-6V DC. When power is supplied to sensor, don't send any instruction to the sensor within one second to pass unstable status. One capacitor valued 100nF can be added between VDD and GND for wave filtering.

#### (2) Communication and signal

Single-bus data is used for communication between MCU and DHT22, it costs 5mS for single time communication.

Data is comprised of integral and decimal part, the following is the formula for data.

#### DHT22 send out higher data bit firstly!

DATA=8 bit integral RH data+8 bit decimal RH data+8 bit integral T data+8 bit decimal T data+8 bit check-sum If the data transmission is right, check-sum should be the last 8 bit of "8 bit integral RH data+8 bit decimal RH data+8 bit integral T data+8 bit decimal T data".

When MCU send start signal, DHT22 change from low-power-consumption-mode to running-mode. When MCU finishs sending the start signal, DHT22 will send response signal of 40-bit data that reflect the relative humidity


Thomas Liu (Business Manager)

\_\_\_\_\_

Your specialist in innovating humidity & temperature sensors

and temperature information to MCU. Without start signal from MCU, DHT22 will not give response signal to MCU. One start signal for one time's response data that reflect the relative humidity and temperature information from DHT22. DHT22 will change to low-power-consumption-mode when data collecting finish if it don't receive start signal from MCU again.

1) Check bellow picture for overall communication process:

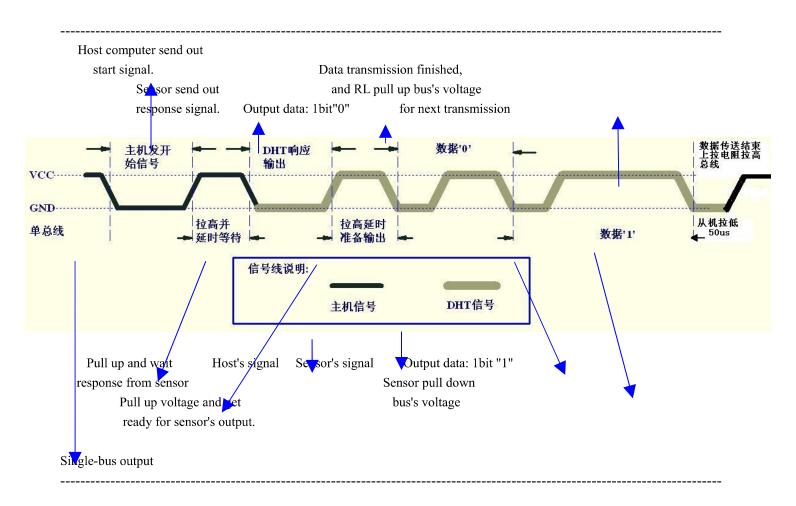

#### 2) Step 1: MCU send out start signal to DHT22

Data-bus's free status is high voltage level. When communication between MCU and DHT22 begin, program of MCU will transform data-bus's voltage level from high to low level and this process must beyond at least 1ms to ensure DHT22 could detect MCU's signal, then MCU will wait 20-40us for DHT22's response.

Check bellow picture for step 1:

6

Thomas Liu (Business Manager)

-----

Your specialist in innovating humidity & temperature sensors Host computer send start signal Sensor send out response signal and keep this signal at least 1ms and keep this signal 80us Host pull up voltage -and wait sensor's response Sensor pull up bus's voltage 主机拉高 DHT拉高 80us VCC-开始传送数据 GND DHT响应信号 单总线 主机至少拉低 1818 80us 信号线说明: DHT信号 Signal from host Start data transmission

Single-bus signal

.-----

Step 2: DHT22 send response signal to MCU

Signal from sensor


When DHT22 detect the start signal, DHT22 will send out low-voltage-level signal and this signal last 80us as response signal, then program of DHT22 transform data-bus's voltage level from low to high level and last 80us for DHT22's preparation to send data.

Check bellow picture for step 2:

Thomas Liu (Business Manager)

Your specialist in innovating humidity & temperature sensors

\_\_\_\_\_

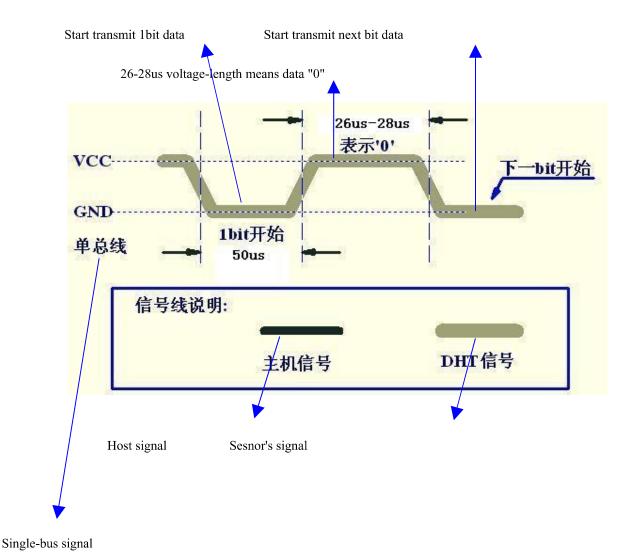

------

Step 3: DHT22 send data to MCU


When DHT22 is sending data to MCU, every bit's transmission begin with low-voltage-level that last 50us, the following high-voltage-level signal's length decide the bit is "1" or "0".

Check bellow picture for step 3:

8

Thomas Liu (Business Manager)

Your specialist in innovating humidity & temperature sensors

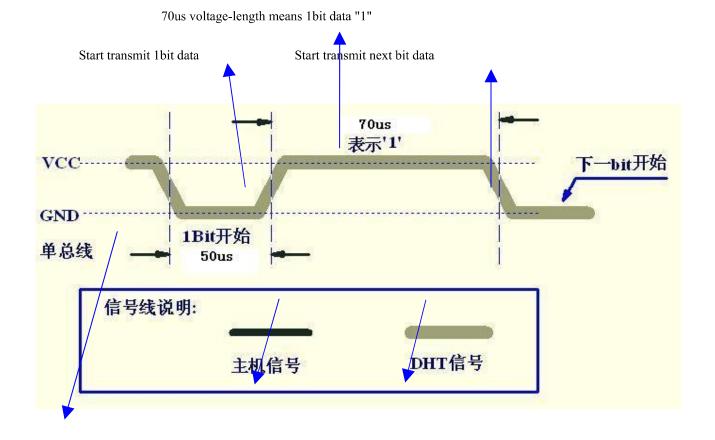

Host signal Sesnor's signal

Single-bus signal

\_\_\_\_\_

If signal from DHT22 is always high-voltage-level, it means DHT22 is not working properly, please check the electrical connection status.

#### 7. Electrical Characteristics:

Item	Condition	Min	Typical	Max	Unit
Power supply	DC	3.3	5	6	V
Current supply	Measuring	1		1.5	mA
	Stand-by	40	Null	50	uA
Collecting	Second		2		Second
period					

<sup>\*</sup>Collecting period should be : >2 second.

9

Thomas Liu (Business Manager)

\_\_\_\_\_

Your specialist in innovating humidity & temperature sensors

#### 8. Attentions of application:

#### (1) Operating and storage conditions

We don't recommend the applying RH-range beyond the range stated in this specification. The DHT22 sensor can recover after working in non-normal operating condition to calibrated status, but will accelerate sensors' aging.

(2) Attentions to chemical materials

Vapor from chemical materials may interfere DHT22's sensitive-elements and debase DHT22's sensitivity.

(3) Disposal when (1) & (2) happens

Step one: Keep the DHT22 sensor at condition of Temperature 50~60Celsius, humidity <10%RH for 2 hours; Step two: After step one, keep the DHT22 sensor at condition of Temperature 20~30Celsius, humidity >70%RH for 5 hours.

(4) Attention to temperature's affection

Relative humidity strongly depend on temperature, that is why we use temperature compensation technology to ensure accurate measurement of RH. But it's still be much better to keep the sensor at same temperature when sensing.

DHT22 should be mounted at the place as far as possible from parts that may cause change to temperature.

(5) Attentions to light

Long time exposure to strong light and ultraviolet may debase DHT22's performance.

(6) Attentions to connection wires

The connection wires' quality will effect communication's quality and distance, high quality shielding-wire is recommended.

- (7) Other attentions
  - \* Welding temperature should be bellow 260Celsius.
  - \* Avoid using the sensor under dew condition.
- \* Don't use this product in safety or emergency stop devices or any other occasion that failure of DHT22 may cause personal injury.

1