Page 1 / 2

E095-5JN-0066


<Date> June 16, 2014


Subject	Note on parts replacement (Change to the shape of Exit guide and Bracket)				
Model	TASKalfa 750c, TASKalfa 650c, TASKalfa 550c				
Classification	Field measure timing:	Information (including compatibility)			
	Problem:	Except SC/Error, Paper Feeding/Conveying, Image or Machine operation			
	Type of change:	Hardware			

Exit guide (No. 2) and Bracket (No. 3) are changed as shown below for the assembly work efficiency purposes. A special attention is required when replacing the parts after this change, please refer to the [Field Measure].

FIG. 77 RADF-FEED-6-ASM

(Change is applicable only to the machine front side)

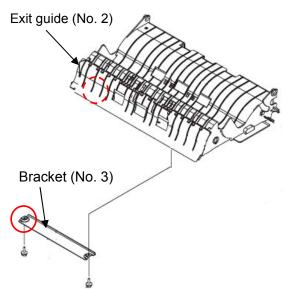

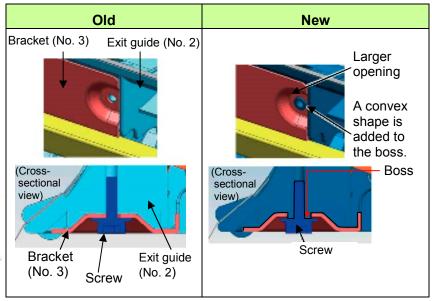

[Installing the new Bracket (No. 3)]

When installing the new Bracket (No. 3) to the new Exit guide (No. 2), fit the boss on the Exit guide into the opening on the Bracket and then secure it using a screw.

Field Measure	When replacing with new Exit guide No. 2), please use a set part (No. 1). (As for installation, refer to [Installing new Bracket (No. 3)] above.)		
Implement timing	There is no current production.		

Parts information

				Intch		Q'ty		
No.	Old P/N	New P/N	Description	Old	New	Old	New	Remarks
1		305JN94100 5JN94100	PARTS GUIDE SET SP	-	1	-	0	Set parts (No. 1 + No. 2)
2	305JN71Y20 5JN71Y20	305JN71Y21 5JN71Y21	+ GUIDE ASSY:ASYS-GUIDE-EXIT	1	1	0	X*1	
3	305JN71XT0 5JN71XT0	305JN71XT1 5JN71XT1	+ BRACKET:BRKT-GUIDE-PUSH	1	1	X*1	0	

Parts with the [+] sign are component parts.

^{*1:} When using the new Exit guide (No. 2), please use the new bracket (No. 3).


Page 2 / 2

E095-5JN-0066

<Date> June 16, 2014


Content of changes

[Exit guide (No. 2)]

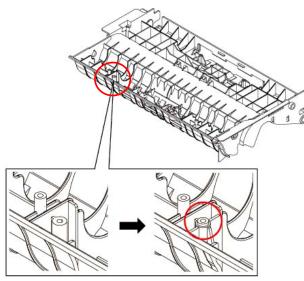

A convex shape is added to the even-shaped boss as shown.

[Bracket (No.3)]

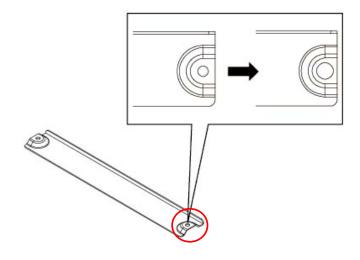

According to the change to the Exit guide (No. 2), the opening on the Bracket is enlarged.