C142 (BU)

7C078/7E443

B88
Heated Oxygen
Sensor (HO2S) #12
(9G444)

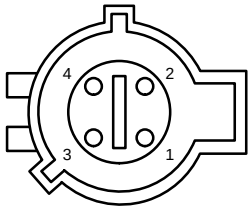

F04082

Pin	Circuit	Circuit function
1	391 (RD/YE)	Voltage supplied in Start and Run (overload protected)
2	389 (WH/BK)	Heated Oxygen Sensor (HO2S) #12 (9G444), heater
3	359 (GY/RD)	signal, return
4	392 (RD/LG)	Heated Oxygen Sensor (HO2S) #12 (9G444), input

C143

7C078

B44a
Turbine shaft speed
sensor (7H103)

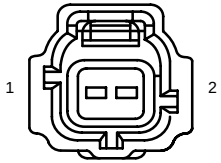

F02101

Pin	Circuit	Circuit function
1	970 (DG/WH)	Turbine shaft speed sensor (7H103), signal
2	359 (GY/RD)	signal, return

C144

14398

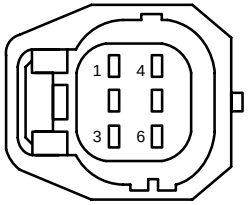

F06142

(1) 1205 (BK)
(2) 12 (LG/BK)
(3) 2 (WH/LB)
(4) 14 (BN)
(5) 161 (DG/OG)
(6)

14A408

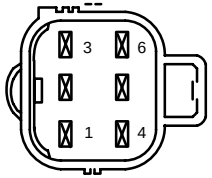

F06140

C147

2B559

B140
Primary brake pres-
sure sensor

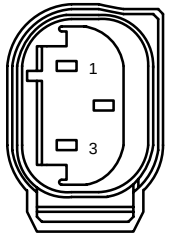

F03110

Pin	Circuit	Circuit function
1	3603 (RD)	Sensor, Power
2	3600 (RD/WH)	Sensor, Ground
3	3601 (WH/RD)	Sensor, signal

C148

14398

B141
Secondary brake
pressure sensor

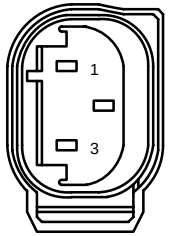

F03110

Pin	Circuit	Circuit function
1	3010 (TN)	Brake pedal position sensor, Power
2	3011 (BK/OG)	Brake pedal position sensor, Ground
3	3012 (WH)	Brake pedal position sensor, signal