Schematic

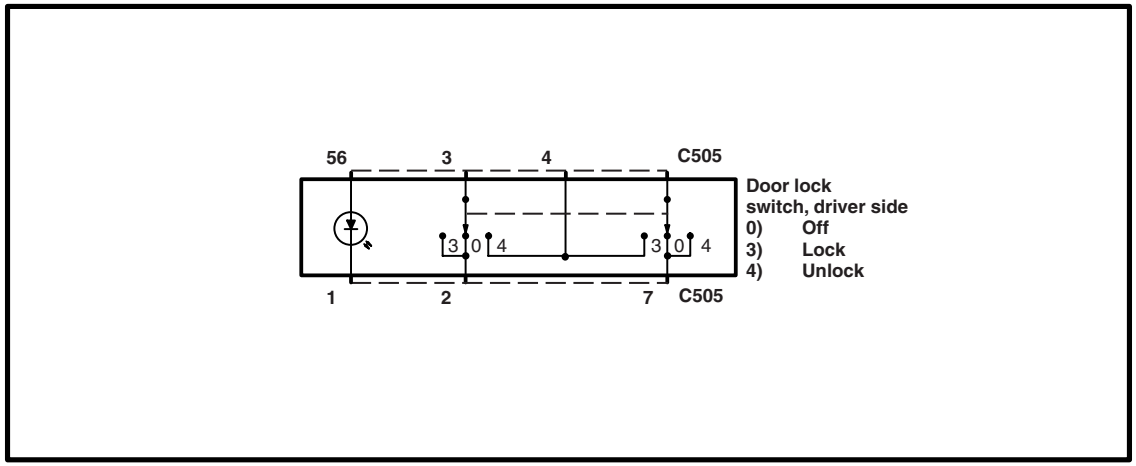

Terminals

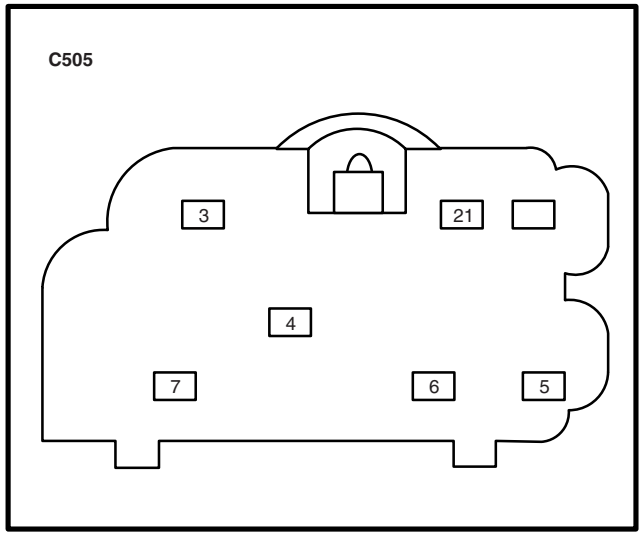

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Unlock Switch Circuit	4 and 2	Unlock	Closed circuit
	3 and 2	at rest, Lock	Closed circuit
Lock Switch Circuit	4 and 7	Lock	Closed circuit
	6 and 7	at rest, Unlock	Closed circuit