C137

12A581

M112
Windshield washer
pump motor (17618)

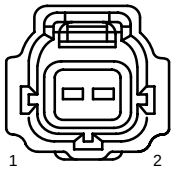

F02091

Pin	Circuit	Circuit function
1	57 (BK)	Ground
2	941 (BK/WH)	Windshield washer pump motor (17618), feed

C138

12A581

N400
Washer fluid level
switch

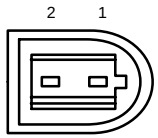

F02093

Pin	Circuit	Circuit function
1	81 (RD/LG)	Washer fluid level switch
2	57 (BK)	Ground

C141

15525

B87
Heated Oxygen
Sensor (HO2S) #22
(9G444)

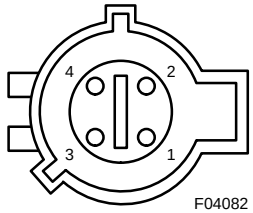

F04082

Pin	Circuit	Circuit function
1	1138 (VT/WH)	Voltage supplied in Start and Run (overload protected)
2	390 (TN/YE)	Heated Oxygen Sensor (HO2S) #22 (9G444), heater
3	359 (GY/RD)	to, Powertrain Control Module (PCM) (12A650)
4	393 (VT/LG)	Heated Oxygen Sensor (HO2S) #22 (9G444), input

C142 (BL)

15525

B88
Heated Oxygen
Sensor (HO2S) #12
(9G444)

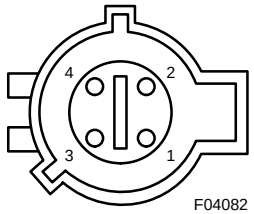

F04082

Pin	Circuit	Circuit function
1	1138 (VT/WH)	Voltage supplied in Start and Run (overload protected)
2	389 (WH/BK)	Heated Oxygen Sensor (HO2S) #12 (9G444), heater
3	359 (GY/RD)	to, Powertrain Control Module (PCM) (12A650)
4	392 (RD/LG)	Heated Oxygen Sensor (HO2S) #12 (9G444), input

C143

15525

B44
Turbine shaft speed
sensor (7M101)

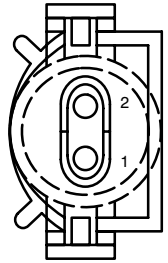

F02031

Pin	Circuit	Circuit function
1	970 (DG/WH)	Turbine shaft speed sensor (7M101)
2	971 (PK/BK)	Signal return