TERMINALS

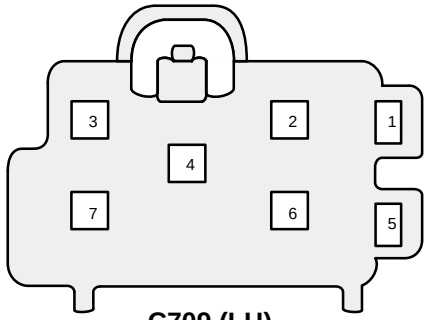

C709 (LH)
C809 (RH)
LEFT AND RIGHT REAR WINDOW SWITCH

SCHEMATIC

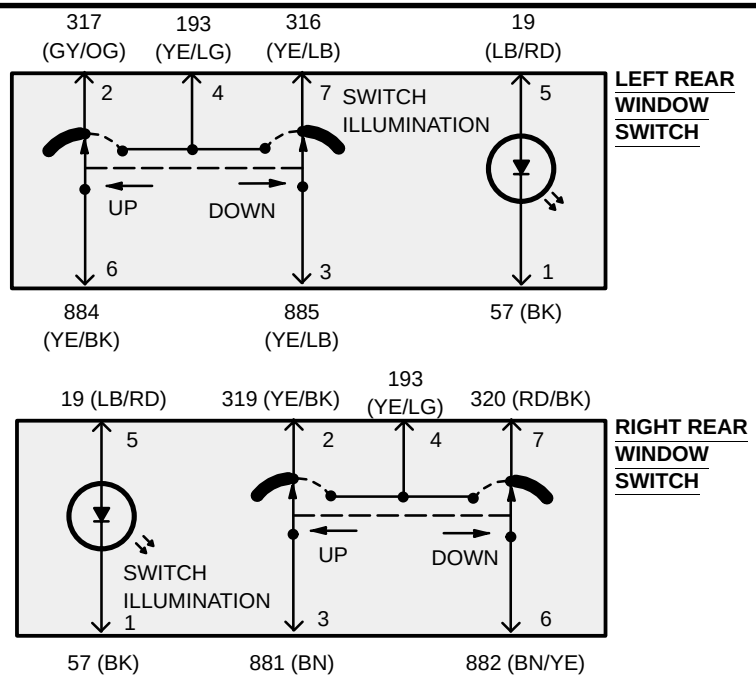

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Up Switch Circuit (Left)	4 and 3	Up	Closed Circuit
	2 and 6, 7 and 3	At Rest	Closed Circuit
Up Switch Circuit (Right)	4 and 6	Up	Closed Circuit
	2 and 3, 7 and 6	At Rest	Closed Circuit
Down Switch Circuit (Left)	4 and 6	Down	Closed Circuit
	7 and 3, 2 and 6	At Rest	Closed Circuit
Down Switch Circuit (Right)	4 and 3, 7 and 6	Down	Closed Circuit
	7 and 6, 2 and 3	At Rest	Closed Circuit