C141 (BU)

12B637

B87
Heated Oxygen Sensor (HO2S) #22

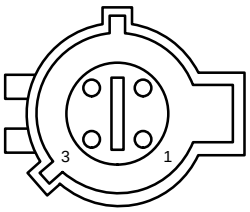

F04082

Pin	Circuit	Circuit Function
1	361 (RD)	Voltage supplied in Start and Run (overload protected)
2	390 (TN/YE)	Heated Oxygen Sensor (HO2S) #22, heater
3	359 (GY/RD)	signal, return
4	393 (VT/LG)	Heated Oxygen Sensor (HO2S) #22, input

C142 (BU)

12B637

B88
Heated Oxygen Sensor (HO2S) #12

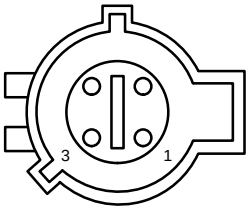

F04082

Pin	Circuit	Circuit Function
1	361 (RD)	Voltage supplied in Start and Run (overload protected)
2	388 (YE/LB)	Heated Oxygen Sensor (HO2S) #12, heater
3	359 (GY/RD)	signal, return
4	94 (RD/BK)	Heated Oxygen Sensor (HO2S) #12, input

C143

12B637

B44
Turbine shaft speed (TSS) sensor

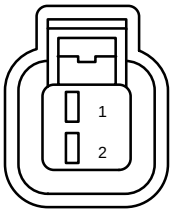

F02069

Pin	Circuit	Circuit Function
1	359 (GY/RD)	signal, return
2	970 (DG/WH)	Turbine shaft speed (TSS) sensor

C150 (BK)

14290

B15
Wheel speed sensor, left front

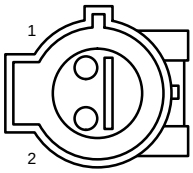

F02085

Pin	Circuit	Circuit Function
1	521 (TN/OG)	Wheel speed sensor, left front +
2	522 (TN/BK)	Wheel speed sensor, left front +

C152

14290

E43
Fog lamp, left front

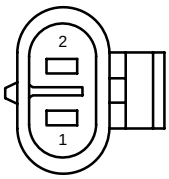

F02038

Pin	Circuit	Circuit Function
1	57 (BK)	Ground
2	478 (TN/OG)	Fog lamp switch, to front fog lamp

C160

14290

B14
Wheel speed sensor, right front

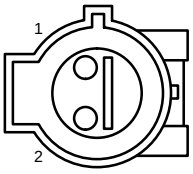

F02085

Pin	Circuit	Circuit Function
1	516 (YE/BK)	Wheel speed sensor, right front -
2	514 (YE/RD)	Wheel speed sensor, right front +