TERMINALS

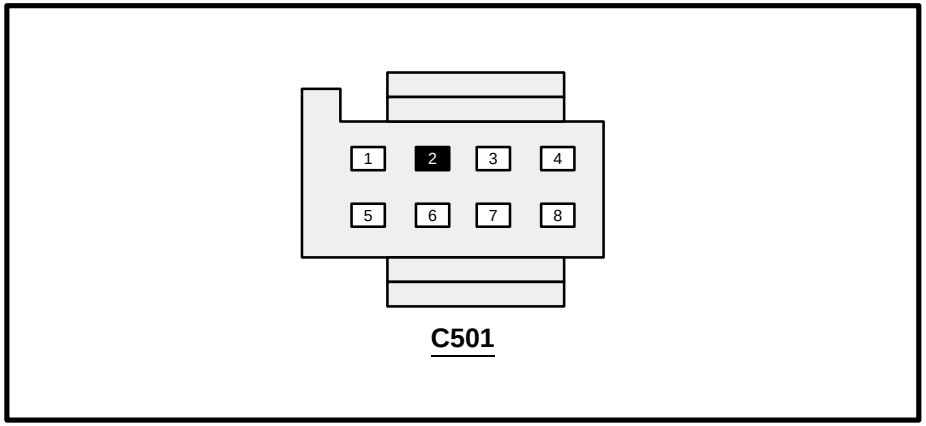

SCHEMATIC

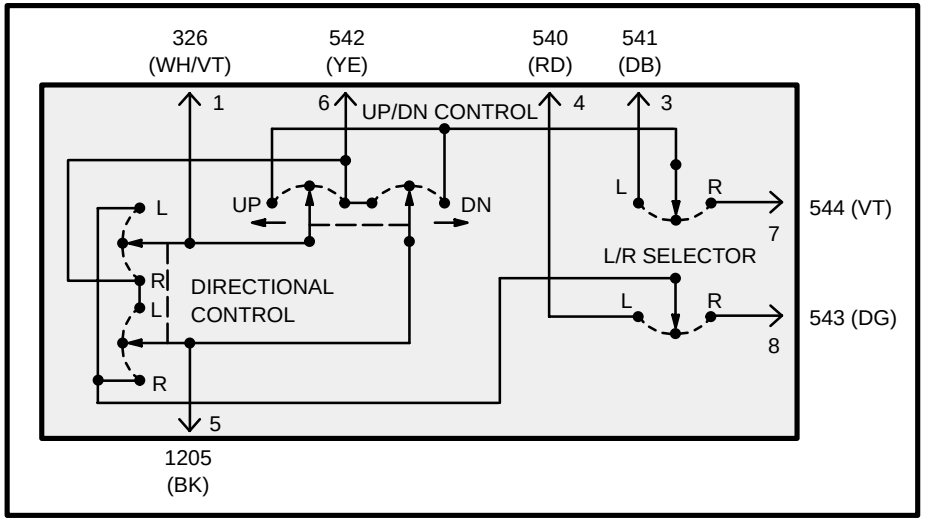

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
LEFT MIRROR		Selector Switch Left	
UP	1 and 3 6 and 5	Up	Closed Circuit Closed Circuit
DOWN	1 and 6 3 and 5	Down	Closed Circuit Closed Circuit
LEFT	1 and 4 6 and 5	Left	Closed Circuit Closed Circuit
RIGHT	1 and 6 4 and 5	Right	Closed Circuit Closed Circuit
RIGHT MIRROR		Selector Switch Right	
UP	1 and 7 6 and 5	Up	Closed Circuit Closed Circuit
DOWN	1 and 6 7 and 5	Down	Closed Circuit Closed Circuit
LEFT	1 and 8 6 and 5	Left	Closed Circuit Closed Circuit
RIGHT	1 and 6 8 and 5	Right	Closed Circuit Closed Circuit